Heritage at **Risk**



East of England Register 2020

Contents

The Register	III				
Content and criteria					
Key statistics	V				
Key to the entries	VI				
Entries on the Register by local planning authority	VIII				
Bedford (UA)	I				
Cambridgeshire	2				
Cambridge	2				
East Cambridgeshire	2				
Fenland	4				
Huntingdonshire	5				
South Cambridgeshire	8				
Central Bedfordshire (UA)	12				
Essex	4				
Braintree	14				
Brentwood	15				
Chelmsford	16				
Colchester	16				
Epping Forest	17				
Harlow	19				
Maldon Tara dain -	19				
Tendring Uttlesford	21 24				
	25				
Hertfordshire					
Broxbourne	25				
Dacorum East Hertfordshire	26 26				
North Hertfordshire	28				
St Albans	30				
Stevenage	30				
Three Rivers	31				
Watford	31				
Welwyn Hatfield	32				
Luton (UA)	32				
Norfolk	32				
Breckland	32				
Broadland	38				
Great Yarmouth	39				
King's Lynn and West Norfolk	41				
Norfolk Broads (NP)	45				
North Norfolk	45				
Norwich South Norfolk	49 51				
Peterborough, City of (UA)	53				

Southend-on-Sea (UA)					
Suffolk					
Babergh	58				
West Suffolk	59				
lpswich	61				
Mid Suffolk	61				
East Suffolk	64				
Thurrock (UA)	69				

THE REGISTER

The Heritage at Risk Register includes historic buildings and sites at risk of being lost through neglect, decay or deterioration.

It includes all types of designated heritage assets, including Conservation Areas, which are designated and assessed by Local Planning Authorities.

The aim of the Register is to focus attention on those places in greatest need. Historic England, in partnership with others, is able to help tackle heritage at risk. We work with owners, friends groups, developers and other stakeholders to find imaginative solutions for historic places and sites at risk across England.

More information about our role, the advice and funding available, and useful <u>publications</u> and <u>guidance</u> is available on our <u>website</u>.

Criteria for inclusion on the Register

RISK ASSESSMENTS

Heritage assets included on the Register are assessed according to the nature of the site. The risk assessment methodologies outlined below are based on factors which can threaten the different types of heritage assets and lead to them becoming at risk.

BUILDINGS AND STRUCTURES

To be considered for inclusion on the Register, buildings or structures must be:

- listed on the National Heritage List for England; and
- in secular (non-worship) use. And either:
- a grade I or II* listed building, or
- a grade II listed building in London, or
- a structural scheduled monument with upstanding remains.

Buildings or structures are assessed on the basis of condition and, where applicable, occupancy (or use) reflecting the fact that a building which is occupied is generally less vulnerable than one that is not.

Occupancy (or use) is assessed as 'vacant', 'partoccupied', 'occupied', 'not applicable', or occasionally, 'unknown'. Many structures fall into the 'not applicable' category, for example: ruins, walls, gates, headstones or boundary stones.

Condition is assessed as 'very bad', 'poor', 'fair' or 'good'. The condition of buildings or structures on the Register is typically very bad or poor, but can be fair or, very occasionally, good. This reflects the fact that some buildings or structures are vulnerable because they are empty, underused or face redundancy without a new use to secure their future. Assessing vulnerability in the case of buildings in fair condition necessarily involves judgement and discretion. A few buildings remain on the Register in good condition, having been repaired or mothballed, but still awaiting a new use or occupancy.

Buildings or structures are removed from the Register when they are fully repaired/consolidated, and their future secured either through occupation and use, or through the adoption of appropriate management.

PLACES OF WORSHIP

To be considered for inclusion on the Register, places of worship must be listed grade I, grade II* or grade II on the National Heritage List for England, and be used as a public place of worship at least six times a year.

Places of worship are assessed on the basis of condition only. If a place of worship is in very bad or poor condition, it is added to the Register. This includes places of worship which are generally in fair or good condition but have major problems with one key element, like the tower.

Once on the Register, places of worship can move through the condition categories (e.g. from very bad to poor, to fair, even good) as repairs are implemented and the condition improves, until they are fully repaired and can be removed from the Register. This means that there are some places of worship in good condition on the Register but with outstanding issues still to be resolved at the time when they were assessed.

ARCHAEOLOGY

To be considered for inclusion on the Register, archaeological sites must be listed as scheduled monuments and included on the National Heritage List for England.

Archaeology assessments cover scheduled earthworks and buried archaeology.

HERITAGE AT RISK 2029 / EAST OF ENGLAND

The risk assessment is based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability. A site's condition is expressed in terms of the scale and severity of adverse effects on it, ranging from 'extensive significant problems' to 'minor localised problems'.

Archaeological entries are removed from the Register once sufficient progress has been made to address the identified issues, and a significant reduction in the level of risk has been demonstrated.

PARKS AND GARDENS

To be considered for inclusion on the Register, parks and gardens must be listed as grade I, grade II* or grade II and included on the National Heritage List for England. Parks and gardens are assessed in terms of condition and vulnerability. Steps being taken by owners to address problems are also taken into consideration.

Parks and gardens assessed as being at risk are typically affected by development and neglect. They have frequently been altered by development or are faced with major change. The original function of these landscapes has often changed and divided ownership leads to the loss of their cohesive historic design.

Park and garden entries are removed from the Register once steps have been taken to address issues and positive progress is being made.

BATTLEFIELDS

To be considered for inclusion on the Register, battlefields must be listed and included on the National Heritage List for England. Battlefields deemed to be at risk of loss of cultural significance are included on the Register.

The principal risks and threats are:

- development pressure e.g. encroachment of buildings;
- pressures of particular use within the site e.g. arable cultivation;
- damage e.g. unregulated metal detecting.

Battlefields are removed from the Register either when damaging activities cease/are managed, or when threats recede due to effective planning.

WRECK SITES

To be considered for inclusion on the Register, wrecks must be listed and included on the National Heritage List for England. Wreck sites are assessed based on their current condition, vulnerability and the way they are being managed.

Wrecks are vulnerable to both environmental and human impacts. Risks that contribute to inclusion on the Register range from unauthorised access to erosion and fishing damage. The monitoring process ensures that the significance of the site is identified and maintained. In spite of the inherent difficulties in caring for this type of site, careful management must be maintained.

Wrecks are removed from the Register once an appropriate management and monitoring regime is operational.

CONSERVATION AREAS

Once a year Historic England asks every local authority in England to consider the state of its conservation areas and fill in (and update as appropriate) risk assessment questionnaires for those that cause concern, or are believed to no longer be at risk.

Conservation areas that are deteriorating, or are in very bad or poor condition and not expected to change significantly in the next three years, are defined as being at risk.

The approach taken to assess conservation areas at risk has been refined since the first survey in 2008/2009. An overall category for condition, vulnerability and trend is included for each conservation area on the Heritage at Risk Register. Conservation areas identified as at risk in 2009, but not reassessed since using the revised methodology, are included on the Register but with limited information.

Conservation areas are removed from the Register once plans have been put in place to address the issues that led to the conservation area being at risk, and once positive progress is being made.

THE EFFECT OF COVID-19 ON THE COLLECTION AND COLLATION OF THE STATISTICS USED FOR THE 2020 REGISTERS

The collection of this year's data has been affected by Covid-19. From the onset of 'lockdown' site visits were not possible for either our staff or local authority colleagues, meaning that the usual level of on-site checking of existing or proposed entries on/for the Register was not possible for that period. However, desk-based assessments and updates were carried out.

Key statistics

BUILDINGS AND STRUCTURES

- Nationally, 766 (3.4%) out of a total of 22,485 grade I and II* listed buildings (excluding places of worship) are on the Register. In the East of England the percentage is 2.1% (71 listed secular buildings).
- In addition to this, of the 1,754 scheduled monuments in the East of England, 37 (2.1%) structural scheduled monuments are on the Register.
- 3 building or structure entries (including structural scheduled monuments) have been removed from the 2019 East of England Register because their futures have been secured, and 5 have been added.

PLACES OF WORSHIP

- Of the 14,788 listed places of worship in England, 932 (6.3%) are on the Register. In the East of England 116 (5.0%) are on the Register.
- 12 places of worship have been removed from the 2019 East of England Register following repair work, and 22 have been added.

ARCHAEOLOGY

- Of the 19,895 scheduled monuments in England, 2,090 (10.5%) are on the Register assessed as archaeology. Of the 1,754 archaeological scheduled monuments in the East of England, 114 (6.5%) are on the Register.
- 9 archaeology entries have been removed from the 2019 East of England Register for positive reasons, and one has been added.

PARKS AND GARDENS

 Of the 1,670 registered parks and gardens in England 103 (6.2%) are on the Register. Of the 218 registered parks and gardens in the East of England, 8 (3.7%) are on the Register. No park and garden entries were added to or removed from the 2019 East of England Register in the past year.

BATTLEFIELDS

• Of the 47 registered battlefields in England, 3 (6.4%) are on the Register. The one registered battlefield in the East of England is not on the Register.

WRECK SITES

• Of the 54 protected wreck sites around England's coast, 3 (5.6%) are on the Register. The two protected wreck sites in the East of England are not on the Register.

CONSERVATION AREAS

- There are currently 491 conservation areas on the Register. Of these, 49 are in the East of England.
- No conservation areas have been removed from the 2019 East of England Register for positive reasons and one has been added.

HISTORIC ENGLAND FUNDING

• £1.77 million in grant was spent on 36 entries on the East of England Register during 2019/20.

Risk assessments of heritage assets are based on the nature of the site. Buildings and structures include structural scheduled monuments and listed buildings (excluding listed places of worship); archaeology assessments include earthworks and buried archaeology. Please note that some sites may have more than one entry under different risk assessment methodologies, for example if a site has more than one listing for its different elements or if it consists of buried and structural remains.

Key to the entries

The Register includes the following risk assessment types:

- Building or structure (grade I and II* listed buildings, grade II listed buildings in London and structural scheduled monuments)
- Place of worship
 - (grade I, II* and II listed buildings)
- Archaeology
 - (scheduled monuments earthworks and buried archaeology)
- Park and garden
 (Registered parks and gardens)
- Battlefield
 - (Registered battlefields)
- Wreck site
 - (Protected wreck sites)
- Conservation area
 - (Conservation areas)

Details are given here for all risk assessment types even if entries are not present in the Regional Register.

ORDER

Entries are grouped and ordered alphabetically, first by County (dark grey bands) or Unitary Authority (light grey bands), and then by Local Planning Authority (National Park/Unitary Authority/District or Borough).

A blank band denotes the end of a county and the beginning of a unitary authority.

Sites that straddle more than one local planning authority are included under the lead authority.

Within each planning authority, entries are grouped by risk assessment type in the following order:

- Buildings or structures
- Places of worship
- Archaeology
- Parks and gardens
- Battlefields
- Wreck sites
- Conservation areas

Within each risk assessment type, entries are ordered alphabetically by parish, locality and street/site name (except for conservation areas and protected wreck sites which are ordered by site name only).

LISTING

The principal listing type is noted for each entry and includes:

- Listed Building (LB) grade I or II*
- Listed Place of Worship grade I, II* or II
- Scheduled Monument (SM)
- Registered Park and Garden (RPG) grade I, II* or II
- Registered Battlefield (RB)
- Protected Wreck Site (PWS)
- Conservation Area (CA)

Other listing types that apply to a given site, including location within a World Heritage Site (WHS), are also noted.

If an entry is a dual list entry (both listed and scheduled), 'and' rather than a comma is used (eg 'Scheduled Monument and Listed Building grade I'). If a scheduled monument entry is a dual list entry with a number of listed buildings, each is separated by a semicolon.

The National Heritage List Entry Number is included for all entries (except conservation areas). If a site has dual list entries, all relevant List Entry Numbers are noted.

CONDITION

For buildings (including places of worship), condition is graded as: 'very bad', 'poor', 'fair' and 'good'.

For sites that cover areas (scheduled monuments – archaeology assessments, parks and gardens, battlefields and wreck sites) one overall condition category is recorded. The category may relate only to the part of the site or monument that is at risk and not the whole site:

- extensive significant problems
- generally unsatisfactory with major localised problems
- generally satisfactory but with significant localised problems
- generally satisfactory but with minor localised problems
- optimal
- unknown (noted for a number of scheduled monuments that are below-ground and where their condition cannot be established)

For conservation areas, condition is categorised as: 'very bad', 'poor', 'fair' and 'optimal'.

If a site has suffered from heritage crime it is noted in the summary. Heritage crime is defined as any offence which harms the heritage asset or its setting and includes arson, graffiti, lead theft and vandalism.

OCCUPANCY/USE

For buildings (excluding places of worship) that can be occupied or have a use, the main vulnerability is vacancy or under-use. Occupancy (or use) is noted as follows:

- vacant
- part occupied
- occupied
- unknown
- not applicable

VULNERABILITY

Principal vulnerability is noted for archaeology assessments and may relate only to the part of the site that is at risk, and include:

- animal burrowing
- arable ploughing
- coastal erosion
- collapse
- deterioration in need of management
- scrub/tree growth
- visitor erosion

For parks and gardens, battlefields, wreck sites and conservation areas, vulnerability is noted as high, medium or low.

PRIORITY CATEGORY

Priority for action is assessed on a scale of A to F, where 'A' is the highest priority for a site which is deteriorating rapidly with no solution to secure its future, and 'F' is the lowest priority.

For buildings and structures and places of worship the following priority categories are used as an indication of trend and as a means of prioritising action:

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented
- C Slow decay; no solution agreed
- D Slow decay; solution agreed but not yet implemented
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- F Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented

For battlefields and wreck sites the following priority categories are used as a means of prioritising action:

- A No action/strategy identified or agreed (where trend is declining or unknown)
- B Action/strategy agreed but not yet implemented (where trend is declining or unknown)
- C No action/strategy identified or agreed (where trend is stable or improving)
- D Action/strategy agreed but not yet implemented (where trend is stable or improving)
- E Monitoring as appropriate (any trend)
- F Action implemented/strategy underway/scheme in progress (any trend)

Previous year priority categories are given in brackets, otherwise 'New entry' is noted.

'New entry – re-assessed' indicates an existing site on the Register that has been re-assessed using a different risk assessment methodology and is included on this year's Register under the new assessment type.

TREND

Trend for archaeology entries, parks and gardens, battlefields and wreck sites may relate only to the part of the site that is at risk and is categorised as:

- declining
- stable
- improving
- unknown

For conservation areas trend is categorised as:

- deteriorating
- deteriorating significantly
- no significant change
- improving
- improving significantly
- unknown

OWNERSHIP

A principal ownership category is given for each entry, and if sites are in divided ownership, a 'multiple' ownership category is noted.

CONTACT

This is the member of the Historic England local team who acts as a first point of contact for the case, and to whom enquiries should be addressed.

For conservation areas, the contact is the conservation/planning officer at the relevant local planning authority (indicated by 'LPA').

We are not in any sense agents for the owners of the sites included, but we will endeavour to put people in touch with them where appropriate.

- CA Conservation Area
- HE Historic England
- HLF Heritage Lottery Fund
- LB Listed Building
- LPA Local Planning Authority
- NP National Park
- PWS Protected Wreck Site
- RB Registered Battlefield
- RPG Registered Park and Garden
- SM Scheduled Monument
- UA Unitary Authority
- WHS World Heritage Site

Entries on the Register by local planning authority

	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
BEDFORD (UA)			1				
Bedford (UA)	0	3	5	0	0	0	I
CAMBRIDGESHIRE				-			
Cambridge	1	1	0	0	0	0	0
East Cambridgeshire	0	I	8	0	0	0	I
Fenland	I	1	5	0	0	0	5
Huntingdonshire	2	7	3	0	0	0	0
South Cambridgeshire	I	8	14	0	0	0	5
CENTRAL BEDFORDSHIRE (UA)						
Central Bedfordshire (UA)	I	7	4	0	0	0	0
ESSEX							
Braintree	I	1	2	0	0	0	2
Brentwood	2	I	0	0	0	0	0
Chelmsford	0	I	0	1	0	0	1
Colchester	3	I	2	0	0	0	1
Epping Forest	4	I	2	0	0	0	4
Harlow	0	0	1	0	0	0	0
Maldon	4	0	2	0	0	0	1
Rochford	0	0	0	0	0	0	0
Tendring	8	2	4	0	0	0	5
Uttlesford	3	2			0	0	0
HERTFORDSHIRE		_					
Broxbourne	0	0	0	0	0	0	2
Dacorum			0	0	0	0	0
East Hertfordshire	2		3		0	0	0
East Hertfordshire / Epping							
Forest [†]	0	0	0		0	0	0
North Hertfordshire	5	3	4	0	0	0	0
St Albans	I	0	0	0	0	0	0
Stevenage	0	0	0	0	0	0	3
Three Rivers	I	0	0	0	0	0	0
Watford	2	0	0	0	0	0	0
Welwyn Hatfield	I	0	0	0	0	0	0
LUTON (UA)							
Luton (UA)	0	0	0	0	0	0	2
NORFOLK							
Breckland	11	3	3	0	0	0	2
Broadland	2	2	I	0	0	0	0
Great Yarmouth	3	7	0	0	0	0	3
King's Lynn and West Norfolk	5	13	4	0	0	0	I
Norfolk Broads (NP)	0	0	0	0	0	0	1
North Norfolk	6		3	1	0	0	2
Norwich	9			0	0	0	
South Norfolk	2		5	0		0	0
PETERBOROUGH, CITY OF							
Peterborough, City of (UA)	4	6	16	0	0	0	0
LINCOLNSHIRE	•	0	10	Ŭ	0		
Peterborough, City of (UA) / South Kesteven ¹	0	0	I	0	0	0	0
SOUTHEND-ON-SEA (UA)							
Southend-on-Sea (UA)	1	0	0	0	0	0	L
SUFFOLK		0	0	0	0	0	
			3	0	0	0	0
Babergh			5	0	0	0	0
Babergh West Suffolk	3	4	7		0	0	3

Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
5	8	I		0	0	0
10	6	7		0	0	1
2	0	1	1	0	0	1
108	116	4	8	0	0	49
	structure entries 5 10 2	structure worship entries 5 8 10 6 2 0	structure entriesworship entriesentries5811067201	structure entriesworship entriesentriesgarden entries581110671U201111	structure entriesworship entriesentriesgarden entriesentries58110106710	structure entriesworship entriesentriesgarden entriesentriesentries5811001067100201100

[†] Sites that cross local planning authority boundaries

BEDFORD (UA)

	- (-)			
		SITE NAME:	Church of St Martin, Clapham Road, Bedford	Church of 1888-9 by JA Chatwin of Birmingham, in Gothic style. A large urban church of yellow brick with red brick
		DESIGNATION:	Listed Place of Worship grade II, CA	banding; stone copings to gable. Four bay nave and arcades; shallow transepts; Lady Chapel; polygonal apse and east baptistery. North vestry and ancillary rooms;
		CONDITION:	Very bad	church hall to south. Movement on north side of church now largely ceased and some cracks closed up following
		PRIORITY CATEGORY:	A (A)	tree removal. Vestry movement more severe. Architect
	TRUE I	OWNER TYPE:	Religious organisation	and Structural Engineer advising Parish.
		LIST ENTRY NUMBER:	1390539	Contact: Trudi Hughes 01223 582739

© Historic England



	SITE NAME:	Church St Mary the Virgin, Church Road, Keysoe, Bolnhurst and Keysoe	The oldest part of church dates from C12 with the north aisle and south porch added in C14. North chapel, tower and spire C15. Stone is falling from the tower; possible
l	DESIGNATION:	Listed Place of Worship grade I	structural instability. Lengthy inspection and 'first aid' on tower and spire in 2018 led to a substantial amount of
	CONDITION:	Poor	loose render and a dangerous gargoyle head was removed, leaning south parapet. Parish considering obtaining further
	PRIORITY CATEGORY:	A (A)	professional advice.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	4778	Contact: Trudi Hughes 01223 582739

© Historic England

	SITE NAME:	Parish Church of St Denys, Church Road, Church End, Colmworth	Early C15 with window tracery re-worked in C19. Chancel of cobblestone but coursed freestone everywhere else. Chancel, north vestry, nave, south porch and west tower
	DESIGNATION:	Listed Place of Worship grade I	with broach spire which dominates the surrounding countryside. Nave roof covering has failed in spite of
	CONDITION:	Very bad	repeated patching and requires urgent replacement to protect late medieval carvings incorporated into roof
	PRIORITY CATEGORY:	B (New entry)	beneath and medieval walls. Parapets slender and loose
	OWNER TYPE:	Religious organisation	especially on north and east elevations but maybe elsewhere. Vestry roof leaks. Excessively damp internally.
	LIST ENTRY NUMBER:	4867	Contact: Trudi Hughes 01223 582739
storic England			

© Historic England

12.24

SITE NAME:Manor Farm Iron Age univallate hillfort and medieval woated enclosure. Bolnhurst and KeysoeDESIGNATION:Scheduled Monument, LB grade IIUST ENTRY NUMBER:1012066CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Settlement site north of Chapel End Farm, CardingtonUST ENTRY NUMBER:1005390CONDITION:Scheduled MonumentUST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STE NAME:Scheduled MonumentUST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STE NAME:Yarl's Wood hermitage and moated site., Milton ErwerInterny NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:Will Fletcher 01223 582710				
CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Settlement site north of Chapel End Farm, CardingtonIJST ENTRY NUMBER:1005390CONDITION:Scheduled MonumentIJST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrerDavid Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrerI012057DESIGNATION:Scheduled MonumentIJST ENTRY NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY:No	SITE NAME:	Manor Farm Iron Age univallate hillfort and med	ieval moated enclosur	e, Bolnhurst and Keysoe
PRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Settlement site north of Chapel End Farm, CardingtonInternet of Contraction (Contraction)DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrorDavid Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrorIo12057CONDITION:Scheduled MonumentLIST ENTRY NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY?:No	DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1012066
OWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Settlement site north of Chapel End Farm, CardingtorIIST ENTRY NUMBER:1005390DESIGNATION:Scheduled MonumentIIST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErretDavid Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErretIO12057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY?:No	CONDITION:	Extensive significant problems	TREND:	Declining
STEE NAME:Settlement site north of Chapel End Farm, CardingtonDESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULINERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrorIDST ENTRY NUMBER:1012057DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULINERABILITY:Scrub/tree growthNEW ENTRY:No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1005390CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrerIo12057DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY?:No	OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrerIol 2057DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY?:No	SITE NAME:	Settlement site north of Chapel End Farm, Cardi	ngton	
PRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErnetDavid Kenny 01223 582760DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012057CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY?:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005390
OWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Yarl's Wood hermitage and moated site., Milton ErrestDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY?:No	CONDITION:	Extensive significant problems	TREND:	Declining
SITE NAME: Yarl's Wood hermitage and moated site., Milton Ernet DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1012057 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1012057 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	SITE NAME:	Yarl's Wood hermitage and moated site., Milton	Ernest	
PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012057
	CONDITION:		TREND:	Declining
OWNER TYPE: Private CONTACT: Will Fletcher 01223 582710	PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
	OWNER TYPE:	Private	CONTACT:	Will Fletcher 01223 582710

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / BEDFORD (UA) / CAMBRIDGE / EAST CAMBRIDGESHIRE

SITE NAME:	Bury Hill Camp: a motte and bailey castle with thre	ee fishponds. Thurle	eigh
DESIGNATION:	Scheduled Monument, LB grade II, part in CA	1009155	
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Palaceyard Wood medieval moated enclosure and earthworks, Wyboston, Chawston and Colesden /		res, woodland bank and cultivation
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010948
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Claire Fidler 01223 582735
SITE NAME:	Bedford		
DESIGNATION:	Conservation Area, 103 LBs, 2 RPGs, 4 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Jack Watkins (LPA) 01234 718563

CAMBRIDGESHIRE

CAMBRIDGE

	SITE NAME:	Old Cheddar's Lane pumping station	The pumping station was built in 1894 to house two Hathorn Davey steam engines and pumps to pump the
	DESIGNATION:	Scheduled Monument, CA	town's sewage to the treatment works two miles away. Household rubbish was burned as boiler fuel to raise the
	CONDITION:	Fair	steam to drive the engines. The site ran under steam, gas and electricity before closing in 1968. It is now the
	OCCUPANCY:	Occupied/in use	Cambridge Museum of Technology. In 2016 the National
	PRIORITY CATEGORY:	C (C)	Lottery Heritage Fund awarded a grant towards the further development of the Museum. Historic England grant aided
	OWNER TYPE:	Charity (heritage)	the first stage of internal repairs and funded a report to investigate the condition of further elements.
© Historic England	LIST ENTRY NUMBER:	1006896	Contact: Claire Fidler 01223 582735

	SITE NAME:	Church of St Andrew the Less, Newmarket Road, Cambridge	Abbey church of early CI3 date consisting of chancel and nave. Rubble with some dressed stone. Built by Barnwell
	DESIGNATION:	Listed Place of Worship grade II, CA	Priory on original Augustinian site. The church was restored 1854-6; the vestry and organ-chamber added in the late C19. Walls, roof and churchyard in very poor
	CONDITION:	Very bad	condition. Discussions taking place with Diocese about reuse of building by congregation associated with Christ
	PRIORITY CATEGORY:	A (A)	Church. Project has been delayed. Additional funding to be
	OWNER TYPE:	Religious organisation	sought for repairs.
	LIST ENTRY NUMBER:	1126143	Contact: Domenico D'Alessandro 01223 582742

© Historic England

EAST CAMBRIDGESHIRE

	SITE NAME:	Church of St Andrew, High Street, Soham	Minster church dating from 1180-90, of cruciform plan. Extended in C15 by one bay to the west when the tall four-
	DESIGNATION:	Listed Place of Worship grade I, CA	stage west tower was built. Constructed of limestone, rubble and pebble stone with flint. Clunch and limestone internally. Restoration in Ketton stone. Nave roof with C15
	CONDITION:	Poor	tie beams on jack-posts. Wall paintings in chancel. The tower has been cordoned off due to loose masonry. The
	PRIORITY CATEGORY:	A (F)	church suffers extensively from damp. National Lottery
	OWNER TYPE:	Religious organisation	Heritage Fund grant awarded towards drainage work completed in 2019 as first essential stage of a larger repair
	LIST ENTRY NUMBER:	1126450	project but a recent grant bid failed.
d			Contact: Trudi Hughes 01223 582739

© Historic England

PRIORITY CATEGORIES

- C Slow decay; no solution agreed.
- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
 C Slow decay: no solution agreed.
 D Slow decay; solution agreed but F not yet implemented.
 C Slow decay: no solution agreed.
 D Slow decay; solution agreed but F not yet implemented.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but F not yet implemented.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but not yet implemented. use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / EAST CAMBRIDGESHIRE

SITE NAME:	All Saints' Church, remains of, Ashley		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1006898
CONDITION:	Generally unsatisfactory with major localised	TREND:	Declining
	problems		5
PRINCIPAL VULNERABILITY:	Vandalism Minada mukinka anaman	NEW ENTRY?: CONTACT:	No
Owner Tipe:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Long barrow at Foulmire Fen, 140m north west	of the junction of Bac	k and Small Fen Drove, Haddenham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019983
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Roman settlement, Lode		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006793
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Long barrow at South Fen, 90m south west of th	ne west end of Ryman	moor Long Turning, Sutton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019988
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Long barrow at South Fen, 180m south east of Between Ditches Drove, Sutton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009994
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Round barrow 690m SSW of Stocking Drove Fa	rm, Sutton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019987
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Long barrow 650m NNW of Lythel's Farm, Swa	ffham Bulbeck	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020843
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Long barrow 410m south east of Partridge Hall	Farm, Swaffham Prior	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020842
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	David Kenny 01223 582760

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / EAST CAMBRIDGESHIRE / FENLAND

SITE NAME:	Soham		
DESIGNATION:	Conservation Area, 38 LBs	NEW ENTRY?:	Yes
CONDITION:	Poor	TREND:	Deteriorating significantly
VULNERABILITY:	High	CONTACT:	Chris Partrick 01353 616309

FENLAND

	SITE NAME:	The Museum, Museum Square, Wisbech	One of the first purpose-designed museums in England, 1846-7, and an important feature in Wisbech. Neoclassical
	DESIGNATION:	Listed Building grade II*, CA	style, with gault brickwork and slate roofs. The original display cases, bookcases, and decoration survive. Roofs in
	CONDITION:	Very bad	very poor condition, with leakage now causing serious damage to internal plasterwork and details. With a Historic
	OCCUPANCY:	Occupied/in use	England grant, project development for the repair project is
	PRIORITY CATEGORY:	B (B)	complete and emergency repairs will be carried out pending fund raising for the main work.
ALL DEL	OWNER TYPE:	Charity (heritage)	
storic England	LIST ENTRY NUMBER:	1126669	Contact: Malcolm Starr 01223 582723

© Histo

	SITE NAME:	Parish Church of St Peter and Paul, Wisbech	Parish church. Built of limestone with Barnack dressings, limestone and pebble rubble, originally plastered. Visible
	DESIGNATION:	Listed Place of Worship grade I, CA	remains of C12 church at west end and in north aisle. Chancel rebuilt in C14 and nave enlarged. Extensive restoration 1885-6 by Mr Bassett-Smith. Issues include
	CONDITION:	Very bad	dangerous turret stair and pinnacle which overhangs public footpath; roof coverings over north and south aisles
	PRIORITY CATEGORY:	F (B)	coming to the end of their serviceable life; and
	OWNER TYPE:	Religious organisation	groundwater drainage issues. Parish received a National Lottery Heritage Fund project development grant in
-	LIST ENTRY NUMBER:	1229992	February 2019. Project on-going.
			Contact: Trudi Hughes 01223 582739

© Nicholas Warns Architects

SITE NAME:	Bowl barrow 250m south of Honey Farm, Chatte	eris	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020393
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Bowl barrow 580m east of Mount Pleasant Bridge, Chatteris		
DESIGNATION: Scheduled Monument LIST ENTR		LIST ENTRY NUMBER:	1020394
CONDITION: Extensive significant problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Religious organisation	CONTACT:	David Kenny 01223 582760
SITE NAME:	Bowl barrow 600m west of Honey Hill Farm, Ch	atteris	
DESIGNATION: Scheduled Monument			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011718
DESIGNATION: CONDITION:	Scheduled Monument Extensive significant problems	LIST ENTRY NUMBER: TREND:	1011718 Declining
CONDITION:	Extensive significant problems	TREND:	Declining
CONDITION: PRINCIPAL VULNERABILITY:	Extensive significant problems Arable ploughing	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Extensive significant problems Arable ploughing Religious organisation	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Extensive significant problems Arable ploughing Religious organisation Neolithic enclosures at Grey's Farm, Horseley Fe	TREND: NEW ENTRY?: CONTACT:	Declining No David Kenny 01223 582760
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Extensive significant problems Arable ploughing Religious organisation Neolithic enclosures at Grey's Farm, Horseley Fe Scheduled Monument Generally unsatisfactory with major localised	TREND: NEW ENTRY?: CONTACT: CONTACT: CONTACT: LIST ENTRY NUMBER:	Declining No David Kenny 01223 582760
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Extensive significant problems Arable ploughing Religious organisation Neolithic enclosures at Grey's Farm, Horseley Fe Scheduled Monument Generally unsatisfactory with major localised problems	TREND: NEW ENTRY?: CONTACT: CONTACT: CONTACT: LIST ENTRY NUMBER: TREND:	Declining No David Kenny 01223 582760 1009993 Declining

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

use).

D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / FENLAND / HUNTINGDONSHIRE

SITE NAME:	Bowl barrow 500m south of Bunting's Farm, V	Vhittlesey		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020847	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Bowthorpe, Wisbech			
DESIGNATION:	Conservation Area, 5 LBs	NEW ENTRY ?:	No	
CONDITION:	Poor	TREND:	Deteriorating	
VULNERABILITY:	Low	CONTACT:	Katie McAndrew (LPA)	
SITE NAME:	Chatteris			
DESIGNATION:	Conservation Area, 101 LBs	NEW ENTRY ?:	No	
CONDITION:	Very bad	TREND:	Improving	
VULNERABILITY:	Low	CONTACT:	Katie McAndrew (LPA)	
SITE NAME:	March			
DESIGNATION: Conservation Area, 27 LBs NEW ENTRY?: No			No	
CONDITION: Poor TREND:		TREND:	Deteriorating	
VULNERABILITY:	Low	CONTACT:	Katie McAndrew (LPA)	
SITE NAME:	Whittlesey			
DESIGNATION:	Conservation Area, 63 LBs, SM	NEW ENTRY?:	No	
CONDITION:	Poor	TREND:	No significant change	
VULNERABILITY:	Low	CONTACT:	Katie McAndrew (LPA)	
SITE NAME:	Wisbech			
DESIGNATION:	Conservation Area, 231 LBs, RPG grade I	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY:	Low	CONTACT:	Katie McAndrew (LPA)	

HUNTINGDONSHIRE



D

Е

SITE NAME:	Great Gransden Windmill, Great Gransden
DESIGNATION:	Scheduled Monument and Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1006820 and 1211279

Constructed c1612, Great Gransden is one of the oldest surviving windmills in England. In 2017 the owner, Cambridgeshire County Council, completed major scheme of structural repairs to the buck and trestle with Historic England grant aid. A second phase of grant-aided work, to reinstate the stocks and sails, with much community involvement is likely to complete by the end of 2021.

© Historic England

Contact: Trudi Hughes 01223 582739

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HEF

HERITAGE AT RISK 2020 / EAST C	FENGLAND / HUNTIN		
-	SITE NAME:	St Andrew's Church, Church End, Wood Walton	Redundant church now in the care of the Friends of Friendless Churches. C13 south arcade of nave, C14 to
	DESIGNATION:	Listed Building grade II*	C15 west tower, C14 chancel and C16 north arcade. Much rebuilt 1856-9. Coursed limestone rubble, limestone
	CONDITION:	Poor	dressings and a plain tile roof. High-level repairs and installation of new rainwater goods and drainage have been
ALT IT THE	OCCUPANCY:	N/A	completed between 2013 and 2019. Structural movement
	PRIORITY CATEGORY:	C (C)	being monitored. Active Local Friends group. The charity is seeking funding for repairs to the interior of the church.
T LAT	OWNER TYPE:	Charity (heritage)	
© Historic England	LIST ENTRY NUMBER:	1130123	Contact: Domenico D'Alessandro 01223 582742
	SITE NAME:	Church of St Mary, High Street, Huntingdon	Large parish church of C12 or earlier origin, with a well- documented rebuilding of the early C17. Late C14 west
	DESIGNATION:	Listed Place of Worship grade I, CA	tower, partly rebuilt on the north side after its partial collapse in 1607. The ridge beam of the tower roof has fractured as the result of water penetration. The roof
THE WAY OF THE T	CONDITION:	Very bad	structure has spread, endangering the surrounding walls
	PRIORITY CATEGORY:	F (F)	and bell frame below, leading to the church being temporarily closed in summer 2018 for safety reasons. Part
	OWNER TYPE:	Religious organisation	of the nave floor is also unsafe. Historic England Repair Grants for Heritage at Risk grant for emergency repairs,
	LIST ENTRY NUMBER:	1161910	which are due to complete during 2020.
© Historic England			Contact: Claire Fidler 01223 582735
	SITE NAME:	Parish Church of All Saints, Morborne	All Saints is a charming church situated in the hearth of the countryside. Cl2 chancel arch and nave, mid Cl3 chancel,
1	DESIGNATION:	Listed Place of Worship grade I	north aisle c.1240, south transept and south aisle c.1250- 60. C16 west tower and north porch. Structural movement
	CONDITION:	Very bad	affecting the south transept, the tower and generally the whole church is a matter for concern. The roofs, except
	PRIORITY CATEGORY:	B (New entry)	the Tower roof, are covered in Collyweston and are in
	OWNER TYPE:	Religious organisation	poor condition. The rainwater goods and drainage are in a poor state. The congregation are seeking funding for major
-B	LIST ENTRY NUMBER:	1222032	repairs.
© Historic England			Contact: Domenico D'Alessandro 01223 582742
day	SITE NAME:	Church of All Saints, High Street, Offord Cluny and	Medieval church at centre of this large village, sited on the road between St Neots and Godmanchester, C13 arcades
		Offord D'Arcy	and chancel arch; altered in CI5 and CI6. Chancel dated 1726. CI9 south porch. CI5 century tower of Barnack
2000	DESIGNATION:	Listed Place of Worship grade II*, CA	with pebblestone, which can be seen on other parts of the church. The building has been the subject of heritage crime
	CONDITION:	Poor	Drainage repairs have been competed in 2019. Additional funding to be sought for additional major repairs and
	PRIORITY CATEGORY:	B (B)	reordering.
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	3028	Contact: Domenico D'Alessandro 01223 582742
	SITE NAME:	Parish Church of St Swithin, Brington Road, Old Weston	North doorway c.1200, nave arcades late C13, chancel rebuilt c.1300, mid C14 north and south aisles, south porch
	DESIGNATION:	Listed Place of Worship grade II*	and clerestory added, late C14 west tower. East wall of chancel and western walls of north aisle rebuilt in C15.
	CONDITION:	Poor	Walls of coursed Weldon and Ketton rubble limestone and dressed stone with some brick repairs. Live structural
-	PRIORITY CATEGORY:	B (B)	movement in window and buttress on north side of
	OWNER TYPE:	Religious organisation	chancel; structural movement in south aisle which contains wallpaintings. On-going public consultations to discuss the
	LIST ENTRY NUMBER:	1130116	future of the building.

11 2 © Historic England

Contact: Domenico D'Alessandro 01223 582742

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

H

HERITAGE AT RISK 2020 / EAST O	F ENGLAND / HUNTIN	IGDONSHIRE		
	SITE NAME:	Church of St Thomas, Herne Road, Ramsey	polygonal east er	It in 1869 by subscription. Nave with id, bell turret. Gault brick, slate roof, red
	DESIGNATION:	Listed Place of Worship grade II	mortar failure in	arly English fenestration. High-level general brickwork and around windows with
AGG T GRANNA ALL	CONDITION:	Poor	some cracking visible. Plant growth taking hold in porcl and on rainwater goods. Internally, evidence of damp i	
	PRIORITY CATEGORY:	C (C)	patches and crac	king over arches and under cills and in
	OWNER TYPE:	Religious organisation	shrinkage. Investi	of structural movement due to ground gation required to assess whether
	LIST ENTRY NUMBER:	1330457	movement is on- appoint structura	going or historic. The congregation to
© Historic England				idler 01223 582735
	SITE NAME:	Parish Church of St John the Baptist, Church Lane, Sibson- cum-Stibbington	Nave and chancel early to mid C12; extended by Teul 1848-49 at which time the north and south aisles were added along with the vestry, organ chamber, south po and timber bellcote. West tower demolished. The chu is suffering from excess rising and falling dampness; vall gutters and cast iron rainwater goods leaking. Salt	
	DESIGNATION:	Listed Place of Worship grade II*, CA		
	CONDITION:	Very bad	migration noted	on exterior stonework. Some solid floors s concealing salt migration and harbouring
and Manager	PRIORITY CATEGORY:	A (A)	dampness. Comp	plex set of conditions which require
	OWNER TYPE:	Religious organisation	Historic England	return the building to a stable condition. advising.
© Historic England	LIST ENTRY NUMBER:	1274862	Contact: Trudi H	lughes 01223 582739
	SITE NAME:	Parish Church of St Remigus, Old Great North Road, Water Newton	Situated on the bank of the river Nene and close to Roman site of Durobrivae, the church comprises a chancel, south aisle and lengthened nave. Early C14 west tower and nave clerestory. Altered in late C14 C15. Restored 1887. Felt on south aisle roof comin end if its service life. Maintenance required to Colly	
	DESIGNATION:	Listed Place of Worship grade II*, CA		
	CONDITION:	Poor	slates on chancel	
	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Religious organisation		
© Tony Capon (St Remigius Water Newton PCC)	LIST ENTRY NUMBER:	1237953	Contact: Trudi H	lughes 01223 582739
SITE NAME:	Buckden Palace, I	Buckden		
DESIGNATION:	Scheduled Monur	nent, 3 LBs, CA	LIST ENTRY NUMBER:	1006855
CONDITION:	Generally satisfact problems	tory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in	need of management	NEW ENTRY?:	Yes
OWNER TYPE:	Private		CONTACT:	Will Fletcher 01223 582710
SITE NAME:	Monk's Hole barr	row, 630m NNE of Monk's Wood	Farm, Sawtry	
DESIGNATION:	Scheduled Monur	nent	LIST ENTRY NUMBER:	1015007
CONDITION:	Extensive significa	nt problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple o	wners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Moated site in To	oseland Wood, Toseland		
DESIGNATION:	Scheduled Monur	nent	LIST ENTRY NUMBER:	1017881
CONDITION:	Generally satisfact problems	tory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing	g - moderate	NEW ENTRY?:	No
OWNER TYPE:	VNER TYPE: Commercial company		CONTACT:	Claire Fidler 01223 582735

PRIORITY CATEGORIES

A Immediate risk of further rapid deterioration or loss of fabric; no

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SOUTH CAMBRIDGESHIRE C19 timber-framed skin drying shed with adjustable timber SITE NAME Large tannery building at Hutchins and Harding Ltd, High louvered walls. Major areas of roof and south and west walls exposed and admitting rain. Internal boarded floors in very bad condition and partly collapsed. Redundant and at Street (east side), Sawston DESIGNATION: Listed Building grade II*, CA immediate risk of further deterioration or loss of fabric. An application for Listed Building Consent for total demolition CONDITION: Very bad was submitted in 2019. Consents now in place and demolition contract let. Work removing the building due to OCCUPANCY: Vacant/not in use be undertaken in 2020. PRIORITY CATEGORY: A (C) OWNER TYPE: Commercial company © Historic England LIST ENTRY NUMBER: 1127985 Contact: Andrew Martindale 01223 582705



SITE NAME:	Church of St Peter, High Street, Coton	C12 nave and chancel, early and late C14 south aisle, C15 north aisle, C14 west tower. Pebble and fieldstone,
 DESIGNATION:	Listed Place of Worship grade I, CA	dressed and carved limestone ashlar, clunch as inner walling and originally to door and window openings. The rainwater goods and drainage are generally in poor condition; the
CONDITION:	Poor	interior of the church is extremely damp. The soft clunch masonry is decaying at low level on the chancel south wall,
PRIORITY CATEGORY:	C (New entry)	where the choir platform collapsed. The congregation are
OWNER TYPE:	Religious organisation	liaising with Architect over scope of scheme.
LIST ENTRY NUMBER:	1127774	Contact: Domenico D'Alessandro 01223 582742

© Historic England



SITE NAME: Church of All Saints, Church CI3 and CI4 north and south aisles; CI4-CI5 west tower, Chancel 1687 remodelled in 1867. Built of fieldstone, brick, Lane, Croydon clunch rubble and dressed clunch. Tiled roofs. On-going DESIGNATION: Listed Place of Worship grade II* structural movement in almost all areas of the church including in relatively recent repair work. Tower buttresses CONDITION: Very bad are cracking; at least two CI5 windows on the south side PRIORITY CATEGORY: of the church are at risk of collapse; there has been recent A (A) structural movement in the chancel floor. Project team OWNER TYPE: Religious organisation seeking funding for key monitoring works and urgent repairs. LIST ENTRY NUMBER: 1163333 Contact: Domenico D'Alessandro 01223 582742

© Historic England

A	SITE NAME:	Parish Church of St Mary, Church Street, Fen Drayton	Parish church. Late C13 West wall of nave and lower courses of chancel and possibly the lower stage of the
	DESIGNATION:	Listed Place of Worship grade II*, CA	tower. Tower rebuilt c. 1330; chancel, nave and south aisle C15. Roofs replaced in restoration of 1855. Barnack limestone, limestone and pebble rubble. Slate roofs. Nave
	CONDITION:	Very bad	parapet gutters unstable and in an advanced state of deterioration; have been admitting excess moisture. C
	PRIORITY CATEGORY:	A (A)	structural defects. Above and below ground drainage
	OWNER TYPE:	Religious organisation	around entire building is defective. Suffering from significant salt migration in all areas. The congregation are liaising with
E a construction of the co	LIST ENTRY NUMBER:	1127229	Architect over scope of scheme.
Historic England			Contact: Domenico D'Alessandro 01223 582742

© Historic England



9	SITE NAME:	Church of St Mary the Virgin, Church Street, Gamlingay	Parish Church of C13 origin extensively rebuilt in C14-C15. Carrstone and fieldstone with clunch and limestone
	DESIGNATION:	Listed Place of Worship grade I, CA	dressings. West tower, nave with transeptal chapels and north and south aisles, north and south porches, chancel. West tower C13 origin rebuilt in C14-C15. Extensive
	CONDITION:	Very bad	water penetration from above and below. The building has been the subject of heritage crime. National Lottery
	PRIORITY CATEGORY:	A (A)	Heritage Fund grant bid being developed with strong local
	OWNER TYPE:	Private, multiple owners	community involvement however a recent grant application failed.
	LIST ENTRY NUMBER:	1330908	Contact: Trudi Hughes 01223 582739

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ÍΙΑ Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTH CAMBRIDGESHIRE



NE ES	SITE NAME:	Church of St Andrew, Burgoynes Road, Impington	Parish church comprising early CI3 nave and tower, upper stages rebuilt CI4. South porch CI5, chancel rebuilt during
	DESIGNATION:	Listed Place of Worship grade I, CA	restoration of 1878. Walls of Barnack limestone with limestone and pebble rubble. Timber-framed porch. Plain tile roofs with gable parapets to nave and chancel with
	CONDITION:	Very bad	cross finials. South elevation has a three-stage tower with Barnack limestone quoins. Severe cracks in tower and nave
	PRIORITY CATEGORY:	A (A)	monitored 1999-2012. Movement stabilised after removal
	OWNER TYPE:	Religious organisation	of trees pre-2009 but the structural condition of the church remains a concern.
	LIST ENTRY NUMBER:	1178832	Contact: Malcolm Starr 01223 582723

© Historic England

	SITE NAME:	Church of All Saints and St Andrew, Church Lane, Kingston	The church was substantially rebuilt in 1488 following a fire and the materials of C13 church reset or incorporated.
	DESIGNATION:	Listed Place of Worship grade I, CA	Fieldstone and clunch rubble with limestone and clunch dressings. Tiled roofs. Much of the interior wall surface except in the tower retains painting of the C13-C16 or
	CONDITION:	Fair	early C17. The south aisle roof is in poor condition. An area of the Nave lath and plaster celling failed in 2017. A
1,0 m	PRIORITY CATEGORY:	D (New entry)	temporary protective ceiling has been installed allowing continue use of the church whilst seeking funding for urgent
	OWNER TYPE:	Religious organisation	continue use of the church whilst seeking funding for urgent repairs.
	LIST ENTRY NUMBER:	1127592	Contact: Domenico D'Alessandro 01223 582742

© Historic England

1	SITE NAME:	Church of St Giles, Potton Road, Tadlow	Parish church. C13 nave and chancel; C14 west tower. Restored c1860 under supervision of W Butterfield.
	DESIGNATION:	Listed Place of Worship grade II*	Fieldstone, clunch rubble with limestone and clunch dressing. Plain tiled roof. West tower of three stages.
TT	CONDITION:	Poor	Crack to second stage of tower on east face. Some displacement and cracking to buttress on north wall
	PRIORITY CATEGORY:	B (B)	adjacent to infilled north door. Further crack to north side
A Second	OWNER TYPE:	Religious organisation	of east gable. Extensive ivy growth reported; deterioration continues. Transfer to a charitable Trust being negotiated
	LIST ENTRY NUMBER:	1317879	and managed.
			Contact: Domenico D'Alessandro 01223 582742

© Historic England

SITE NAME:	Parish Church of St Mary, Church Street, Whaddon	Parish Church. Early C13 chancel, late C13 to early C14 nave arcades, north and south aisles and clerestorys. Late
DESIGNATION:	Listed Place of Worship grade I	C14 north doorway inserted into opening of former vaulted north porch. C15 tower and nave and aisle roofs.
CONDITION:	Poor	Church was a victim of heritage crime in 2019.
PRIORITY CATEGORY:	A (New entry)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1164317	Contact: Trudi Hughes 01223 582739

© Historic England

SITE NAME:	John O'Gaunt's House: a motte castle and moated site 300m north east of Haygate Farm, Bassingbourn cu Kneesworth		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010865
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Settlement site west of Town's End Farm, Comb	erton / Barton	
SITE NAME: DESIGNATION:	Settlement site west of Town's End Farm, Combo Scheduled Monument	erton / Barton List entry number:	1006879
			1006879 Declining
DESIGNATION:	Scheduled Monument Generally unsatisfactory with major localised	LIST ENTRY NUMBER:	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTH CAMBRIDGESHIRE

SITE NAME:	Settlement site by Caudle Corner Farm, Fulbourn				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006878		
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY ?:	No		
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Henge 220m ESE of Herring's House, Great Wilbra	aham			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011716		
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Roman villa 1000yds (910m) north east of Ashwell	village, Guilden Mo	orden		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006876		
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Private, multiple owners	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Roman villa site south of Rose Villa, Ickleton				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006872		
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining		
RINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Bowl barrow 205m SSE of Lodge Cottage, Melbour	rn			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011720		
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760		
ITE NAME:	Bowl barrow, known as Grinnel Hill, 260m SSE of	Lodge Cottage, Me	lbourn		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011719		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining		
RINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY ?:	No		
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760		
ITE NAME:	Five bowl barrows 790m north west of Chain Hou	ise, part of the Ove	r round barrow cemetery, Over		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019874		
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	David Kenny 01223 582760		
ITE NAME:	Three bowl barrows 380m south of Brownshill Sta Over	unch House, part c	of the Over round barrow cemetery,		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019130		
CONDITION:	Extensive significant problems				
CONDITION: PRINCIPAL VULNERABILITY:	Extensive significant problems Arable ploughing	NEW ENTRY?:	No		

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTH CAMBRIDGESHIRE

SITE NAME:	Borough Hill: a large multivallate hillfort, Sawston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009396
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Arrington Bridge Romano-British site, Shingay cum	Wendy / Whaddo	n
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006874
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Wandlebury Camp: a multivallate hillfort, earlier ur formal garden remains, Stapleford	nivallate hillfort, Iro	n Age cemetery and 17th century
DESIGNATION:	Scheduled Monument, 3 LBs	LIST ENTRY NUMBER:	1009395
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE: Mixed, multiple owners CONTACT:			David Kenny 01223 582760
SITE NAME: Roman settlement south of Chronicle Hills, Whittlesford / Thriplow			
DESIGNATION:	•		1006794
CONDITION: Generally satisfactory but with significant localised TREND: De		Declining	
RINCIPAL VULNERABILITY: Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Duxford Airfield, Duxford/Whittlesford		
DESIGNATION:	Conservation Area, 34 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY: Medium		CONTACT:	Celia Wignall (LPA) 01954 712907
SITE NAME:	Fulbourn Hospital		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Celia Wignall (LPA) 01954 712907
SITE NAME:	Papworth Everard		
DESIGNATION:	Conservation Area, 6 LBs, SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Celia Wignall (LPA) 01954 712907
SITE NAME:	Sawston		
DESIGNATION:	Conservation Area, 36 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Celia Wignall (LPA) 01954 712907

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTH CAMBRIDGESHIRE / CENTRAL BEDFORDSHIRE (UA)

SITE NAME:	Waterbeach		
DESIGNATION:	Conservation Area, 14 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Celia Wignall (LPA) 01954 712907

CENTRAL BEDFORDSHI	RE (UA)		
	SITE NAME:	Priory House (Council Offices), High Street south, Dunstable	C18 house on site of Priory guesthouse with C13 medieval undercroft and some pre-Georgian cellars. The undercroft,
	DESIGNATION:	Listed Building grade II*, CA	built in Totternhoe stone, is subject to complex structural movement and dampness issues. Excess surface water
	CONDITION:	Very bad	remains a significant agent of decay undermining the Totternhoe stone foundations and front wall causing
	OCCUPANCY:	Occupied/in use	further instability. Historic England High Street Heritage
	PRIORITY CATEGORY:	B (A)	Action Grant awarded and Priory House will be repaired as part of this scheme.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1114593	Contact: Trudi Hughes 01223 582739
	SITE NAME:	Church of St Peter and All Saints, Battlesden	Medieval church of CI3 origin with later additions and alterations. Rubble walls with later brick to both CI8
	DESIGNATION:	Listed Place of Worship grade I, RPG grade II	tower and modern parapets. Internal damp; black mould on walls which were only re-limewashed some four years ago. Various possible causes of damp can be identified.
	CONDITION:	Very bad	The tower has received quite a lot of cementitious patch repairs, which is not a good combination with the soft
	PRIORITY CATEGORY:	D (D)	clunch stone used for construction. Some structural
	OWNER TYPE:	Religious organisation	movement. Parish have completed priority 1 actions from 2017 quinquennial inspection report; and developing plans
	LIST ENTRY NUMBER:	1311979	to address priority 2 actions.
© Historic England			Contact: Trudi Hughes 01223 582739
	SITE NAME:	Church of All Saints, Eyeworth	Parish church. CI4 with CI5 and CI9 additions; nave and
ACTED STATE	DESIGNATION:	Listed Place of Worship grade I	aisle reworked C20. Repairs, involving renewal of nave roof and masonry repairs, funded by a National Lottery
-610	CONDITION:	Poor	Heritage Fund and Historic England Repair Grants for Places of Worship grant completed 2013. Nave roof
	PRIORITY CATEGORY:	A (A)	recovered in Zinc. Significant erosion and falls of stone a
	OWNER TYPE:	Religious organisation	concern, soft clunch windows and buttresses poor in places. Quinquennial inspection report in 2019 will help
	LIST ENTRY NUMBER:	1137817	define repair priorities. Diocesan Fabric Support Officer to continue to provide advice.
© Historic England			Contact: Trudi Hughes 01223 582739
- 0			
	SITE NAME:	Church of All Saints, The Grove, Houghton Conquest	Parish church, C14 with some late C19 restoration, particularly to chancel, by Sir GG Scott. Coursed ironstone
	DESIGNATION:	Listed Place of Worship grade I	rubble with ashlar dressings, mostly of Totternhoe stone. The building has been the subject of heritage crime. The
And And And And	CONDITION:	Very bad	congregation are considering options for the repairs.
THE FUEL FUEL	PRIORITY CATEGORY:	A (A)	

© Historic England

CATEGORY A (A) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1113919 Contact: Trudi Hughes 01223 582739

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / CENTRAL BEDFORDSHIRE (UA)



Church of St Mary the Virgin, Church Road, Meppershall	Parish church dating to C12 and half rebuilt 1875-6 by S Arthur Blomfield. Stonework of coursed ironstone with	
Listed Place of Worship grade II*, CA	ashlar dressings and clay tile roofs. The clunch corner stones are decaying as well as the tracery to the south aisl chapel and vestry, render panels failing. High-level masonr	
Very bad	problems and tower in need of repointing. Following a failed National Lottery Heritage Fund bid, the congregatio	
B (B)	have tendered for urgent interim repairs to the tower and	
Religious organisation	transept roofs. Fund raising actively being explored with the aim to have work on site 2020-2021.	
1312589	Contact: Trudi Hughes 01223 582739	
	Church Road, Meppershall Listed Place of Worship grade II*, CA Very bad B (B) Religious organisation	

© Historic England

	SITE NAME:	Parish Church of St Leonard, Church End, Old Warden	Parish church, originally part of the endowment of Warden Abbey. C12 origins, predominantly C13, with C14, C15
	DESIGNATION:	Listed Place of Worship grade I, CA	and C16 details, reworked mid and late C19. Mainly of brown cobblestones with limestone dressings, later works in red brick and coursed limestone. Interior: C16, C17 and
	CONDITION:	Very bad	C18 carved woodwork, apparently mainly Flemish and English, collected by Robert Henley 3rd Lord Ongley,
	PRIORITY CATEGORY:	A (New entry)	installed 1841. All the roofs, except the Chancel roof
	OWNER TYPE:	Religious organisation	covering, are in a poor state. A merlon on the south side of the Tower collapsed. Poor rainwater management.
	LIST ENTRY NUMBER:	1274774	Dampness is putting the interior fittings at risk.
© Historic England			Contact: Trudi Hughes 01223 582739
		Parish Church of St Margaret	Parish church CI4 and CI5 details but extensively

	EIST EINTRE NOTIBER.	12/4//4	
			Contact: Trudi Hughes 01223 582739
	SITE NAME:	Parish Church of St Margaret, Higham Gobion, Shillington	Parish church. C14 and C15 details, but extensively reworked 1879-80 by Burton and Wood. Coursed
	DESIGNATION:	Listed Place of Worship grade II*	ironstone and cobblestones, with ashlar dressings. Gabled clay tile roofs. Chancel, nave, narrow north aisle, west
	CONDITION:	Very bad	tower. The chancel has two-stage buttresses to angles and to north and south walls. Comprehensive cracking in nave
	PRIORITY CATEGORY:	A (A)	and chancel internally; evidence of past structural repairs
Contraction of the local distribution of the	OWNER TYPE:	Religious organisation	externally. Awaiting Engineer's report to inform future discussions.
	LIST ENTRY NUMBER:	1113758	Contact: Trudi Hughes 01223 582739

© Historic England

© Hist

storic England	SITE NAME:	Church of St Peter, Church Lane, Wrestlingworth, Wrestlingworth and Cockayne Hatley	Parish church. CI2 origins, with additions and alteration of CI3, CI4, CI5 and CI9. Rubble walls, mixture of cobbles and ironstone with some fragments of CI2 masonry. Ashlar dressings, mostly of clunch. Slate roofs. Chancel,
	DESIGNATION:	Listed Place of Worship grade I, CA	nave, north and south aisles, south porch, west tower. Vertical cracking to tower turret stair found not to be an issue. Church has recently been subject to heritage crime.
	CONDITION:	Very bad	Repairs to the tower and window masonry on hold. Fundraising underway.
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1321637	Contact: Trudi Hughes 01223 582739

SITE NAME:	A ringwork and bailey castle, ring ditch and enclos	ures east of Brookla	and Farm, Biggleswade
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010115
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lacentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / CENTRAL BEDFORDSHIRE (UA) / BRAINTREE

DESIGNATION:Scheduled Monument, LB grade IILIST ENTRY NUMBER:1013016CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Visitor erosion - limited/localisedNEW ENTRY?:NoOWNER TYPE:Commercial companyCONTACT:Will Fletcher 01223 582710SITE NAME:Moated site at Ivy Hall, CranfieldCONTACT:1009592DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1009592condition:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateContact:David Kenny 01223 582760SITE NAME:Totternhoe Castle: a motte and bailey castle, medization and the significant localised DESIGNATION:LIST ENTRY NUMBER:1020772CONDITION:Generally satisfactory but with significant localised TREND:LIST ENTRY NUMBER:1020772	NAME:	Ringwork at The Round House, Brogborough Park	Farm, Brogboroug	h
CONDITION: problems Private Declining PRINCIPAL VULNERABILITY: Visitor erosion - limited/localised NEW ENTRY?: No OWNER TYPE: Commercial company CONTACT: Will Fletcher 01223 582710 SITE NAME: Moated site at Ivy Hall, Cranfield UST ENTRY NUMBER: 1009592 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1009592 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Totternhoe Castle: a motte and bailey castle, medieval quarries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772	SNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1013016
OWNER TYPE:Commercial companyCONTACT:Will Fletcher 01223 582710SITE NAME:Moated site at Ivy Hall, CranfieldDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1009592CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateTotternhoe Castle: a motte and bailey castle, mediative and curries and curries and curries. TotternhoeDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1020772DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1020772	DITION:		TREND:	Declining
SITE NAME: Moated site at lvy Hall, Cranfield DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1009592 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Totternhoe Castle: a motte and bailey castle, medieval quarries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772	CIPAL VULNERABILITY:	Visitor erosion - limited/localised	NEW ENTRY ?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1009592 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Totternhoe Castle: a motte and bailey castle, medieval quarries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772	IER TYPE:	Commercial company	CONTACT:	Will Fletcher 01223 582710
CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Totternhoe Castle: a motte and bailey castle, medieuries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772	NAME:	Moated site at Ivy Hall, Cranfield		
CONDITION: problems INEND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Totternhoe Castle: a motte and bailey castle, medieval quarries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772	SNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009592
OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Totternhoe Castle: a motte and bailey castle, medieval quarries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772 Generally satisfactory, but with significant localised Interview of the statisfactory but with significant localised	DITION:		TREND:	Declining
SITE NAME: Totternhoe Castle: a motte and bailey castle, medieval quarries and cultivation terraces, Totternhoe DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: [020772] Generally satisfactory, but with significant localised	CIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020772	IER TYPE:	Private	CONTACT:	David Kenny 01223 582760
Generally satisfactory but with significant localised	NAME:	Totternhoe Castle: a motte and bailey castle, medi	ieval quarries and cu	ultivation terraces, Totternhoe
Generally satisfactory but with significant localised	SNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020772
problems	DITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY: Visitor erosion - extensive NEW ENTRY?: No	CIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY ?:	No
OWNER TYPE: Local authority CONTACT: David Kenny 01223 582760	IER TYPE:	Local authority	CONTACT:	David Kenny 01223 582760

ESSEX

BRAINTREE



A timber-framed water mill with an integral dwelling SITE NAME: Codham Mill and Mill House, thought to date to the mid-late C18. The mill building is Codham's Lane, Wethersfield little altered, and retains its water wheel, primary and DESIGNATION: Listed Building grade II* secondary gearing and the great majority of its milling machinery. The water management system on the site is CONDITION: Poor also unaltered making this ensemble of buildings, machinery OCCUPANCY: and watercourses an extremely rare survival. Continuing Vacant/not in use concern over condition of mill. Local Authority monitoring. PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1123325 Contact: Sheila Stones 01223 582716

© Historic England



SITE NAME:	Parish Church of St Mary Magdalene, High Street, Wethersfield
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1337860

Contact: Trudi Hughes 01223 582739

Mainly CI2 to early CI5 altered in CI8, restored in CI9. Flint and pebble rubble with dressings of limestone and clunch, roofed with red clay tiles, felt and lead. The nave is covered with felt roofing which is beyond its design life and showing extensive signs of leakage. There is a complete late C15 camber beam roof immediately below with extensive evidence of water ingress. North aisle roof is also leaking onto medieval wall fabric and monuments.

© Historic England

SITE NAME:	Circular cropmark at Ferriers Farm, 190m south we	st of Hill Farm, Bu	res Hamlet
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010501
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	David Kenny 01223 582760

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / BRAINTREE / BRENTWOOD

SITE NAME:	Roman villa 480m south east of Hill Farm, Gestin	ngthorpe / Wickham S	St. Paul
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011806
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY ?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Sible Hedingham South (Swan Street), Sible Hed	ingham	
DESIGNATION:	Conservation Area, 46 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Emma Goodings (LPA) 01376 552525
SITE NAME:	Silver End		
DESIGNATION:	Conservation Area, 22 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Emma Goodings (LPA) 01376 552525

BRENTWOOD

	SITE NAME:	Chantry Chapel and Mausoleum, Thorndon Park	Mid C19 private Roman Catholic chapel and mausoleum of the Petre family with a polychrome Gothic Revival interior.
	DESIGNATION:	Listed Building grade II*, RPG grade II*, CA	Designed by William Wardell and located south west of Thorndon Hall (now flats). Historic England have given Grants for Heritage at Risk grants towards three phases of
	CONDITION:	Poor	external repairs to the masonry and roofs, which are approaching completion, but an extensive programme of
	OCCUPANCY:	Vacant/not in use	internal conservation is still needed. The Historic Chapels
© Historic England	PRIORITY CATEGORY:	C (C)	Trust now own the building and plan to return it to use in connection with the opening of the adjoining burial ground.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1293260	Contact: Malcolm Starr 01223 582723

© Historic England	SITE NAME:	Thoby Priory ruins, Thoby Lane, Mountnessing	comprising south wall of presbytery and south nave arcade.
	DESIGNATION:	Scheduled Monument and Listed Building grade II	The buried archaeological remains secured as part of a housing scheme. Opportunities for improved monument management. No progress on repair of wall.
	CONDITION:	Poor	5 1 5 1
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1005560 and 1293183	Contact: Will Fletcher 01223 582710



	SITE NAME:	Church of St Paul, Mores Lane, Brentwood	Parish church 1878, by EC Lee. Flint walls with stone dressings. Leaking iron gutters on stone stringcourses
	DESIGNATION: Listed Place of Worship grade II Much Bath	starting to cause failure in stone. Evidence of active leakage. Much Bath stone in evidence, some of which appears to be	
		Poor	of poor quality and particularly susceptible to decay due to excess moisture. In 2016 the Parish succeeded in obtaining
	PRIORITY CATEGORY:	C (C)	a Listed Places of Worship Roof Repairs Grant for re-
	OWNER TYPE:	Religious organisation	roofing but much decaying stonework remains. Parish considering potential sources for future grants.
1 24	LIST ENTRY NUMBER:	1207545	Contact: Trudi Hughes 01223 582739

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

LIST ENTRY NUMBER:

1235784

CHELMSFORD



St Michael's Roxwell is a medieval church of probable C14 SITE NAME: Church of St Michael, The Street, Roxwell date but much restored in C19. Flint rubble with stone dressings, tiled roofs, timber porch and bell turret, shingled Listed Place of Worship grade spire. The roof tiling has loosened and tiles are slipping. Evidence of continuing internal leakage. Roofs investigated DESIGNATION: II*, CA and priority areas established. Parishioners considering CONDITION: Very bad issues and possible solutions which involve wider PRIORITY CATEGORY: community involvement. A (A) OWNER TYPE: Religious organisation

© Historic England



SITE NAME:	Danbury Park, Danbury / Sandon	Mid C19 gardens created for the Bishops of Rochester, focussed on the early C19 Danbury Palace and set with a
DESIGNATION:	Registered Park and Garden grade II, 2 LBs, SM, part in CA	C16-C18 landscape park developed by the Mildmay, Fytche and Round families from an earlier medieval deer park. The site is divided between multiple owners, resulting
CONDITION:	Generally unsatisfactory with major localised problems	in differential management, obstructed views and fragmentation of the designed landscape. Numerous features, such as the icehouse, ha-ha, lakes, and Lime
VULNERABILITY:	High	Avenue are deteriorating. An historic landscape survey
TREND:	Declining	exists, but a shared vision and strategy for improved management across the whole site is required.
NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	
LIST ENTRY NUMBER:	1000739	Contact: Christopher Laine 07780 545 979

Contact: Trudi Hughes 01223 582739

SITE NAME:	West End		
DESIGNATION:	Conservation Area, 3 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Michael Hurst (LPA) 01245 606739

COLCHESTER

	SITE NAME:	Ruins of Church of St Mary, North of Birch Hall, Birch	Small Norman church dated to C12. No longer used for worship. Now a roofless ruin with some structural
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	problems. Principally, the unconsolidated flint rubble walling is at risk. There is currently no public access to the site. A Conservation Management Plan has been
	CONDITION:	Very bad	completed, but no repair scheme has been agreed.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1002144 and 1110898	Contact: David Kenny 01223 582760

© Historic England



	LIST ENTRY NUMBER:	1002144 and 1110898	Contact: David Kenny 01223 582760
*	SITE NAME:	Municipal Water Tower "Jumbo", Balkerne Passage, Colchester	Monumental water tower, C19, decommissioned in the 1980s. Redundant building and local landmark. A feasibility study has been undertaken by the Colchester and North
in the second	DESIGNATION:	Listed Building grade II*, CA	East Essex Building Preservation Trust, and they have developed a project with the aim of securing repair and
	CONDITION:	Very bad	future publically beneficial use.
a strange	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1123669	Contact: Andrew Martindale 01223 582705

PRIORITY CATEGORIES

© Essex County Council

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

use).

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / COLCHESTER / EPPING FOREST



SITE NAME:	Barn south of Marks Tey Hall, Hall Chase, Barn south of Marks Tey Hall, A12, Marks Tey	A timber-framed barn of three bays with brick nogging infill and a clay tiled roof. Internally a crown post roof is in complete condition and two shuttered windows survive
DESIGNATION:	Listed Building grade II*	with the sliders in situ. The original purpose of the building is uncertain but the first floor was fitted out and used as a
CONDITION:	Poor	granary at an early date. The building is now in a poor state of repair. Rotten timbers, missing tiles, concrete rendering
OCCUPANCY:	Vacant/not in use	and lack of rainwater goods contribute to its condition.
PRIORITY CATEGORY:	C (C)	The building has been sheeted, propped and mothballed. Discussions with owner and local authority are on-going.
OWNER TYPE:	Private	, , ,
LIST ENTRY NUMBER:	1224577	Contact: Claire Fidler 01223 582735

© Historic England



SITE NAME:	Church of St Peter, North Hill, Colchester	C I Sto
DESIGNATION:	Listed Place of Worship grade II*, CA	sta sto une
CONDITION:	Very bad	Mc dai
PRIORITY CATEGORY:	B (C)	urg
OWNER TYPE:	Religious organisation	reg use
LIST ENTRY NUMBER:	1123570	Co

15 church, re-modelled C17 and with C19 alterations. one rubble with brick west tower of 1758, the upper two ages of which have rusticated quoins. The high-level onework is in fair condition. Perimeter gutters are dersized and below ground drainage is inadequate. ovement in north porch. Plaster fall internally due to imp ingress. Nave and chancel roofs in need of very gent repair. The congregation launched a major generation project in 2019 to address repairs and greater e.

ontact: Trudi Hughes 01223 582739

© Historic England

SITE NAME:	Roman villa 450m south of Warren's Farm, Great	Теу	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013516
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Remains of St Mary the Virgin's Church, Virley		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1019880
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Religious organisation	CONTACT:	David Kenny 01223 582760
SITE NAME:	Birch		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Unknown
VULNERABILITY:	Medium	CONTACT:	Simon Cairns (LPA) 01206 508650

EPPING FOREST



SITE NAME:	Essex Redoubt at Ongar Radio Station, North Weald Bassett / Bobbingworth	Late and a conc
DESIGNATION:	Scheduled Monument	local Con
CONDITION:	Poor	site a deve
OCCUPANCY:	Vacant/not in use	there
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1018456	Con

e C19 redoubt consisting of early concrete structures associated earthworks. Buildings at risk from failure of crete and vandalism. Discussions with the owners and l authority have centred on proposals to commission a nservation Management Plan for beneficial re-use of the as an outdoor activity centre in the context of local elopment proposals. These discussions have stalled and e has been no further progress.

ntact: Will Fletcher 01223 582710

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

D

Е

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. obvious new user (applicable only to buildings capable of beneficial

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / EPPING FOREST

	SITE NAME:	Littlebury Farmhouse, Romford Road, Stanford Rivers	Timber-framed house of c1540 and earlier. A lean-to roof is not watertight and is in poor condition. The timber frame
	DESIGNATION:	Listed Building grade II*	is protected by ply sheeting. The building remains unoccupied and although gutters have been cleared and
	CONDITION:	Poor	vegetation cut back its condition continues to deteriorate. Discussions with owner and local planning authority are
14 GENERAL	OCCUPANCY:	Vacant/not in use	on-going.
	PRIORITY CATEGORY:	C (C)	
A ALCONTRACTOR	OWNER TYPE:	Private	
© Epping Forest District Council	LIST ENTRY NUMBER:	1306771	Contact: Sheila Stones 01223 582716



© Historic England

	SITE NAME:	Grand Magazine, Waltham Abbey Royal Gunpowder Mills, Waltham Abbey	C19 rectangular, barrel-vaulted brick structure with a smaller barrel-vaulted west 'transept'. Masonry has collapsed and there is extensive vegetation growth.
	DESIGNATION:	Scheduled Monument, 2 LBs, part in CA	Cracking is evident throughout the structure, with flattening to the head of the vault and extensive moisture ingress. A programme of tree clearance around the
	CONDITION:	Poor	structure has been completed and repair proposals should be addressed once the future management of the site is
	OCCUPANCY:	Vacant/not in use	clarified.
- Cash	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1016618	Contact: David Kenny 01223 582760

	SITE NAME:	Quinan Stove, Waltham Abbey Royal Gunpowder Mills, Waltham Abbey	A technologically innovative building of 1935. Eighteen bays in length with steel hooped frames and longitudinal purlins. There is extensive evidence of steelwork corrosion and the
	DESIGNATION:	Scheduled Monument, 2 LBs, part in CA	roof and windows are deteriorating. Historic England Heritage at Risk Grant accepted in July 2018 and a project development phase to identify a suitable conservation
	CONDITION:	Very bad	strategy was successfully completed in 2019.Trials for repairs completed. Further more detailed evaluation
And I - H-	OCCUPANCY:	Vacant/not in use	required to establish most appropriate and viable
	PRIORITY CATEGORY:	B (B)	conservation option.
© Historic England	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1016618	Contact: David Kenny 01223 582760
Å	SITE NAME:	Church of St Nicholas, Willingale Road, Fyfield	Parish church dated to C12. Central tower incorporating re-used Roman materials, but displaying problems with
	DESIGNATION:	Listed Place of Worship grade II*	eroded quoins and open joints.
	CONDITION:	Poor	
IIE A THEIR RAFE OF	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1337250	Contact: Malcolm Starr 01223 582723

© Historic England

SITE NAME:	A London mobilisation centre known as the North	Weald Redoubt, N	North Weald Bassett / Bobbingworth
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018456
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Will Fletcher 01223 582710

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / EPPING FOREST / HARLOW / MALDON

SITE NAME:	Waltham Abbey Royal Gunpowder Factory, Walth	am Abbey	
DESIGNATION:	Scheduled Monument, 2 LBs, part in CA	LIST ENTRY NUMBER:	1016618
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Other not for profit group	CONTACT:	David Kenny 01223 582760
site name:	Lower Sheering, Sheering		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Maria Kitts (LPA) 01992 564358
SITE NAME:	Nazeing and South Roydon, Nazeing / Roydon		
DESIGNATION:	Conservation Area, 49 LBs, SM	NEW ENTRY?:	No
CONDITION:	Optimal	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Maria Kitts (LPA) 01992 564358
site name:	Royal Gunpowder Factory, Waltham Abbey, Walth	nam Abbey	
DESIGNATION:	Conservation Area, 21 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Maria Kitts (LPA) 01992 564358
SITE NAME:	Waltham Abbey		
DESIGNATION:	Conservation Area, 49 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Maria Kitts (LPA) 01992 564358
HARLOW			
SITE NAME:	Roman villa 500m north east of Harlowbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014738
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760

MALDON

	SITE NAME:	Creeksea Place, Ferry Road, Creeksea, Burnham-on-Crouch	Former Elizabethan courtyard house completed 1569, the south range was demolished in 1740 and the east range
	DESIGNATION:	Listed Building grade II*	rebuilt in C19. Fine original garden walls and gateways. The house suffers from major structural problems and is
	CONDITION:	Very bad	extensively propped internally. Comprehensive project development completed with grant aid from Historic
	OCCUPANCY:	Part occupied/part in use	England to survey the building, research its history and plan
	PRIORITY CATEGORY:	F (B)	long-term repairs. The owners have stabilised the building, brought parts into use and carried out maintenance repairs.
and some the	OWNER TYPE:	Private	Historic England grant has secured first phase repairs to roofs of C16 wing.
Historic England	LIST ENTRY NUMBER:	1123776	Contact: Malcolm Starr 01223 582723

©Ні

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / MALDON
--

	SITE NAME:	Former Stow Maries Airfield, Flambirds Farm, Stow Maries, Cold Norton	Twenty-four surviving buildings of a World War I Royal Flying Corps airfield; the largest known surviving group of this kind, now owned by a Trust, who maintain a collection
CHRISTIC - LET	DESIGNATION:	Listed Building grade II*, CA	of flying (replica) WWI aircraft and operate the site as a museum, visitor attraction, and operational private
	CONDITION:	Very bad	aerodrome. Urgent repairs are in progress or have been completed to some of the buildings, mainly with grants
N632	OCCUPANCY:	Part occupied/part in use	from Historic England, but a long term plan is needed for
	PRIORITY CATEGORY:	B (B)	the funding of future repairs and the use of all the buildings.
	OWNER TYPE:	Charity (heritage)	
© Historic England	LIST ENTRY NUMBER:	1406155	Contact: Malcolm Starr 01223 582723

	SITE NAME:	Plume Library, including Tower of Former Church of St Peter, High Street, Maldon	Late C17 library built on the site of the church of St Peter now retaining only the West tower. The old church was granted to the Premonstratensian Canons in 1180. In 1690
	DESIGNATION:	Listed Building grade I, CA	Thomas Plume built the two-storey brick and timber library building which occupies the footprint of the nave to
	CONDITION:	Very bad	house his book collection of over 4,000 rare and important C16 and C17 texts. The lath and plaster ceiling over the
	OCCUPANCY:	Occupied/in use	library has lost its key in many places and is at risk of
Contraction of the second	PRIORITY CATEGORY:	A (New entry)	collapse. Evidence of possible structural movement and cracking in various parts of the building.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1256632	Contact: Claire Fidler 01223 582735

	SITE NAME:	Wickham Bishops timber trestle railway viaduct, Wickham Bishops	The last surviving timber trestle railway bridge in England. It comprises two adjoining viaducts, one crossing the River Blackwater, the second the Wickham Mill leat. The
	DESIGNATION:	Scheduled Monument	structures were part of the Braintree to Maldon branch line, built to carry freight and passengers inland from the
	CONDITION:	Very bad	port at Maldon. The line was operational between 1848 and 1966 although it closed to passenger traffic in 1964.
The second second	OCCUPANCY:	Vacant/not in use	Although there were extensive repairs in the 1990's, many
	PRIORITY CATEGORY:	C (C)	timbers are suffering from rot and decay caused by damp, lack of maintenance and heavy tree growth across, and
	OWNER TYPE:	Local authority	through, much of the monument.
© Historic England	LIST ENTRY NUMBER:	1002126	Contact: David Kenny 01223 582760

SITE NAME:	Mill Mound: a bowl barrow 300m south west of Bec	kingham Hall, Toll	leshunt Major
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009449
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Woodham Walter Hall: an early C16 house and its	associated garden	earthworks, Woodham Walter
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1021442
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY ?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Stow Maries World War One Aerodrome, Off Hac Purleigh	kmans Lane to rea	r of Flambirds Farm, Cold Norton /
DESIGNATION:	Conservation Area, LB grade II*	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Tim Howson (LPA) 01621 875725
	Very bad		Improving

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

20

TENDRING

Image: With the second secon	SITE NAME:	Martello Tower "D", 450 metres SSW of Clubhouse, Clacton Golf Course, Clacton on Sea	One of 29 Martello towers originally built along the east coast 1808-12, against the threat of French invasion. Owned by Tendring District Council, but access is difficult because site sits partly within a private golf course. The
	DESIGNATION:	Scheduled Monument and Listed Building grade II	forward battery was lost in the 1980s during construction of new sea defences. No internal access currently possible but the monument suffers from water ingress and loss of
	CONDITION:	Poor	render. Historic England funded a feasibility study in 2015-6 to help Tendring District Council identify beneficial use and
	OCCUPANCY:	Vacant/not in use	repair costs, and options are being reviewed.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1016553 and 1111524	Contact: Will Fletcher 01223 582710



	LIST EINTRT NOMBER.	1016553 and 1111524	Contact: Will Fletcher 01223 582710
	SITE NAME:	Martello Tower "E", 300 metres south west of junction of Marine Parade West and Wash Lane, Clacton on Sea	One of 29 Martello towers originally built along the east coast 1808-12, against the threat of French invasion. The forward battery was destroyed in 1819. The tower contains a large water tank, inserted after 1935 when the tower
	DESIGNATION:	Scheduled Monument and Listed Building grade II	became incorporated into a holiday camp. Suffers from water ingress and loss of render. In March 2020 Historic England grant aided Tendring District Council for urgent
Ĩ	CONDITION:	Poor	repairs to make the building safe and water-tight. Options for reuse are currently being reviewed.
8	OCCUPANCY:	Vacant/not in use	for reduce are currently being reviewed.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1016554 and 1337150	Contact: Will Fletcher 01223 582710



SITE NAME:	Spring Valley Mill, Spring Valley Lane, Ardleigh	C18 watermill, white weatherboarding over painted by base. Beam engine of c1873 now gone but mill machin intact. Mill disused since1930s. Roofs leaking and buildi splitting apart. Front wall bulging and some of the
DESIGNATION:	Listed Building grade II*	
CONDITION:	Very bad	weatherboarding is missing. These defects put the structur and the machinery inside at serious risk. Investigation and
OCCUPANCY:	Vacant/not in use	urgent works to 'mothball' the building, grant aided by
PRIORITY CATEGORY:	B (B)	Historic England, have been carried out. Final report to be reviewed with owner, his advisers and local planning
OWNER TYPE:	Private	authority as appropriate to determine a viable way forward.
LIST ENTRY NUMBER:	1112053	

© Historic England

© Historic England



© Historic England

3	OWNER TYPE:	Private	forward.		
LIST ENTRY NUMBER: 2053		1112053	Contact: Domenico D'Alessandro 01223 582742		
	SITE NAME:	Martello Tower "K", Kirby Road, Walton on the Naze, Frinton and Walton	One of 29 Martello towers originally built along the east coast 1808-12, against the threat of French invasion. Some internal alteration and problems arising from water ingress.		
	DESIGNATION:	Scheduled Monument and Listed Building grade II	Pre-application discussions for domestic conversion commenced May 2014. Structural investigations have been undertaken and the principles of proposed domestic		
1-	CONDITION:	Poor	conversion have been agreed with Historic England. A scheme for domestic conversion has been discussed with		
-	OCCUPANCY:	Vacant/not in use	Historic England but has yet to be agreed and		
	PRIORITY CATEGORY:	C (D)	implemented.		
	OWNER TYPE:	Private			
	LIST ENTRY NUMBER:	1016787 and 1111504	Contact: Will Fletcher 01223 582710		

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lacentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument


HERITAGE AT RISK 2020 / EAST OF ENGLAND / TENDRING

	SITE NAME:	Redoubt, Main Road, Harwich	Redoubt. 1808-1810. Of brick and granite. Circular plan
DES	DESIGNATION:	Listed Building grade II*, SM	form with internal courtyard and brick vaulted chambers. Designed as bomb-proof fortification with effective artillery
	CONDITION:	Poor	power to withstand lengthy siege. Upper level contains batteries for ten 24-pounder cannon. Dry moat revetment
Contraction of the second seco	OCCUPANCY:	Part occupied/part in use	in brick. Suffering effects of water ingress - significant loss of
	PRIORITY CATEGORY:	B (New entry)	pointing to inner and outer moat walls, or cement poin resulting in loss of brick facings. Internally there are
	OWNER TYPE:	Charity (heritage)	significant signs of plant growth throughout, as a result of missing pointing and failing roof coverings.
	LIST ENTRY NUMBER:	1187916	Contact: Claire Fidler 01223 582735

© Copyright of HE


© Historic England

	SITE NAME:	Beacon Hill Fort, Harwich	Ruined coastal artillery fortification of late C19; refortified
DESIGNATION: CONDITION: CONDITION: CONDITION: PRIORITY CATEGOR OWNER TYPE:	DESIGNATION:	Scheduled Monument, part in CA	during the two World Wars. Fabric at risk from failure of concrete, water ingress and vandalism. Monument is in split ownership. Historic England continues to liaise with
	CONDITION:	Poor	Tendring District Council, private owners and interested third parties over potential new uses. New private owner
	OCCUPANCY:	N/A	in 2018 and vegetation clearance begun.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1018958	Contact: Will Fletcher 01223 582710

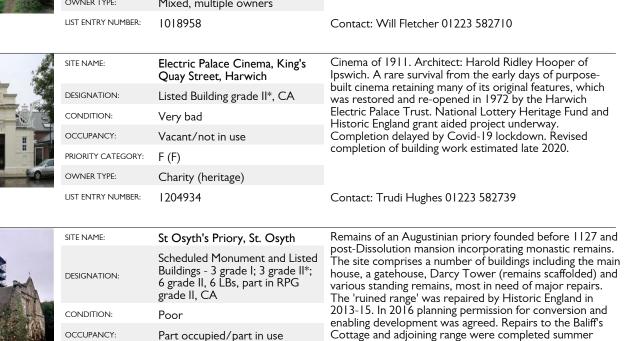

© Historic England

© Historic England

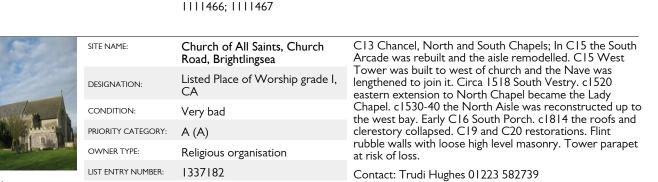

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but not yet implemented.

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

F (F)

Private

1002193 and 1337158;

1337159; 1111495; 1308972;

1337160; 1166310; 1111468; ||||496; ||||460; ||||462;

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

2017. On-going discussions with the owners and the St

Contact: Andrew Martindale 01223 582705

Osyth Priory and Parish Trust.

- Conservation Area Listed Building LB
- I PA
 - Local Planning Authority National Park NP
 - Registered Park and Garden Scheduled Monument RPG
 - SM ΪA
 - Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / TENDRING

II*, CA

Poor

A (A)



A substantial late medieval church of flint and stone rubble, Church of St Michael, The much restored in the C19. The building suffers from Street, Frinton and Walton subsidence at the east end of the chancel, resulting in Listed Place of Worship grade substantial cracks in the walls and at the junction of the chancel roof and the east gable. Structural movement continues, with previously repaired areas cracking again. Monitoring, soil investigation and analysis have been carried out for repair options to be considered by the PCC. Religious organisation 1111500 Contact: Malcolm Starr 01223 582723

© Historic England

SITE NAME:	Crop mark site south of Ardleigh, Ardleigh		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002146
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	The Dovercourt lighthouses and causeway, Harwich	I	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017200
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Will Fletcher 01223 582710
SITE NAME:	The Harwich Treadwheel Crane, Harwich		
DESIGNATION:	Scheduled Monument, LB grade II*, CA	LIST ENTRY NUMBER:	1017202
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Trudi Hughes 01223 582739
SITE NAME:	Beacon Hill Fort: a late 19th and 20th century coast	al artillery fortifica	tion, Harwich
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1018958
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Will Fletcher 01223 582710
SITE NAME:	Clacton Seafront, Clacton-on-Sea		
DESIGNATION:	Conservation Area, 6 LBs, RPG grade II, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	William Fuller (LPA) 01255 686188
SITE NAME:	Dovercourt, Harwich		
DESIGNATION:	Conservation Area, 6 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	William Fuller (LPA) 01255 686188
SITE NAME:	St Osyth, St. Osyth		
DESIGNATION:	Conservation Area, 59 LBs, part in RPG grade II, SM	NEW ENTRY ?:	No
	.		
CONDITION:	Poor	TREND:	Deteriorating

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA LB

- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM

UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / TENDRING / UTTLESFORD

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

SITE NAME:	Thorpe-le-Soken		
DESIGNATION:	Conservation Area, 24 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	William Fuller (LPA) 01255 686188
SITE NAME:	Thorpe-le-Soken Station and Maltings, Thorpe-le-Soken		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:		TREND:	Detenionating significantly
condition.	Very bad	INEND:	Deteriorating significantly

UTTLESFORD

	SITE NAME:	Stone Hall, Little Canfield	Stone Hall dates back to the fourteenth century originally
	DESIGNATION:	Listed Building grade II*	used as a religious retreat together with gardens and woods extending to 25 acres. The Countess of Warwick
	CONDITION:	Poor	developed the garden and pleasure garden in the early C20. There is surviving ornamental planting as well the
	OCCUPANCY:	Vacant/not in use	remains of a grotto at the pond/sunken area to the south
	PRIORITY CATEGORY:	A (New entry)	of the Hall. Overall structural movement affecting the whole property is a matter for concern. Roofs are leaking
	OWNER TYPE:	Private	locally and rainwater goods are in a poor state. Property is vacant; local planning authority and Historic England to
	LIST ENTRY NUMBER:	33409	discuss next steps with the owner.

© Historic England

© Historic England

© Historic England



Tilty Mill, Tilty

Vacant/not in use

Very bad

A (A)

Private

II*, CA

Poor

A (A)

1233999

1112221

Listed Building grade II*

Church of St Mary the Virgin,

Listed Place of Worship grade

The Street, Manuden

Religious organisation

Contact: Trudi Hughes 01223 582739

Watermill, early C18. Milling machinery intact. Evidence of major structural failure which is endangering interior features. The Local Authority served an Urgent Works Notice in 2018 to make the building wind and watertight. This has now been complied with, however a comprehensive programme of repairs is needed. Discussions continue between Historic England and the Local Authority in relation to the preparation of a full schedule of repairs and service of a Repairs Notice.

Contact: Domenico D'Alessandro 01223 582742

Contact: Robert Parkinson

Church with probable C12 origins. Largely demolished and rebuilt in the 860s. Constructed from flint rubble with stone dressings and a tile roof. Shingled spire showing signs of loss and curling of shingles; north transept (vestry) roof tiles are slipping. The latter are over a C15 roof structure with plastered ceiling and there is mould growth on the western part of the ceiling, which is indicative of a leaking roof. Patch repairs secured. Tiles slipping elsewhere. The parish have set up a subcommittee to advance the reroofing project, which they hope will be followed by a spire project.

Contact: Trudi Hughes 01223 582739

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / UTTLESFORD / BROXBOURNE



SITE NAME: Church of St Mary the Virgin, Church End, Stebbing Listed Place of Worship grade I, DESIGNATION: CA CONDITION: Poor PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1112777

An unusually well preserved fourteenth century church, with some later work including the three-bay stone rood screen, built in imitation of the CI4 original by Woodyer in 1884. Settlement in many areas of the nave and aisle flooring, due to continuing leaks of a post WWII under floor heating system. In some areas this is becoming a health and safety issue. It's also primarily responsible for the salt migration and decay of medieval fabric. C16 series of painted texts in the north aisle in urgent need of consolidation. Major scheme of repairs being developed.

Contact: Trudi Hughes 01223 582739

© Historic England

SITE NAME:	Romano-Celtic temple 400m south of Dell's Farm, Great Chesterford				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017453		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Site of Waltham Hall, Takeley				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002161		
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760		



	Commercial com	bany	David Kenny 01223 582760
	SITE NAME:	Easton Lodge, Little Easton	Edwardian gardens designed by Harold Peto c1902,
	DESIGNATION:	Registered Park and Garden grade II, 3 LBs	incorporating a late C17/early C18 grove. The house was fire damaged and finally demolished in 1950. Converted service buildings and infill development remain. Built
	CONDITION:	Generally satisfactory but with significant localised problems	structures within the garden have deteriorated, particularly the Italian Garden. Ownership split between private owners of houses and an investment company. Garden
	VULNERABILITY:	High	continues to open to public in a limited manner under the
	TREND:	Stable	direction of the charity, The Gardens of Easton Lodge Preservation Trust. The majority landowner is producing a
	NEW ENTRY?:	No	Conservation Management Plan with the Trust.
	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	1001484	Contact: Christopher Laine 07780 545 979

HERTFORDSHIRE

© Historic England

HERTFORDSHIKE			
BROXBOURNE			
SITE NAME:	Churchgate		
DESIGNATION:	Conservation Area, 23 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Colin Haigh (LPA) 01992 785555 ext: 5951
SITE NAME:	Wormley		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Colin Haigh (LPA) 01992 785555 ext: 5951

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

use).

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

DACORUM

and the second	SITE NAME:	The Grotto, the Tomb, and the Tunnel at Ashridge Management College (100 metres to south of the Chapel), Little Gaddesden	A garden feature, known also as "The Souterrain", executed c1813-1821 by Wyatville to a design by Repton (who laid out the garden). The "tomb" is that of the Duke of Bridgewater's favourite horse, and adjoins the Tunnel,
	DESIGNATION:	Listed Building grade II*, RPG grade II*	which is lined with flint on a structural iron grid. The latter is corroding, causing the flints to fall out, and making the tunnel unsafe, and forcing its closure
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
© Historic England	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Educational (independent)	
	LIST ENTRY NUMBER:	74274	Contact: Andrew Martindale 01223 582705

	SITE NAME:	Church of St Leonard, High Street, Flamstead	Tower is early C12; nave arcades, aisles and part of chancel early C13; clerestory, nave roof, upper stage of tower,
	DESIGNATION:	Listed Place of Worship grade I, CA	spirelet, north and south porches C15. The chancel was repaired c1860 for University College Oxford; restoration c1902-5 by EF Cobb; further restoration in 1974. Flint
	CONDITION:	Very bad	walling with coursed flint facing and Totternhoe stone dressings. Nave roof propped with its covering at end of its
	PRIORITY CATEGORY:	E (B)	life; nationally significant cycles of wall paintings at risk from
	OWNER TYPE:	Religious organisation	damp. National Lottery Heritage Fund second stage grant awarded; progress being made.
and the second second second second	LIST ENTRY NUMBER:	1172799	Contact: Trudi Hughes 01223 582739
Historic England			

©Н

EAST HERTFORDSHIRE

	SITE NAME:	Remains of old church tower of St Mary and All Saints Church, Thundridge	Ruinous C15 west tower belonging to the C11 to C12 church of St Mary and All Saints. Flint rubble with some dressings; a Romanesque doorway has been reset within
	DESIGNATION:	Listed Building grade II*, SM	the blocking of the chancel arch. The church was demolished in 1853; only the tower remains substantially
	CONDITION:	Poor	above ground. The site suffers from decay, vandalism and anti-social behaviour but blocking of the tower has reduced
	OCCUPANCY:	N/A	incidence of vandalism. In redundancy process. Discussions
	PRIORITY CATEGORY:	D (D)	have commenced to establish a trust to manage the site locally.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1077953	Contact: James Albone 01223 582781



The church was demolished in 1853; only the separately Remains of St Mary and All Saints, Old Church Lane, SITE NAME listed three-stage tower (see separate entry for remains of Thundridge old church tower) remains substantially above ground within the scheduled churchyard and adjacent manorial Scheduled Monument, LB grade moated site. The rest of the church (demolished to DESIGNATION: II*, part in RPG grade II* foundation level) and the churchyard wall are scheduled, with much of the churchyard wall now lost. Buried CONDITION: Very bad archaeological remains are also considered to be at risk OCCUPANCY: N/A from vandalism and anti-social behaviour. Discussions regarding local management commenced spring 2019. PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1012268 Contact: James Albone 01223 582781

© Historic England

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid в deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / EAST HERTFORDSHIRE

	SITE NAME:	Church of St Mary, The Street, Furneux Pelham	Parish church. Large C15 building, except for mid-C13 chancel and early C16 south chapel. North and south aisles
	DESIGNATION:	Listed Place of Worship grade II*, CA	of chapel with arcades of three bays. Two storey south porch. West tower of three stages with embattled parap and spike. Chancel had C13 lancets and piscina and sedil
	CONDITION:	Very bad	Good C15 tie beam roofs to nave and aisles, and south chapel with traceried spandrels and carved angels. The
	PRIORITY CATEGORY:	A (New entry)	church has been victim of heritage crime and are trying to
	OWNER TYPE:	Religious organisation	raise funds for repairs.
	LIST ENTRY NUMBER:	1307889	Contact: Trudi Hughes 01223 582739

© Historic England

SITE NAME:	Roman site near railway station, Braughing / Standon				
DESIGNATION:	Scheduled Monument, part in CA LIST ENTRY NUMBER: 1005249				
CONDITION:	Extensive significant problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No		
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Baroque garden in Grotto Wood, Hertingfordbury				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020293		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No		
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760		
SITE NAME:	Thundridgebury moated enclosure and associated r Church and graveyard, Thundridge	emains of Thundri	dgebury House, St Mary and All Saints'		
DESIGNATION:	Scheduled Monument, LB grade II*, part in RPG grade II*	LIST ENTRY NUMBER:	1012268		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No		
OWNER TYPE:	Mixed, multiple owners	CONTACT:	James Albone 01223 582781		



C18-early C19 landscape park laid out by Humphry Repton SITE NAME: Panshanger, Hertingfordbury / for early C19 country house (demolished mid C20), Hertford utilising the Mimram valley and earlier C18 landscape by Lancelot 'Capability' Brown at Cole Green. Phased mineral Registered Park and Garden DESIGNATION: grade II*, 6 LBs extraction since the 1990s has impacted landscape character, key views and the condition of landscape Generally satisfactory but with CONDITION: features including gardens, water bodies and woodland. significant localised problems Undergoing restoration as a country park, with some areas VULNERABILITY: High already open to the public. A Heritage Management Plan is informing the next phases as the site shifts from active TREND: Improving quarrying and into restoration. NEW ENTRY ?: No OWNER TYPE: Mixed, multiple owners LIST ENTRY NUMBER: 1000916 Contact: Christopher Laine 07780 545 979

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

27

HERTFORDSHIRE / ESSEX


EAST HERTFORDSHIRE / EPPING FOREST

@ Historic England	SITE NAME:	Briggens, Hunsdon / Roydon / Stanstead Abbots	Early C18 landscape park retaining features designed by Charles Bridgeman c1720, and focussed on a C18 and later
	DESIGNATION:	Registered Park and Garden grade II, 7 LBs	country house set within early C20 Edwardian pleasure grounds designed by Lord Hunsdon. The site is in divided ownership with the majority of the parkland in use as a golf
	CONDITION:	Extensive significant problems	course until recently. Built structures are unoccupied and multiple key features are in very poor condition, including
	VULNERABILITY:	High	Bridgeman's formal water bodies, the arboretum, pleas ground shrubberies, the C18 walled garden, the avenue along the C19 Roydon drive, and the C19 and early C2
	TREND:	Declining	
	NEW ENTRY?:	No	entrance lodges.
	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1001705	Contact: Christopher Laine 07780 545 979

HERTFORDSHIRE

NORTH HERTFORDSHIRE

Jan -	SITE NAME:	Knebworth House, Knebworth	Knebworth House comprises the remains of a C16
ngland	LIST ENTRY NUMBER:	1003542 and 1102564	Contact: James Albone 01223 582781
	OWNER TYPE:	Private	
	PRIORITY CATEGORY:	C (C)	
	OCCUPANCY:	N/A	
	CONDITION:	Poor	
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	Unconsolidated flint rubble. Wall facing is being lost. A building survey was undertaken in 2017, fabric subject to slow deterioration.
	SITE NAME:	Ruins of Church of St Etheldreda, Chesfield, Graveley	Former C14 church of St Etheldreda, part demolished in 1750. Now a roofless ruin in a private garden.
	` L		

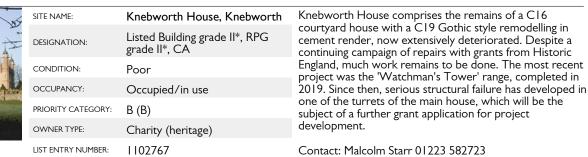

© Historic England

© Historic Eng



© Historic England

C. Action of the	SITE NAME:	Minsden Chapel, Whitwell Road, Langley	Ruined remains of a small C14 two-cell church with bellcote. Built of flint rubble with stone dressings, plastered
The second s	DESIGNATION:	Scheduled Monument and Listed Building grade II	externally. Probably a ruin by end of C17. Church was dedicated to St Nicholas. Inspection showed loss of voussoirs from openings and general erosion of fabric
	CONDITION:	Poor	which requires consolidation. The church has now been declared redundant and is in private hands. Historic
	OCCUPANCY:	N/A	England are discussing the management of the site with the
	PRIORITY CATEGORY:	D (D)	new owner.
N	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1003543 and 1347462	Contact: James Albone 01223 582781

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

ŬA

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORTH HERTFORDSHIRE

HERITAGE AT RISK 2020 / EAST C			
	SITE NAME:	North Hertfordshire Masonic Lodge (the Cloisters), Barrington Road, Letchworth Garden City	Built in 1906-7 as a residential school of ethics and psychology based on Arts and Crafts principles. Architect WH Cowlishaw, a follower of William Morris. Highly idiosyncratic design incorporating a philosophical approach to matrials with both traditional and prograssive themes
ANIN	DESIGNATION:	Listed Building grade II*, CA	to materials with both traditional and progressive themes, but now costly to maintain. Currently the North
RANDER	CONDITION:	Very bad	Hertfordshire Masonic Lodge, but with much of the building unused. Problems of internal and external
	OCCUPANCY:	Occupied/in use	deterioration due to rainwater penetration. The owners
	PRIORITY CATEGORY:	A (A)	are currently exploring sources of funding for repairs.
© Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1102019	Contact: Malcolm Starr 01223 582723
	SITE NAME:	West Barn at Rectory Farm, Shillington Road, Pirton	Tithe barn built late C15 or early C16. The building is now vacant and in need of major repairs. Other buildings on site
	DESIGNATION:	Listed Building grade II*, CA	have been converted into houses. Sympathetic proposals for repair and partial conversion have been agreed but
	CONDITION:	Poor	have yet to be implemented. Barn letting in water. Owner has carried out temporary repairs to keep the weather out
	OCCUPANCY:	Vacant/not in use	Discussions regarding conversion proposals on-going.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1175545	Contact: Lynette Fawkes 01223 582751
	SITE NAME:	Church of St Mary, Church Street, Baldock	Prominently sited parish church dating from the C13, with C14 and C15 alterations and additions. Some C19
	DESIGNATION:	Listed Place of Worship grade I, CA	restoration. Tower spire C19. Tower, with nave and chancel, north and south aisles and porches. Nave and south aisle roofs are leaking. Some flint facework on south
Star Star and	CONDITION:	Poor	aisle and to south porch is loose. National Lottery He Fund Grants for Places of Worship grant for the south
	PRIORITY CATEGORY:	B (B)	roof awarded in 2014. The parish have submitted a project
	OWNER TYPE:	Religious organisation	enquiry to the National Lottery Heritage Fund for reroofing nave and chancel envisaging submitting a grant
LT GALD LEVE DOWNERS AND	LIST ENTRY NUMBER:	3476	application in 2019.
© Barker & Associates LLP			Contact: Malcolm Starr 01223 582723
	SITE NAME:	Church of St Mary, Mill Lane, Ashwell	C14 church (completed 1381). C15 north porch and aisle windows. Ashwell stone and flint rubble with red brick.
	DESIGNATION:	Listed Place of Worship grade I, CA	Low pitched slate roofs behind parapets. West tower is of four stages and has deeply projecting, stepped-angle buttresses. Spire with crenellated octagonal base. Lowest
ALA	CONDITION:	Very bad	stage has four-light decorated tracery window; belfry stage has paired pointed arches with tracery panels. Dramatic
N.m./m./m. H	PRIORITY CATEGORY:	A (A)	decay to the clunch stone on the church tower and north
	OWNER TYPE:	Religious organisation	aisle roof covering is nearing the end of its life. Parish working on a grant application to the National Lottery
and the second s	LIST ENTRY NUMBER:	1102715	Heritage Fund.
© Historic England			Contact: Trudi Hughes 01223 582739
EV4	SITE NAME:	Church of St John the Baptist, Melbourn Street, Royston	Originally church of Augustinian Priory, founded second half C12, converted to parish church post-Dissolution. C13
	DESIGNATION:	Listed Place of Worship grade I, CA	nave and aisles, C16 west tower, C19 chancel and east enc of south aisle. Nave re-roofed early C16. C15 carved stone figures of St Thomas Becket and Madonna and Child. Richly
	CONDITION:	Very bad	carved C15 wood pulpit and lectern. C18 and C19 wall monuments, including carved monument 1732 and
	PRIORITY CATEGORY:	F (A)	monument of 1834 with marble open book. Subject of
	OWNER TYPE:	Religious organisation	major fire in December 2018. Tower and part of the nave damaged. Under repair: work delayed by Covid-19. Due to
	LIST ENTRY NUMBER:	1295575	finish end 2020.
© Historic England			Contact: Andrew Martindale 01223 582705

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORTH HERTFORDSHIRE / ST ALBANS / STEVENAGE

HENTIAGE AT NISK 2020 / EAS	TOTENGLAND / NORTH HERTFORDSHIRE / 31 ALBANS / STEVEN	AGE	
SITE NAME:	Romano-British small town and late Iron Age settle	ement at Baldock	
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1016305
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Slight univallate hillfort on Wilbury Hill, Letchworth	h Garden City / Ick	leford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016410
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Royston Cave, Royston		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1015594
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Flooding - External causes	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	James Albone 01223 582781
SITE NAME:	Wymondley Priory, barn, moat, associated earthwo Wymondley	orks, enclosures, pl	atforms, hollow-way and conduit hea
DESIGNATION:	Scheduled Monument, 5 LBs	LIST ENTRY NUMBER:	1013338
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760

ST ALBANS



Remains of post-Dissolution mansion on site of medieval SITE NAME: The Benedictine Priory of St Mary (Sopwell Priory) and the priory. A major programme of repair works to the ruins has been carried out, with only a final phase of post-medieval mansions known consolidation now required in order to take the site off the as Sopwell House or Lee Hall register. This last phase has yet to be programmed. Scheduled Monument, LB grade DESIGNATION: II, part in CA CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: F (F) OWNER TYPE: Local authority LIST ENTRY NUMBER: Contact: James Albone 01223 582781 1019137

STEVENAGE

© Historic England

SITE NAME:	Broadwater, South east of Stevenage area		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Caroline Danby (LPA) 01438 242823

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / STEVENAGE / THREE RIVERS / WATFORD

SITE NAME:Rectory Lane and St NicholasDESIGNATION:Conservation Area, 9 LBsNEW ENTRY:NoCONDITION:FairTREND:DeterioratingVULNERABILITY:HighCONTACT:Caroline Danby (LPA) 01438 242823SITE NAME:Town SquareSite Name:NEW ENTRY:NoDESIGNATION:Conservation Area, 2 LBsNEW ENTRY:NoCONDITION:PoorTREND:DeterioratingVULNERABILITY:MediumCONTACT:Caroline Danby (LPA) 01438 242823				
CONDITION:FairTREND:DeterioratingVULNERABILITY:HighCONTACT:Caroline Danby (LPA) 01438 242823SITE NAME:Town SquareVDESIGNATION:Conservation Area, 2 LBsNEW ENTRY:NoCONDITION:PoorTREND:Deteriorating	SITE NAME:	Rectory Lane and St Nicholas		
VULNERABILITY: High CONTACT: Caroline Danby (LPA) 01438 242823 SITE NAME: Town Square DESIGNATION: Conservation Area, 2 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating	DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
SITE NAME: Town Square DESIGNATION: Conservation Area, 2 LBs CONDITION: Poor TREND: Deteriorating	CONDITION:	Fair	TREND:	Deteriorating
DESIGNATION: Conservation Area, 2 LBs New ENTRY?: No CONDITION: Poor TREND: Deteriorating	VULNERABILITY:	High	CONTACT:	Caroline Danby (LPA) 01438 242823
DESIGNATION: Conservation Area, 2 LBs New ENTRY?: No CONDITION: Poor TREND: Deteriorating				
CONDITION: Poor TREND: Deteriorating				
о С	SITE NAME:	Town Square		
VULNERABILITY: Medium CONTACT: Caroline Danby (LPA) 01438 242823		•	NEW ENTRY?:	No
	DESIGNATION:	Conservation Area, 2 LBs		

THREE RIVERS

	SITE NAME:	Langleybury House, Langleybury, Abbots Langley	Country house c1725. Formerly in use as part of a school, but vacant since 1996. Proposals for the repair of the house
	DESIGNATION:	Listed Building grade II*	have yet to be implemented, and while use of the buildings for filming helps ensure their protection, the
	CONDITION:	Fair	implementation of a comprehensive scheme remains desirable.
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
listoric England	LIST ENTRY NUMBER:	73 57	Contact: Lynette Fawkes 01223 582751

WATEORD

© His

WATFORD			
	SITE NAME:	Little Cassiobury and former stable block, Hempstead Road	Late C17 house built as dower house to Cassiobury. Last occupied as offices, the building has been empty for many
	DESIGNATION:	Listed Building grade II*, CA	years. Various repairs have been carried out over this period. Lease taken from Hertfordshire County Council by
	CONDITION:	Poor	Watford Borough Council, who accepted a Historic England Repair Grants for Heritage at Risk grant in 2016 to
	OCCUPANCY:	Vacant/not in use	prepare a condition survey and Conservation Management
	PRIORITY CATEGORY:	C (C)	Plan, now completed. Discussions on-going about the future use of the building.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1175392	Contact: Robert Parkinson

	SITE NAME:	Frogmore House, High Street (north east side)
	DESIGNATION:	Listed Building grade II*
	CONDITION:	Fair
	OCCUPANCY:	Vacant/not in use
	PRIORITY CATEGORY:	E (E)
	OWNER TYPE:	Commercial company
) Historic England	LIST ENTRY NUMBER:	1175515

A red brick house built in 1716, Frogmore House was last used as flats. The house was repaired some years ago but remained vacant due to uncertainty surrounding the future use of adjacent land. A scheme for conversion to office use has been granted listed building consent from Watford Council and is currently underway, due for completion in 2020.

© Historic England

Contact: Sheila Stones 01223 582716

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM

UA Unitary Authority WHS World Heritage Site

LIST ENTRY NUMBER:

WELWYN HATFIELD



SITE NAME: Paine Bridge at Brocket Hall, Marford Road, Lemsford, Hatfield Listed Building grade II*, RPG DESIGNATION: grade II CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Commercial company

1173560

Classical bridge, built of stone to designs of James Paine in 1772. Stonework facing has failed on all four bridge abutments and exposed the brick core.

© Historic England

Contact: Christopher Laine 07780 545 979

LUTON (UA)

SITE NAME:	High Town Road		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving significantly
VULNERABILITY:	Low	CONTACT:	Gemma Davies (LPA) 01582 546548
SITE NAME:	Plaiters Lea, Town Centre		
SITE NAME: DESIGNATION:	Plaiters Lea, Town Centre Conservation Area, 9 LBs	NEW ENTRY?:	Νο
		NEW ENTRY?: TREND:	No Improving significantly
DESIGNATION:	Conservation Area, 9 LBs		

NORFOLK

BRECKLAND

BRECKLAND			
	SITE NAME:	Shadwell Court and clock tower, Brettenham	Country house c1720 with substantial C19 additions and large C19 stables attached. The house and stables have
	DESIGNATION:	Listed Building grade I, RPG grade II	been unoccupied for many years. The house was affected by severe dry rot outbreaks set off by leaks in the roof but extensive roof repairs have been undertaken and the main
	CONDITION:	Poor	building is now stabilising. The attached stable yard is in poor condition and in need to urgent repair.
	OCCUPANCY:	Vacant/not in use	poor condition and in need to digent repair.
© Historic England	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1076940	Contact: David Eve 01223 582721



LIST ENTRY NOMBER:	1076940	Contact: David Eve 01223 382721
SITE NAME:	Dereham Maltings, Norwich Road, East Dereham, Dereham	Large complex of C19 maltings, disused and vacant. Proposal to build houses on part of land and bring maltings
DESIGNATION:	Listed Building grade II*	back into use. Initial works carried out to maltings and permission granted for fuller program of repairs and
CONDITION:	Poor	refurbishment.
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	E (E)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1246348	Contact: David Eve 01223 582721

© Andrew Gayton

PRIORITY CATEGORIES	5
---------------------	---

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site



SITE NAME: DESIGNATION:		Tower of All Saints' Church, Garboldisham	A C14 church tower, now a ruin. In 1734 the eastern face of the tower collapsed and the building was abandoned.
		Scheduled Monument, LB grade II, CA	Only part of the tower survives as a free-standing monument, with no upstanding remains of the nave or chancel. A vertical crack in the west face of the tower runs
	CONDITION:	Poor	the full height of the structure giving rise to concern for its structural stability.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	B (B)	
an the	OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:		1004007	Contact: David Kenny 01223 582760

© Historic England

© Historic England



Ste Ste	SITE NAME:	Guntons Farmhouse, Reymerston Road, Garvestone, Garvestone	Timber-framed manor house, late C16. General lack of repairs leading to areas of decay, particularly long-standing decay in rear stair tower. On-going discussion with owners
E	DESIGNATION:	Listed Building grade II*	about repair strategy but solution still to be agreed and implemented.
	CONDITION:	Poor	
	OCCUPANCY:	Occupied/in use	
in .	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1342566	Contact: David Eve 01223 582721

A brick tower mill of 1818, now with reinstated cap and sails. Described in the Statutory List as being the largest

machinery that includes an unusually large crown wheel. There is extensive cracking and bulging of the brickwork,

crosstrees, the fantail and its frame. Project development to define a costed and phased programme of repairs has

been completed with a grant from Historic England. We

leakage in the cap and deterioration of timber in the

diameter mill in England, driving five pairs of millstones with

Windmill, Green Lane, Old

Listed Building grade II*, CA

Buckenham

Occupied/in use

Poor

B (B)

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

PRIORITY CATEGORY:

© Historic England

© Historic England



have now received a further grant application for the first OWNER TYPE: Other not for profit group phase of repairs. LIST ENTRY NUMBER: 1342467 Contact: Malcolm Starr 01223 582723 Ruinous CI4 church of flint with ashlar dressings; significant SITE NAME: Ruins of St Andrew's Church, architectural details survive throughout. The remains form Roudham and Larling a significant monument in the local landscape but are in a Scheduled Monument, LB grade dangerous condition with loose masonry and are cordoned DESIGNATION: off. Negotiations are on-going regarding securing grant assistance in order to implement urgent repairs. CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1004012 Contact: David Kenny 01223 582760 NI . ار م

	SITE NAME:	Church of All Saints, Snetterton	Redundant parish church in the care of the Norfolk
	DESIGNATION:	Listed Building grade I	Churches Trust. Late C13 chancel, remodelled on construction of tower early C14; C15 nave and north aisle.
	CONDITION:	Very bad	Restored 1852. Flint with ashlar quoins and slate roofs. Tower of three stages with diagonal flushwork buttresses
The last	OCCUPANCY:	Vacant/not in use	to west and flat to east. Structural repairs are needed to
	PRIORITY CATEGORY:	F (F)	three parts of the building that are cracking and failing. A National Lottery Heritage Fund Grants for Places of
	OWNER TYPE:	Charity (heritage)	Worship grant was accepted in 2017 and the project has been progressing towards completion since then.
CANAL AC	LIST ENTRY NUMBER:	1248425	Contact: Malcolm Starr 01223 582723

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ΪA Unitary Authority World Heritage Site WHS


	SITE NAME:	Church of All Saints, Stanford	CI2 and later medieval church, now closed. Leased to the
	DESIGNATION:	Listed Building grade I	Ministry of Defence and in battlefield training area. Chancel arch in danger of collapse and propped by structural
	CONDITION:	Very bad	scaffold. Masonry is falling from the tower. Diocese of Norwich and the Ministry of Defence are in discussion with
	OCCUPANCY:	Vacant/not in use	Historic England about the scope of essential repair wor
	PRIORITY CATEGORY:	A (A)	and future management of the building.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1172174	Contact: David Eve 01223 582721

© Historic England



SITE NAME:	Church of St Mary the Less, Bury Road, Thetford	Former church, C11 foundation but building mainly late C14 with the west tower dated to C15. Closed for
DESIGNATION:	Listed Building grade II*, CA	worship, Poor condition and has suffered from vandalism. A scheme for residential conversion was granted consent
CONDITION:	Poor	but was not implemented. Historic England Repair Grants for Heritage at Risk grant offered towards tower repairs
OCCUPANCY:	Vacant/not in use	and work commenced during 2019. Work in progress on
PRIORITY CATEGORY:	E (E)	the tower, Completion delayed by Covid-19, however, repairs to tower anticipated to finish mid 2020
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1297899	Contact: David Eve 01223 582721

© Historic England

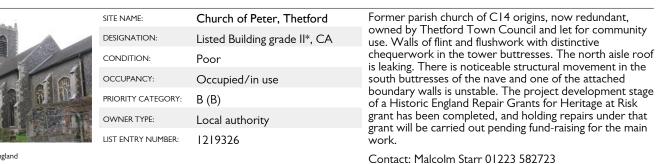

© Historic England

	SITE NAME:	Tittleshall medieval village of Godwick. Probably in use until c	
DESIGNATION: Scheduled Monument, 2 L CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: F (B) OWNER TYPE: Private	DESIGNATION:	Scheduled Monument, 2 LBs	Dual designated as scheduled monument and grade II listed building. Serious decay of flintwork on tower, including at
	CONDITION:	Poor	high level, and in need of wide-ranging repair and consolidation. Cracking of brick and ashlar dressings
	OCCUPANCY:	Vacant/not in use	around opening on west side of tower (possibly related to
	PRIORITY CATEGORY:	F (B)	an earlier rebuilding); this area is at high risk of collapse. Repair scheme has been implemented during 2019-2020.
	Private		
	LIST ENTRY NUMBER:	1002889	Contact: James Albone 01223 582781

© Historic England

î 0

SITE NAME:	Church of St Peter and St Paul, Church Street, Carbrooke	Late C13 and C15, on site of Knights Hospitallers settlement. Flint with ashlar quoins. Early C15 four-stage
DESIGNATION:	Listed Place of Worship grade I	tower with diagonal buttresses. C13 chance, C15 hammerbeam roof to nave. Cracking at high level on tower
CONDITION:	Poor	and flint losses from parapet. Rusting iron cramps forcing stones apart and exacerbating flint losses at parapet level
PRIORITY CATEGORY:	A (A)	and probably elsewhere. Belfry and silence chamber floors
OWNER TYPE:	Religious organisation	may require extensive repair or replacement. Dampness internally, especially on south wall, due to failing rainwater
LIST ENTRY NUMBER:	1305276	gutters and rainwater disposal arrangements. The congregation are reseaching grants.
		congregation are reseaching grants.

Contact: Domenico D'Alessandro 01223 582742

PRIORITY CATEGORIES

© Historic England Archive

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

S. C.	SITE NAME:	Church of St Mary, Church Road, Elsing	Parish church. Built by Sir Hugh Hastings between 1330 and 1347 replacing an earlier church of which a small
E Carlos	DESIGNATION:	Listed Place of Worship grade I	fragment of walling survives in west wall of nave. West tower, exceptionally wide aisleless nave with north and
Made	CONDITION:	Poor	south porches. High level masonry, roofs and rainwater goods failing. Work to south side was completed in 2014.
	PRIORITY CATEGORY:	C (C)	The church applied for a National Lottery Heritage Fun
	OWNER TYPE:	Religious organisation	Grants for Places of Worship grant in 2017 for the north side windows and drains, but was unsuccessful.
	LIST ENTRY NUMBER:	1342548	Contact: Malcolm Starr 01223 582723

© Historic England

	SITE NAME:	Church of St Andrew, Fairstead Lane, Little Cressingham	Parish church. The CI5 tower is partially demolished and the two westernmost bays of the nave and south aisle are
	DESIGNATION:	Listed Place of Worship grade I	roofless. The two westernmost bays of the north aisle have been demolished except for the west wall. The present
	CONDITION:	Poor	entrance is to the west in the brick wall dividing the roofed church in use from the ruin. A corrugated roof covers the south aisle, while the nave is roofed in plain tile. Roof is
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	leaking with damp penetration in aisles. Vegetation growth on the building is also an issue. The congregation are
	LIST ENTRY NUMBER:	1077227	exploring funding options.
			Contact: Domenico D'Alessandro 01223 582742

© Historic England

	SITE NAME:	Church of All Saints, Threxton, Little Cressingham	Medieval and later church. Flint with ashlar and some brick dressings. Plain tile roofs. Circular west tower believed to be of pre-Conquest date; nave with unusually narrow north aisle. Medieval decoration surviving. Extensive rainwater and groundwater ingress affecting the tower and nave. Some windows with medieval glass in poor condition. An application for National Lottery Heritage Fund Grants for Places of Worship grant in 2016 was successful and works are progressing. Anticipated completion by summer
	DESIGNATION:	Listed Place of Worship grade I	
	CONDITION:	Very bad	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1152169	2020.
Control of Labor Door of Bong			Contact: Malcolm Starr 01223 582723

© Historic England

SITE NAME: C12 and C14 parish church in parkland. Surviving round Church of St Peter, Merton tower to the west. Surviving mid C14 screen; C15 nave roof and early C17 box pews internally. The south aisle DESIGNATION: Listed Place of Worship grade I roof was re-covered in 2014 and the south nave roof is CONDITION: Very bad currently covered with plastic sheeting. The building has been a victim of heritage crime. National Lottery Heritage PRIORITY CATEGORY: F (A) Fund grant offered in 2019; works are due to be completed OWNER TYPE-Religious organisation in 2020. LIST ENTRY NUMBER: 1172419 Contact: Domenico D'Alessandro 01223 582742

© Historic England



D

Е

SITE NAME:	Church of St Mary, Holt Road, North Elmham	Parish church, m some brick dres
DESIGNATION:	Listed Place of Worship grade I, CA	porch and chance roof structure is up. There is an a
CONDITION:	Poor	aisle north wall a the nave column
PRIORITY CATEGORY:	B (New entry)	few locations. H
OWNER TYPE:	Religious organisation	repairs to the so
LIST ENTRY NUMBER:	1306186	Contact: Domer

nedieval and later. Flint with ashlar and ssings. West tower, aisled nave with south cel with flanking chapels. The south transept s in poor condition and has been propped area of algal growth over most of the north at low level as well as around the base of ns. The nave roof south slope is leaking in a Historic England offered a grant for urgent outh transept due to be completed in 2020.

enico D'Alessandro 01223 582742

© Anastasia Moskvina

PR	IORI	TΥ	C	ATE	GOR	IES	

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site
- 35



	SITE NAME:	Church of St Nicholas, The Street, North Lopham	Early C14 nave and chancel; mid C14 south aisle and porch; C19 north vestry and porch. Concrete plain tiles or
	DESIGNATION: Listed Place of Worship grade I, CA		nave and chancel roofs; north vestry roof in slate. Walls ar flint with limestone dressings. Loose masonry at top of the tower; structural repairs required to chancel east wall.
NI N	CONDITION:	Very bad	Failing rainwater systems causing excessive dampness, some structural movement and progressive deterioration
1	PRIORITY CATEGORY:	A (B)	to windows. The congregation are still trying to secure
1	OWNER TYPE:	Religious organisation	grant aid.
M 10	LIST ENTRY NUMBER:	1077430	Contact: Trudi Hughes 01223 582739

© Nicholas Warns Architects



	SITE NAME:	Church of St Mary, Mattishall Lane, North Tuddenham	Unusually large parish church, medieval and later, with medieval rood screen with polychrome decoration and
	DESIGNATION:	Listed Place of Worship grade I	painted figures; stained glass (medieval, but salvaged from elsewhere in the C19), and C19 polychrome decoration to
	CONDITION:	Very bad	the interior generally. Rainwater penetration and poor ground drainage are causing damp conditions which
	PRIORITY CATEGORY:	A (A)	threaten these historic features. Progressive deterioration
	OWNER TYPE:	Religious organisation	and cracking is also occurring to the facework and buttresses of the tower. The congregation are seeking
No.	LIST ENTRY NUMBER:	1169192	grant funding for urgent repairs.
			Contact: Domenico D'Alessandro 01223 582742

© Historic England



Church with C12 origins and round tower partly rebuilt in C14 and restored in 1858. Widespread loss of pointing to Church of All Saints, Church SITE NAME: Lane, Old Buckenham brickwork of tower upper stage and some fall of flint rubble Listed Place of Worship grade I, from stage below. North slope of thatched nave roof DESIGNATION: CA shows thinning and some sagging plus quite shallow oversailing detail at eaves. Tower repairs completed but CONDITION: Poor leakage at junction of chancel and nave roofs. Thatch on south nave slope now slipping and is in need of replacement. Important Medieval fabric at risk internally. PRIORITY CATEGORY: F (F) OWNER TYPE: Religious organisation The National Lottery Heritage Fund awarded a grant in 2019. LIST ENTRY NUMBER: 1342465 Contact: Trudi Hughes 01223 582739

© Historic England



SITE NAME:	Church of St Peter, Church Road, Shropham	Parish church featuring mid C13 nave, north aisle and chancel; remodelled in C15. C15 west tower restored
DESIGNATION:	Listed Place of Worship grade I	1867. Flint with ashlar dressings and slated roofs. North nave roof heavily tingled (a form of temporary repair) and
CONDITION:	Poor	may require replacement in near future. Beetle attack in timbers. Slow decline with monitoring on-going. The
PRIORITY CATEGORY:	C (C)	congregation are seeking grant funding for the repairs.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1077578	Contact: Domenico D'Alessandro 01223 582742

© Historic England



SITE NAME:	Church of St Mary, Sporle with Palgrave	Parish church, medieval and later. Flint with ashlar and some brick dressings. C13 to C14 west tower with angle
DESIGNATION:	Listed Place of Worship grade I	buttresses and a rectangular stair projection to south east. Remains of a C15 parclose screen and a late medieval
CONDITION:	Poor	cyclical wall painting in south aisle. The building has been subject to heritage crime. The south aisle has been re-
PRIORITY CATEGORY:	F (F)	roofed but there remain concerns regarding the condition
OWNER TYPE:	Religious organisation	of the walls and the very important wallpaintings. The building and wallpaintings are being monitored.
LIST ENTRY NUMBER:	1169820	Contact: Trudi Hughes 01223 582739

© Nicholas Warns Architects

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Church of St Andrew, Tottington	Parish church dating to 1360, restored 1885-6 by EP Willis. Rendered flint with ashlar quoins and tiled and pantiled
	DESIGNATION:	Listed Place of Worship grade II*	roofs. West tower of four stages. The condition of high- level stonework on the tower is of concern and the chancel
	CONDITION:	Fair	ceiling is at risk of collapse. This is one of a number of battlefield churches under review by Historic England, the
mann Call - 1 -	PRIORITY CATEGORY:	C (C)	Diocese of Norwich and the Ministry of Defence.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1342814	Contact: David Eve 01223 582721

© Historic England

۰.	SITE NAME:	Church of St Mary, Weeting- with-Broomhill	Medieval; restored and largely refaced in C19. Flint with ashlar dressings. Slate roofs. Circular west tower of 1868,
	DESIGNATION:	Listed Place of Worship grade II*	nave with north aisle and south porch; chancel. Masonry on south side of church vulnerable; some areas have been
	CONDITION:	Poor	cordoned off. The building has been the subject of heritage crime.
	PRIORITY CATEGORY:	C (C)	crime.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1172178	Contact: Domenico D'Alessandro 01223 582742

© Ely Diocese

SITE NAME:	Tumulus west of Leader's Spinney, Banham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003161
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Roman villa west of Woodrising Wood, Cranworth	h	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003930
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Leylands Farm Romano-British site, Hockwold, We	eeting-with-Broom	nill / Hockwold cum Wilton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003621
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Dereham, Dereham / Scarning		
DESIGNATION:	Conservation Area, 97 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Andrew Gayton (LPA) 01362 656257
SITE NAME:	Thetford		
DESIGNATION:	Conservation Area, 172 LBs, 9 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Andrew Gayton (LPA) 01362 656257

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

BROADLAND

~	SITE NAME:	Burgh Mill, The Street, Burgh and Tuttington	Three-storey C18 watermill on the Ri ceased and the vacant building is in dis
and the second s	DESIGNATION:	Listed Building grade II*, CA	structural propping in place. Owner co first phase of repairs to weatherboard
	CONDITION:	Very bad	repairs to rainwater disposal arrangen planning authority and Historic England
	OCCUPANCY:	Vacant/not in use	steps with owner.
AND AND AND	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
c England	LIST ENTRY NUMBER:	1250712	Contact: Claire Fidler 01223 582735

nill on the River Bure. Milling has lding is in disrepair. Internal e. Öwner completed substantial eatherboarding and temporary osal arrangements in 2015. Local storic England discussing next

© Historic

	SITE NAME:	Drayton Lodge, Drayton High Road, Drayton	Ruinous hunting lodge constructed early CI5, reputedly by Sir John Fastolft. Built of soft brick, the monument is in
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	need of structural repairs, repointing, and repairs to wall tops.
LT A LL	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	B (A)	
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1003999 and 1306023	Contact: James Albone 01223 582781

Left i	SITE NAME:	Church of All Saints, Beighton, Church Hill, Beighton	Church dated as CI4-CI5 but possibly earlier. Medieval scissor-braced and thatched nave roof is in poor condition.
	DESIGNATION:	Listed Place of Worship grade I	Fine internal features including medieval wallpaintings, decoration, and consecration cross. The National Lottery
	CONDITION:	Very bad	Heritage Fund awarded a Grants for Places of Worship grant in 2016, but the project development failed to gain an
	PRIORITY CATEGORY:	F (F)	offer towards the repair work. In 2017, a re-application
	OWNER TYPE:	Religious organisation	was successful and the project and temporary repairs here a carried out to the thatch of the nave roof. Wider
	LIST ENTRY NUMBER:	1051445	repair project anticipated to complete by summer 2020.
© Historic England			Contact: Malcolm Starr 01223 582723

	SITE NAME:	Parish Church of St Agnes, Church Lane, Cawston	Large medieval church built on iron trade wealth, largely C15. Tower funded by the Earl of Suffolk. Hammerbeam
	DESIGNATION:	Listed Place of Worship grade I, CA	roof, medieval polychrome decoration on nave and south transept roof structure, and more of the decorative scheme on the rood screen which includes figurative
	CONDITION:	Very bad	painted panels of high quality (by Flemish painters) and of international importance. Widespread ingress of damp due
	PRIORITY CATEGORY:	F (F)	to defective ground and rainwater drainage, leaking roofs
	OWNER TYPE:	Religious organisation	and windows. A National Lottery Heritage Fund Grants for Places of Worship grant application in 2016 was successful.
	LIST ENTRY NUMBER:	1263465	Repair works to complete summer 2020.
© Historic England			Contact: Malcolm Starr 01223 582723

SITE NAME:	Roman settlement at Brampton, Brampton / Buxton with Lammas			
DESIGNATION: Scheduled Monument		LIST ENTRY NUMBER:	1003698	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	David Kenny 01223 582760	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

GREAT YARMOUTH



SITE NAME Great Yarmouth town walls, Great Yarmouth Scheduled Monument, LB grade DESIGNATION: II, 3 CAs CONDITION: Very bad OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: B (B) OWNER TYPE: Mixed, multiple owners LIST ENTRY NUMBER: 1003782 Contact: Domenico D'Alessandro 01223 582742

Medieval town walls, just over a mile long with eleven surviving towers. Work started in 1276 and took more than a century to complete. Some of the masonry is in fair condition; other sections of upstanding town walls owned by the Borough Council, and areas in multiple separate ownership, are at risk from loss, particularly at high level. The Borough Council has secured a Historic England Repair Grants for Heritage at Risk grant to support a phased programme of repairs starting in summer 2018 and finishing in spring 2021. Work is on site.

© Historic England



記書で	SITE NAME:	Medieval vaults under, 50-56, Howard Street South, Great Yarmouth	C12 and C14 vaulted undercroft of possible medieval merchant's house. Water penetration, condensation and the poor condition of existing shoring mean that the
and the second	DESIGNATION:	Scheduled Monument, part in CA	structure is at risk of failure.
-	CONDITION:	Poor	
	OCCUPANCY:	N/A	
AA	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	1003935	Contact: James Albone 01223 582781

© Historic England



Cast iron seaside winter gardens, situated on the seafront SITE NAME: The Winter Gardens, Marine Parade, Great Yarmouth within the conservation area. Cruciform plan, with lantern over crossing. Cast iron components corroding due to DESIGNATION: Listed Building grade II*, CA excess moisture leaking into structure. Owner looking at possibility of reinstating winter gardens function. Currently CONDITION: Poor the owner is discussing options, including a bid for National Lottery Heritage Fund grants. OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority

© Historic England



© Historic England



SITE NAME:	Church of St Nicholas, Church Plain, Great Yarmouth	Parish church founded in 1101 in association with adjacent Benedictine priory. Considered by Pevsner to be the
DESIGNATION:	Listed Place of Worship grade II*, CA	largest parish church in England. Base of tower early C12, remainder C13; restored in C19. Extensively fire-damaged in World War II and rebuilt. Urgent repairs completed July
CONDITION:	Poor	in World War II and rebuilt. Urgent repairs completed July 2013. Further urgent repairs are needed including to the central tower and the north transept buttress stonework;
PRIORITY CATEGORY:	A (A)	various other high-level stonework repairs are required. A
OWNER TYPE:	Religious organisation	Listed Places of Worship Roof Repairs Grant was awarded in 2016. Further work remains to be done and the parish
LIST ENTRY NUMBER:	1096813	are considering next steps.
		Contact: Domenico D'Alessandro 01223 582742

Roman Catholic church, 1938-9 by Eric Gill. Nave, red St Peters Church including presbytery, Lowestoft Road, brick, pan tile roof. Cruciform plan. Transepts and chancel, all aisled under continuous roofs. Tripartite windows with glazing bars set within stilted pointed arches. Arcades are Listed Place of Worship grade II* stilted pointed arches. Gabled narthex at west end with one window. Gabled north porch with 3 glazed arcades and an incised brick carving of St Peter the Fisherman by Anthony Foster to Gill's designs. Windows and gutters in poor condition. Evidence of leaks into the Lady Chapel and Religious organisation South transept. The congregation are considering the next steps.

Contact: Clare Campbell 01223 582738

Contact: Domenico D'Alessandro 01223 582742

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed. С
- Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

1271608

Great Yarmouth

A (New entry)

Very bad

1246581

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument

- SM ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / GREAT YARMOUTH



A	SITE NAME:	Church of St Mary, Black Street, Martham	West tower late C14, nave and aisles mid C15, chancel 1456-69 by Robert Everard. Chancel demolished and
A	DESIGNATION:	Listed Place of Worship grade I, CA	rebuilt 1855-61 by Philip Boyce and remainder of church restored. The nave has defective roofing and rainwater goods. A National Lottery Heritage Fund Grants for Places
	CONDITION:	Very bad	of Worship grant was accepted 2017, with repair works to include re-covering of nave roof, repairing clerestories and
	PRIORITY CATEGORY:	F (F)	renewal of rainwater goods. The project delivery phase is
	OWNER TYPE:	Religious organisation	underway, with the Repair phase anticipated for completion summer 2020.
	LIST ENTRY NUMBER:	5235	Contact: Trudi Hughes 01223 582739

© Nicholas Warns Architect

4 parish church. Restored 1896. Flint with ngs and brick repairs. Plain tiles to nave and
icel. Structural movement affecting the chancel or concern. The base of the Tower has been
nid concerns of stonework falling off the south ng. The mullion is missing and the tracery
s precarious. The Chancel roof covering is
evel mortar joints are open, flintwork and re locally poor.
menico D'Alessandro 01223 582742

© Historic England

SITE NAME:	Church of St Peter and St Paul, Repps with Bastwick	Parish church. C12 west tower with late C13 belfry; C14 nave; C15 chancel demolished and replaced C18. Whole
DESIGNATION:	Listed Place of Worship grade II*	church restored C19. Flint with brick and ashlar dressings and brick chancel. Three stage tower, the lower two stages
CONDITION:	Very bad	circular and pierced by one lancet window to west. Need for urgent repairs to rainwater goods, roofs and tower
PRIORITY CATEGORY:	A (A)	identified in Quinquennial Inspection report of 2016 and
OWNER TYPE:	Religious organisation	supplementary report of 2017. High level stonework to tower is failing, presenting safety issues. An application in
LIST ENTRY NUMBER:	1051024	2017 for a National Lottery Heritage Fund grant was unsuccessful.
	DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Repps with BastwickDESIGNATION:Listed Place of Worship grade II*CONDITION:Very badPRIORITY CATEGORY:A (A)OWNER TYPE:Religious organisation

© Historic England



Contact: Domenico D'Alessandro 01223 582742 SITE NAME: Church of St Peter and St Paul, Parish church. Late CII west tower and CI3 nave; chancel Church Road, Burgh Castle, re-modelled in C15. North aisle 1847. Flint construction with ashlar dressings and some brick. Slate roofs. Urgent Great Yarmouth structural work still required to tower, south aisle roof and DESIGNATION: Listed Place of Worship grade II* chancel gable. Some repairs have been completed. CONDITION: Very bad PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1051008 Contact: Trudi Hughes 01223 582739

© Nicholas Warns Architects

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UÁ Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / GREAT YARMOUTH / KING'S LYNN AND WEST NORFOLK

SITE NAME:	King Street		
DESIGNATION:	Conservation Area, 43 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Darren Barker 07760166373
SITE NAME:	Market Place, Rows and North Quay		
DESIGNATION:	Conservation Area, 44 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Darren Barker 07760166373
SITE NAME:	Seafront		
DESIGNATION:	Conservation Area, 14 LBs, part in RPG grade II	NEW ENTRY?:	No
DESIGNATION: CONDITION:	Conservation Area, 14 LBs, part in RPG grade II Poor	NEW ENTRY?: TREND:	No Deteriorating

KING'S LYNN AND WEST NORFOLK

	SITE NAME:	Hanse House, St Margaret's Lane, King's Lynn, Hanse House, south Quay, King's Lynn, Hanse House, St Margaret's Place, King's Lynn	Warehouses set around courtyard built for the Hanseatic League c1475 and later extended, with eastern end replaced by elegant C18 townhouse. Formerly County Council offices, disused for a period before permission granted for part conversion to residential use along with
	DESIGNATION:	Listed Building grade I, CA	cafe, bar, indoor market and function rooms, but the scheme has been only partly implemented. The courtyard
111 H 10001	CONDITION:	Poor	roofs are in poor condition with failing tiles, extensive p growth and signs of water ingress at attic level.
	OCCUPANCY:	Occupied/in use	
© Historic England	PRIORITY CATEGORY:	C (C)	
C Historie Linguine	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1195393	Contact: David Eve 01223 582721

	SITE NAME:	Medieval Merchant's House, 7,9, King Street	Late CI4 hall house, altered CI5 and CI8. L-plan, with hall range in the rear wing to north of courtyard. Yellow brick
The Manual Street	DESIGNATION:	Listed Building grade II*, CA	with stone dressings, tiled and slate roofs. The interior of no 9 is very damp except for front range. Slates missing from
	CONDITION:	Very bad	roof and defective rainwater disposal arrangements; axial beam with no end bearing. Local Planning Authority are
	OCCUPANCY:	Vacant/not in use	taking the lead.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1291131	Contact: Domenico D'Alessandro 01223 582742

	SITE NAME:	Denver Hall, Ely Road, Denver	House with original and unusual C16 features; some C18
	DESIGNATION:	Listed Building grade II*	and C20 alterations. In need of repair and improvement. Roof is in very poor condition. Historic England liaising with
· ····	CONDITION:	Poor	owner to discuss next steps.
	OCCUPANCY:	Occupied/in use	
Call Previous	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1342309	Contact: Claire Fidler 01223 582735

© Historic England

PRIORITY CATEGORIES

- C Slow decay; no solution agreed.

use).

A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
 C Slow decay: no solution agreed.

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / KING'S LYNN AND WEST NORFOLK

			1	A.	
100			1	na	
	and the				
		1			
	第 部	the state of			
		-			-

© Historic England

[SITE NAME:	Chapel of St Andrew, Barret Ringstead, Old Hunstanton	Former chapel, C13 and C14. Roofless and overgrown; in need of consolidation, repair and control of burrowing
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	animals. Historic England is working with local partners to develop a strategy for repair. Condition continuing to deteriorate.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
μî:	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1003986 and 1077919	Contact: James Albone 01223 582781

	SITE NAME:	Ruins of Church of St Edmund, Egmere Road, Egmere, Walsingham / South Creake	Ruined church, C12 and C14. The church represents the only above-ground remains of the surrounding deserted medieval village. It is in need of consolidation due to loose
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	flints.
1	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1018173 and 1039409	Contact: David Kenny 01223 582760

ulu .	SITE NAME:	Church of St Margaret, Saturday Market Place, King's Lynn	Benedictine priory founded 1095, now parish church known as King's Lynn Minster. Rebuilt during C13, altered
	DESIGNATION:	Listed Place of Worship grade I, CA	continuously since. Limestone construction, featuring twin west towers, nave, aisles, transepts with crossing tower, aisled chancel. West front with central arched door under crenellated surround. A National Lottery Heritage Fund Grants for Places of Worship grant was accepted in 2016 for alterations and repairs to decaying high level masonry and Roman cement to west end and west towers: however a significant amount of masonry remains at risk. The
A AN	CONDITION:	Fair	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1211336	congregation considering next steps.
© Historic England			Contact: Domenico D'Alessandro 01223 582742

	SITE NAME:	Church of St Mary, Bell Street, Feltwell	Medieval church at centre of the village. Altered in 1860 by F Preedy to provide Lady Chapel and large north aisle. Fine
. /	DESIGNATION:	Listed Place of Worship grade I	French stained glass by Didron & Dudinot added in chancel. C15 century bench ends in nave. The glazing in south aisle windows is loose; the masonry to window W is loose and may have to be rebuilt. The walling is erodir and buttresses show evidence of moisture ingress, as we
	CONDITION:	Poor	
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Religious organisation	as signs of movement at west end. PCC and Friend's group seeking funding.
T B	LIST ENTRY NUMBER:	1077715	Contact: Domenico D'Alessandro 01223 582742

© Historic England



一般	SITE NAME:	Church of St Lawrence, Church Lane, Harpley, Harpley	C13 evident in interior and to south aisle, C14 tower and chancel, C15 rebuilt nave and north aisle, south porch.
	DESIGNATION:	Listed Place of Worship grade I	Rubble flint with knapped and squared flint and freestone dressings. The building has been a victim of heritage crime.
	CONDITION:	Poor	The congregation are developing a scheme of repairs.
	PRIORITY CATEGORY:	B (New entry)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1077655	Contact: Domenico D'Alessandro 01223 582742

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / KING'S LYNN AND WEST NORFOLK

hand 3	SITE NAME:	Church of All Saints, Church Road, Hilgay	Brick west tower of 1794, remainder of carstone with ashlar dressings. Late C14 south aisle, nave and chancel.
	DESIGNATION:	Listed Place of Worship grade II*	Slate roofs. Two-stage tower supported by angle buttresses to first stage, where belfry is set back at string
	CONDITION:	Poor	course. Three-light timber west window. Roundels to north and south. Arched belfry windows with timber trellis
	PRIORITY CATEGORY:	C (C)	screen. Rain and damp penetration to south vestry roof;
In ILLA	OWNER TYPE:	Religious organisation	rot in internal timber lintel; movement crack in vestry d Below ground drainage suspect. Evidence of damp with
and the second	LIST ENTRY NUMBER:	1077719	instances of salt-affected plaster. The congregation have commenced with vestry repairs.
and			Contact: Domenico D'Alessandro 01223 582742

	SITE NAME:	Church of St Andrew, Church Lane, Little Massingham	Parish church, CI4 and CI5. Flint rubble, dressings of squared and knapped flint, stone, red brick and red clunch.
	DESIGNATION:	Listed Place of Worship grade I	West tower, south porch, three-bay nave with clerestory, north and south aisles, and chancel. Three-stage tower
	CONDITION:	Very bad	with stone plinth and four offset buttresses on west face only. The building has been a victim of heritage crime. The
	PRIORITY CATEGORY:	A (A)	Diocesan Fabric Support Officer will be providing advice
	OWNER TYPE:	Religious organisation	and support to the congregation.
	LIST ENTRY NUMBER:	1171638	Contact: Trudi Hughes 01223 582739

© Ruth & Peter Blackman

© Historic Englan

	SITE NAME:	Church of All Saints, The Green, North Runcton	Rebuilt in 1713, after collapse of the medieval church, by Henry Bell, architect of the Customs House King's Lynn
	DESIGNATION:	Listed Place of Worship grade I	and other buildings in the locality. Baroque style exterior and interior, the latter with distinctive plasterwork,
No. of Concession, Name	CONDITION:	Very bad	panelling, and large-scale paintings of Christ and the Apostles by Giotto Lamponi of Florence. Failing C19
	PRIORITY CATEGORY:	A (A)	external cementitious render, defective roof coverings and
	OWNER TYPE:	Religious organisation	drainage causing internal damage. A small Historic England grant will address urgent works ahead of a resubmission to
	LIST ENTRY NUMBER:	1342408	National Lottery Heritage Fund for a comprehensive scheme of works.
			scheme of works.

© Historic England

SITE NAME: Church of St Clement, Wisbech Road, Outwell DESIGNATION: Listed Place of Worship grade I CONDITION: Very bad PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation known provenance. Funding required for major repairs. LIST ENTRY NUMBER: 1171520

Parish church. CI3 west tower:. Nave and S aisles remodelled C15. Chancel C15; rebuilt in 1853. North transept chapel 1527; church restored 1887. Of Barnack and Ragstone with brick north transept. Nave roof of alternating hammer beams and tie beams, the former with carved angels. Tie beams drop onto wall posts with carved braces.. Roof is at imminent risk of loss due to extensive action by wood-boring insects and this puts at risk the interior as well as a late medieval roof of high quality

Contact: Domenico D'Alessandro 01223 582742

Contact: Claire Fidler 01223 582735

© Historic England



SITE NAME:	Church of All Saints, Church Road, Tilney All Saints	Parish church. Late C12 nave and chancel, late C13 and C14 west tower, spire 1428. Nave and chancel aisles
DESIGNATION:	Listed Place of Worship grade I	remodelled C15. Battlements added 1523-1525. Barnack stone, partly rendered. 4-stage tower. Angle buttresses
CONDITION:	Poor	develop out of polygonal corner turrets which terminate above crenellated parapet in crocketed pinnacles. South
PRIORITY CATEGORY:	B (B)	aisle parapets loose and partly unstable; walls extremely deformed due to historic structural movement. The
OWNER TYPE:	Religious organisation	deformed due to historic structural movement. The building has been the subject of heritage crime.
LIST ENTRY NUMBER:	1264202	Contact: Domenico D'Alessandro 01223 582742

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / KING'S LYNN AND WEST NORFOLK

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

	SITE NAME:	Church of All Saints, Church Road, Walsoken	Parish church featuring possibly the largest Norman church nave in East Anglia. The Nave roof is made of hammer
14 1	DESIGNATION:	Listed Place of Worship grade I	beams on arched braces which drop on wall post to corbels. The wall posts have canopied niches containing
1- 1-	CONDITION:	Poor	painted figures of Kings and Prophets. Painted angels terminate the hammer beams. Overall, the nave lead roc covering is leaking in several locations; there are extensiv
AN A AL	PRIORITY CATEGORY:	B (New entry)	
	OWNER TYPE:	Religious organisation	areas of water staining and the C15 roof is in danger. Funding required for major repairs. Project currently on
	LIST ENTRY NUMBER:	1171765	Funding required for major repairs. Project currently on hold with PCC in discussion with National Lottery Heritage Fund.

© Historic England

	SITE NAME:	Church of St Peter and St Paul, Church Road, Watlington	Parish church. Late C13, C14, restored 1900-02. Carrstone, some brick, and ashlar quoins. The Chancel
	DESIGNATION:	Listed Place of Worship grade I	south slope roof covering is in poor condition. The rainwater goods are generally in poor condition. Carrstone
	CONDITION:	Poor	masonry decaying due to 'hard' cement pointing. The congregation are seeking grant funding for the repairs.
	PRIORITY CATEGORY:	B (New entry)	
	OWNER TYPE:	Religious organisation	
P.I.G.L	LIST ENTRY NUMBER:	1077890	Contact: Domenico D'Alessandro 01223 582742

© Historic England

A	SITE NAME:	Church of St Mary, School Road, West Walton	Large parish church, early C13 with a separate bell tower of the same date, Interior has a C15 hammerbeam roof
6	DESIGNATION:	Listed Place of Worship grade I	with carved figures, and medieval polychrome decoration on the walls of the clerestory and the arcade piers. Extensive ground settlement and active structural movement, with leaning piers, distortion in the arcades, and masonry about to detach from the walls. An
line ()	CONDITION:	Very bad	
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Religious organisation	application in 2017 for a National Lottery Heritage Fund grant was unsuccessful and the congregation are
	LIST ENTRY NUMBER:	1077676	considering to re-apply. Historic England offered a development grant for emergency repairs in June 2019.
			development grant for emergency repairs in june 2017.

© Historic England

Contact: Malcolm Starr 01223 582723

Church built between CI3 and CI6. Carved pew ends c1500 are of great historical importance. The church contains a font donated in 1851 and also the font from the Listed Place of Worship grade I nearby ruined Wiggenhall St Peter's church. Stonework, render, roofs and rainwater goods are in very poor condition. The building has been a victim of heritage crime. Some temporary repairs completed. Major repair scheme being worked up with Architect and Historic Church Buildings Fabric Support Officer.

Contact: Domenico D'Alessandro 01223 582742

Contact: Domenico D'Alessandro 01223 582742

© Historic England



SITE NAME:	Church of St Mary Magdalen, Church Road, Wiggenhall St. Mary Magdalen	C13 west tower of carrstone and limestone ashlar; early C14 belfry. Nave and aisles early C15; Chancel with C15 alterations. Predominantly brick with some rubble stone
DESIGNATION:	Listed Place of Worship grade I	and lead roofs. Tower walls deteriorating largely due to previous cementitious pointing and render repairs causing
CONDITION:	Poor	mortar to fall away leaving deeply recessed and eroded joints or pockets of eroded stonework that undercut the
PRIORITY CATEGORY:	C (C)	adjacent masonry particularly on the south side of the
OWNER TYPE:	Religious organisation	silence chamber and on the adjacent buttress. Similar erosion elsewhere. Extensive cracking. Beetle attack. Some
LIST ENTRY NUMBER:	1077896	windows in need of repair.
		Contact: Domenico D'Alessandro 01223 582742

© Historic England

PRIORITY CATEGORY:	C (C)	adjacent masonry partic
OWNER TYPE:	Religious organisation	silence chamber and on erosion elsewhere. Exte
LIST ENTRY NUMBER:	1077896	windows in need of repa
		Contact: Domenico D'A

Church of St Germans,

Wiggenhall St. Germans

Religious organisation

Very bad

1077892

A (A)

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA
- Conservation Area Listed Building Local Planning Authority National Park LB LPA
- NP RPG
- Registered Park and Garden Scheduled Monument
- SM UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / KING'S LYNN AND WEST NORFOLK / NORFOLK BROADS (NP) / NORTH NORFOLK

TIENTAGE AT NISK 20207 EAST	OF ENGLAND / KINGS ETNIN AND WEST NORFOLK / NORFOLK		HINORFOLK
SITE NAME:	Moated site and associated earthwork enclosures I	90m south east of	Denver Hall, Denver
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016486
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Remains of St Andrew's Church, East Walton		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1019836
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Romano-British villa 400m west of White House, Fi	ring	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020861
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Remains of tower on Lodge Hill, Snettisham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003912
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	King's Lynn		
DESIGNATION:	Conservation Area, 281 LBs, part in RPG grade II, 9 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Pamela Lynn (LPA) 01553 616235

NORFOLK BROADS (NP)

SITE NAME:	Halvergate Marshes, Halvergate, Halvergate / Mautby / Norton Subcourse / Reedham / Stokesby with Herringby / Thurlton / West Caister / Acle / Belton with Browston / Burgh Castle / Fleggburgh / Freethorpe / Fritton and St. Olaves / Haddiscoe, Broadland		
DESIGNATION:	Conservation Area, 28 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Ben Hogg (LPA) 01603 756074

NORTH NORFOLK

(Alter	SITE NAME:	Ruins of Broomholm Priory, Abbey Street, Bacton	Bromholm was founded in 1113 as a Cluniac community. The priory rose from a provincial monastery to a national
	DESIGNATION:	Scheduled Monument and Listed Buildings - I grade I; I grade II*, LB grade II, part in CA	pilgrimage site due to its acquisition of what was claimed to be a fragment of the True Cross. Works underway, started in 2018, with funding from Historic England to conserve the gatehouse, north transept and parts of the chapterhouse and dormatory.
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	E (F)	
© Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1003974 and 1373815; 1049146	Contact: James Albone 01223 582781

PRIORITY CATEGORIES

- А
- В
- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. Slow decay; solution agreed but F Under repair or in fair to good repair, but no user identified; or obvious new user (applicable only to buildings capable of beneficial user

use).

- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORTH NORFOLK

	SITE NAME:	Fakenham gas works, Hempton Road, Fakenham	The gas works produced town gas from 1825 until 1965 and is now the only remaining town gas works of its kind in
	DESIGNATION:	Scheduled Monument, part in CA	England. Acquired by a charity in 1983 and repaired, it was opened as a museum in 1989. Damp and ground movement are causing structural weakness to key industria
	CONDITION:	Poor	buildings and machinery. Corrosion of metalwork and metal components. Issues surrounding the condition and
	OCCUPANCY:	Occupied/in use	structural integrity of retort housing and adjacent chimney.
La la com	PRIORITY CATEGORY:	B (B)	Condition survey undertaken in January 2016 to inform future programme of repairs and consolidation. Historic
	OWNER TYPE:	Charity (heritage)	England are liaising with the Trustees.
D Historic England	LIST ENTRY NUMBER:	1003908	Contact: James Albone 01223 582781
	SITE NAME:	Vineries in Walled Kitchen Garden, Holkham Hall Park, Holkham	Vineries of 1718 by Samuel Wyatt. Gault brick with Coade stone embellishments. Slate roof. Large lean-to glasshouse on south side; principal facade on the north comprising two
	DESIGNATION:	Listed Building grade II*, RPG grade I	storeys of seven bays. The roof slates are laid at too slack a pitch and the gutters are inadequate, causing water ingress and timber rot. Part of the roof to the vineries has
7	CONDITION:	Very bad	collapsed due to structural failure. Urgent repairs are required. Work planned to commence on site late 2020 .
a series and a series of the	OCCUPANCY:	Vacant/not in use	required. Work planned to commence on site late 2020.
Station and	PRIORITY CATEGORY:	B (B)	
🕽 Holkham Estate	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1049485	Contact: Trudi Hughes 01223 582739
	SITE NAME:	Melton Constable Hall, Melton Constable Park, Melton Constable	Country house 1664-1670, enlarged to east in 1810. Service and stable range to north. South and west of the hall are formal C19 terraces, now grassed over. The hall is
	DESIGNATION:	Listed Building grade I, RPG grade II*, CA	on slightly elevated ground overlooking parkland and a lake to the south. The hall is presently not used and is in need o repair, although some work has been undertaken to the
	CONDITION:	Poor	east wing and main building. Historic England in discussion with the owner and North Norfolk District Council about
	OCCUPANCY:	Part occupied/part in use	further repairs.
	PRIORITY CATEGORY:	C (C)	
D Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1153044	Contact: David Eve 01223 582721
	SITE NAME:	Site of Manorial Complex, Hall Farm, Waxham, Sea Palling	CI6 gatehouse and precinct wall. Major structural repair to the gatehouse necessary due to lack of maintenance. Some
	DESIGNATION:	Scheduled Monument, 3 LBs	flint facing falling away. Destructive ivy growth. Several damaged copings. Repairs to the precinct wall also
	CONDITION:	Very bad	necessary. A Historic England Repair Grants for Heritage a
	OCCUPANCY:	N/A	Risk grant was awarded in 2017. Further work needed.
	PRIORITY CATEGORY:	F (F)	
CARLES STATES		()	
at Representation	OWNER TYPE:	Private	
D Norfolk County Council	OWNER TYPE:	Private 1013418	Contact: James Albone 01223 582781
Di Norfolk County Council			Tower mill of 1789. Restored in 1976-85 and formerly par
 Norfolk County Council 	LIST ENTRY NUMBER:	1013418	Tower mill of 1789. Restored in 1976-85 and formerly par of a museum, now closed. The mill's cap became unstable
Porfolk County Council	LIST ENTRY NUMBER:	1013418 Sutton Mill, New Road, Sutton	Tower mill of 1789. Restored in 1976-85 and formerly par of a museum, now closed. The mill's cap became unstable and has been removed for repair. Owner currently undertaking repairs prior to reinstating the cap. Discussion
 Porfolk County Council 	LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	1013418 Sutton Mill, New Road, Sutton Listed Building grade II*	Tower mill of 1789. Restored in 1976-85 and formerly par of a museum, now closed. The mill's cap became unstable and has been removed for repair. Owner currently
Porfolk County Council	LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	1013418 Sutton Mill, New Road, Sutton Listed Building grade II* Poor Vacant/not in use	Tower mill of 1789. Restored in 1976-85 and formerly par of a museum, now closed. The mill's cap became unstable and has been removed for repair. Owner currently undertaking repairs prior to reinstating the cap. Discussion
a) Norfolk County Council	LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY:	1013418 Sutton Mill, New Road, Sutton Listed Building grade II* Poor	Tower mill of 1789. Restored in 1976-85 and formerly par of a museum, now closed. The mill's cap became unstable and has been removed for repair. Owner currently undertaking repairs prior to reinstating the cap. Discussion
» Norfolk County Council	LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY:	1013418 Sutton Mill, New Road, Sutton Listed Building grade II* Poor Vacant/not in use C (C)	Tower mill of 1789. Restored in 1976-85 and formerly par of a museum, now closed. The mill's cap became unstable and has been removed for repair. Owner currently undertaking repairs prior to reinstating the cap. Discussion

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORTH NORFOLK

AND	SITE NAME:	Church of All Saints, Gresham	Parish church largely CI4 with CI5 century windows; early
X	DESIGNATION:	Listed Place of Worship grade II*	C14 chancel and a round west tower. Restored 1886-7. Long and short work on south western corner of south
	CONDITION:	Very bad	aisle. Rainwater goods and surface water drains in very poor condition. Secondary structural issues resulting from
I II deserved	PRIORITY CATEGORY:	F (D)	poor drainage have been identified. National Lottery
A COM	OWNER TYPE:	Religious organisation	Heritage Fund grant offered in 2019 with works are due to be completed in 2020.
	LIST ENTRY NUMBER:	1305530	Contact: Domenico D'Alessandro 01223 582742

© Chris Hunter

	SITE NAME:	Church of St Martin, The Street, Hindringham	Parish church. CI4 with some later Perpendicular details. Flint with stone dressings and slated roofs. West tower,
	DESIGNATION:	Listed Place of Worship grade I, CA	nave with north and south aisles and clerestory, south porch, chancel with north chapel. Overall, the cracks to the tower south east stair turret and east wall are considered
	CONDITION:	Fair	to be of structural significance. Lack of positive drainage t the north side of the church. The congregation are
	PRIORITY CATEGORY:	B (New entry)	exploring funding options.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1049373	Contact: Domenico D'Alessandro 01223 582742

© Historic England

	SITE NAME:	Church of All Saints, Honing	Crostwight. Remotely located fourteenth-century church	rostwight. Remotely located fourteenth-century church
	DESIGNATION:	Listed Place of Worship grade I	with exceptionally complete co-eval scheme of wallpaintings with some evidence of detachment.	
	CONDITION:	Very bad	Conservator has advised that urgent consolidation is required prior to any works being undertaken. The	
	PRIORITY CATEGORY:	A (A)	congregation are working with their Architect and Wallpaintings Conservator on a scheme to conserve wallpaintings and bring about a benign set of equilibrium	
	OWNER TYPE:	Religious organisation		
	LIST ENTRY NUMBER:	1169968	conditions for the wallpaintings.	
a Representation			Contact: Trudi Hughes 01223 582739	

© Historic England

	SITE NAME:	Church of All Saints, The Street, Kettlestone	The church dates from the CI4 to CI5 west tower of that period (a compress
NAME OF TAXABLE PARTY	DESIGNATION:	Listed Place of Worship grade II*	plan). The roof, roof structure, and wal high level are in poor condition, as are t
	CONDITION:	Very bad	and ground drainage to the rest of the o widespread leakage and damp condition
and and	PRIORITY CATEGORY:	B (B)	National Lottery Heritage Fund Grants
and the second	OWNER TYPE:	Religious organisation	Worship grant was awarded in 2017. T completed the development stage but v
	LIST ENTRY NUMBER:	1049261	gaining a grant for the repairs.
			Contact: Malcolm Starr 01223 582723

h dates from the CI4 to CI5 with a distinctive r of that period (a compressed octagon on roof, roof structure, and walls of the tower at are in poor condition, as are the rainwater goods d drainage to the rest of the church, resulting in d leakage and damp conditions internally. A ottery Heritage Fund Grants for Places of rant was awarded in 2017. The project the development stage but was unsuccessful in rant for the repairs.

© Historic England



SITE NAME:	Church of St Giles, Church Road, Swafield	Parish church C14, with west tower of late C15. Flint with ashlar quoins and slate roofs. Nave and chancel. Nave
DESIGNATION:	Listed Place of Worship grade II*	aisles removed and church partly rebuilt 1786. Four-stage tower with string courses between floors. Serious
CONDITION:	Very bad	problems with water penetration in tower; nave stonework poor. Chancel arch has unusual wallpainting of
PRIORITY CATEGORY:	A (A)	Christ displaying his wounds. An application in 2017 to the
OWNER TYPE:	Religious organisation	National Lottery Heritage Fund Grants for Places of Worship grant scheme was unsuccessful.
LIST ENTRY NUMBER:	1306217	Contact: Malcolm Starr 01223 582723

© Diocese of Norwich

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

D

Е

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious pow user (applicable only obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- Conservation Area Listed Building Local Planning Authority National Park LB LPA
- NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORTH NORFOLK

PART N	SITE NAME:	Church of St Mary, Church Lane, Tunstead	Parish church. C14 and later. Flint and stone; lead and copper roofs. West tower, nave, south porch, north and
	DESIGNATION:	Listed Place of Worship grade I	south aisle, chancel. Embattled C14 4- stage tower; Church was largely complete prior to Black Death and work
	CONDITION:	Poor	recommenced in 1371 in Perpendicular style. Complete with fifteenth century rood screen. The church is suffering
	PRIORITY CATEGORY:	C (C)	from excess dampness caused by faulty drainage syste
	OWNER TYPE:	Religious organisation	there are structural cracks in west face of tower at high level. Detaching plaster internally and medieval rood screen
	LIST ENTRY NUMBER:	1152357	potentially at risk due to excess dampness.
			Contact: Domenico D'Alessandro 01223 582742

© Diocese of Norwich

	SITE NAME:	Church of St Nicholas, Church Plain, Wells-Next-the-Sea	Large parish church located within the town. Originally of C15 date but burnt down in 1879 and rebuilt. The building
	DESIGNATION:	Listed Place of Worship grade II*, CA	is well maintained and used for both worship and community activities. A detailed inspection of the towe revealed that the parapet is loose and suffering from th effects of decaying and expanding iron cramps. There a also loose areas of face work and cracks which require attention. The turnet stair is cracking. South aisle roof i
	CONDITION:	Poor	
	PRIORITY CATEGORY:	B (A)	
	OWNER TYPE:	Religious organisation	poor condition. National Lottery Heritage Fund stage one grant offer received March 2020.
uis Farahan d	LIST ENTRY NUMBER:	1230479	Contact: Trudi Hughes 01223 582739

© Historic England

SITE NAME:	Gatehouse at manor house, East Barsham, Barsh	am	
DESIGNATION:	Scheduled Monument, LB grade I, CA	LIST ENTRY NUMBER:	1003997
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	RAF Neatishead Type 84 radar modulator buildi	ng and four radar plin	iths, Neatishead
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021408
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Remains of a medieval ringwork castle known as Wighton	Crabb's Castle, 680n	n north east of Crabb's Castle Farm,

SITE NAME:	Wighton		north case of Crabb's Castle Farm,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018175
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760



Wolterton Hall, Wickmere / Early C18 park and woodland designed as collaboration between Thomas Ripley, Charles Bridgeman and Horatio Erpingham / Itteringham Walpole, surrounding an early C18 Palladian mansion with mid-C19 gardens laid out by William Sawrey Gilpin. Some Registered Park and Garden grade II*, 13 LBs, SM, CA parts of the park are in arable use and other parts are in pasture. There has been loss of definition of lake margins. Generally unsatisfactory with Built structures are in very poor condition, with the Peach major localised problems House in the kitchen garden in a particularly vulnerable High state. The site is in single private ownership and a Parkland Management Plan is now informing on-going maintenance Improving and restoration. No Private

Contact: Christopher Laine 07780 545 979

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

SITE NAME:

DESIGNATION:

CONDITION:

VULNERABILITY:

NEW ENTRY ?:

OWNER TYPE:

LIST ENTRY NUMBER:

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

1001022

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ŬA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORTH NORFOLK / NORWICH


SITE NAME:	Happisburgh		
DESIGNATION:	Conservation Area, 9 LBs, RPG grade I	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Paul Rhymes (LPA) 01263 516367
SITE NAME:	Melton Constable Park, Melton Constable / Swant	on Novers / Hind	lolveston
SITE NAME: DESIGNATION:	Melton Constable Park, Melton Constable / Swant Conservation Area, 19 LBs, part in RPG grade II*	on Novers / Hind NEW ENTRY?:	lolveston No
	,		
DESIGNATION:	Conservation Area, 19 LBs, part in RPG grade II*	NEW ENTRY?:	No

NORWICH



SITE NAME:	6, 9 and 10, Ninham's Court, Norwich	A substantial C17 house constructed of painted flint rubble with brick dressings. A medieval undercroft is beneath part
DESIGNATION:	Listed Building grade II*, CA	of it. Proposals for repair and refurbishment as a residence are under discussion. Some holding repairs to the roof
CONDITION:	Poor	have been carried out.
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1051924	Contact: David Eve 01223 582721

© Historic England

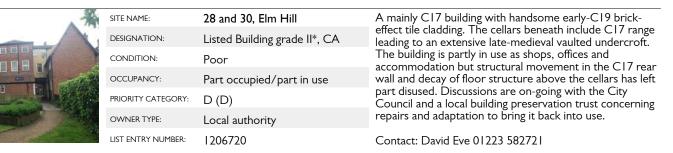

© Historic England

	SITE NAME:	65, Pottergate, Norwich	A small C17 house altered and partly rebuilt with a modern
	DESIGNATION:	Listed Building grade II*, CA	gable wall. The cellar giving access to a large C15 vaulted undercroft, partly under the house and partly under the
	CONDITION:	Very bad	adjacent driveway. Extensive water ingress to the undercroft has caused severe decay of the historic
	OCCUPANCY:	Part occupied/part in use	masonry. Improvements to drainage have not resolved t
	PRIORITY CATEGORY:	C (C)	issue and a temporary supporting system has been installed. Periodic monitoring and discussions with the
	OWNER TYPE:	Commercial company	owners are on-going.
	LIST ENTRY NUMBER:	1051938	Contact: David Eve 01223 582721

© Historic England



Redundant church of C15 to C16 date; closed in 1984 and SITE NAME: Church of St John De now in the care of the Norwich Historic Churches Trust. Sepulchre, Ber Street Built of flint with stone and brick dressings. All DESIGNATION: Listed Building grade I, CA Perpendicular except for the vestry which was constructed in 1906. There is serious and on-going structural CONDITION Very bad movement at the north-western end of the building, with significant movement in the vestry (now propped) and OCCUPANCY: Part occupied/part in use cracking in the north transept chapel. Rainwater goods PRIORITY CATEGORY: F (F) undersized and large trees in close proximity. Historic England Repair Grants for Heritage at Risk grant has been OWNER TYPE: Charity (heritage) offered; repairs delayed by Covid-19. LIST ENTRY NUMBER: 1280767

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM

ΪA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORWICH

	SITE NAME:	Church of St Martin at Oak, Oak Street	Former C15 parish church now redundant and used as music Academy. Flint with stone and brick dressings.
	DESIGNATION:	Listed Building grade I, CA	Pantiles on nave, slate on chancel. West tower, nave and chancel. South aisle and porch. Truncated unbuttressed
	CONDITION:	Poor	tower. Defects include parapets in poor condition, localised areas of loose masonry, poor rainwater goods,
	OCCUPANCY:	Occupied/in use	active leaks to south aisle and north porch roofs. Norwich
	PRIORITY CATEGORY:	D (New entry)	Historic Churches Trust are seeking grant funding for project development phase.
	OWNER TYPE:	Charity (heritage)	
toric England	LIST ENTRY NUMBER:	1051925	Contact: Domenico D'Alessandro 01223 582742
Re 1	SITE NAME:	St Margaret's Church, St Benedict's Street	Former parish church, now a well-used public space hosting art exhibitions throughout the year. CI4 and C
IR AN	DESIGNATION:	Listed Building grade I, CA	Flint with stone and brick dressings. Extensive urgent n and conservation works required to protect the fabric including roof repairs, masonry repairs and improvement to rainwater management system. Norwich Historic
	CONDITION:	Very bad	
The same participant	OCCUPANCY:	Part occupied/part in use	Churches Trust are seeking grant funding for project
	PRIORITY CATEGORY:	B (New entry)	development phase.
	OWNER TYPE:	Charity (heritage)	
toric England	LIST ENTRY NUMBER:	1051898	Contact: Domenico D'Alessandro 01223 582742
	SITE NAME:	Bishop Salmon's Porch, Norwich	Early C14 porch to former Hall of Old Bishop's Palace. Two storeys, of Caen stone. Facing stonework, window

Scheduled Monument and Listed

Building grade II*, CA

Religious organisation

1004030 and 1051329

Bethel Hospital, Bethel Street,

Listed Building grade II*, CA

Part occupied/part in use

Commercial company, multiple

Very bad

N/A

A (A)

Norwich

Poor

A (A)

owners

1051362



DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England

© Histo

© Histo

	#
	-
	I
	-1-
0	

© Norwich City Council



SITE NAME:	St Mary the Less, Queen Street, Norwich	Former parish church with C13 origins, currently used as an historical studies centre but not easily accessible. The
DESIGNATION:	Listed Building grade I, CA	building is thought to be in need of repair, especially the roof. Norwich City Council staff are liaising with owner.
CONDITION:	Poor	
OCCUPANCY:	Part occupied/part in use	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1051918	Contact: David Eve 01223 582721

© Norwich City Council

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

WHS

reveals and buttresses all decaying with periodic losses of

stone. The roof covering comprises rubble set on cement

and allows excess moisture to enter the medieval vaults below. The owners have implemented a scheme of gutter

clearance and minor maintenance but the roof requires a

more comprehensive solution to limit the rate of erosion of important medieval stonework/deterioration of the

fabric. To be reviewed with owners agent late 2020.

Former hospital of the early C18, partly converted to

residential use with new uses agreed for other parts but not fully implemented. The CI9 wing is in poor condition

Conservation Management Plan and full condition survey

have been prepared. Consent granted for residential conversion of the C19 wing but not implemented.

and needing substantial repairs, parts of the earlier core are unoccupied and one area also in need of repair. A

Contact: James Albone 01223 582781

Contact: David Eve 01223 582721

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ŬA
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / NORWICH / SOUTH NORFOLK

SITE NAME:	Bishop Salmon's porch		
DESIGNATION:	Scheduled Monument and Listed Building grade II*, CA	LIST ENTRY NUMBER:	1004030 and 1051329
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY ?:	No
OWNER TYPE:	Religious organisation	CONTACT:	James Albone 01223 582781
SITE NAME:	Mile Cross		
DESIGNATION:	Conservation Area, 2 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Ben Webster (LPA) 01603 212518

SOUTH NORFOLK

Historic England	SITE NAME:	Church of St Wandregelius,	Parish church no longer in use. Early C14 tower, remainder of the building dates from 1868. The church was badly
	DESIGNATION:	Bixley Listed Building grade II*	damaged by a fire in 2004 which destroyed the roof and interior. A CI6 memorial in the chancel was removed for
	CONDITION:	Very bad	safe storage. A scheme for repair and reuse as a house has been approved but not implemented.
	OCCUPANCY:	Vacant/not in use	been approved but not implemented.
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1050487	Contact: David Eve 01223 582721
	SITE NAME:	County Library, Church Street,	Chapel founded 1174; re-fenestrated late C14 and re-



SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	County Library, Church Street, Wymondham	Chapel founded 1174; re-fenestrated late C14 and re- roofed in the late C15. Used as a school post-Reformation.	
	Listed Building grade I, CA	Restored in 1873 and opened as public hall, latterly a county branch library but now disused. Historic England	
	CONDITION:	Poor	discussing plans for repair and use as community arts venue.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Charity (non-heritage)	
	LIST ENTRY NUMBER:	1297495	Contact: David Eve 01223 582721

© Historic England

© His



SITE NAME:	Church of St Nicholas, School Road, Bracon Ash	Medieval parish church restored in C19. Comprises nave, south aisle, north porch, late C13 chancel, and mid C18
DESIGNATION:	Listed Place of Worship grade I	mausoleum on northern side of chancel. Failing rainwater gutters and downpipes causing severe deterioration on
CONDITION:	Poor	chancel north wall, also placing at risk the remains of a very significant C16 terracotta monument, similar in style and
PRIORITY CATEGORY:	B (B)	design to those in Oxborough church, commissioned by
OWNER TYPE:	Religious organisation	the Bedingfield family. An application to the National Lottery Heritage Fund has been unsuccessful. Discussions
LIST ENTRY NUMBER:	1050695	on-going.
		Contact: Malcolm Starr 01223 582723

© Historic England



D

Е

Parish church built in imitation of St. Andrew's Hingham. Late CI4 completed at west in early CI6. South porch roof leaking; all buttresses in south aisle bulging; loose flint facework; south aisle east window: mullions are in poor condition. The congregation are working on a National Lottery Heritage Fund grant bid.

Contact: Domenico D'Alessandro 01223 582742

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; в solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTH NORFOLK


SITE NAME:Church of St Peter, Church Road, Forncett, ForncettParish church. CII, CI4 and CI5. Saxon round west tower with circular openings half way up and near top. Tall nave with clerestory and north and south aisles, with Perpendicular windows. Nave and Chancel roofs are in urgent need of re-slating. The rainwater goods appear to be undersized and gullies are in a poor state. There is an area of subsided floor tiles towards the east end of the north aisle, adjacent to a CI5 alabaster monument requiring conservation. The congregation are working on a National Lottery Heritage Fund grant bid.UST ENTRY NUMBER:I152619Contact: Domenico D'Alessandro 01223 582742				
DESIGNATION: Listed Place of Worship grade I, CA Perpendicular windows. Nave and Chancel roofs are in urgent need of re-slating. The rainwater goods appear to be undersized and gullies are in a poor state. There is an area of subsided floor tiles towards the east end of the north aisle, adjacent to a C15 alabaster monument requiring conservation. The congregation are working on a National Lottery Heritage Fund grant bid.		SITE NAME:		tower with circular openings half way up and near top. Tall
CONDITION: Poor be undersized and gullies are in a poor state. There is an area of subsided floor tiles towards the east end of the north aisle, adjacent to a C15 alabaster monument requiring conservation. The congregation are working on a National Lottery Heritage Fund grant bid.		DESIGNATION:		Perpendicular windows. Nave and Chancel roofs are in urgent need of re-slating. The rainwater goods appear to
PRIORITY CATEGORY: B (New entry) north aisle, adjacent to a C15 alabaster monument OWNER TYPE: Religious organisation requiring conservation. The congregation are working on a National Lottery Heritage Fund grant bid.		CONDITION:	Poor	be undersized and gullies are in a poor state. There is an
WINER TIPE: Religious organisation National Lottery Heritage Fund grant bid.		PRIORITY CATEGORY:	B (New entry)	north aisle, adjacent to a C15 alabaster monument
LIST ENTRY NUMBER: 1152619 Contact: Domenico D'Alessandro 01223 582742		OWNER TYPE:	Religious organisation	requiring conservation. The congregation are working on a National Lottery Heritage Fund grant bid.
		LIST ENTRY NUMBER:	1152619	Contact: Domenico D'Alessandro 01223 582742

© Historic England



	SITE NAME:	Church of St Mary, Low Road, Forncett	C13 and C15 church, tower with Saxon fabric, chancel of 1869. Declared redundant in 1985 and fell into very poor
	DESIGNATION:	Listed Place of Worship grade I, CA	condition throughout, but has subsequently been returned to use for worship and community activities, winning a Historic England Angel Award in 2015. A first phase of
	CONDITION:	Very bad	repairs to the nave and chancel, funded by a National Lottery Heritage Fund Grants for Places of Worship grant,
The state	PRIORITY CATEGORY:	F (F)	has been completed. In 2017, a further application for the
	OWNER TYPE:	Religious organisation	masonry and roofs of the tower and north porch was successful and is anticipated to complete by summer 2020.
	LIST ENTRY NUMBER:	1304627	Contact: Malcolm Starr 01223 582723

© Historic England

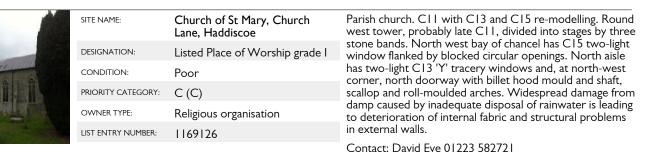

© Historic England

	SITE NAME:	Church of St Botolph, Chapel Lane, Morley	Parish church dating to the CI5, restored and re-roofed in the 1960s. Constructed from flint with ashlar and brick
- ARA	DESIGNATION:	Listed Place of Worship grade II*	dressings. Pantile roof. Although re-roofed in the 1960s, there are a number of slipped tiles on the south slope and
Zanna	CONDITION:	Poor	heavy moss to the north, alongside blocked gutters. The rainwater goods are in a poor condition throughout.
	PRIORITY CATEGORY:	C (C)	Pigeons in the tower may also be causing damage.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1373064	Contact: David Eve 01223 582721

© Historic England

SITE NAME:	Arminghall, sites discovered by air photographs, Bixley / Trowse with Newton			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003620	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Sites discovered by air photography at Markshall, Caistor St. Edmund			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002887	
CONDITION:	Scheduled Monument Generally unsatisfactory with major localised problems	LIST ENTRY NUMBER:	1002887 Declining	
	Generally unsatisfactory with major localised			

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; в solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTH NORFOLK / PETERBOROUGH, CITY OF (UA)

SITE NAME:	Long barrow and round barrows on Broome Heath, Ditchingham / Broome		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004002
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Levelling	NEW ENTRY?:	No
DWNER TYPE: Mixed, multiple owners		CONTACT:	David Kenny 01223 582760
SITE NAME:	Romano-Celtic temple 590m south east of St James	s's Church, Wickle	wood
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020862
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DWNER TYPE: Commercial company		CONTACT:	David Kenny 01223 582760
SITE NAME:	Moot Hill, Wymondham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003993
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760

PETERBOROUGH, CITY OF (UA)

	SITE NAME:	Peterborough Cathedral precinct wall, Peterborough	Parts of the medieval precinct wall of the Cathedral are vulnerable to water penetration and stone decay, and in
	DESIGNATION:	Scheduled Monument and Listed Buildings - 10 grade I, 4 LBs, part in RPG grade II, CA	some places have suffered from later stone and brick re- facings. Repair to those parts of the precinct wall within the control of the Dean and Chapter are being progressed but other parts still remain in poor condition.
	CONDITION:	Poor	
© Historic England	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1003264 and 1126932; 1331514; 1126930; 1126937; 1161429; 1161668; 1331517; 1331494; 1126939; 1161737	Contact: Will Fletcher 01223 582710



© Historic England

	SITE NAME:	Laurel Court, 22, Precincts, Peterborough	An early C18 house adjacent to the remains of the cloister at Peterborough Cathedral. The building is suffering from
	DESIGNATION:	Listed Building grade I, RPG grade II, CA	structural problems and failure of its modern flat roof covering. The building is occupied and maintained, but in need of comprehensive structural and other repairs. Roof
	CONDITION:	Poor	repairs carried out during winter 2018-9. Discussions continue.
	OCCUPANCY:	Part occupied/part in use	continue.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1310019	Contact: Andrew Martindale 01223 582705

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / PETERBOROUGH, CITY OF (UA)



1	SITE NAME:	Barn at Wothorpe Farmhouse near Wothorpe Towers, Wothorpe	C17 stables. Repairs have been on-going for some time. The adjoining barn and granary have been repaired and are occupied.
	DESIGNATION:	Listed Building grade II*	
1	CONDITION:	Fair	
	OCCUPANCY:	Occupied/in use	
-	PRIORITY CATEGORY:	F (F)	
ST SM	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	2745	Contact: Andrew Martindale 01223 582705

© Historic England



	SITE NAME:	Wothorpe Farmhouse near Wothorpe Towers, Wothorpe	C17 farmhouse. Repairs have been on-going.			
	DESIGNATION:	Listed Building grade II*				
	CONDITION:	Fair				
	OCCUPANCY:	Vacant/not in use				
	PRIORITY CATEGORY:	F (F)				
	OWNER TYPE:	Private				
	LIST ENTRY NUMBER:	1265974	Contact: Andrew Martindale 01223 582705			



© Historic England



	SITE NAME:	Church of St Peter and All Souls, Geneva Street, Peterborough	Parish church with attached presbytery of the late 1890s, designed by Leonard Stokes in a free decorated Gothic style. Nave and chancel, North and South aisles, North
	DESIGNATION:	Listed Place of Worship grade II, CA	transept, North West porch and a bellcote on the East gable. St Peter and All Saints is suffering from severe structural movement. Temporary external buttresses have
	CONDITION:	Poor	been installed to stabilise the fabric. Permanent repair works required. The congregation are liaising with their
	PRIORITY CATEGORY:	A (New entry)	Architect over scope of scheme.
«	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1331490	Contact: Domenico D'Alessandro 01223 582742

	SITE NAME:	Church of St Augustine, Oundle Road, Peterborough	Parish church, the oldest part of which features Anglo- Saxon masonry on the west side of the Tower, with a small
	DESIGNATION:	Listed Place of Worship grade I	double-splayed window. Rest of tower and church restored in 1844, 1884 and 1896. Three-light window of
	CONDITION:	Poor	c1300 in the South transept. C14 South arcade with octagonal piers. C13 font. Most of the roofs are in a poor
	PRIORITY CATEGORY:	A (New entry)	condition with water penetrating inside the building.
	OWNER TYPE:	Religious organisation	Structural movement affecting the east of the church is a matter for concern. Funding required for major repairs.
	LIST ENTRY NUMBER:	1126964	Contact: Domenico D'Alessandro 01223 582742

© Historic England



-	SITE NAME:	Church of St Stephen, Main Road, Etton	Located at the end of Etton village to the north of Peterborough on the edge of the Fen, Etton church is of
	DESIGNATION:	Listed Place of Worship grade I, CA	limestone with a fine broach spire. Largely dating from the C13 the building has been the subject of heritage crime.
	CONDITION:	Poor	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1126818	Contact: Trudi Hughes 01223 582739

© Peter Rogan Associates Ltd

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / PETERBOROUGH, CITY OF (UA)

	SITE NAME:	Church of St Peter, High Street, Maxey	Set on slightly rising ground to one end of the village, t church is constructed of coursed stone and ashlar und			
	DESIGNATION:	Listed Place of Worship grade I	metal and slated roofs. C12 tower with early C15 top; C12 nave with C15 clerestory. C13 aisles and C12 tower arch.			
	CONDITION:	Poor	Significant moisture ingress around the tower arch doubtless due to defective roof coverings and flashings			
	PRIORITY CATEGORY:	A (New entry)	above. Rafter feet in very poor condition. On-going			
	OWNER TYPE:	Religious organisation	dampness in the north aisle including salt-affected plaster at west end of nave. South aisle roof leaking in places.			
	LIST ENTRY NUMBER:	1331592	Contact: Trudi Hughes 01223 582739			

© Historic England

	SITE NAME:	Church of St Andrew, Church Street, Northborough	Late CI2 nave; west end containing four thin buttresses with gabled bellcote. Parapet with dog tooth frieze and
	DESIGNATION:	Listed Place of Worship grade I, CA	moulded coping. CI3 aisles. Chancel contains two windows with reticulated tracery. Very large south chantry chapel commissioned by Geoffrey or Henry Delamore.
	CONDITION:	Very bad	Mrs Oliver Cromwell reputed to be buried beneath. Cromwell's daughter married a Claypole. Splendid C16
	PRIORITY CATEGORY:	A (New entry)	funerary monument. Chancel roof covering leaking; south
	OWNER TYPE:	Religious organisation	chapel floor and elsewhere: much algal growth indicative of excessively high moisture retention. External drainage
-200	LIST ENTRY NUMBER:	1126693	probably faulty.
			Contact: Trudi Hughes 01223 582739

© Historic England

	SITE NAME:	Church of St Pega, Chestnut Close, Peakirk	St Pega's church. Pega belonged to one of the great noble families of Mercia and sister of St Guthlac, founder of
	DESIGNATION:	Listed Place of Worship grade I, CA	Crowland Abbey. Pega lived as an Anchoress at Peakirk, a village constructed largely from limestone but situated on the edge of the fens. The church contains traces of
	CONDITION:	Very bad	eleventh century work but dates principally from the twelfth century, comprising a nave, chancel, north and
WE NAVY	PRIORITY CATEGORY:	B (B)	south aisles; chapel and a south porch. Contains a fine and
A	OWNER TYPE:	Religious organisation	extensive set of fourteenth-century wallpaintings. Following heritage crime, a scheme is underway to raise funds to
	LIST ENTRY NUMBER:	1221288	repair the roofs.
nd			Contact: Trudi Hughes 01223 582739

© Historic England

STE NAME:Fletton churchyard crossDESIGNATION:Scheduled Monument, LB grade IIUST ENTRY NUMBER:1006839CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Natural erosion - moderateNEW ENTRY!NoOWNER TYPE:Religious organisationCONTACT:David Kenny 01223 582760SITE NAME:Four book barrows 690m and 550m ESE of The Willwers, Borough FerDecliningDESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1021314CONDITION:Extensive significant problemsREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorDavid Kenny 01223 582760SITE NAME:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningSITE NAME:Roman house north of Castor Mills, CastorUST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningRESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningRESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsNEW ENTRY:NoREND:DecliningDecliningDecli				
conditionEnclosed Fighter inForcescondition:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Natural erosion - moderateNEW ENTRY?Noown RETYPE:Religious organisationCONTACT:David Kenny 01223 582760SITE NAME:Four bowl barrows 690m and 550m ESE of The Willwers, Borough FerDecliningDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021314CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?NoOWN RETYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorDavid Kenny 01223 582760DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:I004673OWN RETYPE:Scheduled MonumentLIST ENTRY NUMBER:I004673CONDITION:Extensive significant problemsTREND:DecliningPESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:I004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?NoPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?No	SITE NAME:	Fletton churchyard cross		
CondensionproblemsProvidenceDecliningPRINCIPAL VULNERABILITY:Natural erosion - moderateNEW ENTRY:NoOWNER TYPE:Religious organisationCONTACT:David Kenny 01223 582760SITE NAME:Four bowl barrows 690m and 550m ESE of The Willwers, Borough FenDecliningDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021314CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorDavid Kenny 01223 582760SITE NAME:Scheduled MonumentLIST ENTRY NUMBER:1004673DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:No	DESIGNATION:	Scheduled Monument, LB grade II	1006839	
OWNER TYPE:Religious organisationCONTACT:David Kenny 01223 582760SITE NAME:Four bowl barrows 690m and 550m ESE of The WIWEWS, Borough FerDESIGNATION:Scheduled MonumentIUST ENTRY NUMBERCONDITION:Extensive significant problemsTREND:PRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?OWNER TYPE:Local authority, multiple ownersCONTACT:DESIGNATION:Scheduled MonumentIST ENTRY NUMBERSITE NAME:Roman house north of Castor Mills, CastorJoavid Kenny 01223 582760SITE NAME:Scheduled MonumentIST ENTRY NUMBERDESIGNATION:Scheduled MonumentIST ENTRY NUMBERDESIGNATION:Scheduled MonumentIST ENTRY NUMBERDESIGNATION:Scheduled MonumentIST ENTRY NUMBERCONDITION:Fxtensive significant problemsTREND:DESIGNATION:Kable ploughingNEW ENTRY?MONGACIONICON:Kable ploughingNEW ENTRY?RINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?	CONDITION:		TREND:	Declining
SITE NAME:Four bowl barrows 690m and 550m ESE of The Willser Borough FenDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021314CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorJourna 1004673DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Extensive significant problemsNEW ENTRY?No	PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021314CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorLIST ENTRY NUMBER:1004673DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	OWNER TYPE:	Religious organisation	David Kenny 01223 582760	
CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorVVDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	SITE NAME:	Four bowl barrows 690m and 550m ESE of The	Willows, Borough Fe	n
PRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorJourna State Name:IO04673DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021314
OWNER TYPE:Local authority, multiple ownersCONTACT:David Kenny 01223 582760SITE NAME:Roman house north of Castor Mills, CastorDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	CONDITION:	Extensive significant problems TREND: Declining		Declining
SITE NAME: Roman house north of Castor Mills, Castor DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004673 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1004673CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	OWNER TYPE:	Local authority, multiple owners	CONTACT:	David Kenny 01223 582760
CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	SITE NAME:	Roman house north of Castor Mills, Castor		
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004673
	CONDITION:	Extensive significant problems	TREND:	Declining
OWNER TYPE:Other not for profit groupCONTACT:David Kenny 01223 582760	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
	OWNER TYPE:	Other not for profit group	CONTACT:	David Kenny 01223 582760

PRIORITY CATEGORIES

А

- В
- C Slow decay; no solution agreed.

Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. Slow decay; solution agreed but F Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial user. use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / PETERBOROUGH, CITY OF (UA)

SITMANDBowl barrow SS0m south east of Hill Farm, EyeUIT FRAFF NUMBER(0/13/04BERNATIONScheduled MonumentINTERNATIONERSDeckningMINIAL VILLANDAURUETAtable ploughingNoNDavid Kenny 01223 582760MITTAINBowl barrow S70m north east of Slipe Farm, EyeDavid Kenny 01223 582760MITTAINBowl barrow S70m north east of Slipe Farm, EyeDeckningMITTAINScheduled MonumentMINIAL NILLANDAURUETDeckningMISIONAL VULKINGUTYAtable ploughingNON VULKINGUTYNoMISIONAL VULKINGUTYAtable ploughingNON VULKINGUTYNoMISIONAL VULKINGUTYAtable ploughingNON VULKINGUTYNoMINIANDAURUKINGUTYAtable ploughingNON VULKINGUTYNoMINIANDAURUKINGUTYAtable ploughingMINIANTNoMINIANDAURUKINGUTYAtable ploughing <th></th> <th></th> <th></th> <th></th>				
statisty I/NScheduled MonumentIst IAMER MURIAIO2 1304COMPTONExtensive significant problemsMRD TMDecliningMINCENT MURIAMUTHAnable ploughingNEW KTTDavid Kanny 01223 582760TITE MAREBowl barrow S70m north east of Slipe Farm, EyeDecliningDecliningIRREARD MURIAMUTHAnable ploughingNEW KURNEDecliningCONTACTBowl barrow S70m north east of Slipe Farm, EyeDecliningDecliningIRREARD MURIAMUTHAnable ploughingNEW KURNEDecliningCONTACTBreater Significant problemsIRREARDDavid Kenny 01223 582760SITE MARESte revealed by aerial photography east of Loham Hall.MaxeyIRREARD MURIAMUMHAnable ploughingNEW KURNEDavid Kenny 01223 582760SITE MAREScheduled MonumentIRREARDDavid Kenny 01223 582760SITE MAREScheduled MonumentIRREARDDavid Kenny 01223 582760SITE MAREAnable ploughingNEW KURNENoOWERL TITEScheduled MonumentIRTE MAREIO21317SITE MAREScheduled MonumentIRTE MARENoSITE MAREScheduled MonumentIRTE MARENoSITE MAREFare Dowl barrow 390m north west of The FirsNoSITE MAREScheduled MonumentIRTE MARENoSITE MAREFare Dowl barrow saft ari informationIRTE MARENoSITE MAREFare Dowl barrow saft ari informationIRTE MARENoSITE MAREScheduled MonumentIRTE MARE	SITE NAME:	Bowl barrow 550m south east of Hill Farm, Eye	1	
PRINTERNA VILLATIONAnable ploughingNAVE NEEDERDecide ContractionDecide Contra	DESIGNATION:			1021304
Conversion Private Conversion David Kenny 01223 582760 Silk AMPS: Sold barrow 570m north east of Slipe Farm, Eye Declining 1021303 CONDITION Scheduled Monument Lat SCHENTWARDER No CONDITION Extensive significant problems NO No OWNERTING: Anabe ploughing NOVE No OWNERTING: Scheduled Monument Lat NETHER MURRAW Declining Scheduled Monument Lat NETHER MURRAW Dodd Kenny 01223 582760 Silk AMPS: Scheduled Monument Lat NETHER ModeS7 CONDITION: Extensive significant problems No No OWNERTING: Miked, multiple owners CONTRCT: David Kenny 01223 582760 Silk AMPS: Three bowl barrows 390m north west of The Firs, Newberough Declining Sink AMPS: Three bowl barrows 390m north west of The Firs, Newberough Declining Sink AMPS: Able ploughing No Declining OWNERTING: Able ploughing No Declining Sink AMPS: Scheduled Monument Lat NETHE	CONDITION:	Extensive significant problems	TREND:	Declining
Instruction Bowl barrow S70m north east of Slipe Fam, Eye INSTRUME Scheduled Monument INTERNETATION Declining CONDITION Extensive significant problems INTERNETATION Declining CONDITION Extensive significant problems INTERNETATION No CONDITION Arabie ploughing No Declining CONDITION Site revealed by aerial photography east of Lohm HARKEY Doed/ KennyO1223 582760 Site revealed by aerial photography east of Lohm HARKEY Doed/ KennyO1223 582760 Site revealed by aerial photography east of Lohm HARKEY Doed/ KennyO1223 582760 Site revealed by aerial photography east of Lohm HARKEY No CONDITION Extensive significant problems HERKEY No CONDITION Extensive significant prob	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLST BATRY NARGE:1021303CONDITION:Extensive significant problemsTRADE:DecliningWIRCHER VILLERARGELIY:Arable ploughingNODavid Kenny 01223 582760WIRCHER VILLERARGELIY:Ste revealed by aerial photography east of LolhamINIT MARE:DocklargeBIRKDAM, LOXDERARDENSte revealed by aerial photography east of LolhamINIT MARE:DocklargeBIRKDAM, LOXDERARDENSte revealed by aerial photography east of LolhamINIT MARE:DocklargeBIRKDAM, LOXDERARDENExtensive significant problemsTRADE:DocklargeCONDERON:Extensive significant problemsTRADE:DocklargeCONDERON:Extensive significant problemsTRADE:DocklargeCONDERON:Extensive significant problemsTRADE:DocklargeCONDERON:Extensive significant problemsTRADE:DocklargeCONDERON:Extensive significant problemsTRADE:DocklargeCONDERON:Extensive significant problemsTRADE:David Kenny 01223 582760STEMAM:Conderon:Trade:NoCONDERON:Extensive significant problemsTRADE:David Kenny 01223 582760STEMAM:Conderon:Trade:NoCONDERON:Extensive significant problemsContract:David Kenny 01223 582760STEMAM:Contract:Trade:David Kenny 01223 582760STEMAM:Contract:David Kenny 01223 582760David Kenny 01223 582760STEMAM:Contract:	OWNER TYPE:	ER TYPE: Private		David Kenny 01223 582760
CONNITIONExtensive significant problemsNoMPRINCEAL YOURTRADUTYArabie ploughingNOVENTRYNoOWNERTTYEPrivateCONTACT:David Kenny 01223 582760STEENARCSter revealed by aerial photography east of LolhanIL MAXCE:Doc6027STEENARCSterenave significant problemsITENARCDoc6027CONTORNScheduled MonumentNODoc6027CONTORNArabie ploughingNEW SUTTY:NoCONTORNMixed, multiple ownersCONTACT:David Kenny 01223 582760STENARCThree boot barrows 390m north west of The FixVertexDecliningCONTONScheduled MonumentSTENRIN SUMMER1021317CONTONExtensive significant problemsNoNoOWNERTTYEPrivateCONTACT:David Kenny 01223 582760STENARCArabie ploughingNoNoOWNERTTYEPrivateCONTACT:NoCONTACT:David Kenny 01223 582760David Kenny 01223 582760STENARCThree boot barrows and a ring dicth 590m and 50% FIRTY SUMMERNoCONTACT:David Kenny 01223 582760David Kenny 01223 582760STENARCKatesive significant problemsITENARCNoCONTACT:David Kenny 01223 582760David Kenny 01223 582760STENARCKatesive significant problemsCONTACT:David Kenny 01223 582760STENARCScheduled MonumentLat DATRY SUMMERNoCONTACT:David Kenny 01223 582760Scheduled MonumentScheduled Monu	SITE NAME:	Bowl barrow 570m north east of Slipe Farm, Ey	e	
MINICIPAL FURIERArable ploughingMAY MENTRYNoOWNER TYPEPrivateCONTACT:David Kenny 01223 582760STET NAME:Site revealed by aarial photography east of Lohkan HIL, Maxey1006827DESIGNATIONScheduled MonumentUST ENTRY NAMES1006817CONTACT:David Kenny 01223 582760DecliningCONTACT:Maxed, multiple ownersCONTACT:David Kenny 01223 582760CONTACT:Three book barrow 390m north west of The First NEWFORDNoCONTACT:DecliningNoDecliningCONTACT:Scheduled MonumentUST PHIRY NAMES1021317CONTACT:David Kenny 01223 582760DecliningCONTACT:David Kenny 01223 582760DecliningCONTACT:David Kenny 01223 582760DecliningCONTACT:David Kenny 01223 582760DecliningDIRINGRAVAUXURAUXURAUXURAUXURAUXURAUXURAUXURAU	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021303
OWNERTING:PrivateDavid Kenny 01223 582760STRE NAME:Ster evealed by aerial photography east of Lollam HatzIOG6827DESIGNATIONAScheduled MonumentISTE INTRA NUMBERIOG6827DESIGNATIONAExtensive significant problemsTRND:DecliningMINICARA MULTERIAAtable ploughingNew MITZENoOWNERTITE:Mixed, multiple ownersCONTRACT:DecliningSISENAME:Three body barrow 390m north west of The First NUMBER10/1317CONDUCIONExtensive significant problemsINFENDER:10/231 582760CONDUCIONExtensive significant problemsINFENDE:DecliningCONDUCIONExtensive significant problemsINFENDE:David Kenny 01223 582760STRENAME:PrivateCONTRACT:David Kenny 01223 582760CONDUCIONExtensive significant problemsINFENDE:David Kenny 01223 582760STRENAME:PrivateCONTRACT:David Kenny 01223 582760STRENAME:PrivateCONTRACT:David Kenny 01223 582760STRENAME:PrivateNoINTENDE:David Kenny 01223 582760STRENAME:Scheduled MonumentINTENDE:David Kenny 01223 582760STRENAME:PrivateCONTRACT:David Kenny 01223 582760STRENAME:Astressive significant problemsINTENDE:David Kenny 01223 582760STRENAME:Astressive significant problemsINTENDE:David Kenny 01223 582760STRENAME:Astressive significant problemsINTENDE:NoSTREN	CONDITION:	Extensive significant problems	TREND:	Declining
Site revealed by aerial photography east of Lollam Hall, Maxey DeskRAARION Site revealed by aerial photography east of Lollam Hall, Maxey DeskRAARION Scheduled Monument Dit ENTRY NUMBER ID06827 CONDITION Extensive significant problems TRAND: Declining Selectave ULNERABILITY: Arable ploughing No David Kenny 01223 582760 STETAME: Three bowl barrows 390m north west of The Firs, Newborough David Kenny 01223 582760 STETAME: Three bowl barrows 390m north west of The Firs, Newborough Dollarity Deskerstrom: Scheduled Monument David Kenny 01223 582760 STETAME: Three bowl barrows and a ring ditch 590m and 500m north west of The Four Winds, Newborough Deskerstrom: Private David Kenny 01223 582760 STETAME: Three bowl barrows and a ring ditch 590m and 500m north west of The Four Winds, Newborough Deskerstrom: Private Declining Stenews: Stenews: significant problems IPRNO: Declining Stenews: Stenews: significant problems IPRNO: Declining Stenews: Stenews: significant problems IPRNO:	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
personal noneScheduled Monumentust ENTRY NUMBER:1006827CONDITIONExtensive significant problemsTREND:DecliningPRINDRY NUMBRABILTY:Anable ploughingNeW BATKY:NoOWNER TYPE:Mixed, multiple ownersCONTACT:David Kenny 01223 582760STEE NAME:Three bowl barrows 300m north west of The Firs, NewboroughUSTENTRY NUMBER:1021317DESIGNATION:Scheduled MonumentUSTENTRY NUMBER:1021317CONTITION:Extensive significant problemsTEND:DecliningPRINCIPAL VULNERABULTY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STET NAME:Three bowl barrows and a ring ditch 590m and 500m north west of The Four Winds, NewboroughDESIGNATION:Scheduled MonumentUSTENTRY NUMBER:1021318CONDITION:Extensive significant problemsTEND:DecliningPRINCIPAL VULNERABULTY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STEE NAME:Scheduled MonumentUSTENTACT:David Kenny 01223 582760STEE NAME:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STEE NAME:Scheduled MonumentUSTENTACT:DecliningSTEE NAME:Scheduled MonumentUSTENTACT:NoOWNER TYPE:Drainage/dewateringNEW ENTRY:NoOWNER TYPE:Bowl barrow 225m ono	OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
CONDITION Extensive significant problems TARIJE: Declining PRINCIPAL VULNERABULTY: Arable ploughing NEW ENTRY: No OWNER TYPE: Mixed, multiple owners CONTACT: David Kenny 01223 582760 STETENAME: Three bowl barrows 390m north west of The Firs, Newborough 1021317 DESIGNATION Scheduled Monument UST ENTRY NUMBER: 1021317 CONNER TYPE: Private No Declining OWNER TYPE: Private ON Declining OWNER TYPE: Private Declining Declining PERIONATION: Scheduled Monument UST ENTRY NUMBER: No OWNER TYPE: Private OWNER TYPE: No DEGRINATION: Scheduled Monument DET TYPE NUMBER: No OWNER TYPE: Scheduled	SITE NAME:	Site revealed by aerial photography east of Lolh	am Hall, Maxey	
PRINCIPAL VULNERABILITY: Arable ploughing New PNTRY: No OWNER TYPE: Mixed, multiple owners CONTACT: David Kenny 01223 582760 STE NAME: Three bowl barrows 390m north west of The Firs, Newborough Declining DESIGNATION: Scheduled Monument UST UNTRY NUMBER 1021317 CONDITION: Extensive significant problems THEND: Declining RINCIPAL VULNERABILITY: Arable ploughing New ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 STE NAME: Three bowl barrows and a ring ditch 590m and 500m north west of The Four Winds, Newborough Declining UNRENTYPE: Private CONTACT: David Kenny 01223 582760 STE NAME: Scheduled Monument LBT INTRY NUMBER 1021318 RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 STE NAME: Scheduled Monument UST ENTRY NUMBER 1406460 OWNER TYPE: David Kenny 01223 582710 Declining <td< td=""><td>DESIGNATION:</td><td>Scheduled Monument</td><td>LIST ENTRY NUMBER:</td><td>1006827</td></td<>	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006827
DWNRETTYPE:Mixed, multiple ownersCONTACT::David Kenny 01223 582760DESIGNATION:Scheduled MonumentUST FINTY NUMBER10[317DESIGNATION:Extensive significant problemsMENO:DecliningONNERT TYPE:Arable ploughingNODevid Kenny 01223 582760ONNERT TYPE:PrivateCONTACT:David Kenny 01223 582760STRENAME:Three bowl barrows and a ring ditch 590m and 500*-orth west of The Society StrengeDESIGNATION:Scheduled MonumentUST ENTRY NUMBER1021318CONTACT:Scheduled MonumentUST ENTRY NUMBER1021318CONTACT:Arable ploughingNW INTRY:NoOWNER TYPE:PrivateCONTACT:DecliningCONTACT:Arable ploughingNW INTRY:NoOWNER TYPE:Scheduled MonumentUST ENTRY NUMBER102131CONTACT:Scheduled MonumentUST ENTRY NUMBER1046400CONTACT:Scheduled MonumentUST ENTRY NUMBER1406460CONTACT:Scheduled MonumentUST ENTRY NUMBER1406460CONTACT:Scheduled MonumentUST ENTRY NUMBER102131CONTACT:Scheduled Monu	CONDITION:	Extensive significant problems	TREND:	Declining
STIE NAME Three book barrows 390m north west of The First, Numbers UST ENTAWE 1021317 DESIGNATION Scheduled Monument LIST ENTRY NUMBERS 1021317 CONDITION: Extensive significant problems THEND: Declining PRINCIPAL VULNERABILITY: Arable ploughing New ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 STE NAME: Three book barrows and a ring ditch 590m and 500m orth west of The Four Winds, Newborough DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021318 CONDITION: Extensive significant problems THEND: Declining RINORPAL VULNERABILITY: Arable ploughing Nev ENTRY: No CONDITION: Extensive significant problems THEND: Declining RINORPAL VULNERABILITY: Arable ploughing Nev ENTRY: No CONDITION: Scheduled Monument UST ENTRY NUMBER: [406460 CONDITION: Generally unsatisfactory with major localised problems THEND: Declining PRINCIPAL VULNERABILITY: Draiage/dewatering Net ENTRY	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
DERIGNATION:Scheduled MonumentLIST ENTRY NUMBER:021317CONDITION:Extensive significant problemsTREND:DecliningPRINCERAL VOLUMERABILITY:Arable ploughingNEW INTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STEE NAME:Three bowl barrows and a ring ditch 590m and 500- bort west of TreeFour Winds, NewboroughDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021318CONTOTION:Extensive significant problemsTREND:DecliningCONTOTION:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STEE NAME:A Bronze Age post alignment and timber platform at Flag Fen and associated Bronze Age and later field systems and settlement to either side of the North-Y Postignamiton:Ide6460CONTACT:David Kenny 01223 582760TREND:DecliningScheduled MonumentLIST ENTRY NUMBER:1406460CONTACT:David Kenny 01223 582710TREND:DISIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1406460CONTACT:Drainage/dewateringNEW ENTRY:NoOWNER TYPE:Mixed, multiple ownersCONTACT:Will Fletcher 01223 582710SITE NAME:Bowl barrow 225m north east of Prior's Fen FartVill Fletcher 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen FartNoOWNER TYPE:Commercial companyCINTACT:NoOWNER TYPE:Commercial companyCINTACT:<	OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
CONDITION:Extensive significant problemsTRIND:DeckningPRINCIPAL VOLUNIAURLITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STE NAME:Three bowl barrows and a ring ditch 590m and 500m metst of the STATAY NUMBER.I021318DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER.I021318CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STE NAME:Asbornze Age post alignment and timber platform:KodedoLIST ENTRY NUMBER.DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER.1406460CONDITION:Scheduled MonumentLIST ENTRY NUMBER.1406460CONDITION:Generally unsatisfactory with major localised problemsTREND:NoOWNER TYPE:David Jarge/dewateringNEW ENTRY:NoOWNER TYPE:Boxl barrow 225m north east of Prior's Fen Farm:NoOWNER TYPE:Scheduled MonumentLIST ENTRY NUMBER.1021311CONDITION:Scheduled MonumentLIST ENTRY NUMBER.NoCONDITION:<	SITE NAME:	Three bowl barrows 390m north west of The F	irs, Newborough	
RRINCIPAL VOLINERABELITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: Three bowl barrows and a ring ditch 590m and S00 morth west of The Four Winds, Newborough Declining DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021318 ORNORPAL VOLINERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Oraco Contortion: Arable ploughing NEW ENTRY: No OWNER TYPE: A Bronze Age post alignment and timber platform at Flag Fen and assoc/steed Bronze Age and later field systems and settlement to either side of the North-Yer David Kenny 01223 582760 SITE NAME: Scheduled Monument LIST ENTRY NUMBER: 1406460 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1406460 CONDITION: Generally unsatisfactory with major localised problems INEW ENTRY: No CONDITION: Generally unsatisfactory set of Prior's Fen Farm. VIII Fletcher 01223 582710 SITE NAME: Bowl barrow 225m north east of Prior's Fen Farm. VIII Fletcher 01223 582710 SITE NAME: Bowl barrow 230m north east of Prior's F	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021317
OWNER TYPE: Private CONTACT: David Kenny 01223 582760 STE NAME: Three bowl barrows and a ring ditch 590m and 500m north west of The Four Winds, Newborough 1021318 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021318 CONDITION: Extensive significant problems TREND: Declining RBINCIPAL VULNERABILITY: Arable ploughing New ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 STE NAME: Sporze Age post alignment and timber platform xF kg Fen and associated Bronze Age and later field systems and settlement to either side of the NoTHY NUMBER: 1406460 CONDITION: Scheduled Monument UST ENTRY NUMBER: 1406460 CONDITION: Scheduled Monument UST ENTRY NUMBER: 1406460 CONDITION: Scheduled Monument UST ENTRY NUMBER: 1406460 CONDITION: Generally unsatisfactory with major localised problems INERND: Declining RBINCIPAL VULNERABILITY: Drainage / dewatering No No OWNER TYPE: Bowl barrow 225m north east of Prior'S Fen Farm, THOR: Declining	CONDITION:	Extensive significant problems	TREND:	Declining
STRE NAME: Three bowl barrows and a ring ditch 590m and 500m twest of The Four Winds, Newborough DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1021318 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 STRE NAME: Scheduled Monument to either side of the Norther Road, Thorney Vold Kenny 01223 582760 STRE NAME: Scheduled Monument UST ENTRY NUMBER Id06460 CONDITION: Scheduled Monument UST ENTRY NUMBER Id06460 CONDITION: Scheduled Monument UST ENTRY NUMBER Id06460 CONDITION: Generally unsatisfactory with major localised problems NEW ENTRY: No OWNER TYPE: Drainage/dewatering NEW ENTRY: No OWNER TYPE: Bowl barrow 225m north east of Prior's Fen Farm, Thory VIII Fletcher 01223 582710 STRE NAME: Scheduled Monument UST ENTRY NUMBER 1021311 CONDITION: Scheduled Monument UST ENTRY NUMBER No OWNER TYPE: Gommercial company <	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021318CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABULTY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:Scheduled MonumentLIST ENTRY NUMBER:H06460CONDITION:Scheduled MonumentLIST ENTRY NUMBER:H06460CONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:Drainage/dewateringNEW ENTRY:NoOWNER TYPE:Bow barrow 225m north east of Prior's Fen FartWill Fletcher 01223 582710DISIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021311CONDITION:Scheduled MonumentLIST ENTRY NUMBER:1021311CONDITION:Scheduled MonumentLIST ENTRY NUMBER:1021312CONDITION:Scheduled MonumentLIST ENTRY NUMBER:1021311CONDITION:Scheduled MonumentNEW ENTRY:NoCONDITION:Scheduled MonumentNEW ENTRY:NoCONDITION:Scheduled MonumentNEW ENTRY:NoOWNER TYPE:Gommerial companyCONTACT:David Kenny 01223 582760STE NAME:Scheduled MonumentLIST ENTRY NUMBER:NoOWNER TYPE:Scheduled MonumentLIST ENTRY NUMBER:NoSTE NAME:Scheduled MonumentLIST ENTRY NUMBER:NoSTE NAME:Scheduled MonumentLIST ENTRY NUMBER:1021310 <td>OWNER TYPE:</td> <td>Private</td> <td>CONTACT:</td> <td>David Kenny 01223 582760</td>	OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
CONDITION:Extensive significant problemsTREND:DeciningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:David Kenny 01223 582760STE NAME:ABronze Age post alignment and timber platform : Frag Fen and assettlement to either side of the NorthVerser Add and the fieldDESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1406460CONDITION:Scheduled MonumentUST ENTRY NUMBER:1406460CONDITION:Derenally unsatisfactory with major localised problemsTREND:DecliningOWNER TYPE:Drainage/dewateringNEW ENTRY:NoOWNER TYPE:Bist and utiple ownersCONTACT:Will Fletcher 01223 582710STE NAME:Bowl barrow 225m north east of Prior's Fen Far:Verser102111CONDITION:Scheduled MonumentUST ENTRY NUMBER:1021311CONDITION:Scheduled MonumentUST ENTRY NUMBER:1021311CONDITION:Arable ploughingNEW ENTRY:NoOWNER TYPE:Commercial companyCONTACT:DecliningSTE NAME:Bowl barrow 430m north east of Prior's Fen Far:NoSTE NAME:Bowl barrow 430m north east of Prior's Fen Far:NEW ENTRY:DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1021310OWNER TYPE:Bowl barrow 430m north east of Prior's Fen Far:NoSTE NAME:Bowl barrow 430m north east of Prior's Fen Far:IST ENTRY NUMBER:1021310STE NAME:Scheduled MonumentUST	SITE NAME:	Three bowl barrows and a ring ditch 590m and	500m north west of 7	The Four Winds, Newborough
PRINCIPAL VULNERABILITY: Arable ploughing New ENTRY: No OWNER TYPE: Private CONTACT: David Kenny 01223 582760 SITE NAME: A Bronze Age post alignment and timber platform at Flag Fen and asso-stated Bronze Age and later field systems and settlement to either side of the North-VRAd, Thorney Ido4660 SITE NAME: Scheduled Monument List ENTRY NUMBER Id06460 CONDITION: Scheduled Monument List ENTRY NUMBER Id06460 CONDITION: David Kenny 01223 582710 Declining OWNER TYPE: Drainage/dewatering NEW ENTRY: No OWNER TYPE: Mixed, multiple owners CONTACT: Will Fletcher 01223 582710 SITE NAME: Bowl barrow 225m north east of Prior's Fen Farm: VIII Fletcher 01223 582710 SITE NAME: Scheduled Monument LIST ENTRY NUMBER: 1021311 CONDITION: Scheduled Monument LIST ENTRY No CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1021311 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1021310 SITE NAME: Bowl barrow 430m north east of Prior's Fe	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021318
OWNER TYPE:PrivateCONTACT:David Kenny 01223 582760SITE NAME:ABronze Age post alignment and timber platform at Flag Fen and associated Bronze Age and later field systems and settlement to either side of the NOrth-Y Road, ThorneyIde660DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:Id06460CONDITION:Generally unsatisfactory with major localised problemsINEN D:DecliningRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY:NoOWNER TYPE:Bowl barrow 225m north east of Prior's Fen Farm;Vill Fletcher 01223 582710SITE NAME:Bowl barrow 225m north east of Prior's Fen Farm;Vill Fletcher 01223 582710DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021311CONDITION:Extensive significant problemsNEW ENTRY:NoOWNER TYPE:Commercial companyNEW ENTRY:NoOWNER TYPE:Bowl barrow 430m north east of Prior's Fen Farm;NoSTE NAME:Bowl barrow 430m north east of Prior's Fen Farm;NoSTE NAME:Scheduled MonumentLIST ENTRY NUMBER1021310OWNER TYPE:Scheduled MonumentLIST ENTRY NUMBER1021310OWNER TYPE:Bowl barrow 430m north east of Prior's Fen Farm;NoDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER1021310OKONDITION:Scheduled MonumentLIST ENTRY NUMBER1021310DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER1021310CONDITION:Scheduled MonumentLIST ENTRY NUMBER1021310 </td <td>CONDITION:</td> <td>Extensive significant problems</td> <td>TREND:</td> <td>Declining</td>	CONDITION:	Extensive significant problems	TREND:	Declining
SITE NAME: A Bronze Age post alignment and timber platform at Flag Fen and assetted Bronze Age and later field systems and settlement to either side of the Norther Read, Thorney DESIGNATION: Scheduled Monument INTENTRY NUMBER: 1406460 CONDITION: Generally unsatisfactory with major localised problems IREND: Declining PRINCIPAL VULNERABILITY: Drainage/dewatering NEW ENTRY: No OWNER TYPE: Mixed, multiple owners ONTACT: Will Fletcher 01223 582710 STE NAME: Bowl barrow 225m north east of Prior's Fen Far. VIII Fletcher 01223 582710 DESIGNATION: Scheduled Monument IST ENTRY NUMBER: 1021311 CONDITION: Bowl barrow 225m north east of Prior's Fen Far. Declining CONDITION: Scheduled Monument IST ENTRY NUMBER: 1021311 CONDITION: Extensive significant problems TREND: Declining OWNER TYPE: Gommercial company CONTACT: David Kenny 01223 582760 STE NAME: Bowl barrow 430m north east of Prior's Fen Far. No OWNER TYPE: Scheduled Monument IST ENTRY NUMBER: 1021310 STE NAME: Bowl barrow 430m north east of Prior's Fen Far. No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Instruction systems and settlement to either side of the Northey Road, Thorey Instruction DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1406460 CONDITION: Generally unsatisfactory with major localised problems Instruction Declining PRINCIPAL VULNERABILITY: Drainage/dewatering New ENTRY? No OWNER TYPE: Mixed, multiple owners CONTACT: Will Fletcher 01223 582710 SITE NAME: Bowl barrow 225m north east of Prior's Fen Farm, Torney Voltage Declining DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021311 CONDITION: Extensive significant problems NEW ENTRY?: No PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Commercial company Contact: David Kenny 01223 582760 SITE NAME: Bowl barrow 430m north east of Prior's Fen Farm, Treney David Kenny 01223 582760 Ster NAME: Scheduled Monument LIST ENTRY NUMBER: 1021310 Ster NAME: Bowl barrow 430m north east of Prior's Fen Farm, Treney Instructinal Wille Reville Review Instructional Review </td <td>OWNER TYPE:</td> <td>Private</td> <td>CONTACT:</td> <td>David Kenny 01223 582760</td>	OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1406460coNDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:NoOWNER TYPE:Bowl barrow 225m north east of Prior's Fen Farm:Vill Fletcher 01223 582710SITE NAME:Bowl barrow 225m north east of Prior's Fen Farm:1021311CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Extensive significant problemsNEW ENTRY?:NoOWNER TYPE:Gommercial companyCONTACT:David Kenny 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm:NoSITE NAME:Bowl barrow 430m north east of Prior's Fen Farm:Sovid Kenny 01223 582760SITE NAME:Scheduled MonumentUST ENTRY NUMBER:1021310SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm:Sovid Kenny 01223 582760SITE NAME:Scheduled MonumentUST ENTRY NUMBER:1021310SITE NAME:Scheduled MonumentUST ENTRY NUMBER:1021310SITE NAME:Scheduled MonumentUST ENTRY NUMBER:1021310SITE NAME:Scheduled MonumentUST ENTRY NUMBER:1021310CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Katensive significant problemsNEW ENTRY?NoPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?No	SITE NAME:	A Bronze Age post alignment and timber platfor systems and settlement to either side of the No	rm at Flag Fen and ass orthey Road., Thorney	ociated Bronze Age and later field
CONDITION:problem'sFrance is a factor of the factor	DESIGNATION:			
PRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRYP:NoOWNER TYPE:Mixed, multiple ownersCONTACT:Will Fletcher 01223 582710SITE NAME:Bowl barrow 225m north east of Prior's Fen Farm, TorneyDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021311CONDITION:Extensive significant problemsTREND:DecliningOWNER TYPE:Arable ploughingNEW ENTRYP:NoOWNER TYPE:Bowl barrow 430m north east of Prior's Fen Farm, TorneyDavid Kenny 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm, TorneyIST ENTRY NUMBER:1021310DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021310CONDITION:Extensive significant problemsIST ENTRY NUMBER:1021310OWNER TYPE:Bowl barrow 430m north east of Prior's Fen Farm, TorneyIST ENTRY NUMBER:1021310DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021310CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Extensive significant problemsNEW ENTRY?NoPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?No	CONDITION:		TREND:	Declining
OWNER TYPE:Mixed, multiple ownersCONTACT:Will Fletcher 01223 582710SITE NAME:Bowl barrow 225m north east of Prior's Fen Farm, TorneyIST ENTRY NUMBER:1021311DESIGNATION:Scheduled MonumentIIST ENTRY NUMBER:1021311CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Commercial companyCONTACT:David Kenny 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm, TorneyJord Kenny 01223 582760DESIGNATION:Scheduled MonumentIIST ENTRY NUMBER:1021310CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Extensive significant problemsTREND:DecliningCONDITION:Extensive significant problemsTREND:DecliningCONDITION:Extensive significant problemsNEW ENTRY?No	PRINCIPAL VULNERABILITY:	1	NEW ENTRY?:	Νο
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021311CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Commercial companyCONTACT:David Kenny 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm,	OWNER TYPE:	5 5	CONTACT:	
CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Commercial companyCONTACT:David Kenny 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm,Formation:1021310DESIGNATION:Scheduled MonumentIIST ENTRY NUMBER1021310CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	SITE NAME:	Bowl barrow 225m north east of Prior's Fen Fa	rm, Thorney	
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Commercial company CONTACT: David Kenny 01223 582760 SITE NAME: Bowl barrow 430m north east of Prior's Fen Farm, Thorney Designation: Scheduled Monument DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021310 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021311
OWNER TYPE:Commercial companyCONTACT:David Kenny 01223 582760SITE NAME:Bowl barrow 430m north east of Prior's Fen Farm, HorneyDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1021310CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	CONDITION:	Extensive significant problems	TREND:	Declining
SITE NAME: Bowl barrow 430m north east of Prior's Fen Farm, Torney DESIGNATION: Scheduled Monument CONDITION: Extensive significant problems PRINCIPAL VULNERABILITY: Arable ploughing	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021310 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	SITE NAME:	Bowl barrow 430m north east of Prior's Fen Fa	rm, Thorney	
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021310
	CONDITION:	Extensive significant problems	TREND:	Declining
OWNER TYPE: Commercial company CONTACT: David Kenny 01223 582760	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
	OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / PETERBOROUGH, CITY OF (UA) / SOUTHEND-ON-SEA (UA)

SITE NAME:	Bowl barrow 490m west of Gores Farm, Thorne	ŷ	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021307
CONDITION:	DITION: Extensive significant problems TREND:		Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Bowl barrow 730m WSW of Gores Farm, Thorr	ney	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021308
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Bowl barrow 780m east of Bar Pasture Farm, Th	orney	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021309
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Bowl barrow 880m south west of Singlecote Co	ttage, Thorney	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021312
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Two bowl barrows 940m south east of Bar Pastu	ure Farm, Thorney	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021313
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760

LINCOLNSHIRE

PETERBOROUGH, CITY OF (UA) / SOUTH KESTEVEN

SITE NAME:	Settlement site east of Uffington and Barnack Static	ton / Bainton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006792
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760

SOUTHEND-ON-SEA (UA)

· ·	,		
	SITE NAME:	Manor House, Suttons Road, South Shoebury	House, 1681. Currently vacant, last used as residential quarters. Re-use of the building is complicated by its
	DESIGNATION:	Listed Building grade II*	location within a military site. A serious dry rot problem was treated 1998 to 2003 but has caused considerable
	CONDITION:	Poor	damage to the interior. The building has been vacant for many years. Rigid application of three-year break clause in
	OCCUPANCY:	Vacant/not in use	all long leases granted by Ministry of Defence has seriously
	PRIORITY CATEGORY:	A (A)	worsened potential for reuse by charitable trusts. On-going water ingress due to defective rainwater goods.
	OWNER TYPE:	Government or agency	
© Historic England	LIST ENTRY NUMBER:	1306855	Contact: Sheila Stones 01223 582716

PRIORITY CATEGORIES

- А
- В
- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. Slow decay; solution agreed but F Under repair or in fair to good repair, but no user identified; or obvious new user (applicable only to buildings capable of beneficial user use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site
- 57

HERITAGE AT RISK 2020 / EAST OF ENGLAND / SOUTHEND-ON-SEA (UA) / BABERGH

SITE NAME:	Crowstone, Westcliff-on-sea		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Abbie Greenwood (LPA) 01702 215004

SUFFOLK

BABERGH

いたい

	SITE NAME:	Barn north east of Bentley Hall, Bentley Hall Road, Bentley	Barn built C15, timber-framed and brick nogging. It is redundant and is only suitable for a very low-key use. It is
	DESIGNATION:	Listed Building grade II*	structurally unstable and water is penetrating the walls in places, accelerating decay of its structure. Historic England
1	CONDITION:	Very bad	and the Local Authority are involved in on-going discussions with the owner to secure the conservation of
WIDE T	OCCUPANCY:	Vacant/not in use	the barn. Urgent Works Notice served and some repairs
	PRIORITY CATEGORY:	D (D)	implemented. Fully detailed and costed schedule of repairs prepared in anticipation of service of Repairs Notice.
	OWNER TYPE:	Private	Discussions underway with Local Authority and Building Preservation Trust.
© Historic England	LIST ENTRY NUMBER:	1351965	Contact: Lynette Fawkes 01223 582751

	SITE NAME:	Church of St Mary, Fish Pond Hill, Harkstead	Parish church of C12 origin. C14 south arcade and west tower, C15 chancel and south porch. Victorian rebuilding
	DESIGNATION:	Listed Place of Worship grade II*	of roofs of chancel and north chapel. Random flint, rubble and septaria, red brick crenellations to tower, stone
	CONDITION:	Poor	dressings, stone and flint flushwork to buttresses, carved stone panels to plinth of tower. Decay of masonry,
	PRIORITY CATEGORY:	F (F)	particularly tower septaria. Roofs failing. In 2017 a
	OWNER TYPE:	Religious organisation	successful application was made for a National Lottery Heritage Fund Grants for Places of Worship grant. Repairs
	LIST ENTRY NUMBER:	1286085	anticipated to complete in 2020
			Contact: Trudi Hughes 01223 582739

© Historic England

SITE NAME:	Roman villa north east of Rodbridge House, Long Melford			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005969	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Wissington ring ditch cluster, Nayland-with-Wissington			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003758	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Wood Hall moated site, Sudbury			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005997	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
			David Kenny 01223 582760	

PRIORITY CATEGORIES

А

- В
- C Slow decay; no solution agreed.

Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. Slow decay; solution agreed but F Under repair or in fair to good repair, but no user identified; or obvious new user (applicable only to buildings capable of beneficial use use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.


NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

WEST SUFFOLK

	SITE NAME:	Moreton Hall, Bury St. Edmunds	Robert Adam house of 1773. High-level repairs and
	DESIGNATION:	Listed Building grade II*	repairs to the decorative external features are needed. Historic England is in discussion with the school and local
	CONDITION:	Poor	planning authority about how the repair works might be achieved.
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Educational (independent)	
	LIST ENTRY NUMBER:	1022597	Contact: Clare Campbell 01223 582738

© Historic England

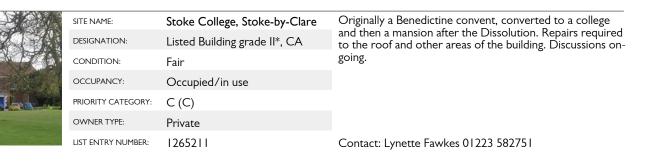

© Historic England

© His

	SITE NAME:	The Umbrello, Great Saxham Hall, Chevington Road, Great Saxham, The Saxhams	Early C19 Coade stone folly. Very poor condition with no roof and water ingress rusting iron core. Following discussions with Historic England and the local planning
	DESIGNATION:	Listed Building grade II*	authority, consent has been granted for the repair of the structure and its relocation on a new site on the estate.
	CONDITION:	Very bad	The consent sets out a timeframe in which the works must be undertaken.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	B (A)	
	OWNER TYPE:	Private	
Historic England	LIST ENTRY NUMBER:	1031410	Contact: Lynette Fawkes 01223 582751

	SITE NAME:	Church of St John, St Johns Street, Bury St. Edmunds	Parish church dated to 1841, by William Ranger (c1800- 1863); east end remodelled 1875 by J Drayton Wyatt.
	DESIGNATION:	Listed Place of Worship grade II*, CA	White brick with red brick to the interior of the high entrance porch within the base of the tower. Early English style nave and chancel, north and south aisles, west tower
	CONDITION:	Good	with spire and entry. Water penetration from nave roof and gutters. A National Lottery Heritage Fund Grants for
	PRIORITY CATEGORY:	F (F)	Places of Worship grant has been awarded and repairs are
	OWNER TYPE:	Religious organisation	due to be completed in 2020.
	LIST ENTRY NUMBER:	1135148	Contact: Malcolm Starr 01223 582723
istonia England			

© Historic England



	Church dating from the CI4, prominently situated in the
DESIGNATION: Listed Place of Worship grade I, Unusual features in	vation Area at the east end of the green. Include the vaulted parvise and external cage and flagpole combined, which sits
CONDITION: Poor on the tower parap	pet. There is some deterioration of wer. The flagpole has begun to lean,
PRIORITY CATEGORY: C (C) possibly because the	ne plated joint at low level is becoming
OWNER TYPE: Religious organisation ineffective.	
LIST ENTRY NUMBER: 1031774 Contact: Malcolm S	Starr 01223 582723

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

D

Е

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious powy user (coplicable only obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Church of St Edmund, Bridge Green, Hargrave	A grade II* church of C12 origins, extended in the C19. Roofs reslated 2013 supported by Historic England grant.
	DESIGNATION:	Listed Place of Worship grade II*	2014 Quinquennial noted the appearance of cracks at East end of chancel which appear to have become worse such
	CONDITION:	Very bad	that the chancel East window, buttresses and gable end is at risk. Scheme of remedial work being developed. A Minor
	PRIORITY CATEGORY:	F (F)	Repair Grant from the Taylor Review Pilot was received in
	OWNER TYPE:	Religious organisation	2019 to help with roof repairs, rainwater goods repairs, drainage and window repairs.
	LIST ENTRY NUMBER:	1186976	Contact: Domenico D'Alessandro 01223 582742

© Historic England

DESIGNAT CONDITIO PRIORITY O OWNER T	SITE NAME:	Church of St Mary, Church Road, Market Weston	Largely C14, restored 1846-7 by Cottingham and again in 1888-9. Nave, chancel, south porch and west tower
	DESIGNATION:	Listed Place of Worship grade II*	constructed mainly in flint rubble with plain freestone dressings. Hammerbeam nave roof structure, possibly C17.
	CONDITION:	Very bad	Roof coverings of plain tiles, with parapets. C15 south porch and five-stage tower. Nave roof truss has failed; the
	PRIORITY CATEGORY:	A (A)	tie bars do not appear to have arrested movement. Major
	OWNER TYPE:	Religious organisation	roof repairs required. Window in chancel has been supported and blocked to stop the stained glass from
	LIST ENTRY NUMBER:	1283638	blowing out and structural collapse. Architect investigating sources of grants with the congregation.
rchitects			Contact: Trudi Hughes 01223 582739

© Nicholas Warns Architects

SITE NAME:	Round barrows, Risby Poor's Heath East, Flemp	ton / Lackford / Risby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006038	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Sites north west and south east of Fornham All	Saints, Fornham All Sa	ints / Hengrave	
DESIGNATION:	Scheduled Monument, 2 CAs	LIST ENTRY NUMBER:	1006018	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Three bowl barrows 750m south west of Pin Farm, Gazeley			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018103	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Two bowl barrows 150m south east of Warren	hill Farm, Herringswel	I	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018674	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760	
SITE NAME:	Mildenhall Roman site, Mildenhall			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006037	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / WEST SUFFOLK / IPSWICH / MID SUFFOLK

SITE NAME:	Roman settlement south of Ixworth, Pakenham		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1006019
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	East Low Hill tumulus, Rushbrooke with Rougham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002974
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Subsidence	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760
SITE NAME:	Haverhill Hamlet Road, Haverhill		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Claire Johnson (LPA) 01284 757339
SITE NAME:	Haverhill Queen Street, Haverhill		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Claire Johnson (LPA) 01284 757339
SITE NAME:	Newmarket, Newmarket / Snailwell		
DESIGNATION:	Conservation Area, 109 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Boyd Nicholas (LPA) 01638 719248

IPSWICH

	SITE NAME:	Unitarian Chapel, Friars Street, Ipswich	Meeting House 1699 for congregation of Dissenters founded in 1672. Much original work and original inter	
	DESIGNATION:	Listed Place of Worship grade I, CA	fittings intact. Square plan with plastered walls and galleries. Mid C20 external render has created conditions for decay of original timber panelling, fittings and joinery. Roofs in	
	CONDITION:	Poor	deteriorating condition. Repair work has started on site with Historic England grant support to help re-tile roofs	
	PRIORITY CATEGORY:	F (B)	stabilise timber framing, repair and conserve the windows	
	OWNER TYPE:	Religious organisation	and renewal of render, A Minor Repair Grant from the Taylor Review Pilot was received in 2019 to replace the	
	LIST ENTRY NUMBER:	1037739	central valley gutter.	
			Contact: Trudi Hughes 01223 582739	

© Historic England

#

MID SUFFOLK

43 <u>2</u> 4 9	
111 50	
1. Jacob	
	and the second
and alk one	

SITE NAME:	Badley Hall barn 100 metres south east of Badley Hall, Badley
DESIGNATION:	Listed Building grade II*, SM, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1231085

A very well built and unusually complete C15 or early C16 timber-framed barn on a flint rubble plinth. Timber frame in need of repair. Historic England are currently reviewing the condition prior to further discussion with the owner and Local Authority about options for the building.

Contact: Malcolm Starr 01223 582723

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

ALC:	SITE NAME:	Badley Hall dovecote 60 metres east of Badley Hall, Badley	A rare example of a near-complete C16 timber-framed dovecote. Some nesting boxes remain. First phase of a
	DESIGNATION:	Listed Building grade II*, CA	repair programme carried out in 2013 but further work needed. Historic England are currently reviewing the
· Jest	CONDITION:	Poor	condition of the building, discussing sources of funding for further repairs with the owner and a strategy for a repair
	OCCUPANCY:	Vacant/not in use	project.
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1231084	Contact: Malcolm Starr 01223 582723

111

	SITE NAME:	Poplar Farmhouse, Brome and Oakley	Two-storey farmhouse, timber framed and plastered with a thatched roof. Main range built c1400 with late C16 cross-
1	DESIGNATION:	Listed Building grade II*	wing, forming T-shape plan. Rare single-ended Wealden form, and very rare combination of queen posts and king
	CONDITION:	Very bad	posts to roof. Part of roof structure, some walls and parts of the interior destroyed by accidental fire in April 2016.
	OCCUPANCY:	Vacant/not in use	Consent for a programme of repair, with demolition of
	PRIORITY CATEGORY:	D (D)	some less historically significant and badly damaged parts of the building has been granted but this has not yet been
の正規	OWNER TYPE:	Private	implemented.
	LIST ENTRY NUMBER:	1284932	Contact: David Eve 01223 582721

© Historic England

© Historic England

	SITE NAME:	Barn at Rook Hall, Eye	Late medieval timber framed barn with significant structural
	DESIGNATION:	Scheduled Monument	issues, requiring intervention to protect the special interest of the site. A Historic England Repair Grants for Heritage
A DOMESTICK	CONDITION:	Very bad	at Risk grant has been awarded towards the cost of temporary works needed to stabilise the structure. These
24 10 2010	OCCUPANCY:	Vacant/not in use	works were implemented in June 2018. The timber frame
	PRIORITY CATEGORY:	C (C)	has been secured, and missing tiles and bargeboards replaced. Ancillary structures have been robustly stabilised
	OWNER TYPE:	Private	to protect the building for the next few years. Discussions required to consider and agree next steps.
	LIST ENTRY NUMBER:	1005957	Contact: James Albone 01223 582781

© Historic England

	S
	C
THE ALL PARTY AND A	C
	C
	Ρ
K	C

	OWNER TYPE: Private		required to consider and agree next steps.	
U.	LIST ENTRY NUMBER:	1005957	Contact: James Albone 01223 582781	
1	SITE NAME:	Barn 200 metres west of Hall's Farmhouse, Halls Lane, Norton	Timber-framed and weatherboarded barn, dated to c1489 by dendrochronology. High quality timber frame with some	
	DESIGNATION:	Listed Building grade II*	rare features. Soleplates rotted and whole barn leaning sideways. Roof now beginning to show signs of cracking	
	CONDITION:	Poor	and movement at plate level. Working with the owner, a Historic England Repair Grants for Heritage at Risk grant	
	OCCUPANCY:	N/A	was awarded to assist with emergency propping and the	
11.1	PRIORITY CATEGORY:	B (B)	commissioning of a structural survey. Further internal propping installed to prevent partial collapse. Consent	
	OWNER TYPE:	Private	granted for conversion to a private residence, but scheme not yet implemented.	
	LIST ENTRY NUMBER:	1352406	Contact: David Eve 01223 582721	

© Historic England



al has not	SITE NAME:	Church of St Mary and St Laurence, The Street, Great Bricett	Formerly the monastic church of the Priory of St Leonard, founded 1114-19. The Prior's Lodgings and remains of the cloister also survive. The walls are much early, possibly
	DESIGNATION:	Listed Place of Worship grade I	original fabric with traces of medieval wallpaintings and decoration. Tiled roofs in poor condition and leaking. A
	CONDITION:	Fair	first National Lottery Heritage Fund Grants for Places of Worship grant application was unsuccessful in 2015; a
	PRIORITY CATEGORY:	F (F)	second application in 2017 was successful. Repairs are
	OWNER TYPE:	Religious organisation	currently in progress and due to complete by summer 2020.
1921	LIST ENTRY NUMBER:	1352160	Contact: Malcolm Starr 01223 582723

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lacentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

1	SITE NAME:	Church of St Mary, The Street, Horham	Medieval parish church. Core of the nave probably dates from C12 and contains C12 doorways. The chancel was
Jan the A	DESIGNATION:	Listed Place of Worship grade II*	largely rebuilt 1879-8. Beneath all the belfry lights is square flushwork. The nave seating includes CI5 benches with
the second	CONDITION:	Poor	poppyhead ends, enriched with buttressing and fleurons. The principal issue is damp, particularly on the external
	PRIORITY CATEGORY:	C (C)	walls of the nave.
AL YER	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1032540	Contact: Malcolm Starr 01223 582723

© Historic England

	SITE NAME:	Nettlestead one with distinctive Saxon-style carving. Simi	Church of C12 origins including nave walls and windows, one with distinctive Saxon-style carving. Similar reused
	DESIGNATION:	Listed Place of Worship grade I	fragments built into tower. Unrestored interior (except for chancel) with important medieval details including font, piscina and pew bench ends with elaborate carvings.
	CONDITION:	Poor	
88.20	PRIORITY CATEGORY:	A (A)	Progressive corrosion of roof fixings is resulting in loss and slippage of roof tiles, recently on a large scale, posing risk
	OWNER TYPE:	Religious organisation	to the interior. Damp conditions reported, caused by cementitious render and ineffective drainage arrangements.
	LIST ENTRY NUMBER:	1263028	A grant from the Taylor Review Pilot was received in 2019 for holding repairs.
© Historic England			Contact: Malcolm Starr 01223 582723
	SITE NAME:	Church of St Andrew, Church Road, Redlingfield	Parish church dating back to C14. Chancel rebuilt c1800. Formerly the church to Redlingfield Nunnery. The stump the tower is of red brick with diaper work in dark header bricks and above is a timber framed belfry probably C16 date. Much medieval pointing externally. Some cementitious plaster internally, Harbouring damp. Excess
	DESIGNATION:	Listed Place of Worship grade II*	
	CONDITION:	Poor	
E PL IMAN.	PRIORITY CATEGORY:	C (New entry)	moisture in and under the walls has caused pew platforms
	OWNER TYPE:	Religious organisation	on the south side of the church to sink. A Minor Repair Grant from the Taylor Review Pilot was received in 2019
	LIST ENTRY NUMBER:	1032497	to help repair stonework, windows, holes in the masonry and flint stonewall, and rainwater goods.
© Historic England			Contact: Trudi Hughes 01223 582739
A	SITE NAME:	Church of All Saints, Church Street, Stradbroke	Medieval parish church, considerably restored 1871-2 and 1879. Nave, chancel, north and south aisles both with
	DESIGNATION:	Listed Place of Worship grade II*, CA	chancel chapels; west tower, north and south porches, north vestry. Flint rubble, mostly faced in knapped flint. Slated roof to nave and chancel; aisle and chapel roofs
			loaded Fine CL5 tower in four stages with cropellated

leaded. Fine C15 tower in four stages with crenellated parapet. Urgent repairs required to chapel and aisle roofs, parapets, walls (including plaster), floors, rainwater goods, drains and two windows. A Minor Repair Grant from the Taylor Review Pilot was received in 2019 to help with the repair of rainwater goods.

Contact: Trudi Hughes 01223 582739

Church with C12 to C13 round flint tower with octagonal CI4 belfry stage. Chancel and porch rebuilt in CI5. Restored and large north vestry added in 1860-2. Tower Listed Place of Worship grade II* repaired and windows altered in 1877. Walls of random flint with limestone dressings; roofs of Staffordshire blue plain tiles. Structural movement and cracking to tower, with masonry falls; tower is cordoned off. Poor rainwater disposal arrangements have led to structural movement in the chancel. A National Lottery Heritage Fund Grants for Places of Worship grant was awarded in 2017 and repair work started mid- 2019.

Contact: Trudi Hughes 01223 582739

PRIORITY CATEGORIES

© Ruth & Peter Blackman

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

CONDITION:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE-

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Very bad

1032854

Very bad

1032794

F (B)

Lane, Stuston

Religious organisation

Religious organisation

Church of All Saints, Church

A (A)

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM

ŬA Unitary Authority World Heritage Site WHS

63

HERITAGE AT RISK 2020 / EAST OF ENGLAND / MID SUFFOLK / EAST SUFFOLK

Les Tod	SITE NAME:	Church of St Margaret, Little Green, Thrandeston	Medieval parish church dating from C15 apart from the C13 chancel, which was re-fenestrated in C15. The church
	DESIGNATION:	Listed Place of Worship grade I, CA	was fully restored c1870-80. Short gabled north porch has a C19 outer arch. There is damp throughout the interior of the church, which is particularly bad around the pews at
	CONDITION:	Poor	low level. A Minor Repair Grant from the Taylor Review Pilot was received in 2019 to help with repairs to the roof and rainwater goods.
	PRIORITY CATEGORY:	C (C)	
THE THE	OWNER TYPE:	Religious organisation	
A HOLE AND A	LIST ENTRY NUMBER:	1032763	Contact: Malcolm Starr 01223 582723
© Historic England			

	SITE NAME:	Church of St Mary, Church Lane, Yaxley	Parish Church, C14 and located at the centre of the village. Significant restoration carried out in C19 by EL Blackburne
	DESIGNATION:	Listed Place of Worship grade I	under the aegis of the Incumbent. There appears to be significant issues relating to structural movement at the east
	CONDITION:	Very bad	end. Cracking evident on all three sides of the Chancel;
	PRIORITY CATEGORY:	A (A)	grooves. There is a small flying buttress on the south side
	OWNER TYPE:	Religious organisation	roof temporarily covered. A Minor Repair Grant from the
	LIST ENTRY NUMBER:	1033114	Taylor Review Pilot was received in 2019 to help with repair to windows
	PRIORITY CATEGORY: OWNER TYPE:	A (A) Religious organisation	some lintols dislocating; glazing pulling out of glazing grooves. There is a small flying buttress on the south which is near to collapse. Poor rainwater goods. Sout roof temporarily covered. A Minor Repair Grant from Taylor Review Pilot was received in 2019 to help with

© Historic England

Contact: Domenico D'Alessandro 01223 582742

SITE NAME:	Baylham Roman site, Coddenham			
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1006033
CONDITION:	Extensive significa	nt problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting -	unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners		CONTACT:	David Kenny 01223 582760
3 m	SITE NAME:	Shrubland Hall, Coddenham / Hemingstone / Barham	CI7 park, for wh	9 Italianate garden by Charles Barry set in ich Humphry Repton prepared a Red
	DESIGNATION:	Registered Park and Garden grade I, 22 LBs, part in CA	Book in 1789 and William Woods in 1808. Many proposa have been implemented in the expanded park. The site is divided ownership following sale in 2009 and boundary fences erected. Management of Old Hall landscape is improving but the built garden features and planting are significantly decayed. Improved management strategies for	
	CONDITION:	Generally unsatisfactory with major localised problems		
	VULNERABILITY:	High	the park as a who	ble need to be developed to safeguard its
	TREND:	Declining	future.	
© Historic England	NEW ENTRY?:	No		
	OWNER TYPE:	Private, multiple owners		
	LIST ENTRY NUMBER:	1000155	Contact: Christo	pher Laine 07780 545 979

EAST SUFFOLK



	SITE NAME:	Martello Tower "Z", south east of Buckanay Farm, Alderton	Martel along
	DESIGNATION:	Scheduled Monument and Listed Building grade II	early (World sound
	CONDITION:	Poor	Natior has inc
OCCUPANCY:	OCCUPANCY:	N/A	Furthe
	PRIORITY CATEGORY:	A (A)	any ur
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1006014 and 1030773	Conta

ello Tower Z forms part of a chain of Martello towers the south and east coast of England dating from the C19. The tower has been unused since the Second d War. Whilst generally robust and structurally d, a 2014 condition survey undertaken as part of the onal Lottery Heritage Fund 'Touching the Tide' Project idicated the need for repairs to prevent water ingress. er discussions with the owner are needed to consider rgent conservation works to the tower.

act: James Albone 01223 582781

PRIORITY CATEGORIES

© Historic England

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site



SITE NAME:	Whaley's, St James' Road, All Saints and St. Nicholas, South Elmham	Former farmhouse, mid to late C16. Two storeys and attics. Timber framed and rendered, with thatched roof, internal chimney stack and cross-entry. The thatched roof
DESIGNATION:	Listed Building grade II*	is in a very poor condition and partially covered by tarpaulin. Several rafters and a purlin have failed. The
CONDITION:	Poor	external render is deteriorating and damp is becoming an issue. Highly decorative plaster ceilings and fireplaces could
OCCUPANCY:	Occupied/in use	be at risk from damp and water ingress.
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1032000	Contact: Claire Fidler 01223 582735

© Historic England



E C C C C C C C C C C C C C C C C C C C	SITE NAME:	Bungay Castle, Bungay	Medieval castle built by Roger Bigod. Problems with the
	DESIGNATION:	Scheduled Monument and Listed Building grade I, CA	southern C13 tower to the gatehouse have been addressed and urgent repairs completed. Discussions ongoing over further repairs and conservation work to the
	CONDITION:	Fair	keep, northern gatehouse tower, and curtain and bailey walls. Conservation statement and condition survey
	OCCUPANCY:	N/A	currently being prepared to inform next steps.
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1006060 and 1034404	Contact: James Albone 01223 582781

Martello tower on golf course adjoining Woodbridge Haven,

Scheduled Monument, LB grade

Part occupied/part in use

Felixstowe

Ш

Poor

D (D)

© Historic England



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

PRIORITY CATEGORY:





OWNER TYPE: Commercial company		
LIST ENTRY NUMBER:	1006036	Contact: Trudi Hughes 01223 582739
	Fuister Dest Mill Mill Desd	One of the tallest post mills in the country. Built 1812 and
SITE NAME:	Friston Post Mill, Mill Road, Friston	operational until 1956. Restored in 1976; temporary
DESIGNATION:	Listed Building grade II*	supports added 2004; post out of alignment, trestle fractured and now in need of comprehensive and
CONDITION:	Very bad	permanent repair. Historic England awaiting condition survey and reports believed to have been commissioned by
OCCUPANCY:	N/A	the owner in order to progress a discussion on repairs. The associated Mill House is also in a very poor condition;
PRIORITY CATEGORY:	A (A)	the roof is only partially intact and has been temporarily
OWNER TYPE:	Private	repaired, but still allows water penetration. Discussions on- going with the local planning authority.
LIST ENTRY NUMBER:	1215741	Contact: Claire Fidler 01222 592725

and interpretation.

© Historic England



and the second	SITE NAME:	Glevering Hall Orangery, Easton Road, Hacheston	Burton. Glass missing, especially from the dome, and	
	DESIGNATION:	Listed Building grade II*	rusting iron cramps are forcing apart the stonework. Discussions regarding repair works ongoing.	
	CONDITION:	Very bad		
	OCCUPANCY:	N/A		
	PRIORITY CATEGORY:	A (A)		
1.12	OWNER TYPE:	Private		
	LIST ENTRY NUMBER:	1377281	Contact: Lynette Fawkes 01223 582751	

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Claire Fidler 01223 582735

ABBREVIATIONS

Martello Tower T on Felixstowe Golf Course forms part of

a chain of Martello towers along the south and east coast of England dating from the early CI9 as part of the

defences against possible Napoleonic invasion. Roof and

Historic England in discussion with the owner over repairs

walls in very poor condition with water penetration.

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	The Long Shop, Main Street, Leiston	The Long Shop, built in 1853 for the manufacture of portable steam engines, is now a museum. Red brick with
EUN	DESIGNATION:	Listed Building grade II*, CA	yellow brick dressings; pan tiled roof with three louvered ventilators at ridge level. Two storeys, nine bays long and
ALL IN	CONDITION:	Poor	three bays wide. Pan tiled roof is in need of re-covering; 1970s glazed roof lights leak and require replacing;
	OCCUPANCY:	Occupied/in use	rainwater disposal arrangements requires overhaul and
	PRIORITY CATEGORY	C (C)	repair. A National Lottery Heritage Fund grant has bee awarded. Historic England Repair Grants for Heritage a
	OWNER TYPE:	Charity (heritage)	Risk grant offered in 2018 as part of funding package. Still seeking funding for delivery stage.
© Historic England	LIST ENTRY NUMBER:	1287610	Contact: Trudi Hughes 01223 582739
MAR MAN	SITE NAME:	Mettingham Castle, Mettingham	Substantial remains of a medieval castle and college of

書 7	DESIGNATION:	Scheduled Monument, LB grade II	canons. The site is in various ownerships. Repairs completed with grants from Historic England in 2009 to the keep and part of curtain wall, and in 2018 to a freestanding
1 Sec	CONDITION:	Poor	structure within the walls. However, further repairs to the gatehouse and the rest of the curtain wall are still urgently
1 4 a	OCCUPANCY:	N/A	needed.
NY S	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1006055	Contact: Malcolm Starr 01223 582723

C16 farmhouse with C19 alterations and brick wing to SITE NAME: Moat Farmhouse, Shadingfield, rear. Good quality timber frame, finely moulded beams and Shadingfield internal joists. Scheduled moated site. Under tarpaulin and DESIGNATION: Listed Building grade II*, SM scaffolded. CONDITION: Poor OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1032132 Contact: Lynette Fawkes 01223 582751 © Waveney District Council

JAN -	SITE NAME:	Remains of Sibton Abbey, Sibton	Remains of a Cistercian abbey built in 1150. A Countryside Stewardship agreement enabled the abbey meadow to be
N BA	DESIGNATION:	Scheduled Monument and Listed Building grade II	brought into appropriate management and part funded repair and consolidation of the bridge in 2018/19. A first phase of work focussed on the monks' refectory was
	CONDITION:	Poor	completed in June 2019 with further support from the owners and Historic England through a Repair Grants for
	OCCUPANCY:	N/A	Heritage at Risk grant. A second phase of work focussing
	PRIORITY CATEGORY:	F (F)	on remaining structures of the south range of the cloister is anticipated in 2019/20.
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1018327 and 1377160	Contact: David Kenny 01223 582760



SITE NAME:	Church of St Andrew, The Street, Alderton	Parish church with ruinous west tower. Chancel rebuilt in 1862 and the nave restored in 1864. The condition of the
DESIGNATION:	drainage an Listed Place of Worship grade II significant e	drainage and guttering is unclear; however, there is significant evidence of damp within the church interior. The
CONDITION:	Poor	ruinous tower is blocked off from the nave and is overgrown by trees and shrubs. Slow decay continues; no
PRIORITY CATEGORY:	C (C)	solution yet agreed for either the church or the ruinous
OWNER TYPE:	Religious organisation	tower. Ivy growth partially killed off; some work appears to have been completed. Review required.
LIST ENTRY NUMBER:	1377186	Contact: Trudi Hughes 01223 582739

© Historic England

© Historic England

「「「「「「「「」」」」」」」」」」

©

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Church of St Margaret, Stoven, Brampton with Stoven	Parish church. C12 doorways. The lower portion of the tower is possibly medieval; remainder entirely rebuilt 1849-
No. of	DESIGNATION:	Listed Place of Worship grade II*	50 in neo-Norman style. The tower is of flint rubble, the bell-chamber stage faced with knapped flint; the nave and
	CONDITION:	Poor	chancel are plastered; stone dressings. Slated roofs with courses of fish-scale slates. Poor construction in C19 has
	PRIORITY CATEGORY:	A (A)	resulted in serious structural failures in masonry,
	OWNER TYPE:	Religious organisation	particularly the south nave wall, and water penetration. Roof poor; interior fair; rainwater goods satisfactory.
ALAN 200	LIST ENTRY NUMBER:	1032100	Contact: Trudi Hughes 01223 582739

© Historic England

	SITE NAME:	Church of St Andrew, St Andrews Road, Felixstowe	Church built c1929-31 and is an interpretation of a late C15 East Anglian church constructed using concrete. The
	DESIGNATION:	Listed Place of Worship grade II*	concrete is in a poor condition and the congregation is exploring options for repair.
	CONDITION:	Poor	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1377388	Contact: Lynette Fawkes 01223 582751

© Historic England

	SITE NAME:	Church of St Andrew, Church Road, Mutford	St Andrew's Mutford consists of a nave, rebuilt in the Late Medieval period but still evidently incorporating some
	DESIGNATION:	Listed Place of Worship grade I	Norman fabric in the lower portion of the wall. C14 chancel and south aisle, the 1891 south porch, the possibly
	CONDITION:	Poor	CI4 galilee porch and the Saxo-Norman round tower, altered in the CI3 and then CI4y, when the octagonal bell
IV	PRIORITY CATEGORY:	C (New entry)	stage was added - the tallest round tower in Suffolk. It is
. Kaller and	OWNER TYPE:	Religious organisation	also thought to be a unique combination of a round tower and a galilee porch. Tower masonry in urgent need of
ANT ANT	LIST ENTRY NUMBER:	1032081	consolidation; roof to Galilee porch leaking; drainage issues.
			135453.

© Historic England

Contact: Trudi Hughes 01223 582739

Church of St Mary, Hall Road, Parham	Parish church. Nave and tower probably late C14 for William de Ufford, second Earl of Suffolk; restored 1886-8. Comprises nave, chancel, west tower and north porch (now the vestry). Random flint rubble construction with			
Listed Place of Worship grade I				
Poor	the chancel plastered; stone dressings. Square tower with flat stone parapet and four-stage buttresses. The church			
C (A)	has been the subject of heritage crime. Nave roof			
Religious organisation	temporarily covered with felt; Parish raising funds for permanent covering.			
1030531	Contact: Trudi Hughes 01223 582739			

© Historic England



	SITE NAME:	Church of the Sacred Heart and attached presbytery, Wymering Road, Southwold	Church and presbytery 1912-16 by Catholic architect Fr. Benedict Williamson. Largely Romanesque style. Oriented north-south with nave and sacristy, with tower above.	
DESIGNATION:	DESIGNATION:	Listed Place of Worship grade II, CA	There has been significant corrosion of the steel beams in the tower roof and elsewhere. The tower parapet has 'lifted' as a result of corroding internal steel. The tower	
	CONDITION:	Very bad	roof slab and turret stair are potentially unsafe. National Heritage Lottery Fund grant delivery phase underway.	
	PRIORITY CATEGORY:	F (F)	Historic England Taylor Review Pilot grant awarded March	
OWNER TYPE:	OWNER TYPE:	Religious organisation	2019 for urgent rainwater goods repairs which will complete late 2020.	
	LIST ENTRY NUMBER:	1384451	Contact: Trudi Hughes 01223 582739	

© Nicholas Warns Architects

D

Е

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

SITE NAME:	Settlement site east of the Cedars, Alderton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005977
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Two moated sites adjoining All Saints' Church, All	Saints and St. Nicho	olas, South Elmham
DESIGNATION:	Scheduled Monument, 2 LBs	LIST ENTRY NUMBER:	1017633
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760
SITE NAME:	Martello tower at Rose Cottage, Bawdsey		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1002969
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	James Albone 01223 582781
SITE NAME:	Settlement sites 330yds (300m) north west of Wal	nut Tree Farm, Ho	llesley
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006002
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Rectilinear enclosures 1 km south west of Boyton H	Hall Farm, Hollesley	/ Boyton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006005
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Henge and associated barrow cemetery south of H	Iome Whin Farm, S	hottisham / Sutton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017632
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	David Kenny 01223 582760
SITE NAME:	Bowl barrow on Waldringfield Heath, 150m south	of Heath Farm, Wa	aldringfield
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008506
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	David Kenny 01223 582760

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2020 / EAST OF ENGLAND / EAST SUFFOLK / THURROCK (UA)

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

		HOLK (UA)	
	SITE NAME:	Bawdsey Manor, Bawdsey	Elaborate gardens laid out between 1885 and 1909 for Sir
and a	DESIGNATION:	Registered Park and Garden grade II, 9 LBs	Cuthbert and Lady Quilter on advice from Alfred Parsons. The site contains numerous garden features built by James Pulham and Son in the 1890s, including an extensive
	CONDITION:	Generally satisfactory but with significant localised problems	artificial cliff garden complete with seats and alcoves. The Pulhamite features require conservation, and both gardens and park are in need of strategic management. Coastal
	VULNERABILITY:	High	erosion remains a major concern, with planned works to
TA ALCON	TREND:	Stable	repair sea defences. Restoration of some features will continue to come forward alongside redevelopment of the
	NEW ENTRY?:	No	site as an outdoor education centre.
) Historic England	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1001465	Contact: Christopher Laine 07780 545 979

SITE NAME:	Lowestoft North		
DESIGNATION:	Conservation Area, 52 LBs, RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Robert Scrimgeour (LPA) 01394 444616

```
THURROCK (UA)
```

Сŀ

	SITE NAME:	State Cinema, George Street, Grays	The State Cinema is one of the best preserved of the 'super cinemas' of the late 1930s. It was constructed in
	DESIGNATION:	Listed Building grade II*	1938 by FGM Chancellor for Frederick's Electric Theatres. The building has suffered from heritage crime and the roof,
	CONDITION:	Very bad	rainwater goods and interior are in poor condition. The reuse of the vast cinema poses complex problems, as
	OCCUPANCY:	Vacant/not in use	confirmed by a feasibility study some years ago. Planning
1 - Trante is	PRIORITY CATEGORY:	F (F)	and Listed Building Consent approval were granted in 2018 for conversion to publWorksic house. Works commenced
He Distant	OWNER TYPE:	Commercial company	in 2019 but have stalled due to the submission of an amended application in 2020.
land	LIST ENTRY NUMBER:	543	Contact: Sheila Stones 01223 582716

Ruined C19 armoured casemate fort on site of earlier battery; refortified for both World Wars. Severe water ingress to casemates; barrack blocks in severe disrepair. The generator house has now been repaired and converted to a café. Historic England have grant aided repair of the gatehouse barrack block in 2011. Subsequent site surveys, in part funded by Historic England, were completed in early 2017, with major repairs to make the site watertight continuing in 2020 with further Historic England grant assistance.

Contact: Will Fletcher 01223 582710

© Historic England

© Historic Englar

SITE NAME:	Crop mark complex, Orsett		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002134
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	David Kenny 01223 582760

Coalhouse Fort, Tilbury

Part occupied/part in use

Scheduled Monument

Very bad

1013943

Local authority

F (F)

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2020 / EAST OF ENGLAND / THURROCK (UA)

	SITE NAME:	Belhus Park	C18 landscape park laid out for Lord Dacre by Lancelot
Site.	DESIGNATION:	Registered Park and Garden grade II, 2 LBs	'Capability' Brown between 1753 and 1763, incorporating C17 and early C18 elements with later additions by Richard Woods in 1770. The house was demolished in
	CONDITION:	Generally unsatisfactory with major localised problems	1957 and the M25 motorway cuts through the eastern park, and surviving features including Brown's shrubbery and Woods' Long Pond are in very poor condition. The
	VULNERABILITY:	High	site is now divided amongst multiple public and private
Contraction of the second	TREND:	Declining	owners, supporting a golf course and other formal and informal recreational uses. The whole landscape requires a
	NEW ENTRY?:	No	shared vision and strategy for improved management.
Historic England	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1000738	Contact: Christopher Laine 07780 545 979

SITE NAME:	East Tilbury		
DESIGNATION:	Conservation Area, 11 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Planning Dept (LPA) 01375 652275

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

This document is one in a series of publications produced as part of Historic England's national **Heritage at Risk** programme. More information about **Heritage at Risk** and other titles in the series can be found at **HistoricEngland.org.uk/har**

Heritage at Risk Published October 2020 4th Floor, Cannon Bridge House 25 Dowgate Hill London EC4R 2YA © Copyright Historic England 2020 Product code: HE0043



East of England Register 2020