Heritage at **Risk**



London Register 2018

Contents

The Register	III	
Content and criteria		
Criteria for inclusion on the Register		
Reducing the risks	VII	
Key statistics	XI	
Publications and guidance	XII	
Key to the entries	XIV	
Entries on the Register by local planning authority	XVI	
Greater London Barking and Dagenham Barnet Bexley Brent Bromley Camden City of London Croydon Ealing Enfield Greenwich Hackney Hammersmith and Fulham Haringey Harrow Havering Hillingdon Hounslow Islington Kensington and Chelsea Kingston upon Thames Lambeth Lewisham London Legacy (MDC) Merton Newham Redbridge Richmond upon Thames Southwark Sutton Tower Hamlets Waltham Forest Wandsworth Westminster, City of	I 2 4 4 5 10 17 18 21 24 27 31 37 40 44 46 48 55 60 66 77 86 90 91 96 98 100 111 112 119 122 125	

THE REGISTER Content and criteria

LISTING Definition

All the historic environment matters but there are some elements which warrant extra protection through the planning system. These are included in the <u>National</u> <u>Heritage List for England (NHLE)</u>, an online searchable database of listed assets. Since 1882, when the first Act protecting ancient monuments and archaeological remains was passed, government has been developing the system of statutory protection of heritage assets. Listing, which is applied to buildings, emerged from the post-Blitz 1940s Planning Acts. There are now over 400,000 assets on the NHLE including listed buildings, scheduled monuments, registered parks and gardens, registered battlefields and protected wreck sites.

Historic England, as the government's expert adviser, is responsible for making recommendations – but it is still the Secretary of State at the Department for Digital, Culture, Media and Sport who makes the decisions on whether an asset is listed. Understanding and appreciation develop constantly, which makes keeping the listing database up-to-date a never-ending challenge.

While still responding to threat-driven cases, our approach is now more strategic, based around thematic and area-based projects. Recent developments have seen a greater striving for openness and transparency in the process of listing a site, and better communication of what makes something special.

In June 2016 Historic England launched <u>Enriching the</u> <u>List</u>, a crowdsourcing initiative opening up the entries on the National Heritage List to contributions by users. Anyone can register as a volunteer and submit extra information about assets on the List or submit photographs to illustrate them. This additional content will then be available for anyone to view with (but separate from) the official List Entry.

Alongside the nationally listed assets found on the National Heritage List for England are locally listed assets. Best known are conservation areas, but local authorities can also create lists of locally valued assets. Most archaeological sites of significance are not scheduled, but rely on local identification and management for their protection.

LISTED BUILDINGS

Listing is the most commonly encountered type of statutory protection of heritage assets. A listed building (or structure) is one that has been granted protection as being of special architectural or historic interest. The older and rarer a building is, the more likely it is to be listed. Buildings less than 30 years old are listed only if they are of very high quality and under threat. Listing is mandatory: if special interest is believed to be present, then the Department for Digital, Culture, Media and Sport has a duty to add the building to the List.

Listed buildings are graded I, II* and II. Grade I buildings are of outstanding interest, and II* are particularly important buildings of more than special interest; together they amount to 8.3% of all listed buildings. The remaining 91.7% are of special interest and are listed grade II. There are over 378,000 entries on the NHLE of buildings of special architectural or historic interest. Entries on the statutory list sometimes group together a number of separate buildings: a terrace will be counted as one entry, rather than as separate units. Entries on this Register reflect how buildings are grouped and recorded on the statutory List.

Structures can occasionally have dual List entries (be both listed as buildings and scheduled as monuments). In such cases, scheduling controls take precedence.

SCHEDULED MONUMENTS

Scheduled monuments include single archaeological sites and complex archaeological landscapes. Nearly 20,000 examples have been listed because of their national importance. Scheduled monuments are not graded. They cover human activity from the Paleolithic era, such as cave sites, to 20th century military and industrial remains. For the millennia before written history, archaeology is the only testament to innumerable generations of people of whom there is no other record. The later 20th century saw unprecedented changes to the landscape. As a result, some types of historic sites that once were commonplace began to become rare. Those that survive often represent just small islands of what once characterised broad sweeps of our towns and countryside.

Although protected by law, scheduled monuments are still at risk from a wide range of processes and intense pressures outside of the planning system. These include damage from cultivation, forestry and, often most seriously of all, wholly natural processes such as scrub growth, animal burrowing and coastal erosion. Scheduling is discretionary, and many archaeological sites of potential importance are not scheduled. Instead, they are managed through the planning system and other regimes.

REGISTERED PARKS AND GARDENS

There are over 1,600 landscapes on the current Historic England Register of Historic Parks and Gardens of Special Historic Interest. These registered landscapes are graded I, II* or II, and include private gardens, public parks and cemeteries, rural parkland and other green spaces. They are valued for their design and cultural importance, and are distinct from natural heritage designations.

Inclusion on the Historic England Register of Historic Parks and Gardens brings no statutory controls, but there is a clear presumption in favour of upholding their significance in government planning guidance, so they do gain protection. Local authorities are required to consult Historic England on applications affecting sites registered as grade I or II*, and the Gardens Trust on sites of all grades. The setting of other listed heritage assets can also protect registered landscapes.

REGISTERED BATTLEFIELDS

Historic England's Register of Historic Battlefields was set up in 1995, and is our youngest category of listing. Its aim is to protect and promote those sites where history was made through military engagement which can be securely identified on the ground. They range from the Battle of Maldon (991) to Sedgemoor (1685): almost half date from the period of the civil wars in the mid-17th century. These special places, where often thousands were killed, deserve our recognition and respect. Recently, additions have been made to the Register of Historic Battlefields for the first time since its creation. There are now nearly 50 registered battlefields.

Protection is needed to prevent encroachment through inappropriate development, or insensitive and damaging metal detecting, which can permanently alter the archaeological record. As with registered parks and gardens, there is a clear presumption in favour of protecting registered battlefields in government planning policy.

PROTECTED WRECK SITES

There are over 50 protected wreck sites in England, which represent a tiny proportion of the 33,000 or so pre-1945 wrecks and recorded casualties that are known to lie in the territorial waters. Wreck sites can be of importance for different reasons: the distinctive design or construction of a ship, the story it can tell about its past, its association with notable people or events and its cargo. The Protection of Wrecks Act 1973 empowers the appropriate Secretary of State to list a restricted area around a vessel to protect it or its contents from unauthorised interference, and Historic England administers the attendant licensing scheme for divers seeking access.

CONSERVATION AREAS

Conservation areas are listed by local authorities and are areas of particular architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance. For over 50 years, ever since the 1967 Civic Amenities Act, conservation areas have proved a highly effective mechanism for managing change on an area-wide basis.

There are currently nearly 10,000 conservation areas in England including town and city centres, suburbs, industrial areas, rural landscapes, cemeteries and residential areas. They form the historic backcloth to national and local life and are a crucial component of local identity.

Criteria for inclusion on the Register

RISK ASSESSMENTS

Heritage assets included on the Register are risk assessed according to the nature of the site rather than the type of listing. Building or structure assessments are used for secular listed buildings and structural scheduled monuments, typically masonry remains. Archaeology assessments are used for scheduled earthworks and below-ground remains. Thus a scheduled monument may appear on the Register in either or both the building and structure and the archaeology sections, depending upon what puts it at risk. Listed buildings that are in use as places of worship are assessed using the places of worship assessment. Registered parks and gardens, conservation areas, battlefields and protected wreck sites have their own assessments because they each have their own particular characteristics and factors that may put them at risk.

BUILDINGS AND STRUCTURES

To be considered for inclusion on the Register, buildings or structures must be:

- listed on the National Heritage List for England;
- a grade I or II* listed building;
- a grade II listed building in London;
- a structural scheduled monument with upstanding remains;
- in secular (non-worship) use.

Buildings or structures are assessed on the basis of condition and, where applicable, occupancy (or use) reflecting the fact that a building which is occupied is generally less vulnerable than one that is not.

Occupancy (or use) is assessed as 'vacant', 'part occupied', 'occupied', 'not applicable', or occasionally, 'unknown'. Many structures fall into the 'not applicable' category, for example: ruins, walls, gates, headstones or boundary stones.

Condition is assessed as 'very bad', 'poor', 'fair' or 'good'. The condition of buildings or structures on the Register is typically very bad or poor, but can be fair or, very occasionally, good. This reflects the fact that some buildings or structures are vulnerable because they are empty, underused or face redundancy without a new use to secure their future. Assessing vulnerability in the case of buildings in fair condition necessarily involves judgement and discretion. A few buildings remain on the Register in good condition, having been repaired or mothballed, but still awaiting a new use or occupancy.

Buildings or structures are removed from the Register when they are fully repaired/consolidated, and their future secured either through occupation and use, or through the adoption of appropriate management.

PLACES OF WORSHIP

To be considered for inclusion on the Register, places of worship must be listed grade I, grade II* or grade II on the National Heritage List for England, and be used as a public place of worship at least six times a year.

Places of worship are assessed on the basis of condition only. If a place of worship is in very bad or poor condition, it is added to the Register. This includes places of worship which are generally in fair or good condition but have major problems with one key element, like the tower.

Historic England has visited and assessed listed places of worship considered to be in poor or very bad condition according to local assessments. Those that are identified as at risk are included on the Register.

Once on the Register, places of worship can move through the condition categories (e.g. from very bad to poor, to fair, even good) as repairs are implemented and the condition improves, until they are fully repaired and can be removed from the Register. This means that there are some places of worship in good condition on the Register but with outstanding issues still to be resolved at the time when they were assessed.

ARCHAEOLOGY

To be considered for inclusion on the Register, archaeological sites must be listed as scheduled monuments and included on the National Heritage List for England.

Archaeology assessments cover scheduled earthworks and buried archaeology. The risk assessment is based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability. A site's condition is expressed in terms of the scale and severity of adverse effects on it, ranging from 'extensive significant problems' to 'minor localised problems'. Archaeological entries are removed from the Register once sufficient progress has been made to address the identified issues, and a significant reduction in the level of risk has been demonstrated.

PARKS AND GARDENS

To be considered for inclusion on the Register, parks and gardens must be listed as grade I, grade II* or grade II and included on the National Heritage List for England. Parks and gardens are assessed in terms of condition and vulnerability. Steps being taken by owners to address problems are also taken into consideration.

Parks and gardens assessed as being at risk are typically affected by development and neglect. They have frequently been altered by development or are faced with major change. The original function of these landscapes has often changed and divided ownership leads to the loss of their cohesive historic design.

Park and garden entries are removed from the Register once steps have been taken to address issues and positive progress is being made.

BATTLEFIELDS

To be considered for inclusion on the Register, battlefields must be listed and included on the National Heritage List for England. Battlefields deemed to be at risk of loss of cultural significance are included on the Register.

The principal risks and threats are:

- development pressure e.g. encroachment of buildings;
- pressures of particular use within the site e.g. arable cultivation;
- damage e.g. unregulated metal detecting.

Battlefields are removed from the Register either when damaging activities cease/are managed, or when threats recede due to effective planning.

WRECK SITES

To be considered for inclusion on the Register, wrecks must be listed and included on the National Heritage List for England. Wreck sites are assessed based on their current condition, vulnerability and the way they are being managed.

Wrecks are vulnerable to both environmental and human impacts. Risks that contribute to inclusion on the Register range from unauthorised access to erosion and fishing damage. The monitoring process ensures that the significance of the site is identified and maintained. In spite of the inherent difficulties in caring for this type of site, careful management must be maintained.

Wrecks are removed from the Register once an appropriate management and monitoring regime is operational.

CONSERVATION AREAS

Once a year Historic England asks every local authority in England to consider the state of its conservation areas and fill in (and update as appropriate) risk assessment questionnaires for those that cause concern, or are believed to no longer be at risk.

Conservation areas that are deteriorating, or are in very bad or poor condition and not expected to change significantly in the next three years, are defined as being at risk.

The approach taken to assess conservation areas at risk has been refined since the first survey in 2008/2009. An overall category for condition, vulnerability and trend is included for each conservation area on the Heritage at Risk Register. Conservation areas identified as at risk in 2009, but not reassessed since using the revised methodology, are included on the Register but with limited information.

Conservation areas are removed from the Register once plans have been put in place to address the issues that led to the conservation area being at risk, and once positive progress is being made.

Reducing the risks

One of the primary aims of the <u>Historic England</u> <u>Corporate Plan 2017-2020</u> is protecting places through Heritage at Risk grants and advice, thereby reducing the risk to heritage assets. In order to achieve this aim we are working to:

- better understand the nature and extent of risk
- encourage others to save and re-use heritage at risk
- build the capacity of the sector to deliver solutions for heritage at risk
- provide advice and grant aid to help remove sites from the Register.

Dedicated Heritage at Risk teams in our regional offices are tasked with achieving this aim.

Whilst each type of heritage asset and individual site will require its own approach and solution, there are some general approaches that are relevant to all 'at risk' assets. Finding solutions for heritage at risk requires working in close partnership with owners, local planning authorities and a wide variety of other organisations. The provision of clear advice is essential to further understanding of heritage at risk.

Maintenance and occupation or use (where appropriate) are essential in preventing heritage from becoming at risk. Maintenance of assets already at risk can prevent them from decaying further. Without maintenance, the cost of repair and consolidation escalates, the challenge for owners and occupiers increases, and the scope for affordable solutions declines.

The Heritage at Risk Register helps us understand what factors lead to heritage assets becoming at risk, what action is most likely to influence their condition and where resources can be focused to best effect. Historic Environment Records and local heritage at risk registers, maintained by local authorities, are additional repositories of information on local historic assets. They underpin the work of local authority historic environment services and can help improve the protection, conservation and management of assets.

Historic England provides a wide range of published guidance on reducing the risks, including: finding partners, funding, new uses for heritage assets, and enforcing urgent works and repairs. These are available to download from our website, <u>www.historicengland.org.uk</u>. Key publications and guidance are also listed in this Register.

BUILDINGS AND STRUCTURES

Historic England regional teams can help owners and local authorities better understand buildings and

structures at risk, advise on necessary repairs and on finding new uses. Our teams can provide support with commissioning specialist surveys, help with feasibility studies and with brokering solutions. In particularly difficult cases, they can draw on the expertise of Historic England's national advisers specialising in structural engineering, quantity surveying, development economics, enforcement and planning law.

Historic England can help with access to funding. We have two principal grant streams ourselves: Repair Grants for Heritage at Risk and Section 17 Management Agreements (which are smaller grants for scheduled monuments). More information on funding can be found on the <u>Historic England</u> website. The support of other grant providers, including the Heritage Lottery Fund, the Architectural Heritage Fund and Natural England, is also critical.

We know how useful our own Register is in managing risk, prioritising action and engaging partners. We also know that heritage, when well cared for, helps create vibrant and successful places. Our regional teams are therefore working with local authorities to encourage them to develop their own strategies for tackling buildings in poor condition. These strategies should include the use of enforcement powers; 'Stopping the Rot' is our published guidance on this. Our legal team can provide training and support for local authorities considering enforcement action. In certain circumstances we can also provide grant aid to underwrite the cost of serving Urgent Works and Repairs Notices.

Building preservation trusts (BPTs) offer a tried and tested way of saving buildings at risk. We have close links with the <u>Architectural Heritage</u> <u>Fund</u> and help fund their regional support officers to work across the country. They help BPTs and other not- for-profit organisations to access funding, carry out feasibility studies and develop solutions for places at risk. The <u>Heritage Trust</u> <u>Network</u> is also a valuable source of advice. Further guidance and case studies are available on the <u>Historic England</u> website.

PLACES OF WORSHIP

Historic places of worship are cared for by thousands of volunteers throughout the country. Sometimes these treasured buildings will require major repairs. However, regular maintenance will help prevent minor problems developing into unnecessary crises. Keeping drains and gutters clear is essential: the overflowing gutter soon soaks the wall beneath, rots the roof timbers behind it and makes the whole building vulnerable. In some areas congregations group together to engage reputable contractors at competitive rates to clear gutters and rainwater goods. Such cooperation enables them to get good quality work carried out at reasonable prices by firms that understand historic buildings. The practical resources created by the <u>Maintenance Cooperatives Project</u> run by the Society for the Protection of Ancient Buildings are available from their website. These are a great starting point for local groups wanting to work together to do basic, regular maintenance safely.

Historic England supports congregations wanting to keep their places of worship in use and recognises the need for appropriate new facilities such as kitchens and toilets that are sensitive to the building's special character. Our <u>advice web pages</u> help congregations understand how changes can be achieved. The <u>Heritage Lottery Fund</u> welcomes applications from places of worship seeking to do repairs, develop facilities or welcome more visitors.

A network of support officers, employed locally but part-funded by Historic England, offers direct advice and encouragement to congregations. Projects to achieve repairs and develop necessary new facilities for both the community and visitors are breathing a new lease of life into these treasured parts of our heritage.

From September 2018 to March 2020 the Department for Digital, Culture, Media and Sport is funding a <u>pilot study</u> to explore a slightly different approach. This is focusing on fabric maintenance (supported by a small grant fund) and community development to explore opportunities for wider engagement beyond the congregation in voluntary, social and commercial sectors. Pilot schemes, which cover listed places of worship of all denominations and faiths, are running in Greater Manchester and Suffolk.

The Government's Listed Places of Worship scheme, enabling the reclaiming of VAT on eligible repairs, maintenance and authorised alterations, is available to all listed places of worship, whether they have obtained grants or are funding work themselves. Local and national charities also offer grants.

ARCHAEOLOGY

The continued excellent progress which is being made with reducing the number of scheduled monuments on the Register demonstrates the value which owners and land managers are placing upon the positive management of archaeological sites.

The large majority of scheduled monuments in England are on land classified as agricultural. Effective information sharing with Natural England and Defra is therefore of great importance for prioritising management action and for targeting agri-environment grant schemes to best effect. This has been especially important under the Countryside Stewardship Scheme, where our advice has resulted in the removal of 29 sites from being at risk this year. Our work in partnership with Natural England on agrienvironment schemes has removed well over 800 scheduled monuments from the Register since 2009 and we therefore welcomed the recognition given to the value and importance of heritage within the 25 Year Environment Plan and the Agriculture Bill. The Bill proposes that the conservation of rural heritage will be one of the environmental public goods funded through the domestic successor to the Common Agricultural Policy after the UK leaves the European Union. We also continue to work closely with local trusts, volunteers and the Heritage Lottery Fund to identify the nationally important monuments for enhanced conservation, presentation and access projects which is providing increased public value and enjoyment of our heritage.

Loss and damage as a consequence of arable cultivation remains the greatest source of risk to scheduled monuments on the Register, affecting 38% of archaeological entries on it. The Conservation of Scheduled Monuments in Cultivation (COSMIC) project has provided updated risk assessments for all sites affected by arable cultivation on the Register. It provides bespoke recommendations for each monument, enabling cultivation to continue where it does not present a risk. It will also be an important tool for advising owners on the longer term management of their monuments as the existing ten year Environmental Stewardship agreements expire.

Although great progress has been made, analysis of entries on the Register shows that unmanaged woodland, tree, scrub and bracken growth remains one of the most widespread causes of long-term damage to both urban and rural archaeological sites. Such vegetation growth, combined, makes up 30% of the risk factors affecting monuments at risk. To help address one of these key risk factors Historic England have been working with landowners and scientists to research and provide guidance on bracken control.

In most cases simple, low cost but regular maintenance is the key, with such improvements in management removing 36 sites from the Register this year alone. The delivery of these will always be reliant upon the help and goodwill of landowners. We are also sponsoring a number of projects to help volunteers and the public to get involved – which not only helps owners but also promotes wellbeing and public understanding of heritage.

PARKS AND GARDENS

Although a statutory list, the Register of Historic Parks and Gardens of Special Historic Interest in England in itself brings no additional statutory powers, instead it is used in the development control process to provide a valuable tool for the protection of the sites it includes. The Government's National Planning Policy Framework (NPPF) stresses the desirability of sustaining and enhancing the significance of all heritage assets and finding viable uses consistent with their conservation.

The NPPF states that great weight must be given to the conservation of sites included on the Register of Historic Parks and Gardens of Special Historic Interest and that substantial harm or loss of such features can only be justified in exceptional cases.

A great many historic parks and gardens are either privately owned or held in trust. In addition, local authorities are responsible for nearly all the public parks and cemeteries in our towns and cities.

Registered parks and gardens are typically large, complex heritage assets, many of them in multiple ownership. It can take years to identify and implement proposals to improve their condition and trajectory. To help reduce the risks, Historic England encourages and works with owners to develop conservation management strategies. Landscape architects working in our Heritage at Risk teams can help tailor conservation management plans and funding packages for individual landscape features or whole sites. We work with partners, such as Natural England and the Heritage Lottery Fund, to help source funding to secure sustainable futures for parks and gardens at risk.

BATTLEFIELDS

As with registered parks and gardens, the Register of Historic Battlefields brings no additional statutory controls to registered battlefields, but the NPPF makes it clear that registered battlefields are 'assets of the highest significance', and of equal significance to scheduled monuments, buildings listed grade I and II*, registered parks and gardens and protected wreck sites. Therefore, the positive conservation and management of registered battlefields is a core element of current heritage policy and legislation.

Historic England continues to work with owners to develop management plans for registered battlefields and, in appropriate cases, contributes towards the cost of management plans. We work to develop positive landscape strategies with owners and partners such as Defra and Natural England through environmental stewardship schemes. In some circumstances, we may encourage the conversion from arable to pasture of especially sensitive locations to protect battlefield archaeology from the effects of ploughing and as part of a wider drive to prevent unauthorised and damaging metal detecting.

Local authorities invite comments from Historic England and the Battlefields Trust on planning applications that affect registered battlefield sites.

Historic England also continues to encourage greater access to battlefields and the enhancement of their amenity value. We wish to ensure an increased understanding and wider appreciation of the ways that these dramatic historic events have shaped our nation.

WRECK SITES

At the strategic level, the major sources of risk to protected wreck sites have been identified. In terms of high priority sites, practical requirements have also been implemented through conservation management plans and appropriate intervention.

Risks to protected historic wreck sites can often be reduced through education, provision of marker buoys, or planning policies that take full account of their national importance. However, some sites require significant resources to stabilise their condition or to carry out detailed archaeological assessments of their conservation requirements. Although Historic England has statutory power to allocate funds to promote the preservation and maintenance of protected wreck sites, its financial resources can solve only a small proportion of the problems.

In spite of the inherent difficulties with caring for this type of site, careful management must be maintained if we are to avoid the loss of wreck sites. It is therefore close cooperation between the owners of protected wreck sites (where known), authorised divers and all organisations charged with care for the marine and coastal environment, that will make the real difference to their long term survival. Practical advice on the management of historic wreck sites, whether at the coast edge or under water, is available from <u>Historic England</u>.

CONSERVATION AREAS

Looking after conservation areas is a responsibility shared by those of us who live, work or do business in them, as well as those of us whose job it is to manage them or make decisions about their future.

The reasons conservation areas become at risk are difficult to address as they can cover large areas of land; they include streets, spaces, archaeology and trees as well as buildings and structures and therefore involve many different owners and approaches to management.

Local authorities assess conservation areas and fill in a questionnaire for those newly at risk, giving us an insight into the issues which have had a negative effect upon the conservation area, and so help us to establish how these issues can be addressed.

Strong planning policies, guidance and a clear management strategy for individual conservation areas, backed up by effective enforcement, are all critical in managing change in these areas. Local authorities across the country continue to see their resources reduced, and this is making their task more difficult to deliver. Armed with the information provided by conservation area questionnaires we, local authorities and other partners will have the evidence to direct resources much more accurately towards those conservation areas at greatest risk.

There are opportunities for members of the local community to get involved with protecting and enhancing their conservation area, either individually or through groups. Some local groups have helped to prepare character appraisals and management plans for conservation areas whilst others have carried out their own assessments to identify management issues.

Key statistics

BUILDINGS AND STRUCTURES

- Nationally, 834 (3.7%) of grade I and II* listed buildings (excluding places of worship) are on the Register. In London the percentage is 3.5% (59 listed secular buildings).
- 2.4% (402) of London's grade II listed secular buildings are on the Register.
- 31 building or structure entries have been removed from the 2017 London Register because their futures have been secured, and 14 have been added.
- 96% of buildings or structures on the London baseline 1991 Register have been removed because their futures have been secured.

PLACES OF WORSHIP

- Nationally, 6.2% of listed places of worship are on the Register. In London, 10.9% (88) are on the Register.
- 5 places of worship have been removed from the London Register following repair work, and 7 have been added.

ARCHAEOLOGY

- 2,431 (12.2%) of England's 19,852 scheduled monuments are on the Register. 26 (15.8%) of London's 165 scheduled monuments are on the Register.
- 2 archaeology entries have been removed from the 2017 London Register for positive reasons, and none have been added.
- 40.5% of archaeology entries (15) on the London baseline 2009 Register have been removed for positive reasons, compared with the national figure of 47.7%.

• Nationally, damage from arable cultivation is the greatest cause of risk affecting 38.3% of archaeological entries on the Register. In London the proportion is 11.5%. The greatest risk, to 34.6% of entries on the London Register, is from unrestricted scrub and tree growth. The national figure for scrub and tree growth is 13.2%.

PARKS AND GARDENS

- 99 (5.9%) of England's 1,664 registered parks and gardens are on the Register. Of the 152 registered parks and gardens in London, 11 (7.2%) are on the Register.
- I park and garden entry was added and no entries were removed from the 2017 London Register.

BATTLEFIELDS

• Of the 47 registered battlefields in England, 4 (8.5%) are on the Register. The one registered battlefield in London is not on the Register.

WRECK SITES

• Of the 53 protected wreck sites around England's coast, 4 (7.5%) are on the Register. London has no protected wreck sites.

CONSERVATION AREAS

- There are currently 502 Conservation Areas on the Heritage at Risk Register. Of these 74 are in London.
- 5 conservation areas have been removed from the 2017 London Register for positive reasons, and none have been added.

HISTORIC ENGLAND FUNDING

• £891k in grant was spent on 25 entries on the London Register during 2017/18.

Risk assessments of heritage assets are based on the nature of the site. Buildings and structures include listed buildings (excluding listed places of worship) and structural scheduled monuments; archaeology assessments cover earthworks and buried archaeology.

Publications and guidance

Historic England has produced the following publications relating to heritage at risk, including:

Assessment of Heritage at Risk from Environmental Threat: Key Message (2013)

COSMIC 3 – Grappling with a 140-Year-Old Conservation Problem (2014) – <u>Historic</u> <u>England Research News 21</u>, available online

<u>Counting our Heritage: a Heritage at Risk Survey</u> <u>for High Peak Staffordshire Moorlands by</u> <u>Community Volunteers</u> (2013)

Heritage at Risk 2010 - Report (2010)

Heritage at Risk: Conservation Areas (2009)

Heritage at Risk 2018 – national summary leaflet

<u>Heritage at Risk Online Register</u> – detailed listings for: East Midlands, East of England, London, North East, North West, South East, South West, West Midlands, and Yorkshire can be downloaded from our website or viewed on an interactive database.

<u>Monuments at Risk (2008)</u> – summary of scheduled monuments at risk for: East Midlands, East of England, London, North East, North West, South East, South West, West Midlands, and Yorkshire.

Historic Wreck Sites at Risk: A Risk Management Toolkit (2017)

Stopping the Rot: A Guide to Enforcement Action to Save Historic Buildings (2016)

Vacant Historic Buildings: Guidelines on Managing Risks (2018)

HERITAGE AT RISK ON THE WEB

To find out more about the Heritage at Risk programme visit <u>Heritage at Risk</u> where you will find an interactive database providing detailed information on all heritage sites at risk nationally.

Details of all nationally designated historic places in England are available in one place on the <u>National Heritage List for England</u> online database. Further information about the different classes of designated heritage assets, including listed buildings, scheduled monuments, registered parks and gardens, registered battlefields and protected wreck sites can be viewed at the same address.

GUIDANCE NOTES AND APPLICATION FORMS FOR GRANTS

<u>Historic England Grant Schemes</u> – online overview of all our current grant schemes, including the Repair Grants for Heritage at Risk scheme.

<u>Grants to Local Authorities to Underwrite Urgent</u> <u>Works Notices</u>

Acquisition Grants to Local Authorities to Underwrite <u>Repairs Notices</u>

Repair Grants for Heritage at Risk

CONSERVATION ADVICE AND GUIDANCE

The following publications are among the numerous guidance documents available for free on <u>Historic England Advice</u> web page:

Conservation Area Designation, Appraisal and Management (2018)

<u>Conservation Principles, Policies and Guidance</u> <u>for the Sustainable Management of the</u> <u>Historic Environment</u> (2008)

<u>Conservation and Management of War</u> <u>Memorial Landscapes (</u>2016)

The Conservation, Repair and Management of War Memorials (2015)

Guidance on Constructive Conservation

Guidance on Improving Streets and Public Spaces

Guidance on Looking after Historic Buildings

<u>Guidance on Looking after Historic Cemeteries and</u> <u>Burial Grounds</u>

<u>Guidance on Looking after Historic Parks, Gardens</u> <u>and Landscapes</u>

Guidance on Looking after Places of Worship

<u>Guidance on Protecting the Rural Historic</u> <u>Environment</u>

Guidance on Tackling Heritage Crime

<u>Heritage Works: a Toolkit of Best Practice in</u> <u>Heritage Regeneration (</u>2017)

<u>Latest Advice and Guidance</u> – this web page highlights our most recent advice on a wide range of heritage-related topics.

Managing Local Authority Heritage Assets: Some Guiding Principles for Decision Makers (2017)

Metal Theft from Historic Buildings. Prevention, Response and Recovery (2017)

<u>Practical Building Conservation</u> – revised ten-part series: Building Environment; Concrete; Conservation Basics; Earth, Brick & Terracotta; Roofing, Glass & Glazing; Metals; Mortars, Renders & Plasters; Stone; Timber (2012–2015)

<u>Pillars of the Community: the Transfer of Local</u> <u>Authority Heritage Assets (2015)</u>

Post-War Public Art: Protection, Care and Conservation (2016)

<u>Registration Selection Guide: Battlefields</u> (2017)

<u>Scheduled Monument Consents: A</u> <u>Guide for Owners and Occupiers</u> (2014)

<u>The Disposal of Heritage Assets: Guidance Note</u> <u>for Government Departments and</u> <u>Non Departmental Public Bodies (</u>2010)

The Installation of Telecommunications Equipment, Including Broadband and Mobile, in Churches and Other Listed Places of Worship (2017)

Key to the entries

The Register includes the following risk assessment types:

- Building or structure (grade I and II* listed buildings, grade II listed buildings in London and structural scheduled monuments)
- Place of worship
 - (grade I, II* and II listed buildings)
- Archaeology
 - (scheduled monuments earthworks and buried archaeology)
- Park and garden
 (Registered parks and gardens)
- Battlefield
 - (Registered battlefields)
- Wreck site
 - (Protected wreck sites)
- Conservation area
 - (Conservation areas)

Details are given here for all risk assessment types even if entries are not present in the Regional Register.

ORDER

Entries are grouped and ordered alphabetically by London borough. Within each borough, entries are grouped by risk assessment type in the following order:

- Buildings or structures
- Places of worship
- Archaeology
- Parks and gardens
- Battlefields
- Wreck sites
- Conservation areas

Within each risk assessment type, entries are ordered alphabetically by street and site name. Conservation areas are ordered by site name only. Where appropriate, parks and gardens are integrated by locality.

LISTING

The principal listing type is noted for each entry and includes:

- Listed Building (LB) grade I, II* or II
- Listed Place of Worship grade I, II* or II
- Scheduled Monument (SM)
- Registered Park and Garden (RPG) grade I, II* or II
- Registered Battlefield (RB)
- Protected Wreck Site (PWS)
- Conservation Area (CA)

Other listing types that apply to a given site, including location within a World Heritage Site (WHS), are also noted.

If an entry is a dual list entry (both listed and scheduled), 'and' rather than a comma is used (eg 'Scheduled Monument and Listed Building grade I'). If a scheduled monument entry is a dual list entry with a number of listed buildings, each is separated by a semicolon.

The National Heritage List Entry Number is included for all entries (except conservation areas). If a site has dual list entries, all relevant List Entry Numbers are noted.

CONDITION

For buildings (including places of worship), condition is graded as: 'very bad', 'poor', 'fair' and 'good'.

For sites that cover areas (scheduled monuments – archaeology assessments, parks and gardens, battlefields and wreck sites) one overall condition category is recorded. The category may relate only to the part of the site or monument that is at risk and not the whole site:

- extensive significant problems
- generally unsatisfactory with major localised problems
- generally satisfactory but with significant localised problems
- generally satisfactory but with minor localised problems
- optimal
- unknown (noted for a number of scheduled monuments that are below-ground and where their condition cannot be established).

For conservation areas, condition is categorised as: 'very bad', 'poor', 'fair' and 'optimal'.

If a site has suffered from heritage crime it is noted in the summary. Heritage crime is defined as any offence which harms the heritage asset or its setting and includes arson, graffiti, lead theft and vandalism.

OCCUPANCY/USE

For buildings (excluding places of worship) that can be occupied or have a use, the main vulnerability is vacancy or under-use. Occupancy (or use) is noted as follows:

- vacant
- part occupied
- occupied
- unknown
- not applicable

VULNERABILITY

Principal vulnerability is noted for archaeology assessments and may relate only to the part of the site that is at risk, and include:

- animal burrowing
- arable ploughing
- coastal erosion
- collapse
- deterioration in need of management
- scrub/tree growth
- visitor erosion

For parks and gardens, battlefields, wreck sites and conservation areas, vulnerability is noted as high, medium or low.

PRIORITY CATEGORY

Priority for action is assessed on a scale of A to F, where 'A' is the highest priority for a site which is deteriorating rapidly with no solution to secure its future, and 'F' is the lowest priority.

For buildings and structures and places of worship the following priority categories are used as an indication of trend and as a means of prioritising action:

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented
- C Slow decay; no solution agreed
- D Slow decay; solution agreed but not yet implemented
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- F Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented

For battlefields and wreck sites the following priority categories are used as a means of prioritising action:

- A No action/strategy identified or agreed (where trend is declining or unknown)
- B Action/strategy agreed but not yet implemented (where trend is declining or unknown)
- C No action/strategy identified or agreed (where trend is stable or improving)
- D Action/strategy agreed but not yet implemented (where trend is stable or improving)
- E Monitoring as appropriate (any trend)
- F Action implemented/strategy underway/scheme in progress (any trend)

Previous year priority categories are given in brackets, otherwise 'New entry' is noted.

'New entry – re-assessed' indicates an existing site on the Register that has been re-assessed using a different risk assessment methodology and is included on this year's Register under the new assessment type.

TREND

Trend for archaeology entries, parks and gardens, battlefields and wreck sites may relate only to the part of the site that is at risk and is categorised as:

- declining
- stable
- improving
- unknown

For conservation areas trend is categorised as:

- deteriorating
- deteriorating significantly
- no significant change
- improving
- improving significantly
- unknown

OWNERSHIP

A principal ownership category is given for each entry, and if sites are in divided ownership, a 'multiple' ownership category is noted.

CONTACT

This is the member of the Historic England local team who acts as a first point of contact for the case, and to whom enquiries should be addressed.

For conservation areas and grade II listed buildings, the contact is the conservation/planning officer at the relevant local planning authority (indicated by 'LPA').

We are not in any sense agents for the owners of the sites included, but we will endeavour to put people in touch with them where appropriate.

- CA Conservation Area
- HE Historic England
- HLF Heritage Lottery Fund
- LB Listed Building
- LPA Local Planning Authority
- NP National Park
- PWS Protected Wreck Site
- RB Registered Battlefield
- RPG Registered Park and Garden
- SM Scheduled Monument
- UA Unitary Authority
- WHS World Heritage Site

Entries on the Register by local planning authority

Local planning authority	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
GREATER LONDON							
Barking and Dagenham	4	1	1	0	0	0	1
Barnet	6	2	1	0	0	0	I
Bexley	2	0	0	0	0	0	0
Brent	6	1	0	0	0	0	0
Bromley	17	1	3	1	0	0	I
Camden	22	12	0	0	0	0	0
City of London	1	3	3	0	0	0	0
Croydon	6	5	2	0	0	0	I
Ealing	9	1	2	0	0	0	5
Enfield	9	2	0	3	0	0	2
Greenwich	18	1	0	0	0	0	4
Hackney	20	8	0	I	0	0	2
Hammersmith and Fulham	10	2	0	0	0	0	I
Haringey	13	3	0	0	0	0	5
Harrow	8	1	5	I	0	0	0
Havering	8	0	1	0	0	0	I
Hillingdon	28	1	2	0	0	0	9
Hounslow	19	0	2		0	0	2
Islington	13	10	0	0	0	0	11
Kensington and Chelsea	37	4	0		0	0	I
Kingston upon Thames	4	1	0	0	0	0	3
Lambeth	36	1	0	0	0	0	3
Lewisham	16	2	0	0	0	0	I
London Legacy (MDC)	6	0	0	0	0	0	2
Merton	15	0	1		0	0	6
Newham	13	0	0	0	0	0	0
Old Oak and Park Royal (MDC)	0	0	0	0	0	0	0
Redbridge	5	I	0	I	0	0	3
Richmond upon Thames	14	I	0	0	0	0	I
Southwark	30	5	2	I	0	0	2
Sutton	5	0	0	0	0	0	1
Tower Hamlets	24	7	1	0	0	0	5
Waltham Forest	10	5	0	0	0	0	0
Wandsworth	14	0	0	0	0	0	0
Westminster, City of	3	7	0	0	0	0	0
TOTAL	461	88	26	11	0	0	74

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

GREATER LONDON

BARKING AND DAGENHAM

	SITE NAME:	The Old Vicarage, Crown Street, Dagenham	House, dated 1665, and remodelled in the C19. The building is currently partly occupied and has been at risk of
	DESIGNATION:	Listed Building grade II, CA	vandalism. Planning Permission was granted for residential conversion into flats. The Local Authority is awaiting the
	CONDITION:	Poor	submission of conditions relating to the consented scheme.
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
England	LIST ENTRY NUMBER:	1064411	Contact: Daniel Pope (LPA) 020 8227 3929

© Historic E




SITE NAME:	The Marks Stones, Whalebone Lane North, Chadwell Heath	Boundary marker of the Liberty of Havering-atte-Bower, set up in 1642. There are two stones; one 12 inches high
DESIGNATION:	Listed Building grade II	inscribed 'Marks Stone' and one 30 inches high inscribed 'Marks Stone Sept 1642'. One stone is broken and in
CONDITION:	Very bad	safekeeping, the other remains in its original position. The stones are to be repaired by the quarry operators once
OCCUPANCY:	N/A	restoration of the area is complete. A feasibility report,
PRIORITY CATEGORY:	D (D)	with funding from the Heritage Lottery Fund in 2015, explored the potential of the site. The site's use and
OWNER TYPE:	Crown	maintenance is being discussed with the Local Authority, the Crown Estate and Historic England.
LIST ENTRY NUMBER:	1079887	Contact: Daniel Pope (LPA) 020 8227 3929

© Historic England



© Historic England Archive



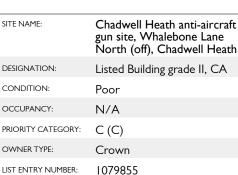

II*, CA

D (D)

1359302

Poor

N/A

D (D)

Crown

1184884

The Warren Stone, Whalebone

Lane North, Chadwell Heath

Listed Building grade II

Authority, the Crown Estate and Historic England. Contact: Daniel Pope (LPA) 020 8227 3929 The substantial remains of a World War II anti-aircraft battery with pits for eight guns in two groups of four and associated structures. The buildings are in an isolated spot and have been subject to vandalism. The former quarry is being restored, including the land levels around the gun site and when complete there will also be a five year aftercare plan. A feasibility report, with funding from the Heritage

Boundary stone erected in 1642. The stone marked the boundary of Hainault Forest, along with the Marks Stones

and the Forest Bounds Stone. The stone is in storage at

Warren Farm during ongoing quarrying operations. The stone will be reinstated in its original position once

feasibility report, with funding from the Heritage Lottery Fund in 2015, explored the potential of the site. The site's

use and maintenance is being discussed with the Local

quarrying is finished and land levels have been restored. A

Local Authority, the Crown Estate and Historic England.

Lottery Fund in 2015, explored the potential of the site.

The site's use and maintenance is being discussed with the

Contact: Daniel Pope (LPA) 020 8227 3929

Church of St Peter and St Paul, Most of the church was rebuilt in 1800 in the Strawberry Crown Street, Dagenham Hill Gothic style, using red brick quoins and dressings to frame ashlar and ragstone panels. A fine open-truss roof Listed Place of Worship grade spans the nave. The chancel and north chapel are medieval, rendered over ragstone; the interior has been re-ordered. The church has been awarded a first round pass from the Very bad Heritage Lottery Fund for repairs to the tower roof and lantern as well as masonry and windows. The repairs are expected to start on site in the autumn of 2018. Religious organisation

Contact: lan Harper 020 7973 3786

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed. С
- Slow decay; solution agreed but not yet implemented. Under repair or in fair to good
- repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ΪA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / BARKING AND DAGENHAM / BARNET

SITE NAME:	Barking Abbey		
DESIGNATION:	Scheduled Monument, LB grade II, part in CA	LIST ENTRY NUMBER:	1003581
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Chadwell Heath Anti-Aircraft Gun Site, Marks Gat	te	
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Daniel Pope (LPA) 020 8227 3910

BARNET

© Histo

	SITE NAME:	College Farm - main building, Fitzalan Road N3	Stables, teashop and dairy, built in 1883 to the design of Frederick Chancellor in a picturesque style. Model dairy
	DESIGNATION:	Listed Building grade II, CA	farm of the Express Dairy Company. The site is owned by the College Farm Trust. The building is in a deteriorating
	CONDITION:	Fair	condition and discussions are ongoing regarding the future use of the site and necessary repairs.
	OCCUPANCY:	Occupied/in use	use of the site and necessary repairs.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Charity (heritage)	
toric England	LIST ENTRY NUMBER:	1359127	Contact: Jonathan Hardy (LPA) 020 8359 4655

	SITE NAME:	College Farm Dairy, Fitzalan Road N3	Dairy built in 1883 to the design of Frederick Chancellor, with an ornate timber lantern roof and decorative tilework
	DESIGNATION:	Listed Building grade II, CA	to the interior. The site is owned by the College Farm Trust. The building is in a deteriorating condition and
	CONDITION:	Fair	discussions are ongoing regarding the future use of the site and necessary repairs.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Charity (heritage)	
© Historic England	LIST ENTRY NUMBER:	1064789	Contact: Jonathan Hardy (LPA) 020 8359 4655

~	-	8 6		
			-	-
	Ł.			and the second

Silo built in 1883 to the design of Frederick Chancellor as SITE NAME: Silo, Fitzalan Road, College Farm N3 part of the Express Dairy Company's pioneering model farm. The site is owned by the College Farm Trust. The DESIGNATION: Listed Building grade II, CA building is in a deteriorating condition and discussions are ongoing regarding the future use of the site and necessary CONDITION: Fair repairs. OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: C (C) OWNER TYPE: Charity (heritage) LIST ENTRY NUMBER: 1359128 Contact: Jonathan Hardy (LPA) 020 8359 4655

© Historic England



	SITE NAME:	Monument to Major John Cartwright, St Mary at Finchley Churchyard, Hendon Lane N3	Monument erected in 1835 to Major John Cartwright by public subscription. Built of yellow oolitic limestone, with a square tapering obelisk and armorial and portrait roundels.
	DESIGNATION:	Listed Building grade II, CA	The monument has been dismantled since 2008 due to its dangerous condition. A condition survey was carried out in
	CONDITION:	Poor	2017 with funding from Historic England. Faculty Consent was granted in 2018 for the conservation and repair of the
	OCCUPANCY:	N/A	vault and obelisk. Works are in progress with funding from
	PRIORITY CATEGORY:	F (A)	Historic England and are due to be completed in 2018.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1246062	Contact: Jonathan Hardy (LPA) 020 8359 4655

PRIORITY CATEGORIES

© Historic England Archive

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

D

Е

- obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

2

HERITAGE AT RISK 2018 / LONDON / BARNET



Ĩ	SITE NAME:	Railway Hotel including sign in front and former off-sales building to west, Station Road, Edgware	The Railway Hotel dates from 1931 and was designed by AE Sewell for the brewers, Truman Hanbury Buxton. It is a large three storey half-timbered roadhouse and one of the best examples of its type in the country. It is no longer in
	DESIGNATION:	Listed Building grade II	use as a public house and was damaged by a fire in July 2016. The listing includes the former off-sales building and
	CONDITION:	Poor	the gibbet sign on the frontage. An approved scheme to restore and extend the building for hotel use has not been
	OCCUPANCY:	Part occupied/part in use	implemented. The Local Authority has taken enforcement
	PRIORITY CATEGORY:	D (D)	action relating to the building's condition and use of the surrounding site.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1096066	Contact: Jonathan Hardy (LPA) 020 8359 4655

© Historic England



	SITE NAME:	Physic Well, Well Approach	Timber-framed cruciform cover to a well, circa 1937.
	DESIGNATION:	Listed Building grade II	Beneath is the original C17 barrel-vaulted brick well chamber. Once a fashionable rendezvous for Londoners
	CONDITION:	Poor	for the medicinal qualities of the mineral waters. A condition survey was carried out in 2017 with funding from
	OCCUPANCY:	Vacant/not in use	Historic England. Planning Permission and Listed Building
	PRIORITY CATEGORY:	F (C)	Consent were granted in 2018 for the full conservation and repair of the building. Works are in progress with funding
	OWNER TYPE:	Local authority	from Historic England and the Heritage of London Trust, and are due to be completed in Autumn 2018.
	LIST ENTRY NUMBER:	1064804	Contact: Jonathan Hardy (LPA) 020 8359 4655

© Historic England

SITE NAME: Church of St Jude, Central Designed by Sir Edwin Lutyens, St Jude's was consecrated Square, Hendon NWII in 1911 with the west end finally completed in 1935. There are frescoes throughout by Walter Starmer, dating from Listed Place of Worship grade I, DESIGNATION: 1919-30. Built in grey and red brick with stone dressings CA and clay tiled roofs. It has a tall open tower and spire. The church has damp issues including the crypt, which is prone CONDITION: Poor to flooding. There is cracking evident internally and some PRIORITY CATEGORY: C (C) areas of the frescoes are suffering from salt damage. The heating system requires overhauling. The congregation is OWNER TYPE: Religious organisation actively exploring possible sources of funding. LIST ENTRY NUMBER: 1294714 Contact: Tracey Craig 020 7973 3756

© Historic England



	SITE NAME:	Church of All Saints, Oakleigh Road, Barnet N20	Built in 1883, designed by Joseph Clark in Early English style, with tiled pitched roofs and flint faced walling with ashlar
	DESIGNATION:	Listed Place of Worship grade II	dressings. It has a tall tower and stone spire. The structure has suffered from general erosion of stonework and has
	CONDITION:	Poor	extensive cementitious repairs which are failing, with particular concern over those at high level becoming loose.
	PRIORITY CATEGORY:	F (D)	There are some areas of bulging and missing flints. Repairs
	OWNER TYPE:	Religious organisation	are underway to the spire and tower grant-aided by the Heritage Lottery Fund and are due to complete in 2018.
	LIST ENTRY NUMBER:	1064881	Further repairs to masonry will be required, particularly to the west end.

© Historic England

SITE NAME: Brockley Hill Romano-British pottery and settlement				
DESIGNATION:	Scheduled Monument		1018006	
CONDITION: Generally satisfactory but with significant localised problems		TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145	
SITE NAME:	College Farm, Finchley N3			
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No	
CONDITION:	Poor	TREND:	Deteriorating	
VULNERABILITY:	Medium	CONTACT:	Jonathan Hardy (LPA) 020 8359 4655	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but $\ \ F$ not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Tracey Craig 020 7973 3756

ABBREVIATIONS

Conservation Area Listed Building CA

- LB LPA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM

UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / BEXLEY / BRENT

BEXLEY

BEXLEY			
	SITE NAME:	Crossness Pumping Station, Belvedere Road SE28	Opened 4 April 1865; the engineer was Joseph Bazalgette. The building retains important cast iron interior fittings and
	DESIGNATION:	Listed Building grade I, CA	four colossal beam engines by James Watt and Co. The Crossness Engines Trust has restored the building and
	CONDITION:	Good	grounds, with funding from the Heritage Lottery Fund and others. Repairs to embedded rainwater pipes are still
MAMPA	OCCUPANCY:	Occupied/in use	needed.
	PRIORITY CATEGORY:	C (F)	
	OWNER TYPE:	Charity (heritage)	
Historic England	LIST ENTRY NUMBER:	1064241	Contact: Elizabeth Whitbourn 07889 808145

©⊦



	SITE NAME:	Chapel House, 497, Blackfen Road, Sidcup	An eye-catcher as part of the layout of Danson Park, circa 1761 and attributed to Lancelot 'Capability' Brown. The
	DESIGNATION:	Listed Building grade II	Chapel House is now separated from the park by the A2 trunk road and modern houses. The owner continues to
	CONDITION:	Fair	maintain the building and carried out vegetation clearance in 2017 and is discussing render repairs with the Local
	OCCUPANCY:	Vacant/not in use	Authority. The permission for a larger redevelopment
	PRIORITY CATEGORY:	E (E)	scheme has expired and there are no immediate plans to bring the building back into use.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1064248	Contact: Alex Csicsek (LPA) 020 3045 3317

© Historic England



© London Borough of Brent

	SITE NAME:	Former Savoy Cinema, Burnt Oak Broadway, Edgware	The Savoy Cinema was built for the independent circuit Goide & Glassman and was designed by cinema architect
	DESIGNATION:	Listed Building grade II	George Coles. It opened on 29th June 1936 with Bobby Breen in "Rainbow on the River". It is an impressive cinema
	CONDITION:	Poor	with all of its internal Moderne fittings intact. It operated as a bingo hall from the 1960s but closed in 2014. Despite
	OCCUPANCY:	Vacant/not in use	several attempts to sell, occupy and find a new use for the
	PRIORITY CATEGORY:	C (New entry)	building it remains empty and in a declining state with crumbling plasterwork.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1384932	Contact: Mark Price (LPA) 0208 937 5236

	SITE NAME:	Cambridge Hall, Cambridge Avenue, Kilburn NW6	Built in 1863 as St James's Episcopal Chapel. It is a prefabricated structure of corrugated iron with boarded
	DESIGNATION:	Listed Building grade II, CA	roof covered in corrugated asbestos. Since 1920 it has been the home of the Willesden & St Marylebone Cadet
-	CONDITION:	Poor	Corps which converted the interior to resemble a boat, in itself of historic interest. Planning Permission and Listed
	OCCUPANCY:	Part occupied/part in use	Building Consent were granted in 2016 for an adjacent
	PRIORITY CATEGORY:	C (C)	residential building, as well as some repair works to Cambridge Hall. Discussions are underway about
	OWNER TYPE:	Other not for profit group	restoration and funding sources.
	LIST ENTRY NUMBER:	1271962	Contact: Mark Price (LPA) 0208 937 5236

© Historic England



SITE NAME:	Old Oxgate Farm, Coles Green Road, Cricklewood NW2	C16 and C17 timber-framed building suffering from subsidence to the brick plinth and structural failure of beam
DESIGNATION:	Listed Building grade II*	ends to the ground floor due to damp penetration. The owner carried out urgent works in 2013 and is explorir
CONDITION:	Poor	possible long term solutions. A condition assessment was produced in 2016, with funding from Historic England, and
OCCUPANCY:	Part occupied/part in use	priority works identified in that survey to safeguard the
PRIORITY CATEGORY:	A (A)	building were completed in 2017. Funding for repair of the front facade is due to be secured through a Section 106
OWNER TYPE:	Private	agreement but this has not yet been implemented.
LIST ENTRY NUMBER:	1078875	Contact: Elizabeth Whitbourn 07889 808145

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	Summerhouse, Kingsbury Manor, 288, Kingsbury Road	Summerhouse, circa 1899, by William West Neve, who designed the adjoining Kingsbury Manor for Mary Blair, Duchess of Sutherland. Built in the Arts and Crafts style, timber-framed with patterned brick nogging on a brick
	DESIGNATION:	Listed Building grade II	
	CONDITION:	Poor	plinth edged with stone, and a hipped thatched roof. The thatched roof is deteriorating and the building is in need of
	OCCUPANCY:	N/A	repair. The Local Authority and the owner have begun
A REAL PROPERTY AND A REAL	PRIORITY CATEGORY:	C (New entry)	discussions to develop a strategy for the summerhouse repair and re-use.
	OWNER TYPE:	Charity (non-heritage)	
ondon Borough of Brent	LIST ENTRY NUMBER:	1322049	Contact: Mark Price (LPA) 020 8937 5236

	SITE NAME:	Wembley Hill Lodge, 114, Wembley Hill Road, Brent HA9	Early C19 orné style cottage which was formerly a lodge to Wembley Park. Single storey and attic with gable to the
	DESIGNATION:	Listed Building grade II	front. Featuring twin chimneys and thatched catslide roof. The detached property was severely damaged by a fire in
	CONDITION:	Very bad	2013 and the owner is intending to sell the building.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
oric England	LIST ENTRY NUMBER:	1359001	Contact: Mark Price (LPA) 0208 937 5236

© Lon

© Histor

Mid-C19 twin Anglican and nonconformist chapels SITE NAME: The Chapels at Paddington connected by a pair of carriage-porches and a central bell Cemetery, Willesden Lane tower behind which is a lodge. Designed by Thomas Little Listed Building grade II, RPG in 1855 as part of a new cemetery. The vacant buildings are DESIGNATION: grade II, CA isolated within the cemetery and too dangerous to use. Funding for repairs and a long term solution are being CONDITION: Very bad sought. OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: A (C) OWNER TYPE: Local authority LIST ENTRY NUMBER: 1359002 Contact: Mark Price (LPA) 0208 937 5236

SITE NAME:	Church of St Andrew, High Road, Willesden Green NW10	Designed by James Brooks and built in 1885 in red brick with stone dressings and steeply pitched slated roofs.
DESIGNATION:	Listed Place of Worship grade II*, CA	There is a small bell turret with a slate clad fleche over the crossing. Brooks also designed the adjacent grade II vicarage. The church suffers from cracking, some severe,
CONDITION:	Poor	mainly at the eastern end. Potentially loose stones internally have been pinned to secure them and the church
PRIORITY CATEGORY:	C (New entry)	is undergoing monitoring and various investigations in orde
OWNER TYPE:	Religious organisation	to ascertain the cause of movement which is resulting in the cracking.
LIST ENTRY NUMBER:	1078881	Contact: Tracey Craig 020 7973 3756
	DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Road, Willesden Green ŇW10 DESIGNATION: Listed Place of Worship grade II*, CA CONDITION: Poor PRIORITY CATEGORY: C (New entry) OWNER TYPE: Religious organisation

© Historic England

© Historic England

BROMLEY

© Historic England



D

Е

SITE NAME:	Victorian Folly of 'Medieval Ruins' in Bromley Palace Park, Rafford Way	Folly wi and by There is
DESIGNATION:	Listed Building grade II	engulfin stonew
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY CATEGORY:	C (New entry)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1186785	Contac
PRIORITY CATEGORY: OWNER TYPE:	C (New entry) Local authority	Contac

vith Norman style detailing, probably of mid-1860s the important firm of garden contractors, Pulham. is significant ivy and other woody vegetation ng the structure and seriously damaging the vork and lime render.

ct: Kevin Munnelly (LPA) 020 8313 4582

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / BROMLEY

HERITAGE AT RISK 2018 / LONDO	ON / BROMLEY		
	SITE NAME:	Crystal Palace Park SE19	Mid-C19 pleasure grounds designed by Sir Joseph Paxton
	DESIGNATION:	Registered Park and Garden grade II*, 9 LBs, part in CA	as a setting for the Crystal Palace, burnt down in 1936. The park is in variable condition with related listed structures also at risk. Improvement projects funded by the Mayor of
<u> </u>	CONDITION:	Generally satisfactory but with significant localised problems	London and the Local Authority continue, including a new café and ongoing conservation work to the dinosaurs. The Local Authority continues development of a regeneration
· · · ·	VULNERABILITY:	Medium	plan for the park to realise the vision of the 2011
and a provide the second	TREND:	Improving	masterplan, and a new sustainable governance and management model.
	NEW ENTRY?:	No	C .
© Historic England	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1000373	Contact: Christopher Laine 07780 545 979
		.	
bearing the	SITE NAME:	Pedestrian subway under Crystal Palace Parade, Crystal Palace SE19	Pedestrian subway, circa 1854, that once provided access from the now-demolished Crystal Palace High Level Station directly into the Palace. It has a fan-vaulted roof, with
	DESIGNATION:	Listed Building grade II*, part in RPG grade II*	roundels between fans in red and cream brick with diaper patterning. A condition survey and investigative works have been carried out, grant-aided by Historic England. Repairs
	CONDITION:	Poor	to one terrace are planned imminently. Discussions are ongoing to secure full repair as part of the park's wider
	OCCUPANCY:	N/A	regeneration plan.
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1385457	Contact: Verena McCaig 020 7973 3718
	SITE NAME:	North and south railings, Crystal Palace Parade, Crystal Palace Park SE19	Decorative cast iron railings on gault brick plinths with stone copings, which formed the main pedestrian entrance to the Crystal Palace (demolished following a major fire in
	DESIGNATION:	Listed Building grade II, RPG grade II*	1936) from Crystal Palace Parade. There is damage to some cast iron panels and the dwarf wall, and a long section of curved railing is missing from the north section.
	CONDITION:	Poor	A condition survey of the railings was completed in 2015, with funding from Historic England. Discussions are
Carlos A	OCCUPANCY:	N/A	ongoing to secure their full repair as part of the park's
	PRIORITY CATEGORY:	C (C)	wider regeneration plan.
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1393659	Contact: Kevin Munnelly (LPA) 020 8313 4582
	SITE NAME:	Upper and Lower Terraces, Crystal Palace Park SE19	Terraces designed by Sir Joseph Paxton and situated to the east of the site of Crystal Palace (re-erected here in 1852-4
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	and burnt down in 1936), on the west of Crystal Palace Park. The terraces are in a very poor condition and suffering from erosion. Repair and conservation works
	CONDITION:	Poor	have been completed on the six sphinxes which adorn them, funded by the Local Authority, the Mayor of London,
A REAL	OCCUPANCY:	N/A	and Historic England. Discussions are ongoing to determine
THE REAL PROPERTY OF A CARDING OF A CARDINGO	PRIORITY CATEGORY:	C (C)	an approach to further conservation works as part of the wider strategic regeneration plan for the park.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1064352	Contact: Kevin Munnelly (LPA) 020 8313 4582

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / BROMLEY

調

© Histori

1	SITE NAME:	Downe Court Manor, Cudham Road, Downe	Modest red brick house of 1690. The building has been vacant and showed the effects of long term neglect. Roof
A	DESIGNATION:	Listed Building grade II	and joinery repairs have been undertaken to arrest the decline of the building. Attempts are being made by
	CONDITION:	Poor	Historic England to contact the owner to reassess the condition of the building.
	OCCUPANCY:	Unknown	condition of the building.
	PRIORITY CATEGORY:	C (C)	
The second second	OWNER TYPE:	Private	
ric England	LIST ENTRY NUMBER:	1064357	Contact: Kevin Munnelly (LPA) 020 8313 4582

TEMORA	SITE NAME:	Frontage building to Richard Klinger Factory, Edgington Way, Sidcup	Offices, cutting shop, tool room and storage factory. Completed in 1937 to the designs of Wallis Gilbert and Partners for Richard Klinger Ltd, founded in Austria in
	DESIGNATION:	Listed Building grade II	1893. The building has been vacant for many years. The Crittal window frames are intact, but the interior is
	CONDITION:	Very bad	dilapidated. Planning Permission and Listed Building Consent have been granted for conversion of the building
	OCCUPANCY:	Vacant/not in use	for storage and light industrial uses, and works are
	PRIORITY CATEGORY:	F (D)	underway.
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1387704	Contact: Kevin Munnelly (LPA) 020 8313 4582

	SITE NAME:	91, High Street, St Mary Cray	C16 dwelling with crown post roof. The building is in a very
	DESIGNATION:	Listed Building grade II, CA	poor condition and a flank wall is at risk of collapse. Listed building Consent has been granted for repairs to the
	CONDITION:	Very bad	ground floor and structure, and applications for Planning Permission and Listed Building Consent have been approved for works in connection with the conversion of
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	B (B)	the house to residential use.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1298993	Contact: Kevin Munnelly (LPA) 020 8313 4582
© Historic England			

	SITE NAME:	The Royal Bell Hotel, 173-177, High Street, Bromley	This range of buildings was rebuilt in 1898 on the site of an earlier hostelry of 1666. The Royal Bell Hotel has been
88888	DESIGNATION:	Listed Building grade II, CA	vacant for some years and is in need of repair to halt its decline. Discussions are ongoing regarding its future re-use
	CONDITION:	Poor	following a recent change of owner.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
A Martin A Martin A Martin State	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1054095	Contact: Kevin Munnelly (LPA) 020 8313 4582



	LIST ENTRY NUMBER:	1054095	Contact: Kevin Munnelly (LPA) 020 8313 4582
	SITE NAME:	Buildings I-5 (Airmen's barrack blocks), West Camp, Main Road, A233 (east side), Biggin Hill	Group of five airmen's barracks blocks, dating from 1930. The buildings have been vacant since the RAF withdrew from Biggin Hill in 1993. Urgent repairs are required to roofs and rainwater goods. There are no current plans for
	DESIGNATION:	Listed Building grade II, CA	re-use of the buildings.
	CONDITION:	Poor	
A	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1391589	Contact: Kevin Munnelly (LPA) 020 8313 4582

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

use).

D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- 7

HERITAGE AT RISK 2018 / LONDON / BROMLEY

	SITE NAME:	Building 12 (Candidates' Club, Former Sergeants' Mess), West Camp, Main Road, A233 (east side), Biggin Hill	Sergeants' mess, dating from 1932, built by the Air Ministry's Directorate of Works and Buildings. The building has been vacant since the RAF withdrew from Biggin Hill in 1993. There are no current plans for its re-use.
	DESIGNATION:	Listed Building grade II, CA	
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
Carl Martin Contractor	PRIORITY CATEGORY:	С (С)	
London Borough of Bromley	OWNER TYPE:	Commercial company	
с <i>,</i>	LIST ENTRY NUMBER:	1391606	Contact: Kevin Munnelly (LPA) 020 8313 4582
	SITE NAME:	Building 15, Hawkinge Block, West Camp, Main Road, A233 (east side), Biggin Hill	Barrack block dated 1934, built by the Air Ministry's Directorate of Works and Buildings. The building has beer vacant since the RAF withdrew from Biggin Hill in 1993.
YESSA	DESIGNATION:	Listed Building grade II, CA	There are no current plans for its re-use.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
Sec. Portage States	OWNER TYPE:	Commercial company	
Historic England	LIST ENTRY NUMBER:	1391604	Contact: Kevin Munnelly (LPA) 020 8313 4582
			, (,
	SITE NAME:	Building 33 (Station HQ), West Camp, Main Road, A233 (east side), Biggin Hill	Office block dated 1931, formerly the station headquarter building. The building has been vacant since the RAF withdrew from Biggin Hill in 1993. There are no current
	DESIGNATION:	Listed Building grade II, CA	plans for its re-use.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
A CANADA TO THE MILLION OF THE OWNER	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
London Borough of Bromley	LIST ENTRY NUMBER:	1391587	Contact: Kevin Munnelly (LPA) 020 8313 4582
	SITE NAME:	lce house to Sundridge Park, Plaistow Lane, Bromley	Ice house circa 1800, in the south west corner of a late C18 landscape park designed by Humphry Repton, now a
	DESIGNATION:	Listed Building grade II, RPG grade II	golf course. The ice house has previously been subject to vandalism despite strenuous efforts by the owners to prevent access. Scrub now obscures its location and
	CONDITION:	Very bad	Historic England is working with a local archaeological
	OCCUPANCY:	N/A	group and the site manager to reassess its condition and current management issues.
	PRIORITY CATEGORY:	A (A)	_
	OWNER TYPE:	Commercial company	
Historic England	LIST ENTRY NUMBER:	1254001	Contact: Kevin Munnelly (LPA) 020 8313 4582
	SITE NAME:	lce house to Old Palace, Stockwell Close, Bromley Palace Park	Ice house to Bromley Old Palace. Probably dating from the late C18, and remodelled in the early C19 as a garden shelter. It was possibly used as a stopping-off point when
	DESIGNATION:	Listed Building grade II	guests at the Old Palace were taken for a perambulation o the grounds. Considerable repairs have been undertaken,
And the second second	CONDITION:	Poor	along with vegetation clearance, but further substantial
	OCCUPANCY:	N/A	works are required to the roof above the chamber itself. Historic England, the Local Authority, and Friends of
	PRIORITY CATEGORY:	C (D)	Bromley Town Parks & Gardens are in early discussions to
	OWNER TYPE:	Local authority	develop a suitable project to secure the necessary conservation works.
A State of the second s			
Historic England	LIST ENTRY NUMBER:	1281268	Contact: Kevin Munnelly (LPA) 020 8313 4582

- A infinediate risk of further rapid deterioration or loss of fabric; no solution agreed.
 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
 C Slow decay; no solution agreed.
 D Slow decay; solution agreed but not yet implemented.
 C Slow decay; no solution agreed.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but not yet implemented. use).
- (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- Last year's priority category is shown in brackets (otherwise, New Entry is noted).

 - LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Pulhamite fernery, Stockwell Close, Bromley Palace Park	Pulhamite rockwork garden feature constructed circa 1865 as part of the improvements to the gardens of Bromley
	DESIGNATION:	Listed Building grade II	Palace that had been acquired by Coles Child, a wealthy coal merchant. The fernery is at the northern end of the
	CONDITION:	Poor	ornamental lake and is in need of repair. Historic England, the Local Authority, and Friends of Bromley Town Parks &
	OCCUPANCY:	N/A	Gardens are in early discussions to develop a suitable
	PRIORITY CATEGORY:	C (C)	project to secure the necessary conservation works.
	OWNER TYPE:	Local authority	
oric England	LIST ENTRY NUMBER:	1392584	Contact: Kevin Munnelly (LPA) 020 8313 4582

Old Town Hall, Tweedy Road,

Listed Building grade II, CA

Vacant/not in use

Bromley

1186832

Fair



© Histori

CARR N	SITE NAME:	Pulhamite waterfall, Stockwell Close, Bromley Palace Park	Pulhamite rockwork garden feature constructed circa 1865 as part of the improvements to the gardens of Bromley
	DESIGNATION:	Listed Building grade II	Palace that had been acquired by Coles Child, a wealthy coal merchant. The waterfall is at the southern end,
	CONDITION:	Poor	adjacent to a probably late C18 ice house, and is in need of repair. Vegetation clearance has taken place but structural
	OCCUPANCY:	N/A	works are needed. Historic England, the Local Authority,
101	PRIORITY CATEGORY:	C (C)	and Friends of Bromley Town Parks and Gardens are in early discussions to develop a suitable project to secure the
	OWNER TYPE:	Local authority	necessary conservation works.
	LIST ENTRY NUMBER:	1392583	Contact: Kevin Munnelly (LPA) 020 8313 4582

Former Town Hall building built in 1906 and used as

Implementation of a consented scheme for the conversion

of the building into a hotel has been halted. There are no

premises for Bromley College until 2006/07.

current plans for the re-use of the building.

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

LIST ENTRY NUMBER:

© Historic England

© Historic England

a		
	5	

PRIORITY CATEGORY:	C (D)			
OWNER TYPE:	Local authority			
LIST ENTRY NUMBER:	1299012	Contact: Kevin Munnelly (LPA) 020 8313 4582		
SITE NAME:	Church of St John the Evangelist, High Street, Penge SE20	The church was designed by John Nash and Edwin Nash of Bermondsey in the Early English style and completed in 1849. It is built of ragstone with Bath stone dressings,		
DESIGNATION:	Listed Place of Worship grade II, CA	including the spire. The church is suffering from water ingress at roof and lower levels, and dampness at lower levels. High level repairs to the east end were completed in		
CONDITION:	Poor	2013, grant-aided by Historic England and the Heritage Lottery Fund. Further repairs are required to the west end.		
PRIORITY CATEGORY:	C (C)	Discussions are ongoing between Historic England and the		
OWNER TYPE:	Religious organisation	church regarding a development scheme, which is expected to include these repairs.		

© Historic England

SITE NAME:	Iron Age settlement and Roman villa at Warbank, K	eston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002024
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Scadbury Manor moated site and fishponds		
SITE NAME: DESIGNATION:	Scadbury Manor moated site and fishponds Scheduled Monument, CA	LIST ENTRY NUMBER:	1409786
		LIST ENTRY NUMBER: TREND:	1409786 Declining
DESIGNATION:	Scheduled Monument, CA		

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

D

Е

use).

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: lan Harper 020 7973 3786

ABBREVIATIONS

CA LB

Conservation Area Listed Building Local Planning Authority National Park

- LPA NP RPG SM
 - Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / BROMLEY / CAMDEN

SITE NAME:	Romano-British masonry building and Saxon cemetery, Fordcroft, Orpington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001973
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Local authority, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Biggin Hill RAF		
DESIGNATION:	Conservation Area, 14 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Kevin Munnelly (LPA) 020 8313 4582

CAMDEN



1	SITE NAME:	Cattle trough to south east of the Roundhouse, Chalk Farm Road NWI	Late C19 granite cattle trough. Placed by the Metropolitan Cattle Trough and Drinking Fountain Association in memory of the Christian Socialist Charles Kingsley. Some
	DESIGNATION:	Listed Building grade II, CA	repairs have been carried out but investigation into the security of the trough on the plinth is required. It is
-	CONDITION:	Fair	vulnerable given its location adjacent to the bus lane and bus stop.
	OCCUPANCY:	N/A	<i>bus stop.</i>
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1258104	Contact: Alan Wito (LPA) 020 7974 6392

© Historic England

© Historic England



	LIST ENTRY NOT DER	1230104	Contact. Aian Wito (LFA) 0207374 6332
	SITE NAME:	Drinking fountain set in wall next to the Roundhouse, Chalk Farm Road NWI	Late C19 Gothic style drinking fountain presented by the Metropolitan Cattle Trough and Drinking Fountain Association. Cleaning has been carried out, but the drinking
	DESIGNATION:	Listed Building grade II, CA	fountain remains prone to littering and damage. Options for repair are being explored with the relevant partner
-	CONDITION:	Fair	organisations.
N. N.	OCCUPANCY:	N/A	
a lan	PRIORITY CATEGORY:	C (C)	
-	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1258105	Contact: Alan Wito (LPA) 020 7974 6392



	SITE NAME:	Former Strand Union Workhouse (Middlesex Hospital Annex), 44, Cleveland Street WI	Former Strand Union Workhouse, dating from 1778, with an austere symmetrical brick building facing Cleveland Street behind later high brick walls. Vacated by University College London Hospital and in temporary occupation by
	DESIGNATION:	Listed Building grade II, CA	live-in guardians and site staff in the adjoining unlisted buildings. The buildings are weathertight and secure.
	CONDITION:	Fair	Applications for refurbishment and alterations to provide residential accommodation and mixed-use development to
	OCCUPANCY:	Part occupied/part in use	the rear of the listed building have been approved and
	PRIORITY CATEGORY:	F (C)	work has started on site.
	OWNER TYPE:	Health authority	
	LIST ENTRY NUMBER:	1242917	Contact: Alan Wito (LPA) 020 7974 6392

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	26, Denmark Street WC2	Early C18 terraced house; windows altered in the C20.
	DESIGNATION:	Listed Building grade II, CA	The windows, parapets and gutters are in poor condition. Listed Building Consent and Planning Permission have been
	CONDITION:	Poor	granted as part of a wider scheme which includes residential use on the upper floors and repairs to the roof
	OCCUPANCY:	Vacant/not in use	and front parapet. Work has started and initial
	PRIORITY CATEGORY:	F (F)	investigations within the main building have revealed structural issues. The building has been propped to allow
	OWNER TYPE:	Private	for further investigations and a final proposal for remedial works.
	LIST ENTRY NUMBER:	1271982	Contact: Alan Wito (LPA) 020 7974 6392

© Historic England

SIT	SITE NAME:	3, Endsleigh Street	One in a terrace of four houses, dating from circa 1825,
Terrar I	DESIGNATION:	Listed Building grade II, CA	built by Thomas Cubitt and constructed from multi- coloured stock brick. It comprises four storeys and a
Ħ	CONDITION: Poor	basement with a round-arched doorway and first floor casements with continuous cast iron balconies. The	
OCCUPANCY: Vacant/not in use	Vacant/not in use	property is empty and whilst externally it is in fair condition	
	PRIORITY CATEGORY:	C (New entry)	there have been unauthorised works internally. The Local Authority has contacted the owner to discuss the building's
	OWNER TYPE:	Private	condition.
12 Mar	LIST ENTRY NUMBER:	1078298	Contact: Alan Wito (LPA) 020 7974 6392

© London Borough of Camden

	SITE NAME:	The Elms (formerly Elm Lodge), Fitzroy Park N6	Detached house built between 1838 and 1840 to the design of George Basevi. A listed building enforcement
	DESIGNATION:	Listed Building grade II, CA	notice was served in 2012 following unauthorised works during refurbishment. Planning Permission and Listed
	CONDITION:	Good	Building Consent have been granted to rectify these unauthorised works, but have not yet been implemented.
	OCCUPANCY:	Vacant/not in use	The building is wind and watertight.
	PRIORITY CATEGORY:	D (D)	
THE PARTY OF	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1078355	Contact: Alan Wito (LPA) 020 7974 6392

	SITE NAME:	43, Fitzroy Street	One of a terrace of four houses, dating from the late C18, constructed from darkened multi-coloured stock brick with
	DESIGNATION:	Listed Building grade II, CA	some stucco dressings. It comprises four storeys and a
	CONDITION:	Poor	basement. The property is partially occupied and in a deteriorating condition. The Local Authority has contacted
	OCCUPANCY:	Part occupied/part in use	the owner to discuss the building's condition.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1322184	Contact: Alan Wito (LPA) 020 7974 6392

© Historic England

	SITE NAME:	34 and 39, Great James Street	Two in a terrace of 14 houses, dating from 1720-24, all of
	DESIGNATION:	Listed Building grade II*, CA	four storeys with basements and constructed from brown brick. Both properties are currently empty. Listed Building
	CONDITION:	Poor	Consent and Planning Permission were granted in 2011 for refurbishment and a rear extension at 39 Great James
	OCCUPANCY:	Vacant/not in use	Street, however the consented scheme has not been
	PRIORITY CATEGORY:	C (C)	implemented and no repairs have been undertaken. The Local Authority is currently discussing the condition of 34
	OWNER TYPE:	Commercial company, multiple owners	Great James Street with the owner.
Historic England	LIST ENTRY NUMBER:	1113203	Contact: Elizabeth Whitbourn 07889 808145

© Historic England

WNER TYPE:	Commercial company, multiple owners	Great James Street with the o
T ENTRY NUMBER:	1113203	Contact: Elizabeth Whitbourn

PRIORITY CATEGORIES


- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

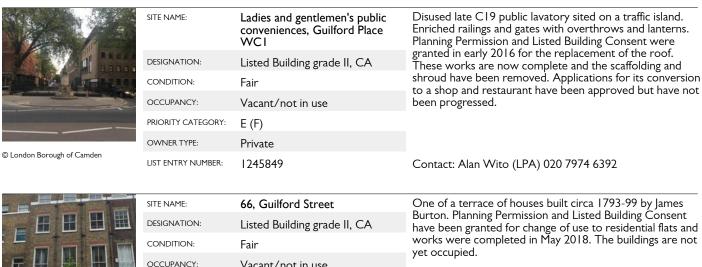

© Historic England

© Historic England

			One of a tarman of house huilt since 1702 00 huilance
	LIST ENTRY NUMBER:	1245858	Contact: Alan Wito (LPA) 020 7974 6392
	OWNER TYPE:	Commercial company	
	PRIORITY CATEGORY:	E (F)	
	OCCUPANCY:	Vacant/not in use	
	CONDITION:	Fair	yet occupied.

The loss P	SITE NAME:	67, Guilford Street WCI	One of a terrace of houses built circa 1793-99 by James
	DESIGNATION:	Listed Building grade II, CA	Burton. Planning Permission and Listed Building Consent have been granted for change of use to residential flats and
	CONDITION:	Fair	works were completed in May 2018. The buildings are not yet occupied.
	OCCUPANCY:	Vacant/not in use	jet occupied.
EEE	PRIORITY CATEGORY:	E (F)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1245860	Contact: Alan Wito (LPA) 020 7974 6392

Drinking fountain likely to date from the 1880s. SITE NAME: Drinking fountain in St James Constructed from cast iron, the design closely resembles a Gardens, Hampstead Road NWI pattern illustrated in Macfarlane's catalogue of circa 1880. The fountain has been temporarily removed from its plinth DESIGNATION: Listed Building grade II due to fire damage, and is being stored by the Local Authority with a view to its future repair. When repaired a CONDITION: Very bad new location may need to be found as St James Gardens is likely to be redeveloped as part of the HS2 development at OCCUPANCY: N/A Euston Station. PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority © London Borough of Camden LIST ENTRY NUMBER: 1378714 Contact: Alan Wito (LPA) 020 7974 6392

	SITE NAME:	Four sculptures surrounding pond in Italianate Garden, Witanhurst, Highgate West Hill N6	Four carved figures, circa 1913, probably part of Harold Peto's design for Sir Arthur Crosfield's garden. The original sculptures are missing from the completed scheme.
and the second	DESIGNATION:	Listed Building grade II, CA	
	CONDITION:	Poor	
1.40000	OCCUPANCY:	N/A	
Carlos -	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1379028	Contact: Alan Wito (LPA) 020 7974 6392

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

ΪA

WHS

- Conservation Area Listed Building
- LB LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
 - - Unitary Authority World Heritage Site

	SITE NAME:	Railings and bollards to terraced paths, Holly Hill	C19 railings and bollards to terraced paths. Cast iron standards and rail with terminal bollards of cannot type
	DESIGNATION:	Listed Building grade II, CA	inscribed "St. Johns/Hampstead/B. Griffin and J. Kelly Surveyors 1828". Sections of the ironwork are missing or in
and	CONDITION:	Poor	a poor state of repair.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1379076	Contact: Alan Wito (LPA) 020 7974 6392

	SITE NAME:	College Chapel, Kings College, Kidderpore Avenue	Former Kings College chapel built 1928-9 by Percy Morley Horder and Verner Rees. Rendered brickwork with a
	DESIGNATION:	Listed Building grade II, CA	stone portico. Shallow hipped roof with projecting eaves. Austere and restrained classical design and rectangular in
	CONDITION:	Poor	plan with a semi-circular apse internally. Planning Permission and Listed Building Consent have been granted
	OCCUPANCY:	Vacant/not in use	for the wider site. As part of this scheme the chapel will be
Martin Martin Bart Bart	PRIORITY CATEGORY:	F (F)	converted to residential use and works are in progress.
The second second	OWNER TYPE:	Educational (independent)	
© Historic England	LIST ENTRY NUMBER:	1379249	Contact: Alan Wito (LPA) 020 7974 6392

The Summerhouse, Kings

College, Kidderpore Avenue

Listed Building grade II, CA

Educational (independent)

Poor

N/A

F (F)

1379253



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England

© Hist

storic England		1377233	
S	SITE NAME:	Drinking Fountain on north west corner, Lincoln's Inn Fields	Stone gabled drinking fountain with a semi-circular basin on a half pedestal. Erected in 1861, restored circa 1992, and
	DESIGNATION:	Listed Building grade II, RPG grade II, CA	inscribed "The Fear of the Lord is a Fountain of Life". An early public drinking fountain erected at the time when the St Giles's parish wells were polluted and when Lincoln's Inn
	CONDITION:	Poor	Fields was being restored and renovated. The fountain is not functioning and has a plaque and rear maintenance
4	OCCUPANCY:	N/A	panel missing. The Local Authority is working towards a
	PRIORITY CATEGORY:	C (New entry)	repair scheme.
- Transfer	OWNER TYPE:	Local authority	
storic England	LIST ENTRY NUMBER:	1379337	Contact: Alan Wito (LPA) 020 7974 6392

	SITE NAME:	Heath House, North End Way NW3	Substantial early C18 double-fronted detached house, with C19 extensions. Much of the house was rebuilt following
	DESIGNATION:	Listed Building grade II*, CA	war damage. The building has suffered prolonged water penetration and most interior fittings and detailings have
	CONDITION:	Poor	been removed. The monoflex wrapping and temporary roof have been removed and the Local Authority is in
1	OCCUPANCY:	Vacant/not in use	discussion with the owner about their replacement in
	PRIORITY CATEGORY:	A (C)	order to ensure the building is wind and weathertight. A planning application has been submitted to convert the
0	OWNER TYPE:	Commercial company	building to a single family dwelling.
	LIST ENTRY NUMBER:	3 83	Contact: Elizabeth Whitbourn 07889 808145

© London Borough of Camden

BER:	3 83	

Disused mid-C19 summerhouse. Timber with concrete

columns in a classical style, painted white with a Doric

portico and broken pediment. Planning Permission and

temporarily removed for conservation before being

reinstated on site for community use.

Contact: Alan Wito (LPA) 020 7974 6392

Listed Building Consent have been granted for the wider site. As part of this scheme the summerhouse has been

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; в solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

use).

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

A	SITE NAME:	St Stephen's Church, Rosslyn Hill NW3	Church built 1869-71 to the design of SS Teulon, in an early French Gothic style. The London Diocesan Fund has
	DESIGNATION:	Listed Building grade I, CA	leased the church to St Stephen's Restoration and Preservation Trust for use by Hampstead Hill School and
	CONDITION:	Fair	as a community lifelong learning centre. Repair works to the south slope of the nave roof, grant-aided by Historic
	OCCUPANCY:	Occupied/in use	England, were completed in March 2016. Further repail are needed to the other roofs and the tower.
	PRIORITY CATEGORY:	C (C)	are needed to the other roots and the tower.
	OWNER TYPE:	Charity (heritage)	
e	LIST ENTRY NUMBER:	1130394	Contact: Ian Harper 020 7973 3786



© Historic England Archive

SITE NAME:	Section of boundary wall to St Stephen's Church, Rosslyn Hill NW3	Brick and stone boundary wall along Hampstead Green, dating from 1869. Repairs are complete to the wall and piers by entrances, but other areas on Rosslyn Hill and
DESIGNATION:	Listed Building grade II, CA	fronting Hampstead Green need repairs to the stone copings and repointing. The Local Authority has approved
CONDITION:	Poor	an application for further remedial works to part of the wall.
OCCUPANCY:	N/A	van.
PRIORITY CATEGORY:	D (D)	
OWNER TYPE:	Charity (non-heritage)	
LIST ENTRY NUMBER:	1130395	Contact: Alan Wito (LPA) 020 7974 6392

Toll Gate House, Spaniards Road, Highgate NW3

Listed Building grade II, part in

Eastern coal drops at Kings Cross Goods Yard, York Way

Listed Building grade II, CA

CA

Good

E (E)

NI

Vacant/not in use

Local authority

1378793

Late C18 toll house, marking the spot where the road

entered the Bishop of London's estate. It stands at a traffic bottleneck on a busy road and has suffered impact damage

from heavy vehicles. A bollard was erected in late 2008 to

Coal drops built in 1851-2, probably to the design of Lewis Cubitt, to carry high level track for the transport of coal

into storage bins. Part of a system of distributing coal from

the North East and Yorkshire to the London market.

Planning Permission and Listed Building Consent were granted in 2015 for a retail conversion. Works have

provide protection from traffic. Roof and guttering repair works have been undertaken and the property is now in

good condition, but remains unoccupied.

Contact: Alan Wito (LPA) 020 7974 6392



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England

© Historic England



© Historic England Archive



	CONDITION:	Poor	granted in 2015 for a retail conversion. Works have commenced on site and the buildings are due to open in
	OCCUPANCY:	Vacant/not in use	autumn 2018.
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1379214	Contact: Alan Wito (LPA) 020 7974 6392
	SITE NAME:	St George's Cathedral (formerly Christ Church), Albany Street, Camden Town NWI	Former parish church. Antiochian Orthodox Cathedral since 1989. Designed by Sir James Pennethorne, built in 1837 in neo-Grecian style to serve Nash's development
	DESIGNATION:	Listed Place of Worship grade II*, CA	east of Regents Park, with later alterations. Grey stock brick with Roman cement and stone dressings. The Roman cement mouldings and past repairs in cementitious mortar
	CONDITION:	Poor	are failing in places. Cracking is evident, particularly on the principal street elevations.
	PRIORITY CATEGORY:	A (A)	principal su eet elevations.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1378620	Contact: Tracey Craig 020 7973 3756

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building CA

- LB I PA
 - Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- ŬA

Unitary Authority World Heritage Site WHS

	SITE NAME:	Church of St Michael, Camden Road, Camden Town NWI	The nave and aisles were built in 1881 designed by GF Bodley and T Garner, the chancel was added in 1894 and
10	DESIGNATION:	Listed Place of Worship grade II*	the vestries in 1908. Bodley's altar, reredos, stone chapel vaulting and screen survive. The church has undergone
	CONDITION:	Poor	structural and stonework repair, re-roofing and drainage works. New electrical and lighting installations were
	PRIORITY CATEGORY:	C (C)	completed in early 2016 grant-aided by the Heritage
	OWNER TYPE:	Religious organisation	Lottery Fund. The interior fabric and heating remain in need of attention.
4 - 8 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1	LIST ENTRY NUMBER:	1244156	Contact: Tracey Craig 020 7973 3756

© Historic England

veland	SITE NAME:	Church of the Holy Trinity with St Barnabas, Clarence Way NW I	Built in 1849-50 in a C14 Gothic style to the design of Thomas H Wyatt and David Brandon. The building was bomb damaged during World War II. The tower roof was
	DESIGNATION:	Listed Place of Worship grade II	re-covered and the roofs re-slated with a grant from the Heritage Lottery Fund and Historic England. The church
	CONDITION:	Poor	was awarded a subsequent grant from the Heritage Lo Fund for repairs to the tower stonework and this was
	PRIORITY CATEGORY:	C (C)	completed in summer 2015. The western end of the south
	OWNER TYPE:	Religious organisation	aisle has suffered from structural movement and in part there is shoring in place externally and scaffolding internally
	LIST ENTRY NUMBER:	1356761	Contact: Tracey Craig 020 7973 3756
ngiang			

Church of the Holy Cross,

WCI

CA

Cromer Street, Camden Town

Listed Place of Worship grade II,

© Historic Engl



SITE NAME

DESIGNATION:

SITE NAME:

© Historic England



			gallery. There is settlement of the foundations at the north
	CONDITION:	Very bad	east corner causing structural cracking to the vestry and associated walls of the church itself. Other repairs are
	PRIORITY CATEGORY:	A (A)	needed to the east end roofing, north side guttering and
	OWNER TYPE:	Religious organisation	brickwork. The congregation is actively exploring possible sources of funding.
	LIST ENTRY NUMBER:	1067375	Contact: Ian Harper 020 7973 3786
	SITE NAME:	Church of St Mary the Virgin, Eversholt Street, Camden Town NWI	Built in 1824-7, designed by H and HW Inwood in Gothic style with the apse added in 1888 by Ewan Christian who also removed the side galleries. The church has slate
ò	DESIGNATION:	Listed Place of Worship grade II	pitched roofs and brick walling with stone dressings. There is a central tower at the west end. The roofs are in poor
h.	CONDITION:	Poor	condition along with the gutters, flashings and rainwater goods. Water staining is evident internally, along with
	PRIORITY CATEGORY:	C (C)	dampness at low level. Areas of the stone window
	OWNER TYPE:	Religious organisation	surrounds are decayed and there are some past cementitious repairs.
	LIST ENTRY NUMBER:	1342049	Contact: Tracey Craig 020 7973 3756

© Historic England



(formerly Church of St John), Highgate Road, Kentish Town NW5 DESIGNATION: Listed Place of Worship grade II CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation 1379013 LIST ENTRY NUMBER:

Christ Apostolic Church

Church built on the site of the Kentish Town Chapel of 1783 by James Wyatt, of which the nave walls and apse remain. The rest was rebuilt in 1843-45 by IH Hakewill. High level repairs to the west end, grant-aided by the Heritage Lottery Fund and Historic England, were completed in 2011. A chimney fell in a storm in December 2013 causing roof and internal damage. Works to repair the roof damage are complete. Further internal and external repairs are needed.

Church in the Early English style built in 1885 by Joseph

1913. Built of yellow stock brick under clay tiled roofs; stone dressings inside and out with red brick banding

inside. An unusual two storey narthex houses the organ

gallery. There is settlement of the foundations at the north

Peacock, with internal features by Charles Nicholson circa

Contact: lan Harper 020 7973 3786

© Historic England Archive

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ŬA
- Unitary Authority World Heritage Site WHS

	SITE NAME:	St Andrew's Cathedral (former Church of St Barnabas), Kentish Town Road, Hampstead NWI	This church was constructed in the style of a three-aisled basilica (without a dome) by Ewan Christian in 1884-85. It has been in use by the Greek Orthodox Church since 1957
Neder	DESIGNATION:	Listed Place of Worship grade II, CA	and became St Andrew's Cathedral in 1970. All internal walls and ceilings have been decorated in the traditional Byzantine style, and large areas have been repaired where
00 A C 28-0	CONDITION:	Poor	damaged by dampness. Externally the tabled guttering to the aisles and apse needs renewal.
	PRIORITY CATEGORY:	C (C)	the aisies and apselleeus renewal.
	OWNER TYPE:	Religious organisation	
Historic England	LIST ENTRY NUMBER:	1379241	Contact: Ian Harper 020 7973 3786



©Н


	SITE NAME:	Church of St Mary Magdalene, Munster Square, Camden Town NWI	The church, designed by RC Carpenter and completed in 1852, was described in the Ecclesiologist as the 'most artistically correct new church in London'. Even so, it was
	DESIGNATION:	Listed Place of Worship grade II*, CA	altered in 1866-67, and in 1883-84 the north aisle and crypt were added. Built of ragstone with Welsh slate roofs on Baltic fir collar-braced trusses. The interior is richly
	CONDITION:	Poor	decorated with marbles and frescoes. The condition of the frescoes is deteriorating as a result of damp caused by leaks
	PRIORITY CATEGORY:	A (A)	in the roof and defective rainwater goods. Externally there
	OWNER TYPE:	Religious organisation	is localised decay to the stonework.
	LIST ENTRY NUMBER:	1113157	Contact: Ian Harper 020 7973 3786



Church dating from the CI3 and enlarged in the mid-CI9 SITE NAME: St Pancras Old Church, Pancras by AD Gough and RL Roumieu, retaining C13 and C15 Road, Camden Town NWI fabric and wall memorials. Restored by AW Blomfield in Listed Place of Worship grade the late C19 and again by Erith and Terry in 1980. The DESIGNATION: II*, RPG grade II, CA church has cracks externally and internally, the contributing cause thought to be the deep and narrow C19 gully around CONDITION: Poor the building. This was addressed in 2015 with a grant from PRIORITY CATEGORY: the Heritage Lottery Fund. Works are now required to C (C) repair and repoint the stonework externally and to stabilise OWNER TYPE: Religious organisation the interior repairing cracks and blown plaster. LIST ENTRY NUMBER: 1113246 Contact: Tracey Craig 020 7973 3756

© Historic England

© Historic England

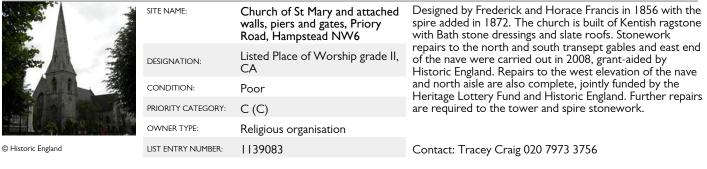



		1157005	
	SITE NAME:	Church of St Pancras, Upper Woburn Place, Camden Town NWI	Designed by H and HW Inwood, built in 1822 and restored in 1953. The earliest Greek Revival church in London. The west end has an lonic portico to a vestibule
	DESIGNATION:	Listed Place of Worship grade I, CA	with tower above. The north and south facades each have a tribune with a portico supported by four caryatids with a sarcophagus behind. Repairs to the west portico roof and
	CONDITION:	Poor	surrounding stone parapets were completed in early 2016, with funding from the Heritage Lottery Fund. The condition
	PRIORITY CATEGORY:	C (C)	of the tower and caryatids has been investigated and both
	OWNER TYPE:	Religious organisation	are in need of repair.
	LIST ENTRY NUMBER:	1379062	Contact: Tracey Craig 020 7973 3756

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ŬA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / CAMDEN / CITY OF LONDON

	SITE NAME:	Church of St Martin, Vicars Road, Gospel Oak, Camden NW5	Designed by Edward Buckton Lamb and built 1864-6. The choir vestry, added in 1928, is now subdivided to allow wider community use. Eclectic Gothic style with Kentish
	DESIGNATION:	Listed Place of Worship grade I	ragstone walls, Bath stone dressings and tiled roofs, with a fine interior. Repairs to the tower stonework and
	CONDITION:	Poor	restoration of the pinnacles were completed in 2014, grant-aided by the Heritage Lottery Fund. The church has a
	PRIORITY CATEGORY:	C (D)	history of subsidence and has been underpinned, but there
	OWNER TYPE:	Religious organisation	is more recent cracking to the choir vestry. The church is currently undergoing structural monitoring in order to
	LIST ENTRY NUMBER:	1379098	determine the scope of repairs.
			Contact: Tracey Craig 020 7973 3756

© Historic England

© Historic England

CITY OF LONDON

	A.	SITE NAME:	St Mary Somerset Tower, Upper Thames Street EC4	Redundant church tower built between 1686-94 by Wren. The body of the church was destroyed in 1871. Work is
	DESIGNATION:	Listed Building grade I	well underway to convert the building for residential use, including an extension to the north of the tower,	
	CONDITION:	Fair	installation of new windows and repairs to the stonework and louvres.	
		OCCUPANCY:	Vacant/not in use	
		PRIORITY CATEGORY:	F (F)	
	16 L	OWNER TYPE:	Local authority	
l		LIST ENTRY NUMBER:	1358904	Contact: Elizabeth Whitbourn 07889 808145



		1556701	
	SITE NAME:	Church of St Bride, Fleet Street, City of London EC4	This Sir Christopher Wren church of 1671-8 was built on the site of an earlier church. The medieval crypts were
	DESIGNATION:	Listed Place of Worship grade I, CA	excavated after World War II. The church has the tallest of all Wren spires, which is unique in form. Repairs to the spire were completed in 2014. In March 2015 the church
	CONDITION:	Poor	was awarded a grant from the Listed Places of Worship Roof Repair Fund and work is complete. Further repair
	PRIORITY CATEGORY:	C (C)	work and decoration has been carried out internally. The
	OWNER TYPE:	Religious organisation	condition of external ashlar masonry, especially to the clerestory walls, remains poor. The clerestory windows are
	LIST ENTRY NUMBER:	1064657	also in néed of repair.
			Contact: Ian Harper 020 7973 3786

This church was built between 1716 and 1727 by Nicholas SITE NAME: Church of St Mary Woolnoth, Hawksmoor on a tight site between Lombard Street and King William Street, City of King William Street. In 1875-6 William Butterfield raised London EC3 the chancel floor and removed the galleries, setting the Listed Place of Worship grade I, carved fronts against the walls. The west side of the square CA plan church is dominated by a baroque tower. There is settlement in the tower causing cracks which need to be CONDITION: Poor monitored. Elsewhere asphalt roofing needs to be PRIORITY CATEGORY: C (C) repaired, along with the nave parapet to Lombard Street. OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1064620 Contact: lan Harper 020 7973 3786

© Historic England

© Historic England



	SITE NAME:	Church of St Margaret, Lothbury, City of London EC2	Designed by Sir Christopher Wren, the church was built between 1686 and 1695. The form is a simple rectangle
	DESIGNATION:	Listed Place of Worship grade I, CA	orientated north-south with a vestry to the east and a tower to the west. The south elevation is faced in Portland stone while the others are rendered brick between stone
	CONDITION:	Poor	quoins. The church has contemporary fittings. The spire is in poor condition, the nave floor has settled, and the
	PRIORITY CATEGORY:	D (D)	leaning tower is being monitored. Repairs to the spire are
ñ	OWNER TYPE:	Religious organisation	due to commence in 2018, with a grant from the Heritage Lottery Fund.
	LIST ENTRY NUMBER:	1064634	Contact: Ian Harper 020 7973 3786

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM

UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / CITY OF LONDON / CROYDON

SITE NAME:	London Wall: remains of Roman and medieval wall Street EC2	from west end of <i>i</i>	All Hallows Church to 38 Camomile
DESIGNATION:	Scheduled Monument, 2 CAs	LIST ENTRY NUMBER:	1002050
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	London Wall: section bounding All Hallows Church	nyard EC2	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1002067
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Roman wall in basement of 90 Gracechurch Street	EC3	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1002035
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145

CROYDON



© London Borough of Croydon

P	SITE NAME:	Kennedy's, 18a, High Street, South Norwood SE25	Built in 1926 for Kennedy, a chain of South London butchers, now closed. It is hoped the ground floor shop
	DESIGNATION:	Listed Building grade II, CA	can be brought back into use. Applications for residential use of the upper floors were consented in 2015 and 2016,
	CONDITION:	Poor	however this work has not yet been carried out. The Local Authority's enforcement team has a live case regarding
	OCCUPANCY:	Vacant/not in use	unauthorised works to the building's front elevation.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1392596	Contact: Sanne Roberts (LPA) 020 8726 6000 ext 63872



Public house circa 1900 in Arts and Crafts style. The SITE NAME: Lesley Arms public house, 62, Lower Addiscombe Road, ground floor of the building has been vacant for many years and its condition is deteriorating, particularly the interiors. Addiscombe The upper floors have now been converted to flats. In DESIGNATION: Listed Building grade II 2017 repairs were carried out to the front parapet wall and rubbish was cleared from the front of the building. CONDITION: Poor Discussions with the Local Authority on the future use of OCCUPANCY: Part occupied/part in use the ground floor have taken place but no progress has been made. PRIORITY CATEGORY: A (A) OWNER TYPE: Commercial company LIST ENTRY NUMBER: 1272418 Contact: Sanne Roberts (LPA) 020 8726 6000 ext 63872

© London Borough of Croydon



P	SITE NAME:	Segas offices, 32, Park Lane, Croydon	Gas company showroom and office, built 1939-41 in Moderne style. The building is in need of maintenance and
Ŧ	DESIGNATION:	Listed Building grade II, CA	vacant. An application for temporary use of the ground floor as a marketing suite is under consideration, and
+++	CONDITION:	Fair	discussions are ongoing regarding the long term use of the building. The Mid Croydon Masterplan and Opportunity
	OCCUPANCY:	Vacant/not in use	Area Planning Framework emphasise the need for a new
. 1	PRIORITY CATEGORY:	E (E)	use to be found for the building, as part of the wider Queen's Square site (St George's Walk and St George's
	OWNER TYPE:	Commercial company	House).
	LIST ENTRY NUMBER:	1262041	Contact: Sanne Roberts (LPA) 020 8726 6000 ext 63872

© London Borough of Croydon

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

	Single stempy ledge to Aimport House hult sizes 1929. The			
	SITE NAME:	Former lodge to Croydon Airport Terminal, Purley Way, Croydon	Single storey lodge to Airport House, built circa 1928. T building has fallen into a state of disrepair through a lack maintenance and possibly vandalism. There are damaged	
	DESIGNATION:	Listed Building grade II	windows, masonry, and overgrown vegetation, and the building is vacant. Works have been undertaken to repair	
	CONDITION:	Poor	the roof. Discussions with the Local Authority are ongoing and Historic England is advising on appropriate repairs.	
	OCCUPANCY:	Vacant/not in use	and thistoric England is advising on appropriate repairs.	
whenese and the	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Commercial company		
ondon Borough of Croydon	LIST ENTRY NUMBER:	1079299	Contact: Sanne Roberts (LPA) 020 8726 6000 ext 63872	

SITE NAME: Surrey Street Pumping Station, Pumping station, built in four phases from 1851. Some exterior repairs have been carried out, however, the Surrey Street, Croydon building is vacant. Located within the Old Town Masterplan DESIGNATION: Listed Building grade II, CA area, its future use has been identified as key to the regeneration of Croydon's Old Town. Discussions with the CONDITION: Fair Local Authority are ongoing regarding the future use and OCCUPANCY: Vacant/not in use repair of the pumping station and regeneration of the surrounding area. PRIORITY CATEGORY: E (E) OWNER TYPE: Private LIST ENTRY NUMBER: 1079248 Contact: Sanne Roberts (LPA) 020 8726 6000 ext 63872 © Historic England



© Lor

OWNER TYPE: © London Borough of Croydon

Early C18 timber-framed house with brick gable ends and 2, Woodside Green, South Norwood SE25 SITE NAME: catslide roof to the rear. The building is unoccupied and in poor condition following extensive fire damage in 1991. DESIGNATION: Listed Building grade II Planning Permission and Listed Building Consent for residential use were granted in 2015. The Local Authority CONDITION Very bad and Historic England are continuing to advise on the OCCUPANCY: Vacant/not in use condition of the building and repair works. In 2017 the tiles and chimney were taken down for safety reasons and the PRIORITY CATEGORY: B (B) building is currently protected by a temporary roof. Applications to discharge conditions associated with the Private extant consents are under discussion. LIST ENTRY NUMBER: 1079280 Contact: Sanne Roberts (LPA) 020 8726 6000 ext 63872

	SITE NAME:	Church of St Mark, Albert Road SE25	Designed by GH Lewis of Linden and Lewis, the nave was built in 1852 and the rest completed by 1890. The church
	DESIGNATION:	Listed Place of Worship grade II, CA	has slate pitched roofs and Kentish ragstone walling. Stonework repairs were completed in 2013, grant-aided be Historic England and the Heritage Lottery Fund. The chancel and south slopes of the nave and aisle were re- roofed in 2016 with funding secured from the Listed Place
11/1/	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	of Worship Roof Repair Fund. The north slopes of the
	OWNER TYPE:	Religious organisation	nave and aisle roofs remain in need of repair.
Fundand	LIST ENTRY NUMBER:	1323688	Contact: Tracey Craig 020 7973 3756

© Historic England



SITE NAME:	Old Tithe Barn, Waddon, 520, Purley Way	C18 former barn, now in use as a place of worship. The barn is an unusual structure of two parallel ranges with an
DESIGNATION:	Listed Place of Worship grade II	M-shaped roof. The timber frame is clad in light brickwork with a steeply pitched tiled roof and wooden louvres at the
CONDITION:	Fair	end of each range. Some repairs have been undertaken to make the building watertight, however further work is
PRIORITY CATEGORY:	C (New entry - re-assessed)	required to the roof and to clear the rainwater goods.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1079247	Contact: Tracey Craig 020 7973 3756

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument

- SM UÁ
- Unitary Authority World Heritage Site WHS

No. of	SITE NAME:	Church of St Andrew, Southbridge Road	Church dating from 1857 by Benjamin Ferrey, with aisles added in 1879, chancel rebuilt and Lady Chapel added in
-	DESIGNATION:	Listed Place of Worship grade II	1891 designed by HB Walton. The church has been re- ordered internally. The unusual bellcote feature has been
	CONDITION:	Fair	dismantled due to its poor structural condition and needs to be reinstated. Works are also required to the rainwater
A AA AALAMAN	PRIORITY CATEGORY:	C (C)	goods and stonework.
A THE R. L.	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1079305	Contact: Tracey Craig 020 7973 3756

© Historic England

JAC YEE

	SITE NAME:	Church of St Augustine, St Augustine's Avenue	Designed by John Oldrid Scott, built in 1884. Re-ordered in 1989 to provide hall accommodation. The church has clay
14×	DESIGNATION:	Listed Place of Worship grade II*	tiled roofs, with flint walling. A jointly funded Heritage Lottery Fund and Historic England grant was awarded in
	CONDITION:	Poor	2012 for roof repairs to the south transept and south chapel, along with associated overhauling of rainwater
Ш	PRIORITY CATEGORY:	C (C)	goods and stone and flint repairs. These works are now
	OWNER TYPE:	Religious organisation	complete. Further repairs are needed to the north aisle roof and tower stonework.
	LIST ENTRY NUMBER:	1079301	Contact: Tracey Craig 020 7973 3756

© Historic England

AN ANTIT.	SITE NAME:	Church of St John, Upper Norwood, Sylvan Road SEI9	Built in 1882, designed by John Loughborough Pearson. The church is located on a hill of shrinkable clay and has
LEBA	DESIGNATION:	Listed Place of Worship grade II*, CA	been subject to ongoing differential movement for many years resulting in substantial cracking mainly to the sout side of the building. Underpinning, stitching of the most severe cracks and securing the south aisle brick and stor vaulting was completed in 2017, grant-aided by the
Mar St	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (F)	Heritage Lottery Fund. Outstanding work includes repair of
and the second	OWNER TYPE:	Religious organisation	weathered stone dressings and the remaining cracks externally and re-roofing.
5.240 E	LIST ENTRY NUMBER:	1079275	Contact: Tracey Craig 020 7973 3756
r England			

© Historic England

SITE NAME:	Group of four World War II fighter pens at the for	rmer airfield of RAI	F Kenley	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1021242	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No	
OWNER TYPE:	Local authority, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145	
SITE NAME:	Surrey Iron Railway embankment, approximately 130m south west of Lion Green Road, Coulsdon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021441	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145	
SITE NAME:	South Norwood, South Norwood, Croydon SE25			
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	No significant change	
VULNERABILITY:	Low	CONTACT:	Sanne Roberts (LPA) 020 8726 6000 ext 63872	

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).


Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

EALING

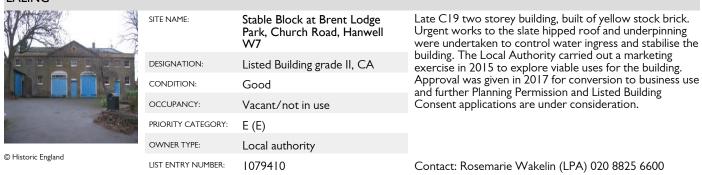

Hanwell Community Centre, Cuckoo Avenue, Hanwell W7

Listed Building grade II, CA

Part occupied/part in use

Good

C (D)

1079330

Local authority

	. k. k. s	-	
1 St	Depart		- inter
S			E A
			115 1
			Sec. 1
-		,	
20 2		Cherry Co	and A

-	SITE NAME:	Crossways, 134, Church Road, Hanwell W7	C18 or earlier house. The house is vacant and has been deteriorating for some time. It continues to be shored up
	DESIGNATION:	Listed Building grade II, CA	with scaffolding supporting a tin roof. Planning Permission and Listed Building Consent were granted in March 2017
	CONDITION:	Very bad	for the full repair of the building, but work has not yet started.
	OCCUPANCY:	Vacant/not in use	
-	PRIORITY CATEGORY:	egory: B (B)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1358740	Contact: Rosemarie Wakelin (LPA) 020 8825 6600

Administration block of the former London District

Schools, 1856. The Local Authority carried out major repairs in 2010 and the building is now in good condition.

Management of the building has reverted to the Local Authority and an options survey has been carried out to

inform future uses, as well as a planned programme of

maintenance. A planning application for changes to the

Contact: Rosemarie Wakelin (LPA) 020 8825 6600

taken over one of the wings.

building has been submitted and a long term business plan

has been formulated to support the new school which has

© Historic England



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© London Borough of Ealing



LIST ENTRY NUMBER: 1358760 Contact: Rosemarie Wakelin (LPA) 020 8825 6600 Built 1801-3 by Sir John Soane for the auctioneer and SITE NAME Norwood Hall, Norwood Green Road, Southall estate agent John Robins. Extended in the late C19 and includes substantial grounds, outbuildings and a walled DESIGNATION: Listed Building grade II, CA garden. The building was used as a horticultural college for several years but is now used as a community centre by the CONDITION: Fair present owner. Works are ongoing to restore the house OCCUPANCY: Part occupied/part in use and a new school complex has been built in the grounds. PRIORITY CATEGORY: F (F) OWNER TYPE: Private

© Historic England



SITE NAME:	Two chapels at South Ealing Cemetery, South Ealing Road W5	The two chapels are linked by a porte cochere with clock and belfry above, designed by Charles Jones and built in 1861. The buildings have fallen into disrepair and are now
DESIGNATION:	Listed Building grade II	considered too dangerous to use. Funding for emergency repairs is being sought and a long term solution explored.
CONDITION:	Very bad	
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1380227	Contact: Rosemarie Wakelin (LPA) 020 8825 6600

© London Borough of Ealing

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D


Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM ΪA
- Unitary Authority World Heritage Site ŴĤS

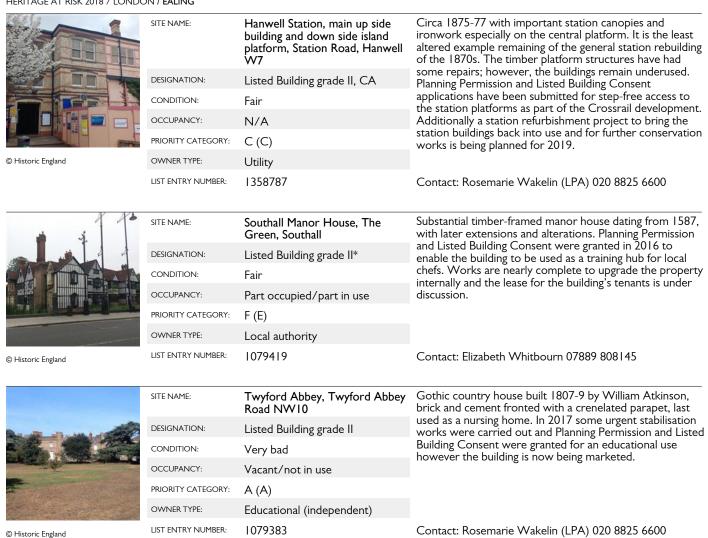

St Bernard's Hospital, Uxbridge

Road, Southall

Health authority

Fair

F (C)

1079364

LIST ENTRY NUMBER:

Listed Building grade II

Part occupied/part in use

SITE NAME:
DESIGNATION:
CONDITION:
OCCUPANCY:
PRIORITY CATEGORY:
OWNER TYPE:

© Historic England Archive



-	SITE NAME:	Christ the Saviour Church, New Broadway, Ealing W5	Constructed in 1852, designed by Sir George Gilbert Scott in Early English style with some additions by GF Bodley. It
	DESIGNATION:	Listed Place of Worship grade II*, CA	was restored following World War II bomb damage. Pitched roofs are slated with parapet gutters, walling is in Kentish ragstone with Bath stone dressings. There is a tall
	CONDITION:	Poor	tower and spire at the west end. The nave has a hammerbeam roof and the interior is richly decorated. The
in the	PRIORITY CATEGORY:	C (C)	roofs and gutter linings are in poor condition and
	OWNER TYPE:	Religious organisation	penetrating rainwater is damaging the plaster and paint finishes.
	LIST ENTRY NUMBER:	1079392	Contact: Tracey Craig 020 7973 3756

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed. С

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Former mental asylum (1829) by William Alderson; extended in 1854-57. Part of the original complex has been

restored for continuing healthcare use. Applications for the

refurbished. The chapel, ballroom and remaining wards are

conversion of the listed wards to private residential use were approved in 2013 and the site is now partially

still vacant and work on these is now in progress.

Contact: Rosemarie Wakelin (LPA) 020 8825 6600

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM
- ΪA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LOP	NDON / EALING		
SITE NAME:	Hanwell flight of locks and brick boundary wall of S	St Bernard's Hospit	al
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1001963
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY ?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Moated site at Down Barns Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005552
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Acton Town Centre, Acton W3		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rosemarie Wakelin (LPA) 020 8825 6600
SITE NAME:	Cuckoo Estate, Hanwell W7		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rosemarie Wakelin (LPA) 020 8825 6600
SITE NAME:	Ealing Town Centre, Ealing W5		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rosemarie Wakelin (LPA) 020 8825 6600
SITE NAME:	Haven Green, Ealing W5		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating significantly
/ULNERABILITY:	Medium	CONTACT:	Rosemarie Wakelin (LPA) 020 8825 6600
SITE NAME:	Norwood Green, Southall		
DESIGNATION:	Conservation Area, 7 LBs, part in RPG grade II*	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Rosemarie Wakelin (LPA) 020 8825 6600

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

ENFIELD

- CARLON COM	SITE NAME:	Broomfield Park N13	Early C18 formal gardens associated with Broomfield
	DESIGNATION:	Registered Park and Garden grade II, 4 LBs, part in CA	House, comprising a walled enclosure focussed on a series of formal lakes, and set within a landscape park. Converted for use as a public park in the early C20, with input from
	CONDITION:	Generally satisfactory but with significant localised problems	Thomas Mawson. The lakes are in poor condition and the historic parkland has suffered losses to development. The house and stable block are in very bad condition and are at
	VULNERABILITY:	Medium	risk, and the Local Authority is developing strategies for
and the second sec	TREND:	Declining	their restoration. A Conservation Management Plan exists for the landscape and discussions are needed to secure its
D Historic England	NEW ENTRY?:	Yes	implementation.
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1000517	Contact: Christopher Laine 07780 545 979
	SITE NAME:	Broomfield House, Broomfield Park, Broomfield Lane NI3	C16 house with late C18 additions, situated in a public park. The building is severely fire damaged, although
	DESIGNATION:	Listed Building grade II*, RPG grade II	significant parts of the interior are in safe storage. Additional scaffolding works were carried out in 2016 funded by Historic England and the Local Authority.
A CARLON DENNIEL	CONDITION:	Very bad	Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision
	OCCUPANCY:	Vacant/not in use	on the future of the building.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Local authority	
) Historic England	LIST ENTRY NUMBER:	1078934	Contact: Verena McCaig 020 7973 3718
Historic England	LIST ENTRY NUMBER:	1078934 Stable block in Broomfield Park, Broomfield Lane N13	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to
) Historic England		Stable block in Broomfield Park,	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive
) Historic England	SITE NAME:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of
Historic England	SITE NAME: DESIGNATION:	Stable block in Broomfield Park, Broomfield Lane NI3 Listed Building grade II*, RPG grade II	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is
Historic England	SITE NAME: DESIGNATION: CONDITION:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG grade II Very bad	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of
	SITE NAME: DESIGNATION: CONDITION: OCCUPANCY:	Stable block in Broomfield Park, Broomfield Lane NI 3Listed Building grade II*, RPG grade IIVery badVacant/not in use	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of
	SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY:	Stable block in Broomfield Park, Broomfield Lane N13Listed Building grade II*, RPG grade IIVery badVacant/not in useA (A)	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of
	SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG grade II Very bad Vacant/not in use A (A) Local authority	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of the building. Contact: Verena McCaig 020 7973 3718 1870-1 Gothic Revival cemetery chapel. The chapel is in poor condition and in need of an appropriate use. Repairs are required to arrest deterioration of damaged stonework
	SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG grade II Very bad Vacant/not in use A (A) Local authority 1188544 Nonconformist Chapel, Lavender Hill Cemetery, Cedar	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of the building. Contact: Verena McCaig 020 7973 3718 1870-1 Gothic Revival cemetery chapel. The chapel is in poor condition and in need of an appropriate use. Repairs
	SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG grade II Very bad Vacant/not in use A (A) Local authority 1188544 Nonconformist Chapel, Lavender Hill Cemetery, Cedar Road	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of the building. Contact: Verena McCaig 020 7973 3718 1870-1 Gothic Revival cemetery chapel. The chapel is in poor condition and in need of an appropriate use. Repairs are required to arrest deterioration of damaged stonework
	SITE NAME: DESIGNATION: CONDITION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: OWNER TYPE: ILST ENTRY NUMBER: SITE NAME: DESIGNATION:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG grade II Very bad Vacant/not in use A (A) Local authority 1188544 Nonconformist Chapel, Lavender Hill Cemetery, Cedar Road Listed Building grade II	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of the building. Contact: Verena McCaig 020 7973 3718 1870-1 Gothic Revival cemetery chapel. The chapel is in poor condition and in need of an appropriate use. Repairs are required to arrest deterioration of damaged stonework
	SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG grade II Very bad Vacant/not in use A (A) Local authority 1188544 Nonconformist Chapel, Lavender Hill Cemetery, Cedar Road Listed Building grade II Poor	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of the building. Contact: Verena McCaig 020 7973 3718 1870-1 Gothic Revival cemetery chapel. The chapel is in poor condition and in need of an appropriate use. Repairs are required to arrest deterioration of damaged stonework
9 Historic England P Historic England P Historic England	SITE NAME: DESIGNATION: CONDITION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: OWNER TYPE: ILST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: CONDITION:	Stable block in Broomfield Park, Broomfield Lane N13 Listed Building grade II*, RPG very bad Very bad Vacant/not in use A (A) Local authority 1188544 Nonconformist Chapel, Lavender Hill Cemetery, Cedar Road Listed Building grade II Poor Vacant/not in use	Early C18 stable block to Broomfield House. The building is vacant. Internal propping works have been undertaken to stabilise the floors, and further works carried out following subsequent fire and water damage. Following extensive discussions and commissioned reports, further work is being carried out to help inform a decision on the future of the building. Contact: Verena McCaig 020 7973 3718 1870-1 Gothic Revival cemetery chapel. The chapel is in poor condition and in need of an appropriate use. Repairs are required to arrest deterioration of damaged stonework

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018	

	ON / ENFIELD		
	SITE NAME:	Former Edmonton Girls' Charity School, Church Street, Edmonton N9	Single storey building, with a central arched doorway to the street and sash windows to either side. Above the doorway is a statuette of a female pupil. The condition of
	DESIGNATION:	Listed Building grade II, CA	the building is slowly deteriorating. A Conservation Management Plan, condition survey and options appraisal
	CONDITION:	Poor	have been produced, with funding from Historic England.
	OCCUPANCY:	Vacant/not in use	Urgent works are now required. Discussions are ongoing to identify funding sources and potential new users.
	PRIORITY CATEGORY:	С (С)	
	OWNER TYPE:	Religious organisation	
) Historic England	LIST ENTRY NUMBER:	1079547	Contact: Christine White (LPA) 020 8379 3852
	SITE NAME:	24, Church Street, Edmonton N9	Former teacher's accommodation to the adjoining Charity School. C18 cottage of red brick with renewed pantiled
	DESIGNATION:	Listed Building grade II, 2 CAs	roof. The condition of the building is slowly deteriorating. A Conservation Management Plan, condition survey and
	CONDITION:	Poor	options appraisal have been produced, with funding from Historic England. Urgent works are now required.
	OCCUPANCY:	Vacant/not in use	Discussions are ongoing to identify funding sources and
	PRIORITY CATEGORY:	C (C)	potential new users.
	OWNER TYPE:	Religious organisation	
) Historic England	LIST ENTRY NUMBER:	1079546	Contact: Christine White (LPA) 020 8379 3852
Allite -	SITE NAME:	Trent Park	Late C18 landscape park further developed in the early
	DESIGNATION:	Registered Park and Garden grade II, 19 LBs, SM, part in CA	C20 by Sir Philip Sassoon. Discussions continue with the owner of the mansion house to secure improvements to the core of the historic designed landscape as part of the
	CONDITION:	Generally satisfactory but with significant localised problems	re-development of the former Middlesex University site, including restoration of the terrace which is also at risk. The Local Authority manages the surrounding parkland as
and shares I	VULNERABILITY:	High	country park, and discussions continue towards improving
i de traise à la company de	TREND:	Declining	the inter-relationship between this and the more formal historic core.
) Historic England			
	NEW ENTRY ?:	No	
) Historic England	NEW ENTRY?: OWNER TYPE:	No Mixed, multiple owners	
) Historic England			Contact: Christopher Laine 07780 545 979
) Historic England	OWNER TYPE:	Mixed, multiple owners 1000484	
) Historic England	OWNER TYPE:	Mixed, multiple owners	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping
) Historic England	OWNER TYPE: LIST ENTRY NUMBER:	Mixed, multiple owners 1000484 Trent Park House terrace,	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out.
9 Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which
9 Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as
9 Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad N/A	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which
9 Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad N/A D (C)	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which
D Historic England Image: Constraint of the second secon	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad N/A	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress.
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad N/A D (C) Commercial company	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad N/A D (C) Commercial company	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, in
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad Very bad N/A D (C) Commercial company 1078931 Southgate House, High Street	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, in is now vacant whilst a new use is secured. Water ingress,
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad Very bad N/A D (C) Commercial company 1078931 Southgate House, High Street N14	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, i is now vacant whilst a new use is secured. Water ingress, now halted, has led to outbreaks of dry rot, and vegetation growth has hampered ventilation and drainage to the
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad N/A D (C) Commercial company 1078931 Southgate House, High Street NI4 Listed Building grade II*	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, i is now vacant whilst a new use is secured. Water ingress, now halted, has led to outbreaks of dry rot, and vegetation
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad Very bad N/A D (C) Commercial company 1078931 Southgate House, High Street N14 Listed Building grade II* Poor Vacant/not in use	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, i is now vacant whilst a new use is secured. Water ingress, now halted, has led to outbreaks of dry rot, and vegetation growth has hampered ventilation and drainage to the
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: DESIGNATION: CONDITION: CONDITION:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad Very bad Very bad D (C) Commercial company 1078931 Southgate House, High Street N14 Listed Building grade II* Poor Vacant/not in use A (A)	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, i is now vacant whilst a new use is secured. Water ingress, now halted, has led to outbreaks of dry rot, and vegetation growth has hampered ventilation and drainage to the
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	Mixed, multiple owners 1000484 Trent Park House terrace, Cockfosters Road, Trent Park Listed Building grade II, RPG grade II, CA Very bad Very bad N/A D (C) Commercial company 1078931 Southgate House, High Street N14 Listed Building grade II* Poor Vacant/not in use	Brick and stone terrace reconstructed in the 1920s. The terrace is in very poor condition, with temporary propping in place. Vegetation clearance and further propping works were undertaken after additional surveys were carried out. Full repair and conservation is expected to take place as part of the planned redevelopment of the wider site which is in progress. Contact: Christine White (LPA) 020 8379 3852 Late C18 house with early C19 extension in similar style, with an elliptical entrance hall. Formerly used as a college, it is now vacant whilst a new use is secured. Water ingress, now halted, has led to outbreaks of dry rot, and vegetation growth has hampered ventilation and drainage to the

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / ENFIELD

-	SITE NAME:	Enfield Electricity Works, 20, Ladysmith Road, Enfield	Former Enfield Electricity Works dating from 1906, architect unknown. The building is partially occupied.
	DESIGNATION:	Listed Building grade II	Extensive works have been undertaken to stabilise the building and make it watertight. However, further works
	CONDITION:	Fair	are required to the exterior stone and tile-work to prevent water ingress and further damage. Future operational
	OCCUPANCY:	Part occupied/part in use	requirements are under consideration for the site which
	PRIORITY CATEGORY:	E (E)	will inform its future repair and re-use.
	OWNER TYPE:	Utility	
	LIST ENTRY NUMBER:	1389537	Contact: Christine White (LPA) 020 8379 3852

© Historic England



	SITE NAME:	Barn at Whitewebbs Farm, Whitewebbs Road	Simple, timber-framed barn probably dating from the late C17. Planning Permission and Listed Building Consent have
No.	DESIGNATION:	Listed Building grade II	been granted for residential conversion. The barn has been sold to a new owner who it is hoped will complete the
	CONDITION:	Very bad	necessary works.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1079480	Contact: Christine White (LPA) 020 8379 3852

covering.

north side.

All Saints Church, Church

Religious organisation

New Covenant Church

Halls), Church Street, Edmonton N9

(formerly The Charles Lamb

Listed Place of Worship grade II,

Listed Place of Worship grade

Street N9

II*, CA

Poor

C (C)

CA

Poor

C (C)

No

1000395

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE-

SITE NAME:

DESIGNATION:

OWNER TYPE:

D

Е

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

1079548

© Historic England



© Colin Kerr (Architect)



© Hook Mason Architects



CONDITION: VUI NERABII ITY-TREND: NEW ENTRY?

Religious organisation 1078914 Contact: Ian Harper 020 7973 3786 Late C18 landscape park and lake by Humphry Repton, Grovelands Park NI4 extended in the mid-C19 and laid out as a public park in Registered Park and Garden the early C20 by Thomas Mawson. The mansion and grade II*, 5 LBs, part in CA immediate grounds are now a private hospital. The divided ownership of the park between the Local Authority, Generally satisfactory but with Thames Water and the hospital has led to differential significant localised problems management regimes. The sports area is in very bad condition with intrusive fencing and redundant structures. A Conservation Management Plan has been prepared and Medium Declining discussions are needed in order to secure its implementation. Mixed, multiple owners

Contact: Christopher Laine 07780 545 979

C12 in origin, largely rebuilt in the C15 and clad in brick in

1772. Restored in 1855 and 1871 by Ewan Christian and in

ragstone medieval tower, 1772 brick-faced east and north

sides, and stone south and west sides. The church was awarded a grant from the Heritage Lottery Fund for repair

works to the tower and these works were completed in

The Charles Lamb Halls were built in a collegiate Tudor style by local philanthropist Charles Lamb in 1908. The

buildings are faced in stone under plain tile roofs and are

were completed in 2015 with funding from the Heritage

Lottery Fund. A second phase of work is required to repair the roofs, stonework, rainwater goods and drains on the

now occupied by the New Covenant Church, Edmonton. Repairs to high level stonework and other external fabric

early 2016. The nave and aisle roofs are in need of re-

Contact: Tracey Craig 020 7973 3756

1889 by W Gilbert Scott. The church has a Kentish

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / ENFIELD / GREENWICH

SITE NAME:	Church Street, Edmonton N9		
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Christine White (LPA) 020 8379 3852
SITE NAME:	Fore Street, Edmonton N18		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Christine White (LPA) 020 8379 3852

GREENWICH

© Historic England

© Historic England



NYA.		Leads and as the builded	The Devict American Canal was built 1912 14 to bring
	LIST ENTRY NUMBER:	1079082	Contact: Conservation Team (LPA) 020 8921 5355
	OWNER TYPE:	Educational (state sector)	
	PRIORITY CATEGORY:	C (C)	ensure that the building is wind and watertight.
22	OCCUPANCY:	Occupied/in use	have worked with the owner to secure urgent works to
	CONDITION:	Poor	decided to market the wider site, including the Winter Garden, for sale. The Local Authority and Historic England
	DESIGNATION:	Listed Building grade II	considerable deterioration of the fabric. A previous initiative for repair and re-use was halted as the owner
	SITE NAME:	Winter Garden of former Avery Hill Training College, Bexley Road, Eltham SE9	Large conservatory built in 1889 in a classical style, with domed glass roofs and surmounted by a figure of Mercury. The building is suffering from water ingress and
	LIST ENTRY NUMBER:	1358936	Contact: Verena McCaig 020 7973 3718
1 mar	OWNER TYPE:	Commercial company	
h	PRIORITY CATEGORY:	F (F)	
-	OCCUPANCY:	Part occupied/part in use	
	CONDITION:	Fair	
	DESIGNATION:	Listed Building grade II*, CA	conversion. Works began in spring 2008 and are continuir in phases.
	SITE NAME:	Royal Military Academy, Academy Road, Woolwich SE18	Military college built in 1805 to the designs of James Wyatt Planning Permission has been granted for residential



	SITE NAME:	Lock and swing bridge, Broadwater Estate SE28	The Royal Arsenal Canal was built 1812-14 to bring supplies into the arsenal. The swing bridge was built circa
	DESIGNATION:	Listed Building grade II	1876 to carry railway tracks across the canal. Some work was carried out to the bridge in the early 1980s but since
	CONDITION:	Poor	then the lock and bridge have both lain derelict. The Local Authority and Historic England are in discussions with the
	OCCUPANCY:	N/A	owner to secure the first phase of conservation and repair
	PRIORITY CATEGORY:	C (C)	works which will include repointing of brick and stonework, patch repairs, and removal of rust and graffiti.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1213695	Contact: Conservation Team (LPA) 020 8921 5355

© Historic England



SITE NAME:	Garden House to north west of Charlton House, Charlton Road, Charlton SE7	Small red brick garden house with undercroft and high pyramidal swept roof, dating from the mid to late C17 and attributed to Inigo Jones. It was previously used as a public
DESIGNATION:	Listed Building grade I, CA	lavatory, but is now vacant. A condition survey and heritage assessment commissioned by the Royal
CONDITION:	Poor	Greenwich Heritage Trust is now informing a programme of works to restore and re-use the building. The first phase
OCCUPANCY:	Vacant/not in use	of enabling works has been granted Listed Building Consent
PRIORITY CATEGORY:	F (D)	and Planning Permission, and these works are now underway.
OWNER TYPE:	Charity (heritage)	
LIST ENTRY NUMBER:	1291892	Contact: Verena McCaig 020 7973 3718

© Historic England

- PRIORITY CATEGORIES
- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

D

Е

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT	RICK 2018		
TERLIAGE AT	KISK 2010 /	LONDON	GREEINVVICH

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

C (C)

Private

1358957

	SITE NAME:	Enderby House, 100, Christchurch Way, Greenwich SE10	Early to mid-C19 wharf-side building of Samuel Enderby, largest whalers and sealers in Britain and pioneers of Atlantic exploration. An unusual octagonal room gives onto
	DESIGNATION:	Listed Building grade II	a projecting bay, allowing views of approaching vessels. A scheme has been agreed in principle, with a Section 106
	CONDITION:	Very bad	agreement in place, but future use of the building has yet to
	OCCUPANCY:	Vacant/not in use	be determined. Repair and reinstatement works are underway, in close liaison with the Local Authority and
	PRIORITY CATEGORY:	E (A)	Historic England.
	OWNER TYPE:	Commercial company	
Historic England	LIST ENTRY NUMBER:	1079026	Contact: Conservation Team (LPA) 020 8921 5355
	SITE NAME:	Old brick wall between gardens in front of Nos. 34 and 36, Court Yard, Eltham SE9	Brick wall with sloped coping of C16 appearance. It is in poor condition with some structural problems caused by overgrowth of vegetation. This vegetation needs to be
ALASSA AL	DESIGNATION:	Listed Building grade II*, SM, CA	removed, allowing for repair and repointing.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	

© Historic England

	SITE NAME:	95A, Eltham High Street, Eltham SE9	C17 or earlier stable building with three diagonal chimney shafts. Although the building has been made weathertight,
	DESIGNATION:	Listed Building grade II	it is showing signs of a lack of maintenance and pigeon ingress. It is currently in residential use.
	CONDITION:	Poor	
	OCCUPANCY: Par	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1219821	Contact: Conservation Team (LPA) 020 8921 5355

	SITE NAME:	Forecourt railings and gates to Red Barracks, and Gate Lodge, Frances Street, Woolwich SE18	Railings and entrance gateway and lodge to the former Rec Barracks (1858-60 but now demolished). Structural repairs and repointing to the small watch tower to the north were
	DESIGNATION:	Listed Building grade II	completed in 2013. The railings, piers, and gate piers are generally in good condition. The gate lodge, however, is in
	CONDITION:	Very bad	particularly poor condition, threatened by extensive vegetative growth and continued deterioration of fabric.
	OCCUPANCY:	Vacant/not in use	Discussions are at an early stage regarding repair and
	PRIORITY CATEGORY:	A (A)	identification of a new use.
	OWNER TYPE:	Local authority	
Historic England	LIST ENTRY NUMBER:	1358950	Contact: Conservation Team (LPA) 020 8921 5355



©

	SITE NAME:	Garrison Church of St George, Grand Depot Road, Royal Artillery Barracks, Woolwich SE18	The Garrison Church, designed by two members of the Wyatt family, was completed in 1863. Although severely bomb damaged in 1944, the Royal Artillery war memorials survived in the apse, including one to those awarded the
2.5	DESIGNATION:	Listed Building grade II	Victoria Cross. A permanent protective roof was erected in 2015, grant-aided by the Heritage Lottery Fund. Mosaic
R.M.	CONDITION:	Poor	wall decorations were repaired in 2016, and new gates were installed in 2018 by the Woolwich Garrison Church
<u>100</u>	OCCUPANCY:	N/A	Trust. The repair of the memorials, further wall finishes,
	PRIORITY CATEGORY:	F (F)	the floor, pulpit and altar, is expected to complete by 2019, grant-aided by Historic England.
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1078985	Contact: Conservation Team (LPA) 020 8921 5355

PRIORITY CATEGORIES

© Historic England

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Verena McCaig 020 7973 3718

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

28

HERITAGE AT RISK 2018 / LONDO	ON / GREENWICH		
The second	SITE NAME:	Huts 1-4 in the south west Corner of Gordon School Playground, Grangehill Road SE9	Four interlinked corrugated iron-clad huts erected at Gordon School during World War I to provide places for the children of munitions workers on the nearby Progress Estate. The huts have been vacant for some years and their
The sector	DESIGNATION:	Listed Building grade II	condition is deteriorating. The iron cladding is corroding, and the linking corridor is showing signs of rainwater
	CONDITION:	Poor	ingress. Rainwater goods and timber sash windows are
	OCCUPANCY:	Vacant/not in use	generally in poor condition due to a lack of maintenance. There are currently no plans for re-use of the huts but the
	PRIORITY CATEGORY:	C (C)	Local Authority is exploring options.
© Historic England	OWNER TYPE:	Educational (state sector)	
	LIST ENTRY NUMBER:	1392379	Contact: Conservation Team (LPA) 020 8921 5355
	SITE NAME:	The Rotunda, Green Hill, Woolwich Common SE18	24-sided polygon, single storey building designed by John Nash. Concave conoid roof; first erected in the grounds of
	DESIGNATION:	Listed Building grade II*, CA	Carlton House in 1814 for (premature) celebration of Allied victory in the Napoleonic wars. The Rotunda housed
Eran .	CONDITION:	Very bad	the reserve collection of the 'Firepower' museum but is now vacant. The roof covering is leaking and there is
	OCCUPANCY:	Vacant/not in use	considerable concern about the condition of internal
	PRIORITY CATEGORY:	A (A)	timbers. Urgent works are needed and investigations into the roof structure are outstanding. Discussions regarding
ANG NO DE CONTRACTOR	OWNER TYPE:	Government or agency	its potential re-use continue.
© Historic England	LIST ENTRY NUMBER:	1078987	Contact: Verena McCaig 020 7973 3718
	SITE NAME:	I, Greenwich South Street, Woolwich SEI0	End terrace to an early C18 group, three storeys and attic with mansard roof. The upper floors have been
	DESIGNATION:	Listed Building grade II, CA	unoccupied for a number of years and the building fabric deteriorated. The owners have undertaken urgent works
D HAIN	CONDITION:	Poor	to secure the structural stability of the building as a result of
142	OCCUPANCY:	Part occupied/part in use	enforcement action taken by the Local Authority with the support of Historic England. Minor works are still
	PRIORITY CATEGORY:	С (А)	outstanding and being pursued.
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1079000	Contact: Conservation Team (LPA) 020 8921 5355
-	SITE NAME:	Conduit Head, Hyde Vale SE10	Stone conduit head, square in plan with hipped roof and
	DESIGNATION:	Listed Building grade II, CA	squat octagonal shaft surmounted by a cast iron bracket. It has four semi-circular stone bowls with cambered arches
	CONDITION:	Poor	above. Loss of mortar and cracking to the stone shaft and
	OCCUPANCY:	N/A	base has allowed water ingress, causing further damage.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
© Royal Borough of Greenwich	LIST ENTRY NUMBER:	1031858	Contact: Conservation Team (LPA) 020 8921 5355
I A	SITE NAME:	Riverside Guard Rooms, Royal Arsenal, Plumstead Road, Woolwich SE18	Royal Arsenal's guardrooms, 1814. One building has been converted into a café/restaurant, and the other for small business use. However, there are a number of outstanding
	DESIGNATION:	Listed Building grade II, CA	external repairs. Listed Building Consent has been secured and works are expected to be carried out imminently.
	CONDITION:	Poor	. ,
9110	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	D (C)	
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1078955	Contact: Conservation Team (LPA) 020 8921 5355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	E BISK 20	18/10	GREENWICH
I LINITAGE A			GILLINAAICH

OCCUPANCY:

OWNER TYPE:

SITE NAME

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY

LIST ENTRY NUMBER:

	SITE NAME:	Royal Arsenal Building 41 and 41a Royal Laboratory Square, Plumstead Road SE18	Ordnance factory and workshop, ammunition factory, then sawmill and cooperage. Quadrangular plan around a central courtyard, with two storey ranges built from 1805
	DESIGNATION:	Listed Building grade II, CA	onwards. Following Local Authority investment, the west wing houses the Royal Greenwich Heritage Trust and
	CONDITION:	Poor	Heritage Centre; the rest of the building is unoccupied. Although recently re-roofed, signs of water ingress in
	OCCUPANCY:	Part occupied/part in use	vacant wings indicate possible issues with rainwater goods
	PRIORITY CATEGORY:	C (C)	and brickwork. The Local Authority has acquired the lease and is actively pursuing the building's re-use as part of a
	OWNER TYPE:	Local authority	wider strategy for this area.
D Historic England	LIST ENTRY NUMBER:	1288913	Contact: Conservation Team (LPA) 020 8921 5355
	SITE NAME:	24, Royal Hill, Greenwich SE10	Early CI8 small urban house of central chimneystack plan,
	DESIGNATION:	Listed Building grade II, CA	the smallest known example of the 1703 Moxon Plan. The building has been vacant for some years and is in poor
	CONDITION:	Poor	condition. A scheme for restoration and conversion was agreed in 2011-2012 but, although works were started,
	0.001/01/01/		

Vacant/not in use

Garden House to south east of

Rush Grove House, Rush Grove

D (F)

Private

1391248

Street SEI8

Very bad

1289930

N/A

A (A)

Poor

F (B)

Listed Building grade II

Commercial company

Officers' Quarters, Royal Arsenal (building 11), Seymour

Listed Building grade II, CA

Street, Woolwich SÉI8

Vacant/not in use

Commercial company

© Historic England



© Historic England



© Historic England Archive



	LIST ENTRY NUMBER:	1289024	Contact: Conservation Team (LPA) 020 8921 5355
	SITE NAME:	Roman Catholic Church of St Peter, Woolwich New Road, Woolwich SE18	This church in the Gothic style was completed by AW Pugin in 1843. It is listed together with detached school buildings on the south side, completed a decade later by
	DESIGNATION:	Listed Place of Worship grade II	EW Pugin. The external masonry and roofing of the church, along with internal plastered ceilings, were repaired
ų	CONDITION:	Poor	in 2017 with a grant from the Heritage Lottery Fund. The condition of the two-storey school buildings is poor; the
	PRIORITY CATEGORY:	C (D)	upper hall is closed due to structural problems and falling
	OWNER TYPE:	Religious organisation	plasterwork caused by roof leaks. The congregation is now seeking funding to repair the school buildings to bring them
	LIST ENTRY NUMBER:	1212426	back into use.

full repair.

Contact: lan Harper 020 7973 3786

they were halted for some years. Following discussions with the Local Authority and Historic England, the owner

works programme are taking place with the owner.

Contact: Conservation Team (LPA) 020 8921 5355

re-commenced internal works but this has been sporadic. Progress is being monitored and discussions regarding the

Late C18 or early C19 octagonal building with pointed slate

roof of moderate pitch. The walls are set back to provide

an open loggia with round wooden arches set in trellis. Extensive loss of tiles from the roof has led to considerable

water ingress. The building is suffering from a prolonged lack of maintenance and is deteriorating rapidly. Efforts are

Contact: Conservation Team (LPA) 020 8921 5355

being made to contact the owners to discuss a strategy for

Officers' block for the Royal Military Academy 1717-20. A

Permission and Listed Building Consent have been granted for its conversion as part of a mixed-use development of

commercial and residential units and works are underway.

masterplan for the whole site has been approved by the

Local Authority. The building has been protected by sheeted scaffold and a temporary roof since 2008. Planning

PRIORITY CATEGORIES

© Historic England

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UÁ WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / GREENWICH / HACKNEY

SITE NAME:	Charlton Village SE7		
DESIGNATION:	Conservation Area, 13 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Conservation Team (LPA) 020 8921 5355
SITE NAME:	East Greenwich, Greenwich SE10		
DESIGNATION:	Conservation Area, 15 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Conservation Team (LPA) 020 8921 5355
SITE NAME:	Royal Arsenal Woolwich SE18		
DESIGNATION:	Conservation Area, 22 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Conservation Team (LPA) 020 8921 5355
SITE NAME:	Westcombe Park, Greenwich SE3		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Conservation Team (LPA) 020 8921 5355

HACKNEY



SITE NAME:	Cleeve Workshops, Calvert Avenue E2	Row of workshops, built 1895-8 to the design of Reginald Minton Taylor of the London County Council as part of the
DESIGNATION:	Listed Building grade II, CA	Boundary Éstate. All the workshops are in use and some repair and security works have taken place. Further works,
CONDITION:	Fair	however, are still required.
OCCUPANCY:	Occupied/in use	
PRIORITY CATEGORY:	C (F)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1264906	Contact: Tim Walder (LPA) 020 8356 4813

© London Borough of Hackney



SITE NAME:	7, Clapton Square E5	Early C19 terraced house. Listed Building Consent has
DESIGNATION:	Listed Building grade II, CA	been granted for the restoration and conversion of the building to accommodate three flats. Repair works are
CONDITION:	Fair	underway, however, the building has suffered from inappropriate and unauthorised works. The Local
OCCUPANCY:	Part occupied/part in use	Authority is considering enforcement action.
PRIORITY CATEGORY:	E (E)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1226411	Contact: Tim Walder (LPA) 020 8356 4813

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	55 and 59, Clapton Terrace E5	Terraced houses, mid to late C18. Now renumbered 10
	DESIGNATION:	Listed Building grade II, CA	and 12 Clapton Terrace. The buildings are suffering from disrepair and under use. The Local Authority has served
	CONDITION:	Fair	Section 215 Notices and works have taken place to improve the external appearance of the properties.
	OCCUPANCY:	Occupied/in use	improve the external appearance of the properties.
	PRIORITY CATEGORY:	F (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1226416	Contact: Tim Walder (LPA) 020 8356 4813
augh of Hacknow			

© London Borough of Hackney

	SITE NAME:	Marlow House, 160, Dalston Lane E8	Early to mid-C18 house. Listed Building Consent was granted for conversion to residential use in 2016. Works
	DESIGNATION:	Listed Building grade II, CA	are underway to implement this scheme, which includes full restoration of the building.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
© Historic England Archive	LIST ENTRY NUMBER:	1226591	Contact: Tim Walder (LPA) 020 8356 4813

	SITE NAME:	St Columba's Vicarage and link to church, Kingsland Road E2	Gothic Revival vicarage built 1873-4 to the design of James Brooks. The vicarage forms part of a larger group of listed
	DESIGNATION:	Listed Building grade I, CA	buildings by the same architect, including the church and Sisters' House. A condition survey was prepared in June
	CONDITION:	Poor	2017, and will help to guide discussions about future repairs. Planning Permission was granted in 2018 for the
	OCCUPANCY:	Occupied/in use	use of the Sisters' House as residential accommodation.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
© Historic England Archive	LIST ENTRY NUMBER:	1265658	Contact: Rebecca Barrett 020 7973 3716

2	SITE NAME:	320, Kingsland Road E8	Early C19 terraced house suffering from under use and lack of maintenance. The Local Authority is making efforts to
	DESIGNATION:	Listed Building grade II, CA	of maintenance. The Local Authority is making efforts to contact the owner to discuss necessary repairs.
	CONDITION:	Fair	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	E (E)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1226848	Contact: Tim Walder (LPA) 020 8356 4813

© London Borough of Hackney

	SITE NAME:	592, Kingsland Road E8	C18 terraced house with a shop on the ground floor and
	DESIGNATION:	Listed Building grade II, CA	vacant upper floors. Listed Building Consent was granted in 2008 for rebuilding the upper parts of the north and east
	CONDITION:	Fair	wall following structural problems. These works are complete, but there are still structural issues to be
	OCCUPANCY:	Part occupied/part in use	resolved. In May 2018 the Local Authority received a Listed
HOES	PRIORITY CATEGORY:	E (E)	Building Consent application for repairs.
E manual	OWNER TYPE:	Private	
the second second	LIST ENTRY NUMBER:	1226776	Contact: Tim Walder (LPA) 020 8356 4813

© London Borough of Hackney

5위

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	Bishop Wood's Almshouses, Lower Clapton Road E5	Late C17 almshouses restored in the late C19. Planning Permission and Listed Building Consent were granted in
	DESIGNATION:	Listed Building grade II, CA	November 2016 for the full repair of the building for residential use. Works have started.
	CONDITION:	Fair	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
n Borough of Hackney	LIST ENTRY NUMBER:	1226891	Contact: Tim Walder (LPA) 020 8356 4813

	SITE NAME:	New Lansdowne Club, 195, Mare Street E8	Substantial detached house, dating from 1715. In April 2018 Planning Permission and Listed Building Consent were
1	DESIGNATION:	Listed Building grade II*, CA	granted, subject to a Section 106 agreement, to convert the house to offices, with residential development to the
	CONDITION:	Poor	rear. Listed Building Consent was also granted in 2018 for emergency repairs. The building has since been sold.
	OCCUPANCY:	Vacant/not in use	chiefgeney repairs. The building has since been sold.
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
chive	LIST ENTRY NUMBER:	1265590	Contact: Rebecca Barrett 020 7973 3716



© London Borough of Hackney

© London Borough of Hackney

© Historic England Arch

© London B

-	SITE NAME:	Air Raid Precaution Centre,	Air raid shelter built in 1938. The building has previously
	LIST ENTRY NUMBER:	1253493	Contact: Tim Walder (LPA) 020 8356 4813
	OWNER TYPE:	Local authority	discussions are being guided by an Assessment of Significance prepared by the Local Authority.
	PRIORITY CATEGORY:	A (A)	and long-term use of the building are ongoing, in association with a Building Preservation Trust. These
	OCCUPANCY:	Vacant/not in use	building is weathertight. Discussions about the full repair
	CONDITION:	Very bad	been carried out, including removal of significant buddleia growth. Further urgent works are needed to ensure the
	DESIGNATION:	Listed Building grade II	poor condition following years of water ingress. The interior has now been cleared and some urgent works have
	SITE NAME:	Hackney Borough Disinfecting Station, Millfields Road E5	Disinfecting station built in 1900 by Gordon and Gunton for Hackney Borough Council. The building is in a very

suffered from flooding. Planning Permission and Listed Rossendale Street (east side) E5 Building Consent were granted in 2004 for the retention of the air raid shelter as a museum and construction of flats above. These works are largely complete and the flats occupied. However, the ownership of the Air Raid Precaution Centre is uncertain, and the space is currently used for storage.

Contact: Tim Walder (LPA) 020 8356 4813

Late C19 walls to the demolished goods station. The gates were repaired some years ago and are now in situ beneath the hoarding. The repair of the listed wall formed part of a large redevelopment proposal for the entire Bishopsgate Goodsyard site, called in by the Mayor of London in 2015. This proposal has not been progressed, and further discussions with the developer are being sought.

© Historic England Archive

SITE NAME:	Walls and gates to Bishopsgate Goods Station, Shoreditch High Street El
DESIGNATION:	Listed Building grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Utility
LIST ENTRY NUMBER:	1235316

Listed Building grade II

Vacant/not in use

Local authority

Fair

E (E)

1235876

Contact: Tim Walder (LPA) 020 8356 4813

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

D

Е

use).

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

_	SITE NAME:	187, Shoreditch High Street EI	Early C18 terraced house with an altered facade. The roof,
	DESIGNATION:	Listed Building grade II, CA	front elevation and windows have been restored and the building is now weathertight. A new shopfront has also
	CONDITION:	Fair	building is now weathertight. A new shopfront has also been fitted. The future use of the building is being considered as part of a wider development scheme.
And a state of the	OCCUPANCY:	Vacant/not in use	considered as part of a wider development scheme.
	PRIORITY CATEGORY:	E (E)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1235320	Contact: Tim Walder (LPA) 020 8356 4813

© London Borough of Hackney

M. Mailan

	SITE NAME:	196, Shoreditch High Street EI	Early C18 building. Stabilisation and repair works are		
L.C. MARINE	DESIGNATION:	Listed Building grade II, CA	complete and all floors are now occupied. Minor repairs are outstanding, including decorative works to the front		
H H H	CONDITION:	Good	elevation and glazing at ground floor level.		
	OCCUPANCY:	Occupied/in use			
	PRIORITY CATEGORY:	C (F)			
	OWNER TYPE:	Commercial company			
Billing and	LIST ENTRY NUMBER:	1235410	Contact: Tim Walder (LPA) 020 8356 4813		
La alta an					

© London Borough of Hackney



	SITE NAME:	Walls to St Leonard's Churchyard, Shoreditch High Street and Boundary Street EI	C19 churchyard walls and stone coped brick piers that occur at intervals along the walls. The railings and gates around the forecourt to St Leonard's Church were
	DESIGNATION:	Listed Building grade II, CA	repaired in 2010 with funding from Historic England. Repairs are also complete to the eastern boundary wall.
	CONDITION:	Fair	Minor repairs are still required to other parts of the wall, as well as the removal of graffiti.
	OCCUPANCY:	N/A	well as the removal of grant.
	PRIORITY CATEGORY:	C (C)	
3	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1235318	Contact: Tim Walder (LPA) 020 8356 4813



145	SITE NAME:	Shrubland Road Evangelical Church, Shrubland Road E8	A rare and complete example of a temporary iron mission church built in 1858. The building is now clad in corrugated		
1	DESIGNATION:	Listed Building grade II, CA	asbestos sheeting and is in need of repair, as a result of localised water ingress. The building was marketed for sale		
	CONDITION:	Poor	in 2016 without success. Efforts are being made to contact the owner to discuss necessary repairs.		
	OCCUPANCY:	Part occupied/part in use	the owner to discuss necessary repairs.		
	PRIORITY CATEGORY:	C (C)			
	OWNER TYPE:	Private			
	LIST ENTRY NUMBER:	1245303	Contact: Tim Walder (LPA) 020 8356 4813		

© Historic England

© Historic England



Til	SITE NAME:	White Lodge, Springfield Park E5	Early to mid-C19 villa. The building is part occupied with a café on the ground floor. The Local Authority has been		
	DESIGNATION:	Listed Building grade II, RPG grade II	awarded a grant from the Heritage Lottery Fund for a scheme to reinvigorate the whole park, including repairs to White Lodge and other buildings. Work has started with		
	CONDITION:	Fair	completion anticipated in summer 2019.		
	OCCUPANCY:	Part occupied/part in use			
	PRIORITY CATEGORY:	F (D)			
	OWNER TYPE:	Local authority			
	LIST ENTRY NUMBER:	1235414	Contact: Tim Walder (LPA) 020 8356 4813		

© Historic England

- А
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented В implemented.
- C Slow decay; no solution agreed.

use).

D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

©Н

©Н

©10

55 B	SITE NAME:	Haggerston Baths, Whiston	Public baths and swimming pool, dating from 1904. The
	LIST ENTRY NUMBER:	1264991	Contact: Tim Walder (LPA) 020 8356 4813
London Borough of Hackney	OWNER TYPE:	Private	
AND AND A DECEMBER	PRIORITY CATEGORY:	D (F)	
	OCCUPANCY:	Vacant/not in use	
	CONDITION:	Poor	implemented.
	DESIGNATION:	Listed Building grade II, CA	Building Consent have been granted for the conversion of the building into two residential units, but not yet
	SITE NAME:	Premises of Testi and Sons Millwrights, Waterworks Lane E5	Mid-C19 Tudor style building, thought to have been a school. The building is vacant and repairs are required to the roof and stonework. Planning Permission and Listed
	LIST ENTRY NUMBER:	1265023	Contact: Tim Walder (LPA) 020 8356 4813
Historic England	OWNER TYPE:	Local authority	
	PRIORITY CATEGORY:	F (E)	
	OCCUPANCY:	Part occupied/part in use	repairs to the chapel, enabling it to be used for community events.
	CONDITION:	Fair	cemetery landscape. This will include a second phase of
	DESIGNATION:	Listed Building grade II, RPG grade II, CA	stonework was completed in 2017, with funding from Hackney Council and Historic England. In January 2018 the Local Authority was awarded a first round pass from the Heritage Lottery Fund for a project to improve the
	SITE NAME:	Mortuary Chapel, Stoke Newington High Street, Abney Park Cemetery N16	Gothic Revival cemetery chapel, dating from 1839. The chapel is situated in the centre of the early C19 cemetery. A first phase of repairs to the roof, spire and high level
	LIST ENTRY NUMBER:	1000789	Contact: Christopher Laine 07780 545 979
	OWNER TYPE:	Local authority	
Historic England	NEW ENTRY?:	No	first-round pass and is now in its development phase.
ALC: NO	TREND:	Improving	Lottery Fund/Big Lottery Fund 'Parks for People' project for significant parts of its implementation has received a
	VULNERABILITY:	High	Management Plan has been prepared, and a Heritage
	CONDITION:	Generally unsatisfactory with major localised problems	condition and, in places, illegible. A Development Board has been established to guide future management and maintenance of the cemetery. A Conservation
	DESIGNATION:	Registered Park and Garden grade II, 18 LBs, part in CA	gardens of two C17 houses. Abney Park is one of London's most important Nonconformist cemeteries. Features of the historic designed landscape survive but are in poor
	SITE NAME:	Abney Park Cemetery N16	Laid out as an arboretum cemetery in 1840 from the



© Historic England



© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

Road E2

Poor

C (C)

Poor

F (B)

1264896

1235838

Listed Building grade II

Church of St Andrew, Bethune

Listed Place of Worship grade II*

Road, Stoke Newington N16

Religious organisation

Vacant/not in use

Local authority

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

- repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Ian Harper 020 7973 3786

building is vacant and in a state of disrepair. Following a

competitive bidding process and public consultation, the

Local Authority selected a preferred developer in November 2017 to repair the building and bring it back

Contact: Tim Walder (LPA) 020 8356 4813

final proposals.

masonry.

into use. Detailed surveys will be carried out to inform the

The church was built in 1883-4 by Sir Arthur Blomfield in the Early English style, using Kentish ragstone with Bath stone dressings. Although plain externally, the interior is

richly decorated. The south nave and aisle roofs, the south clerestory and west windows are recently repaired. The

church has been awarded a grant from the Heritage

side roofs, walls and windows. Repairs are due for

Lottery Fund for a second phase of repairs to the north

completion in 2018. A third phase of roofing repair will be needed to the transepts and chancel roofs and related

- Conservation Area Listed Building CA LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- ŬA Unitary Authority World Heritage Site WHS

A	SITE NAME:	Church of St Chad, Dunloe Street, Hackney E2	Church by Victorian Gothicist architect James Brooks, completed in 1869 to provide for rapidly expanding but
1	DESIGNATION:	Listed Place of Worship grade I	poor suburbs. The adjacent vicarage dates from 1874. The church is high and lofty, with plain detailing in brick and
TOLIN	CONDITION:	Poor	contrasting Bath stone dressings under slated roofs. The vicarage, transept roofs and north nave brickwork were
	PRIORITY CATEGORY:	A (A)	repaired in the late C20. More repairs are needed to
TIA	OWNER TYPE:	Religious organisation	brickwork and rainwater goods, and the timber bellcote above the crossing is in urgent need of assessment and
a landar	LIST ENTRY NUMBER:	1265793	repair. The church is actively seeking funding.
			Contact: Ian Harper 020 7973 3786

© Historic England

© Historic England

m m



	SITE NAME:	Christ Apostolic Church (formerly St Columba), Kingsland Road, Hackney E2	The Parish Church was built in the Gothic revival style in 1868-9 by James Brooks and the mortuary chapel was added in 1904-5 by E Geldart. It forms an enclosed	
	DESIGNATION:	Listed Place of Worship grade I, CA	courtyard with the vicarage and Sisters' House, listed separately. Construction is in red brick with Bath stone dressings. There are defects in the high level lantern above	
	CONDITION:	Poor	the central tower, and in the rainwater disposal system causing damage to the masonry. A recent fall of a section of	
	PRIORITY CATEGORY:	A (New entry)	guttering has caused damage to the slates of the north aisle.	
	OWNER TYPE:	Religious organisation		
	LIST ENTRY NUMBER:	1226862	Contact: lan Harper 020 7973 3786	



© Richard Williams

© Historic England

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

	LIST ENTRY NUMBER:	1226862	Contact: Ian Harper 020 7973 3786
	SITE NAME:	Unitarian Church, Newington Green, Stoke Newington N16	The church was first erected in 1708 and then partially rebuilt and enlarged in 1860 with Sunday schools to the
A REAL PROPERTY AND	DESIGNATION:	Listed Place of Worship grade II, CA	rear. It has problems with leaking roofs, dampness at low levels, and structural movement. The congregation of New Unity has prepared a comprehensive project, 'Recovering
	CONDITION:	Poor	the Dissenter's Legacy', encompassing repairs to the historic fabric and improvements to access and facilities.
	PRIORITY CATEGORY:	D (D)	The project has been awarded a grant from the Heritage
-	OWNER TYPE:	Religious organisation	Lottery Fund and repairs are expected to commence in late 2018.
	LIST ENTRY NUMBER:	1235210	Contact: Ian Harper 020 7973 3786

Church of St Thomas, Old Hill

Street, Clapton Common N16

Religious organisation

Church of St Leonard, Shoreditch High Street EI

Religious organisation

Listed Place of Worship grade I,

CA

Poor

A (A)

CA

Poor

D (F)

1235382

1265859

Listed Place of Worship grade II,

Only the crypt (c1777), the tower and belfry (1827) survived World War II bomb damage in December 1940. The church was re-opened in October 1958 to designs by NF Cachemaille-Day; he incorporated the apse from William Burges's remodelling in 1873 and the 1921 World War I memorial. The asphalt water-proofing of the reinforced concrete roof slab has been much repaired over previous decades. It is still leaking in places, causing concerns about the structural integrity of the roof. The church has commissioned structural investigations and is seeking funding for a repair project.

Contact: Ian Harper 020 7973 3786

Church built between 1736 and 1740 to the design of George Dance the Elder. Built in brick with a Portland stone front facade and dressings, with slate roofs. The roofs to the north and south aisles and the flat roofs either side of the tower have been repaired with funding from the Heritage Lottery Fund and Historic England. The nave roof was re-slated in 2017 with funding from the Listed Places of Worship Roof Repair Fund. The church has received a first round pass from the Heritage Lottery Fund for repairs to the spire, tower, pediment, columns and to the portico roofs.

Contact: Tracey Craig 020 7973 3756

PRIORITY CATEGORIES

© Historic England Archive

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- ÍΙΑ Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / HACKNEY / HAMMERSMITH AND FULHAM

	SITE NAME:	Old Church of St Mary, Stoke Newington Church Street, Stoke Newington N16	The old parish church of Stoke Newington dates from 1563. It was restored in 1827-29 by Charles Barry who raised the nave on a clerestory, added the spire, and the	
	DESIGNATION:	Listed Place of Worship grade II*, CA	the exposed so	e which was lost in WWII and not rebuilt; ft brick of the north wall is now weathering he south aisle roof was repaired with a
	CONDITION:	Poor	grant from the	Listed Places of Worship Roof Repair Fund. are needed internally and externally, and in
TOM	PRIORITY CATEGORY:	A (C)	particular to de	al with structural movement, settlement at
The state of the second	OWNER TYPE:	Religious organisation	the west end of the north aisle, and dampness in the v end of the south aisle.	
© Historic England	LIST ENTRY NUMBER:	1235419	Contact: lan Ha	arper 020 7973 3786
A MARINA	SITE NAME:	Church of St Matthias, Wordsworth Road, Stoke Newington N16	The church was completed in 1851 to an innovative design by William Butterfield in free Gothic style. Stock brick with Bath stone dressings. Repairs to the nave roof and rainwater goods were completed in May 2015 with fundin from the Heritage Lottery Fund and Historic England. Another phase of repairs is required to the aisle roofs, as well as the roofs and masonry of the tower. The electrical system is in need of renewal. Contact: Ian Harper 020 7973 3786	
and a	DESIGNATION:	Listed Place of Worship grade I		
The second	CONDITION:	Poor		
ALTER ALTO PATE	PRIORITY CATEGORY:	C (C)		
THE THE PARTY OF	OWNER TYPE:	Religious organisation		
	LIST ENTRY NUMBER:	1265031		
© Historic England				
SITE NAME:	Mare Street, Hac	kney Central E8		
DESIGNATION:	Conservation Are	ea, 9 LBs	NEW ENTRY?:	No
CONDITION:	Poor		TREND:	Deteriorating
VULNERABILITY:	Low		CONTACT:	Rodney Keg (LPA) 020 8356 7739

			, 8()
SITE NAME:	Sun Street, City of London EC2		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Unknown
VULNERABILITY:	Low	CONTACT:	Rodney Keg (LPA) 020 8356 7739

HAMMERSMITH AND FULHAM

	SITE NAME:	Circular Garden Building, formerly to St Pauls School, Hammersmith Road	Boundary wall in red brick with terracotta finials to brick piers and circular building with conical roof, both formerly part of St Paul's School, 1881-85 by Alfred Waterhouse.
	DESIGNATION:	Listed Building grade II	Now part of St Paul's Open Space. The terracotta finials two brick piers of the boundary wall have become detached and are awaiting reinstatement. The circular building is disused and a low ceiling has been installed internally. There is evidence of deterioration including missing roof tiles, vegetation growth and damp. Discussio on repair and future re-use are ongoing.
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (New entry)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1079820	Contact: Adam O'Neill (LPA) 020 8753 3318

© Historic England

	SITE NAME:	Hope and Anchor public house, Macbeth Street, Hammersmith W6	Public house in neo-Georgian style dating from 1936. Built for Truman's as part of a housing estate. The building is an unusual survival with two exceptionally intact 1930s bar
	DESIGNATION:	Listed Building grade II, CA	interiors. The public house business closed in 2012 and the ground floor remains unoccupied. The upper floors are
	CONDITION:	Good	occupied and in residential use.
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	E (E)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	39279	Contact: Adam O'Neill (LPA) 020 8753 3318

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

H

250

THE REAL PROPERTY OF

©

ര

X

3

©

ര

©

Descrivation Descrivation Poor Poor CONSTICUTE Poor CONSTICUTE Poor CONSTICUTE Poor CONSTICUTE Poor CONSTICUTE CONSTICUTE CONSTICUTE Unknown USTERTIFICATIONE C (C) OWNER TITE Unknown USTERTIFICATIONE C (A) OWNER TITE Unknown USTERTIFICATIONE C (A) OWNER TITE Unknown		SITE NAME:	Tomb of Abraham Smith, Hammersmith Cemetery, Margravine Road W6	White marble tomb monument, circa 1923, by C J Jordan & Son, Acton, dedicated to a gold prospector. Tall, enriched cross surmounting a rubble-carved base. A carved
CONSIDE Poor considerable decay and soling igneding to a log only signed to inform future repair work operations in soling igneding to a log only soliton future repair work operations. Tent: Dybei UNANOWER ITE: UNANOWER ITE: Constant operations in soliton is missing and there is some broken is constant operations. Image: Constant operation is missing and there is some broken is missing and there is some broken is constant operation. Mausoleum dating from 1884. The parapet to device is missing and there is some broken is constant operation. Image: Constant operation is missing and there is some broken is missing and there is some broken. Decasantow. Mausoleum dating from 1884. The parapet to constant operation is missing and there is some broken is constant operation. Image: Constant operation is missing and there is some broken is missing and there is some broken. Decasantow. Mausoleum dating from 1884. The parapet to constant operation. Image: Constant operation is missing and there is some broken is missing and there is some broken. Decasantow. Mausoleum dating from 1884. The parapet to constant operation. Image: Constant operation is missing and there is some broken in the contine to constant operation. Decasantow. Mausoleum dating from 1884. The parapet to constant operation. Image: Constant operation is missing and there is some broken in the contine to constant operation. Decasantow. Mausoleum dating from there is some broken in anabet to entities. <td></td> <td>DESIGNATION:</td> <td>Listed Building grade II, CA</td> <td>vignette at the foot of the cross depicts a gold prospector in a shelter. The surface of the marble is suffering</td>		DESIGNATION:	Listed Building grade II, CA	vignette at the foot of the cross depicts a gold prospector in a shelter. The surface of the marble is suffering
DCCLEMENCY N/A survey is required to inform future repair would be provided to inform future repair would be prov		CONDITION:		considerable decay and soiling, leading to a loss of detail.
Industry CALLOWS C (C) options. Interac Englad URF RYTRY: Unknown INTER TAXMER 1072616 Contact: Adam O'Neill (LPA) 020 8753 3318 Interac Englad Site NAME Tomb of Frederick Harold Young, Hammersmith Centerry, Margravine Road Web Mausoleum dating from 1884. The parapets to elevation is missing and there is source to the England has finded a condition survey to ider Prairs and, together with the Local Authority Interac Englad Descentron: N/A Construct Very bad Construct N/A Reception House, Hammersmith Centerry, Rangravine Road W6 Single-storey octagonal brick building with a store frair a field of condition survey to ider praire to identify possible fundity of a store frair a field a condition survey to ider praires for bodies prior to builal. The store monon which the construct and failing an envirich the store monon which the store monon which the construct and failing an envirich the store monon which the store of the Great West part fundity the store funding to repairs. Interact Englad Site NAME Poor OKITER TAXENDER Draped woman sculpture, North Vertena Gardens W6 Interact Englad Site Marian Interact Englad Site Marian Interact Englad Site Marian Interact Englad </td <td></td> <td>OCCUPANCY:</td> <td>N/A</td> <td>survey is required to inform future repair works. The</td>		OCCUPANCY:	N/A	survey is required to inform future repair works. The
Interde Tagland OWNERT THE: Unknown Interde Tagland Left BATRY NAMMER: 1072616 Contact: Adam O'Neill (LPA) 020 8753 3318 Interde Tagland Site NAME: Tomb of Frederick Harold Young, Hammersmith Cemetery, Margravine Road W6 Mausoleum dating from 1884. The parapet to elevation is missing and there is some broken insisting and there is some broken occupance: N/A Interde Tagland Distignation: Listed Building grade II, CA Friedmark Interde Tagland OWNER TIPE: Unknown Contact: Adam O'Neill (LPA) 020 8753 3318 Interde Tagland OWNER TIPE: Unknown Contact: Adam O'Neill (LPA) 020 8753 3318 Interde Tagland Stel NAME: N/A Friedmark Interde Tagland OWNER TIPE: Unknown Contact: Adam O'Neill (LPA) 020 8753 3318 Interde Tagland Stel NAME: N/A Friedmark Margravine Road W6 Interde Tagland Stel NAME: N/A Friedmark M6 Interde Tagland Stel NAME: Stel NAME: Stel NAME: Interde Tagland Stel NAME: Listed Building grade II. CA Friedmark M6 Interde Tagland Stel NAME:	N. Carlos and and	PRIORITY CATEGORY:	C (C)	Friends of Margravine Cemetery are exploring funding
Instrumentation Instrumentation Contact: Adam O'Neill (LPA) 020 8753 3318 Instrumentation STE NAME Tomb of Frederick Harold Young, Hammersmith, Cemetery, Margravine Road Wé Mausoleum dating from 1884. The parapet to elevation is missing and there is some broken in the some broken repairs and Logether with the Local Authority Friends of Margravine Cemetery, efforts are r made to identify possible fundition survey to identify made to identify possible fundition with a survey made to identify possible fundition with a survey made to identify possible fundition with a survey made to identify possible fundition with a survey manymersmith Cemetery, Margravine Road W6 Internet fundet STE NAME Reception House, Mammersmith Cemetery, Margravine Road W6 Single-storey octagonal brick building with a survey mainwater goods are inadequate and failing, ar to considerable deterioration of the stone for on which the coffing reteation of the stone for no which the coffing reteation of the stone for occuravecer. Internet lengthet N/A Single-storey octagonal brick building mainwater goods are inadequate and failing, ar to considerable deterioration of the stone for no which the coffing reteation of the stone for occuravecer. Internet lengthet Single-storey octagonal brick buildi	The second second	OWNER TYPE:	. ,	
Young, Hammersmith Gemetery, Margravine Road W6 elevation is missing and there is some broken glass. There are structural defects to the floor engain and, together with the Local Authority CocturANCY Interior England DESIGNATION: Listed Building grade II, CA COMPTION: Very bad OCCUPANCY N/A PROFINTOR: Very bad OCCUPANCY N/A PROFINTOR: Very bad OWNER TYPE Unknown LIST ENRIFY Unknown STE NAME Reception House, Hammersmith Cemetery, Margravine Road W6 DESIGNATION: Listed Building grade II, CA OWNER TYPE N/A DESIGNATION: Listed Building grade II, CA OPARTOR: N/A DESIGNATION: Listed Building grade II, CA OPARTOR: N/A DESIGNATION: Listed Building grade II, CA OPARTOR: N/A PROFITY CATEGORY: A (C) CONDITION: Poor COCUPANCY: N/A PROFITY CATEGORY: A (C) OWNER TYPE Local authority Interic England STE NAME STE NAME	oric England	LIST ENTRY NUMBER:	1072616	Contact: Adam O'Neill (LPA) 020 8753 3318
Distrikt NORK Listed Building grade II, CA controller Very bad controller Very bad controller N/A PRORITY CATEGORY A (A) OWNER TYPE Unknown LISTE NAME: 1072617 Contact: Adam O'Neill (LPA) 020 8753 3318 STE NAME: Reception House, Hammersmith Cemetery, Margravine Read W6 Distriktion: Distrikt Number: Distriktion: Distrikt Number: Distriktion: Distriktion: Distriktion: Poor consultation: Poor consultation: N/A PROMITION: Listed Building grade II, CA consultation: Poor consultation: Poor consultation: N/A PROMITION: Listed Building grade II, CA consultation: Poor consultation: Listed Building grade II, CA consultation: N/A PROMITION: Listed Building grade II, CA consultation: N/A PROMITION: Listed Building grade II, CA consultation: Li		SITE NAME:	Young, Hammersmith Cemetery, Margravine Road	Mausoleum dating from 1884. The parapet to the west elevation is missing and there is some broken and missing glass. There are structural defects to the floor. Historic England has funded a condition survey to identify necessary
CONDITION: Very bad OCCUPANICY: N/A Hardin: England OCCUPANICY: Inserve: England OVALE IT YPE: UNIVERTY NUMBER: IO72617 Contact: Adam O'Neill (LPA) 020 8753 33 IB Inserve: England Single-storey octagonal brick building with a science if 869, probably by George Saunders. A. I. Inserve: England Single-storey octagonal brick building with a science if 869, probably by George Saunders. A. I. Inserve: England Single-storey octagonal brick building with a science if 869, probably by George Saunders. A. I. Inserve: England Single-storey octagonal brick building with a science if booles are inadequate and failing, and to occupance: Inserve: England Single-storey octagonal brick building with a science if booles are inadequate and failing, and to occupance: Inserve: England Single-storey octagonal brick building with a science if brooking are inadequate and failing, and to occupance: Inserve: England Single-storey octagonal brick building to provide temp places for booles are inadequate and failing, and to occupance: Inserve: England Single-storey octagonal brick building trace if brooking are inadequate and failing, and to occupance: Inserve: England Single-storey octagonal brick building trace if brooking are inadequate and failing, and to occupance if the Great West Inserve: Engla		DESIGNATION:	Listed Building grade II, CA	repairs and, together with the Local Authority and the Friends of Margravine Cemetery, efforts are now being
Interve England OCCURANCY: N/A Interve England OWNER TYPE: Unknown Interve England ID72617 Contact: Adam O'Neill (LPA) 020 8753 33 18 Interve England Strename: Reception House, Hammersmith Cemetery, Margravine Road W6 Interve England Strename: Listed Building grade II, CA Interve England Strename: Listed Building grade II, CA Interve England N/A Proor Interve England Uit ENTRY NUMBER: I436663 Interver N/A Proor Interver N/A Proor Interver N/A Proor Interver N/A Proor Interver North Verbena Gardens V/A Strated in an open space off the Great West an arry commension of the London County Provide visual amenty in compensation for a condition sur provide visual amenty in compensation for a condition sur provide visual amenty in compensation for a condition sur pr		CONDITION:	Very bad	made to identify possible funding sources that would
Itsence England OWNER TYPE Unknown List ENTRY NUMBER: 1072617 Contact: Adam O'Neill (LPA) 020 8753 3318 Image: Strip Number: Reception House, Harmersmith Cemetery, Margravine Road W6 Single-storey octagonal brick building with as circa 1869, probably by George Sauders. A. reception houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Poor Image: Strip Number: N/A Preception Houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Poor Image: Strip Number: N/A Preception Houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Proor Image: Strip Number: N/A Preception Houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Prior Strip Number: Image: Strip Number: N/A Prior Strip Number: Image: Strip Number: Ids663 Contact: Adam O'Neill (LPA) 020 8753 3318 Image: Strip Number: N/A Prior Strip Number: Image: Strip Number: N/A Prior Strip Number: Strip Number: <tr< td=""><td></td><td>OCCUPANCY:</td><td>N/A</td><td>enable these works to be carried out.</td></tr<>		OCCUPANCY:	N/A	enable these works to be carried out.
Itsence England OWNER TYPE Unknown List ENTRY NUMBER: 1072617 Contact: Adam O'Neill (LPA) 020 8753 3318 Image: Strip Number: Reception House, Harmersmith Cemetery, Margravine Road W6 Single-storey octagonal brick building with as circa 1869, probably by George Sauders. A. reception houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Poor Image: Strip Number: N/A Preception Houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Poor Image: Strip Number: N/A Preception Houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Proor Image: Strip Number: N/A Preception Houses were built to provide temp places for bodies prior to burial. The stone monow which the coffins rested still remain inside. Image: Strip Number: N/A Prior Strip Number: Image: Strip Number: N/A Prior Strip Number: Image: Strip Number: Ids663 Contact: Adam O'Neill (LPA) 020 8753 3318 Image: Strip Number: N/A Prior Strip Number: Image: Strip Number: N/A Prior Strip Number: Strip Number: <tr< td=""><td>Manufacture Party</td><td>PRIORITY CATEGORY:</td><td>A (A)</td><td></td></tr<>	Manufacture Party	PRIORITY CATEGORY:	A (A)	
STE NAME: Reception House, Hammersmith Cemetery, Margravine Road W6 Single-storey octagonal brick building with a s circa 1869, probably by George Saunders. A 1 reception houses were built to provide temp places for bodies prior to burial. The stone m on which the coffins rested still remain inside. rainwater goods are inadequate and failing, ar to considerable deterioration of the stone dri brickwork and mortars. The Friends of Margr Cemetery have funded a costed condition su discussions are underway to secure funding to repairs. www.er.trye: Local authority USTE NAME: Draped woman sculpture, North Verbena Gardens W6 DesignAntion: stre NAME: Draped woman sculpture, North Verbena Gardens W6 DesignAntion: Cast concrete sculpture, circa 1959 by Karel situated in an open space of the Great West an early commission of the London County C Patronage of the Arts scheme, unusually com provide visual amenty in compensation for a scheme. The cast concrete is now cracking in and past repairs are both unsightly and failing, is also being damaged by rusting structural in or provide visual amenty in compensation for a scheme. The cast concrete is now cracking in and past repairs are both unsightly and failing, is also being damaged by rusting structural in and past repairs are both unsightly and failing, is also being damaged by rusting structural in and past repairs are both unsightly and failing, is also being damaged by rusting structural in and of the C18. There is evidence of severe r atmage, invasive vegetation and dumped rubb to be a problem. The Local Authority, Histor the church are in discussion to agree a suitably ob to be a problem. The Local Authority, Histor the church are in discussion to agree a suitably will secure the repair of the monument and in setting. </td <td>oric England</td> <td>OWNER TYPE:</td> <td></td> <td></td>	oric England	OWNER TYPE:		
Hammersmith Cemetery, Margravine Road W6 Margravine Road W6 DESIGNATION: Listed Building grade II, CA CONDITION: Poor OCCUPANCY: N/A PHORITY CATEGORY: A (C) OWNER TYPE Local authority LIST ENTRY NUMBER: 143663 STE NAME: Draped woman sculpture, North Verbena Gardens W6 DESIGNATION: Listed Building grade II, CA CONDITION: A (C) OWNER TYPE Local authority LIST ENTRY NUMBER: 143663 STE NAME: Draped woman sculpture, North Verbena Gardens W6 DESIGNATION: Listed Building grade II, CA CONDITION: Poor CCUPANCY: N/A PHORITY CATEGORY: A (C) DESIGNATION: Listed Building grade II, CA CONDITION: Poor CCUPANCY: N/A PHORITY CATEGORY: C (C) DESIGNATION: Listed Building grade II, CA CONDITION: Poor CCUPANCY: N/A PHORITY CATEGORY: C (C) DESIGNATION: Listed Building grade II, CA CONDITION: Poor CCUPANCY: N/A PHORITY CATEGORY: C (C) DISTENTRY NUMBER: 1431422 STE NAME: Tomb of Samuel Jones, Queen Churchyard W6 DESIGNATION: Listed Building grade II, CA CONDITION: Poor CCUPANCY: N/A PHORITY CATEGORY: C (C) Tomb of Samuel Jones, Queen Churchyard W6 DESIGNATION: Listed Building grade II, CA CONDITION: Very bad CONDITION: Very bad C		LIST ENTRY NUMBER:	1072617	Contact: Adam O'Neill (LPA) 020 8753 3318
DESIGNATION: Listed Building grade II, CA CONDITION: Poor OCCUPANCY: N/A PRORITY CATEGORY: A (C) OWNER TYPE: Local authority LISTE NAME: Draped woman sculpture, North Verbena Gardens W6 DESIGNATION: Listed Building grade II, CA OWNER TYPE: Local authority LIST ENTRY NUMBER: 1436663 CONDITION: Poor CONDITION: Draped woman sculpture, North Verbena Gardens W6 DESIGNATION: Listed Building grade II, CA CONDITION: Poor CONDITION: Poor CONDITION: Poor Contact: Adam O'Neill (LPA) 020 8753 3318 CONDITION: Poor CONDITION: Concal authori	H AND	SITE NAME:	Hammersmith Cemetery,	Single-storey octagonal brick building with a slate roof, circa 1869, probably by George Saunders. A rare survival, reception houses were built to provide temporary resting
CONDITION: Poor rainwater goods are inadequate and failing, art to considerable deterioration of the stone drive to context. Adam O'Neill (LPA) 020 8753 3318 <td></td> <td>DESIGNATION:</td> <td>-</td> <td>places for bodies prior to burial. The stone mortuary slabs</td>		DESIGNATION:	-	places for bodies prior to burial. The stone mortuary slabs
Image: Strematic England OCCUPANCY: N/A Intervic England OCCUPANCY: A (C) Intervic England OWNER TYPE: Local authority Intervic England UST ENTRY NUMBER: 1436663 Intervic England STE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel Verbena Gardens W6 Intervice England STE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel Verbena Gardens W6 Intervice England STE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel Verbena Gardens W6 Intervice England STE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel Verbena Gardens W6 Intervice England STE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel Verbena Gardens W6 Intervice England STE NAME: Draped woman sculpture, N/A Cast concrete sculpture, circa 1959 by Karel Verbena Gardens W6 Intervice England Issternice England Issternice Street, St Paul's Churchyard W6 Contact: Adam O'Neill (LPA) 020 8753 3318 STE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6	TA	CONDITION:		rainwater goods are inadequate and failing, and this has led
PRIORITY CATEGORY: A (C) Cemetery have funded a costed condition surdiscussions are underway to secure funding to discussions are underway to secure funding to repairs. itsoric England LIST ENTRY NUMBER: 1436663 Contact: Adam O'Neill (LPA) 020 8753 3318 ISTE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel' situated in an open space off the Great West an early commission of the London County CP atronage of the Arts scheme, unusually com orvide visual amenity in compensation for a scheme. The cast concrete is now cracking in and past repairs are both unsightly and failing, occUPANCY: N/A istoric England N/A is also being damaged by rusting structural iror funding has been secured for a condition surdicipart of the C18. There is evidence of severe nor churchyard W6 Table tomb over a brick and stone plinth dati end of the C18. There is evidence of severe nor alings. Invasive vegetation and dumped rubb to be a problem. The Local Authority, Histor DESIGNATION: Listed Building grade II, CA OWNER TYPE: Local authority UST ENTRY NUMBER: 1431422 STE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Pau's Churchyard W6 DESIGNATION: Listed Building grade II, CA ONDITION: Very bad DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCULIPANCY:				to considerable deterioration of the stone dressings, brickwork and mortars. The Friends of Margravine
Itstoric England OWNER TYPE: Local authority repairs. Itstoric England LIST ENTRY NUMBER: I 436663 Contact: Adam O'Neill (LPA) 020 8753 3318 Itstoric England SITE NAME: Draped woman sculpture, North Verbena Gardens W6 Cast concrete sculpture, circa 1959 by Karel's situated in an open space off the Great West an early commission of the London County C Patronage of the Arts scheme, unusually com provide visual amenity in compensation for a scheme. The cast concrete is now cracking in and past repairs are both unsighty and falling, is also being damaged by rusting structural infor Funding has been secured for a condition sun OWNER TYPE: Local authority Itstoric England UST ENTRY NUMBER: I431422 Contact: Adam O'Neill (LPA) 020 8753 3318 SITE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6 Table tomb over a brick and stone plinth dati end of the C18. There is evidence of severe n railings. Invasive vegetation and dumped rubb to be a problem. The Local Authority, Histor the church are in discussion to agree a suitable will secure the repair of the monument and in setting.				Cemetery have funded a costed condition survey and
Historic England LIST ENTRY NUMBER: 1436663 Contact: Adam O'Neill (LPA) 020 8753 3318 Image: Strenk Product Prod	A REAL PROPERTY OF A REAL PROPER			
North Verbena Gardens W6 situated in an open space off the Great West an early commission of the London County CP Patronage of the Arts scheme, unusually com provide visual amenity in compensation for a scheme. The cast concrete is now cracking in and past repairs are both unsightly and failing, is also being damaged by rusting structural irro Funding has been secured for a condition sum Historic England VIC (C) Its E NTRY NUMBER: Id31422 SITE NAME: Tomb of Samuel Jones, Queen Churchyard W6 Designation: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority UST ENTRY NUMBER: I431422 Condition: Very bad OCCUPANCY: N/A PIGORITY CATEGORY: Very bad OCCUPANCY: N/A		LIST ENTRY NUMBER:	,	Contact: Adam O'Neill (LPA) 020 8753 3318
DESIGNATION: Listed Building grade II, CA CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority LIST ENTRY NUMBER: I431422 STE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6 DESIGNATION: Listed Building grade II, CA PRIORITY CATEGORY: C (A)		SITE NAME:		Cast concrete sculpture, circa 1959 by Karel Vogel, situated in an open space off the Great West Road. It was
CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority UIST ENTRY NUMBER: 1431422 STE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6 DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A		DESIGNATION:	Listed Building grade II. CA	an early commission of the London County Council's
OCCUPANCY: N/A scheme. The cast concrete is now cracking in and past repairs are both unsightly and failing. is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror Funding has been secured for a condition surverse is also being damaged by rusting structural iror funding has been secured for also to conditin	\sim	CONDITION:		provide visual amenity in compensation for a major road
PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority LIST ENTRY NUMBER: 1431422 Contact: Adam O'Neill (LPA) 020 8753 3318 STE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6 DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: A (A)		OCCUPANCY:		scheme. The cast concrete is now cracking in many places, and past repairs are both unsightly and failing. The concret
OWNER TYPE: Local authority LIST ENTRY NUMBER: 1431422 Contact: Adam O'Neill (LPA) 020 8753 3318 SITE NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6 DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: A (A)		PRIORITY CATEGORY:		is also being damaged by rusting structural iron elements.
Ist ENTRY NUMBER: 1431422 Contact: Adam O'Neill (LPA) 020 8753 3318 Iste NAME: Tomb of Samuel Jones, Queen Caroline Street, St Paul's Churchyard W6 Table tomb over a brick and stone plinth datiend of the C18. There is evidence of severe namage and erosion as well as rusting of the railings. Invasive vegetation and dumped rubb to be a problem. The Local Authority, Histor the church are in discussion to agree a suitable will secure the repair of the monument and in setting. PRIORITY CATEGORY: A (A)		OWNER TYPE:		r unding has been secured for a condition survey.
Caroline Street, Št Paul's Churchyard W6end of the C18. There is evidence of severe in damage and erosion as well as rusting of the in railings. Invasive vegetation and dumped rubb to be a problem. The Local Authority, Histori the church are in discussion to agree a suitabli will secure the repair of the monument and in setting.DESIGNATION:Very badOCCUPANCY:N/APRIORITY CATEGORY:A (A)	oric England	LIST ENTRY NUMBER:		Contact: Adam O'Neill (LPA) 020 8753 3318
DESIGNATION: Listed Building grade II, CA railings. Invasive vegetation and dumped rubb to be a problem. The Local Authority, Histor the church are in discussion to agree a suitabl will secure the repair of the monument and in setting. PRIORITY CATEGORY: A (A)	A CAL	SITE NAME:	Caroline Street, Št Paul's	Table tomb over a brick and stone plinth dating from the end of the C18. There is evidence of severe mechanical damage and erosion as well as rusting of the remaining
CONDITION: Very bad the church are in discussion to agree a suitable will secure the repair of the monument and in setting. PRIORITY CATEGORY: A (A)	in the second	DESIGNATION:		railings. Invasive vegetation and dumped rubbish continue
OCCUPANCY: N/A will secure the repair of the monument and in setting. PRIORITY CATEGORY: A (A)		CONDITION:		the church are in discussion to agree a suitable project that
PRIORITY CATEGORY: A (A)		OCCUPANCY:		will secure the repair of the monument and improve its setting.
		PRIORITY CATEGORY:		-
listoric England	oric England			Contact: Adam O'Neill (LPA) 020 8753 3318

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
 - use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HAMMERSMITH AND FULHAM

		W6	Nurses' home, 1938 by Burnet, Tait and Lorne. Works conversion to residential use have been completed and building is now occupied. Outstanding conditions attach to the Listed Building Consent, including the display of
	DESIGNATION:	Listed Building grade II, CA	artefacts, are yet to be discharged.
	CONDITION:	Good	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	F (F)	
) Historic England	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1269052	Contact: Adam O'Neill (LPA) 020 8753 3318
	SITE NAME:	Former Royal Masonic Hospital, Ravenscourt Park, Hammersmith W6	Hospital, 1933 by Thomas Tait, funded by the Freemason The building has been vacant since the closure of the NHS facility in 2006. Walls within the landscaped garden were
	DESIGNATION:	Listed Building grade II*, CA	demolished in anticipation of implementation of an approved scheme, but works then stalled. Various
of the Hannes	CONDITION:	Fair	proposals have since failed to come to fruition and the building has now been mothballed until a suitable scheme
	OCCUPANCY:	Vacant/not in use	can be identified.
	PRIORITY CATEGORY:	E (E)	
and the second state of the second	OWNER TYPE:	Commercial company	
) Historic England	LIST ENTRY NUMBER:	1192740	Contact: Verena McCaig 020 7973 3718
			U U
	SITE NAME:	Number 2 Gasholder, Fulham Gas Works, Sands End Lane SW6	Gasholder dating from 1830, and considered to be the oldest surviving gasholder in the world. It consists of a single lift wrought iron holder, guided by cast iron 'A'
	DESIGNATION:	Listed Building grade II*, CA	frames with circle decoration. The wider Gas Works site being decommissioned and an application has been made
	CONDITION:	Poor	for Planning Permission for redevelopment. Investigatory works are required into the condition of the gasholder
	OCCUPANCY:	N/A	which will inform its future restoration and re-use on t site. Discussions have commenced between the develo the Local Authority and Historic England.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Utility	, 5
) Historic England	LIST ENTRY NUMBER:	1261959	Contact: Verena McCaig 020 7973 3718
	SITE NAME:	Church of St John, North End Road, Walham Green SW6	Church built in 1827 designed by George Ledwell Taylor. Stonework repairs to the tower and the re-roofing of the
	DESIGNATION:	Listed Place of Worship grade II, CA	aisle roofs were completed in 2016, grant-aided by Histor England and the Heritage Lottery Fund. The nave and chancel were re-roofed in 2017 with funding from the
	CONDITION:	Poor	Listed Places of Worship Roof Repair Fund. The church interior and electrics remain in poor condition and a new
	PRIORITY CATEGORY:	C (F)	below ground rainwater drainage system is required.
1 0- 0- T	OWNER TYPE:	Religious organisation	
Literation Frederical	LIST ENTRY NUMBER:	1079751	Contact: Tracey Craig 020 7973 3756
) Historic England			
TAL	SITE NAME:	Church of St Stephen the Martyr and St Thomas, including stone wall surrounding churchyard, Uxbridge Road W12	Built in 1850, designed by Antony Salvin. Coursed rubbl walling with Bath stone dressings and slate pitched roofs The spire was removed following war damage and the tower is now surmounted with a low octagonal fleche. Roofs and rainwater goods are in poor condition resulti
LAN	DESIGNATION:	Listed Place of Worship grade II, CA	in water ingress.
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
) Historic England	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1261971	Contact: Tracey Craig 020 7973 3756

- solution agreed.
 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
 C Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

use).

redundant buildings with new use agreed but not yet implemented.

New Entry is noted).

- LPA
 Local Planning Authority

 NP
 National Park

 RPG
 Registered Park and Garden

 SM
 Scheduled Monument

 UA
 Unitary Authority

 WHS
 World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HAMMERSMITH AND FULHAM / HARINGEY

SITE NAME:	St Mary's, Kensal Green NW10		
DESIGNATION:	Conservation Area, 10 LBs, part in RPG grade I	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Adam O'Neill (LPA) 020 8753 3318

HARINGEY

-			
	SITE NAME:	Alexandra Palace, Alexandra Palace Way, Wood Green N10	Entertainment complex including exhibition halls and theatre, built 1868-75. From 1935 part of Alexandra Palace
	DESIGNATION:	Listed Building grade II, part in RPG grade II, CA	was leased to the BBC. Urgent repairs to the loggia on the south terrace (western end) and south east roofs were completed in 2013, part funded by Historic England.
State Manual	CONDITION:	Poor	Repairs to the eastern part of the building, including the theatre, are well underway with funding from Haringey Council and the Heritage Lottery Fund. The theatre is du
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	F (F)	to open to the public in December 2018. Discussions regarding other parts of the building are ongoing.
	OWNER TYPE:	Charity (heritage)	
© Historic England	LIST ENTRY NUMBER:	1268256	Contact: Conservation Officer (LPA) 020 8489 4497



SITE NAME: Hornsey Town Hall, Broadway N8 Built in 1935 to the design of RH Uren. Modelled o Dudock's seminal town hall at Hilversum and an im	portant
DESIGNATION: Listed Building grade II*, CA influence in subsequent British town hall design. Th building is in a poor condition, particularly the Asse	mbly
CONDITION: Poor Hall to the rear. The Local Authority has agreed to ownership to Far East Consortium International Ltd	
OCCUPANCY: Part occupied/part in use includes an agreement to guarantee continued publ	reement to guarantee continued public use of, parts of the building. The town hall modate a hotel, with new residential
PRIORITY CATEGORY: D (D) access to, and use of, parts of the building. The tow will also accommodate a hotel, with new residentia	
OWNER TYPE: Local authority development to the rear. Works are due to start o 2019.	n site in
LIST ENTRY NUMBER: 1263688 Contact: Rebecca Barrett 020 7973 3716	

© Historic England



SITE NAME:	Public toilets, Bruce Grove, Tottenham N17	Public toilet circa 1920, with fine external ironwork. The building is currently empty and in a deteriorating condition.
DESIGNATION:	Listed Building grade II, CA	Some works to secure the building have been carried out and the ironwork has been restored, but further works are
CONDITION:	Poor	needed. The Local Authority has commissioned a feasibility study to explore possible new uses for the building and
OCCUPANCY:	Vacant/not in use	applications for full repair are expected in late 2018.
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1259316	Contact: Conservation Officer (LPA) 020 8489 4497

© London Borough of Haringey



SITE NAME:	7, Bruce Grove, Tottenham NI7	One of a pair of early C19 houses. The building is vacant and has suffered substantial internal collapse. A scheme of
DESIGNATION:	Listed Building grade II, CA	refurbishment and conversion to flats has been approved and work is due to start in 2018.
CONDITION:	Very bad	
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	B (B)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1188605	Contact: Conservation Officer (LPA) 020 8489 4497

© London Borough of Haringey

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	West wall, Bruce Castle Park, Church Lane, Tottenham N17	C17 red brick boundary wall to Bruce Castle Park. In urgent need of essential repairs as the brickwork is
	DESIGNATION:	Listed Building grade II, CA	deteriorating. An initial programme of repairs has been undertaken, but further works are needed.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
Haringey	LIST ENTRY NUMBER:	1294666	Contact: Conservation Officer (LPA) 020 8489 4497

© London Borough of Haringey

© Historic E

© London Borough of H

SITE NAME: Probably early C17 red brick wall in Flemish bond, with tall South boundary wall to Bruce Castle Park, Lordship Lane, sloped coping and plinth. The wall is ramped gently up at intervals towards the west. It is now seriously deteriorating Tottenham NI7 with open decayed pointing, loose and unstable brickwork, DESIGNATION: Listed Building grade II, CA previous re-pointing damage, and extensive ivy/creeper and frost damage. A programme of urgent repairs has been CONDITION: Poor undertaken, but further repairs are required. OCCUPANCY: N/A PRIORITY CATEGORY: A (A) OWNER TYPE: Local authority LIST ENTRY NUMBER: 1079218 Contact: Conservation Officer (LPA) 020 8489 4497

	SITE NAME:	662, High Road, Tottenham N17	Early C18 building of three storeys, in stock brick with stone coped parapet, lower than the neighbouring
H H	DESIGNATION:	Listed Building grade II, CA	properties with which it has group value. The building was badly fire damaged during the 2011 riots. Listed Building
	CONDITION:	Fair	Consent has been granted for the repair and refurbishment of the building for residential use, including a mansard
	OCCUPANCY:	Vacant/not in use	extension at roof level. Works are now complete to the
	PRIORITY CATEGORY:	F (F)	upper floors. Discussions are ongoing between the Local Authority and the owner regarding the ground floor shop
	OWNER TYPE:	Commercial company	front.
: England	LIST ENTRY NUMBER:	1358832	Contact: Conservation Officer (LPA) 020 8489 4497

Early C19 house last used as offices. Planning Permission SITE NAME: Warmington House, 744, High and Listed Building Consent have been granted for the Road, Tottenham NI7 wider regeneration of the area, which includes the DESIGNATION: Listed Building grade II, CA restoration of Warmington House and its use as a museum. Repair works have started and are due to finish in CONDITION: Fair 2018. OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: F (D) © London Borough of Haringey



	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1358833	Contact: Conservation Officer (LPA) 020 8489 4497
	SITE NAME:	810, High Road, Tottenham N17	Fine house built circa 1715 as part of a symmetrical pair. Planning Permission and Listed Building Consent have been
	DESIGNATION:	Listed Building grade II*, CA	granted for the refurbishment and re-use of the building as part of Tottenham Hotspur Football Club's wider
	CONDITION:	Fair	redevelopment proposals. Work has not yet started.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1358835	Contact: Rebecca Barrett 020 7973 3716

PRIORITY CATEGORIES

© London Borough of Haringey

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Retaining wall along Highgate Hill (The Bank), Highgate Hill, Highgate N6	Early C19 retaining wall along Highgate Hill between the street pavement and higher paved walk. Some repairs were carried out in 2010/11. Temporary measures were
	DESIGNATION:	Listed Building grade II, CA	implemented in January 2018 to safeguard the wall and permanent repairs have been agreed but not yet
	CONDITION:	Poor	implemented.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Local authority	
© London Borough of Haringey	LIST ENTRY NUMBER:	1079237	Contact: Conservation Officer (LPA) 020 8489 4497

	SITE NAME:	62, Monument Way, Tottenham N17	Late C18 three storey detached house, also known as 62 High Cross Road. The building has been seriously affected
	DESIGNATION:	Listed Building grade II	by water penetration into the structure and interior. Permission for conversion into flats was granted in August
	CONDITION:	Poor	2012, but was not implemented.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (D)	
	OWNER TYPE:	Private	
© London Borough of Haringey	LIST ENTRY NUMBER:	1079226	Contact: Conservation Officer (LPA) 020 8489 4497



		1077220	
1	SITE NAME:	Porters and Walters Almshouses, St Leonard's Almshouses, Nightingale Road, Wood Green N22	Four two storey almshouses, circa 1904, which form a group with a commemorative stone and front railings. The buildings have suffered from a lack of proper maintenance over a number of years.
	DESIGNATION:	Listed Building grade II, CA	
	CONDITION:	Poor	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1079222	Contact: Conservation Officer (LPA) 020 8489 4497

41	SITE NAME:	37, North Road N6	Early C19 house of two storeys and basement, part of two
	DESIGNATION:	Listed Building grade II, CA	pairs linked by recessed porches. The building is built of red brick, with cement detailing including pilaster strips,
	CONDITION:	Poor	entablature and cornice. The condition of the property is deteriorating. The Local Authority is considering options to
- AL-FAX	OCCUPANCY:	Unknown	secure the full repair of the building.
and the second	PRIORITY CATEGORY:	C (C)	
The take	OWNER TYPE:	Private	
·····································	LIST ENTRY NUMBER:	893	Contact: Conservation Officer (LPA) 020 8489 4497

© London Borough of Haringey



	SITE NAME:	Church of St Augustine, Archway Road, Hornsey N6	The Art Workers Guild background of the three architects involved in this late C19 church is very apparent. JF Sedding
	DESIGNATION:	Listed Place of Worship grade II, CA	started the work, was succeeded by his pupil Henry Wilson (west nave and Lady Chapel) and J Harold Gibbons, who in 1916 completed the Arts and Crafts
-	CONDITION:	Poor	facade with its Calvary. The church is dressed in Bath stone and red brick dressings under a plain tiled roof. Internal
N.	PRIORITY CATEGORY:	F (F)	fittings are of a high quality. The tower roof was repaired in
	OWNER TYPE:	Religious organisation	2017 and the Calvary Statuary is being repaired in 2018, both with a grant from the Heritage Lottery Fund.
	LIST ENTRY NUMBER:	1358860	Contact: lan Harper 020 7973 3786

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	Parish Church of All Hallows, Church Lane, Tottenham N17	This medieval church incorporates a C14 tower with C18 battlements. The north aisle was rebuilt in 1855. The chancel, east end extensions and raised clerestories were by William Butterfield in 1875-7. Much C14 and C15 fabric survives internally but some in a decayed condition. In 2017 the roofs and valley gutters were repaired with a grant from the Listed Places of Worship Roof Repair Fund.
	DESIGNATION:	Listed Place of Worship grade II*, CA	
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1188633	Contact: Ian Harper 020 7973 3786
© Historic England			

En 1
II BII R. BULLER

© Historic England

A.	SITE NAME:	The Palace Cathedral (former Tottenham Palace Theatre), High Road, Tottenham N17	The former Tottenham Palace Theatre was built in 1908 by Wylson Long as a variety theatre. The building is now in use for worship. It is suffering from water ingress, which is
-1	DESIGNATION:	Listed Place of Worship grade II, CA	causing significant damage to both the structure and interior plaster work. Some repairs were carried out to the front roofs in 2015, but considerable further work is
A MAR	CONDITION:	Poor	required. Discussions between the Local Authority and the congregation are ongoing to secure necessary urgent
	PRIORITY CATEGORY:	A (A)	works.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1249660	Contact: Ian Harper 020 7973 3786

SITE NAME: Bruce Grove NI7 NEW ENTRY ?: DESIGNATION: Conservation Area, LB grade II No CONDITION: TREND: Very bad Improving VULNERABILITY: CONTACT: Lucy Morrow (LPA) 020 8489 4497 Low SITE NAME: Clyde Circus N15 NEW ENTRY ?: DESIGNATION: Conservation Area No CONDITION: Poor TREND: Deteriorating VULNERABILITY: Medium CONTACT: Lucy Morrow (LPA) 020 8489 4497 SITE NAME: Hornsey Water Works and Filter Beds, Hornsey N8 DESIGNATION: NEW ENTRY? Conservation Area, 2 LBs, part in RPG grade II No CONDITION Fair TREND. Deteriorating significantly VULNERABILITY: Medium CONTACT: Lucy Morrow (LPA) 020 8489 4497 SITE NAME: North Tottenham High Road N17 DESIGNATION: Conservation Area, 30 LBs NEW ENTRY? No CONDITION: TREND: Very bad Improving VULNERABILITY: CONTACT: Lucy Morrow (LPA) 020 8489 4497 Medium SITE NAME: Scotland Green N17 DESIGNATION: Conservation Area, 4 LBs NEW ENTRY? No CONDITION: TREND: Very bad Improving VULNERABILITY: Medium CONTACT: Lucy Morrow (LPA) 020 8489 4497

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HARROW



SITE NAME:	Brick Kiln to south east of the Kiln, Common Road, Stanmore	Lower part of an C18 brick kiln conical chir the upper part no longer exists. In urgent n
DESIGNATION:	Listed Building grade II	stabilisation and repair.
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1079710	Contact: Lucy Haile (LPA) 020 8736 6101

Former Wealdstone Police Station, High Street HA3

Listed Building grade II

Vacant/not in use

Fair

A (A)

Private

1245418

k kiln conical chimney of which exists. In urgent need of structural

Former police station with magistrates' court, later part

after illegal entry by squatters in 2016. Applications were

submitted for the latest scheme and a decision is awaited.

refused in 2016 and 2017 for a proposed new use with extensions and new buildings. An appeal has been

Discussions with the owner are ongoing regarding

Contact: Lucy Haile (LPA) 020 8736 6101

maintenance issues.

library and then entirely a police station. Built in 1908-9 by J Dixon Butler in Free Tudor style. The building has been empty since 2015 and is currently boarded up and secure

© London Borough of Harrow



2	SITE NAME:	Pinner Park Farmhouse, George V Avenue, Pinner	The building dates from circa 1750. It is two storeys with three bays plus hipped wing. The windows to the main
~	DESIGNATION:	Listed Building grade II	house are altered. The building appears in good condition externally but the interior requires attention. There has
	CONDITION:	Poor	been damage from water penetration from the central valley gutter and the building is partly vacant.
I	OCCUPANCY:	Part occupied/part in use	valie, getter and the ballening is partly vacant.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1079715	Contact: Lucy Haile (LPA) 020 8736 6101

© London Borough of Harrow



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England



© London Borough of Harrow



N.S.	SITE NAME: Garden wall to Bernays Gardens, Old Church Lane, Stanmore		C19 wall with buttresses. A high number of bricks are significantly decayed and the wall is in need of repointing. The Local Authority has obtained Listed Building Consent	
ALL A	DESIGNATION:	Listed Building grade II, CA	for works to repair the wall and are investigating funding options.	
A	CONDITION:	Poor		
	OCCUPANCY:	N/A		
	PRIORITY CATEGORY:	D (D)		
18	OWNER TYPE:	Local authority		
	LIST ENTRY NUMBER:	1079749	Contact: Lucy Haile (LPA) 020 8736 6101	
	SITE NAME:	Boundary wall fronting road from Nos 118-128, Stanmore Hill (east side), Stanmore	C18 brick wall with buttresses with chamfered bases. M bricks at the base have weathered away and parts require pointing. The Local Authority is discussing repairs wit	
TT.	DESIGNATION:	Listed Building grade II, CA	the owners.	
	CONDITION:	Poor		
5.34	OCCUPANCY:	N/A		
The state of the				

© London Borough of Harrow

Contact: Lucy Haile (LPA) 020 8736 6101

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

D

Е

C (C)

Private

1194205

obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building CA

- LB LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

44

HERITAGE AT RISK 2018 / LONDON / HARROW

HERITAGE AT RISK 2018 / LONDO			
	SITE NAME:	Boundary wall fronting road (Wellington House), Stanmore Hill (West Side), Stanmore	This brick wall originates from the C18 or early C19. It is 10 foot high, built of red brick with chamfered pilaster buttresses. Many sections of the wall have weathered away
	DESIGNATION:	Listed Building grade II, CA	and parts require repointing. Listed Building Consent was granted in 2016 for repairs to part of the wall and these
	CONDITION:	Poor	were completed in 2018. A suitable scheme for the remaining section is awaited.
	OCCUPANCY:	N/A	remaining section is awared.
and the second se	PRIORITY CATEGORY:	C (D)	
	OWNER TYPE:	Private, multiple owners	
© Historic England	LIST ENTRY NUMBER:	1079648	Contact: Lucy Haile (LPA) 020 8736 6101
	SITE NAME:	Wall to west and north of Springbok House, Wood Lane	C19 wall, 11 foot high, with stone copings, recessed in the centre to pass through the porte-cochere. The wall forms a
	DESIGNATION:	Listed Building grade II, CA	curved forecourt and screening to Springbok House, now the Hussaini Shia Islamic Centre. A leaning section of the
	CONDITION:	Poor	wall was deemed a dangerous structure by the Local Authority and was taken down in 2018 for safety reasons.
	OCCUPANCY:	N/A	The wall has temporary protective hoarding and scaffolding
	PRIORITY CATEGORY:	C (New entry)	in place whilst discussions continue with the owner on its reinstatement and funding of the work.
and the second second	OWNER TYPE:	Charity (non-heritage)	
© London Borough of Harrow	LIST ENTRY NUMBER:	1358673	Contact: Lucy Haile (LPA) 020 8736 6101
- - T T	SITE NAME:	The Rayners public house, 23, Village Way East	A virtually unaltered 1930s public house retaining its internal plan form and original fittings. Listed Building
	DESIGNATION:	Listed Building grade II	Consent was granted for the repair, renovation and re-use of the building. These works have largely been
	CONDITION:	Good	implemented and the building is now in educational use. However, unauthorised signage and some alterations to
	OCCUPANCY:	Occupied/in use	the interior still need addressing.
1 50-0	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
© London Borough of Harrow	LIST ENTRY NUMBER:	1392310	Contact: Lucy Haile (LPA) 020 8736 6101
. Also	SITE NAME:	Old Stanmore Church, Church Road, Stanmore	The now roofless ruined church of St John the Evangelist was built in 1632, attributed to Nicholas Stone. The wall
	SITE NAME: DESIGNATION:		was built in 1632, attributed to Nicholas Stone. The wall heads have exposed brickwork allowing rainwater ingress. This is resulting in the erosion of mortar and bricks and supporting deleterious plant growth. There is decayed
		Road, Stanmore Listed Place of Worship grade	was built in 1632, attributed to Nicholas Stone. The wall heads have exposed brickwork allowing rainwater ingress. This is resulting in the erosion of mortar and bricks and supporting deleterious plant growth. There is decayed mortar, brick, stone and timber elsewhere around the
	DESIGNATION:	Road, Stanmore Listed Place of Worship grade II*, CA	was built in 1632, attributed to Nicholas Stone. The wall heads have exposed brickwork allowing rainwater ingress. This is resulting in the erosion of mortar and bricks and supporting deleterious plant growth. There is decayed
	DESIGNATION: CONDITION:	Road, Stanmore Listed Place of Worship grade II*, CA Poor	was built in 1632, attributed to Nicholas Stone. The wall heads have exposed brickwork allowing rainwater ingress. This is resulting in the erosion of mortar and bricks and supporting deleterious plant growth. There is decayed mortar, brick, stone and timber elsewhere around the building along with some vertical cracking in the walling.
© Historic England	DESIGNATION: CONDITION: PRIORITY CATEGORY:	Road, Stanmore Listed Place of Worship grade II*, CA Poor C (C)	was built in 1632, attributed to Nicholas Stone. The wall heads have exposed brickwork allowing rainwater ingress. This is resulting in the erosion of mortar and bricks and supporting deleterious plant growth. There is decayed mortar, brick, stone and timber elsewhere around the building along with some vertical cracking in the walling.

A C16 estate enlarged and improved in the late C18. Sir Uvedale Price and William Gilpin influenced the design in SITE NAME: **Bentley Priory** Registered Park and Garden the early C19. Royal Air Force Fighter Command occupied DESIGNATION: the mansion from 1936, which played a central role in grade II, LB grade II* World War II, now converted to a museum with Generally satisfactory but with CONDITION: residential units, and new housing in the grounds. The significant localised problems Italian gardens and most of the immediate landscaped VULNERABILITY: Medium surrounds of the mansion have been restored, but boundary treatment, views and the character of the lake in TREND: Stable land owned and managed by the Local Authority remain issues to be resolved. NEW ENTRY ?: No OWNER TYPE: Mixed, multiple owners LIST ENTRY NUMBER: 1001440 Contact: Christopher Laine 07780 545 979

© Historic England

PRIORITY CAT	egories
--------------	---------

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HARROW / HAVERING

HERITAGE AT RISK 2018 7 LOI	NDON / HARROW / HAVERING		
SITE NAME:	Grim's Ditch: four linear sections between Uxbridg	e Road and Oxhey	' Lane
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1003530
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Local authority, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Grim's Ditch: section extending 1500yds (1370m) r	north east from O>	khey Lane
DESIGNATION:	Scheduled Monument, part in RPG grade II, part in CA	LIST ENTRY NUMBER:	1002044
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Grim's Ditch: section north of Blythwood House		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002007
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Linear earthworks in Pear Wood, west of Watling	Street	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001996
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Pinner deer park, Pinner Park Farm		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1019135
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145

HAVERING



C16 and later garden walls to Ockendon Hall (now SITE NAME: Garden walls to former North demolished). These extensive walls are slowly deteriorating Ockendon Hall, Church Lane, although the owners are making efforts to prevent further North Ockendon damage from vegetation. DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1300500 Contact: Martyn Thomas (LPA) 01708 432845

PRIORITY CATEGORIES

© London Borough of Havering

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HAVERING




	SITE NAME:	Outbuilding to the rear of The Old Anchor, Harwood Hall Lane	C19 timber-framed outbuildings which continue the line of the rear wing of The Old Anchor, a C18 timber-framed house. The building is currently used as a workshop. It is in
1	DESIGNATION:	Listed Building grade II, CA	need of roof and brickwork repairs, new rainwater goods, and renewal of the timber lintels. The Local Authority and
l	CONDITION:	Very bad	Historic England are monitoring the condition of the building and have discussed essential repairs with the
l	OCCUPANCY:	Occupied/in use	owner.
l	PRIORITY CATEGORY:	C (C)	
2	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1079891	Contact: Martyn Thomas (LPA) 01708 432845

© Historic England



SITE NAME:	Mill Cottage, The Dell, High Street, Hornchurch	Single storey timber-framed range, now one dwelling, dating from the C17. The building is in very bad condition
DESIGNATION:	Listed Building grade II, CA	and continuing to deteriorate. The roof has undergone extensive temporary repair but continues to present major
CONDITION:	Very bad	maintenance problems. Historic England and the Local Authority are in contact with the owner and monitoring
OCCUPANCY:	Occupied/in use	the building.
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1079898	Contact: Martyn Thomas (LPA) 01708 432845

© Historic England

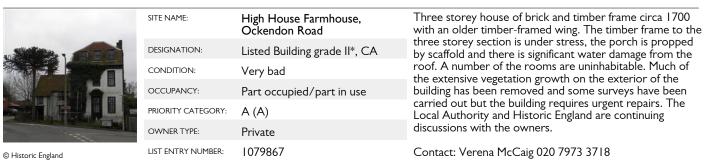

Two brick barns and garden

walls to south of Bretons

House, Rainham Road,

Listed Building grade II

Part occupied/part in use

Hornchurch

Local authority

Very bad

A (A)



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

© London Borough of Havering



LIST ENTRY NUMBER:	1300053	Contact: Martyn Thomas (LPA) 01708 432845
SITE NAME:	Upminster Windmill, St Mary's Lane, Upminster	Smock mill 1803, retaining original machinery. The Friends of Upminster Windmill, in conjunction with the Local
DESIGNATION:	Listed Building grade II*	Authority, have been awarded a grant from the Heritage Lottery Fund. The project includes the full restoration of
CONDITION:	Fair	the mill, and the provision of a workshop and visitors' centre on the site. The adjacent visitors' centre is
OCCUPANCY:	Vacant/not in use	complete, and restoration works are in progress on the
PRIORITY CATEGORY:	F (F)	mill itself, with the cap and sails removed for restoration off-site.
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1079878	Contact: Verena McCaig 020 7973 3718

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Two Tudor barns set around a cobbled courtyard close to

the CI6 garden walls, all associated with Bretons House.

One barn is watertight and in partial use although

deteriorating, and with some earlier unsympathetic alterations and additions. The other barn is in need of

extensive repair, particularly to the roof and walls, and suffers from vandalism. The garden walls are in need of

extensive repair and protection, with areas of collapse. A Conservation Statement has been prepared for these

assets and plans for the wider site are being developed.

However, immediate repairs are required.

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM ÍΙΑ

Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / HAVERING / HILLINGDON

100	The Chase, Cranham The	C16 walls to an earlier house on the site of Cranham Hall. The wall is in need of extensive repairs. Previous localised	
	DESIGNATION:	Listed Building grade II, CA	repairs are inappropriate and uncontrolled plant and tree growth is causing further damage and deterioration.
	CONDITION:	Very bad	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (A)	
	OWNER TYPE:	Private	
h of Havering	LIST ENTRY NUMBER:	1183600	Contact: Martyn Thomas (LPA) 01708 432845

and 54, The Grove, U	SITE NAME:	Footbridge to rear of Nos. 52 and 54, The Grove, Upminster	Footbridge and eye-catcher, circa 1765, probably by James Paine who laid out the estate of Gaynes Park in the 1760s
	DESIGNATION:	Listed Building grade II	for Sir James Esdaile, Lord Mayor of London 1777-78. Erection of fencing on the bridge has seriously damaged the
	CONDITION:	Very bad	structure. Extensive vegetation growth is further
	N/A	threatening its stability. Some structural repairs have been carried out in the past but further works are urgently	
	PRIORITY CATEGORY:	A (A)	required.
	OWNER TYPE:	Local authority	
gland	LIST ENTRY NUMBER:	1323729	Contact: Martyn Thomas (LPA) 01708 432845

SITE NAME: Dagnam Park Farm moated site, Noak Hill, Romford DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1001988 Generally satisfactory but with minor localised CONDITION: TREND: Stable problems PRINCIPAL VULNERABILITY: NEW ENTRY? No Vandalism OWNER TYPE: Local authority CONTACT: Elizabeth Whitbourn 07889 808145 SITE NAME: Romford DESIGNATION: Conservation Area, 4 LBs NEW ENTRY ?: No CONDITION: TREND: Very bad Improving VULNERABILITY: Medium CONTACT: Planning Service (LPA) 01708 433100

HILLINGDON

© London Borough

© Historic Engl

	SITE NAME:	Barn to the west of Weekly House, Bath Road, Harmondsworth	Late C17 or early C18 weatherboarded barn with tiled roof and Queen post truss at the west end. Weekly House, the boundary wall and the barn form a group. The
1	DESIGNATION: Listed Building grade II, CA		barn is in a dilapidated state.
Alt - Je .	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
lillingdon	LIST ENTRY NUMBER:	1286544	Contact: Ian Thynne (LPA) 01895 558326

© London Borough of Hill



SITE NAME:	Former King Henry public house and stables, 456, Bath Road, Longford	Converted to a house, the rear of the building is the former King Henry public house. The front part of the property has been rebuilt, using old material, after a fire. All
DESIGNATION:	Listed Building grade II	the walls have exposed timber framing with brick filling and tiled roofs. The adjacent stables are also of interest with an
CONDITION:	Poor	early diamond mullioned window. The buildings are in poor condition, but have been secured by the owner. They have
OCCUPANCY:	Vacant/not in use	been included in larger development proposals.
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1080296	Contact: Ian Thynne (LPA) 01895 558326

© London Borough of Hillingdon PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet
- implemented. C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBF	EVIATIONS
CA	Conservation Area

- C/ LB LPA
- Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Haves Company for HMV	1912 factory building by the Trussed Concrete Steel Company for HMV. It has an unusual design with a high
	DESIGNATION:	Listed Building grade II, CA	level water tank and is an important local landmark. The building is partially occupied and in a deteriorating
	CONDITION:	Poor	condition. Proposals for conversion to residential use have now been agreed but not yet been implemented.
	OCCUPANCY:	Part occupied/part in use	now been agreed but not yet been implemented.
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
© London Borough of Hillingdon	LIST ENTRY NUMBER:	24486	Contact: Ian Thynne (LPA) 01895 558326

	SITE NAME:	Langley Farm Barn, Breakspear Road North, Harefield	C16 barn in private ownership at Langley Farm. The three bay barn is timber-framed and weatherboarded with a tilec
	DESIGNATION:	Listed Building grade II, CA	roof. It has lost parts of the brick plinth to the north east elevation. Listed Building Consent and Planning Permission
	CONDITION:	Very bad	have been granted for residential use and work has started on site.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
© London Borough of Hillingdon	LIST ENTRY NUMBER:	1080261	Contact: Ian Thynne (LPA) 01895 558326

	SITE NAME:	Garden walls to Church Gardens Nursery, Church Hill, Harefield	C17 red brick garden walls in need of extensive repairs. Some works have already been undertaken to a good standard.
	DESIGNATION:	Listed Building grade II, RPG grade II, CA	
	CONDITION:	Fair	
	OCCUPANCY:	N/A	
A CONTRACTOR	PRIORITY CATEGORY:	B (B)	
© Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1080272	Contact: Ian Thynne (LPA) 01895 558326

Wall running south from the Old Gatehouse west along Church Road, Hillingdon

Listed Building grade II*, CA

Poor

N/A

C (C)

Private



© Historic England



	LIST ENTRY NUMBER:	1358326	Contact: Elizabeth Whitbourn 07889 808145
The second	SITE NAME:	Walls around St Martin's churchyard, north side, Church Road, Hillingdon	Red brick boundary and retaining wall for St Martin's churchyard. Cl6 red brick walls, with tall sloped coping, along the east and north sides of the churchyard and the
	DESIGNATION:	Listed Building grade II*, CA	northern part of the west side. At the south end of the east side there is a square pier with stone cornice and ball
and the	CONDITION:	Poor	finials. A condition survey has been carried out and discussions are underway to secure funding for the
7	OCCUPANCY:	N/A	necessary works.
7	PRIORITY CATEGORY:	C (C)	
71-1	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1286366	Contact: Elizabeth Whitbourn 07889 808145

© Historic England

D

Е

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

C16 red brick wall of varied height, breached in places to create access for houses behind. Some sections have been

been prepared, with funding from Historic England, and discussions are underway with the owners of the wall

repaired, but the quality is varied and much of the remainder is in poor condition. A condition assessment has

regarding the necessary repairs.

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

The second second	SITE NAME:	Walls around St Martin's churchyard, south side, Church Road, Hillingdon	Red brick boundary and retaining wall along the south part of the west side and the south side of St Martin's churchyard. Lower parts of C16 red brick, with the upper
	DESIGNATION:	Listed Building grade II, CA	part rebuilt probably in the C19. A condition survey has been carried out and discussions are underway to secure
	CONDITION:	Poor	funding for the necessary works.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1080276	Contact: Ian Thynne (LPA) 01895 558326
	SITE NAME:	Wall in front of numbers 30 to 36 (even), Church Road, Hillingdon	C16 red brick wall of varied height, breached in places to create access for houses behind. Some sections have beer repaired, but the quality is varied and much of the
	DESIGNATION:	Listed Building grade II, CA	remainder is in poor condition. A condition assessment hat been prepared, with funding from Historic England, and
the states	CONDITION:	Poor	discussions are underway with the owners of the wall
	OCCUPANCY:	N/A	regarding the necessary repairs.
and the second second	PRIORITY CATEGORY:	C (C)	
- A Ward	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1080277	Contact: Ian Thynne (LPA) 01895 558326
		10002/7	
	SITE NAME:	Wall in front of numbers 40 to 50 (even), Church Road, Hillingdon	CI6 red brick wall of varied height, breached in places to create access for houses behind. Some sections have bee repaired, but the quality is varied and much of the
NASSE	DESIGNATION:	Listed Building grade II, CA	remainder is in poor condition. A condition assessment h been prepared, with funding from Historic England, and
	CONDITION:	Poor	discussions are underway with the owners of the wall
	OCCUPANCY:	N/A	regarding the necessary repairs.
	PRIORITY CATEGORY:	C (C)	
1 - 2	OWNER TYPE:	Private	
D Historic England	LIST ENTRY NUMBER:	358327	Contact: Ian Thynne (LPA) 01895 558326
	SITE NAME:	Walls in front of numbers 52-58 (even) and along west end of property, Church Road, Hillingdon	C16 red brick wall of varied height, breached in places to create access for houses behind. Some sections have bee repaired, but the quality is varied and much of the remainder is in poor condition. A condition assessment h
	DESIGNATION:	Listed Building grade II, CA	been prepared, with funding from Historic England, and discussions are underway with the owners of the wall
TRANSPORT OF LAST	CONDITION:	Poor	regarding the necessary repairs.
Contraction of the local division of the loc	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1286348	Contact: Ian Thynne (LPA) 01895 558326
	SITE NAME:	Walls to east and south of	C16 red brick wall of varied height, breached in places to
		garden of number 28 (Coombe House), Church Road, Hillingdon	create access for houses behind. Some sections have repaired, but the quality is varied and much of the remainder is in poor condition. A condition assessme been prepared, with funding from Historic England, a
	DESIGNATION:	Listed Building grade II*, CA	discussions are underway with the owners of the wall
	CONDITION:	Poor	regarding the necessary repairs.
	OCCUPANCY:	N/A	
/	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
D Historic England	OWNER THE.	Trivate	

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

© His

	SITE NAME:	Lych gate to south of Church of St Mary, Church Walk, Hayes	Circa C16 timber lych gate with tiled roof. The timber supports and base are in a very poor state of repair and
	DESIGNATION:	Listed Building grade II, CA	tiles are slipping from the roof. No repairs are planned.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
Historic England	LIST ENTRY NUMBER:	1080234	Contact: Ian Thynne (LPA) 01895 558326

-	SITE NAME:	Cinema, RAF Uxbridge, Grays Road, Uxbridge	Designed in 1918, the building has a large auditorium used historically as a lecture hall, cinema or concert hall. It was
1 miles	DESIGNATION:	Listed Building grade II	converted to a gymnasium in the 1960s. The building is vacant and in poor condition. The roof is being protected
A AND	CONDITION:	Poor	by temporary covers and its condition is being monitored. The Local Authority is considering options for re-use.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Commercial company	
© London Borough of Hillingdon	LIST ENTRY NUMBER:	1392376	Contact: Ian Thynne (LPA) 01895 558326

	SITE NAME:	Front garden wall, The Beeches, High Street, Cowley	C18 red brick wall with sloped coping, located to the north of the Beeches. Repairs to the house have been completed
	DESIGNATION:	Listed Building grade II	and it has been removed from the Heritage at Risk Register. Repairs to the wall are still outstanding.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
© London Borough of Hillingdon	LIST ENTRY NUMBER:	1194165	Contact: Ian Thynne (LPA) 01895 558326

A.P.	SITE NAME:	The Cedars, 66, High Street, Uxbridge	C18 town house with later additions. Three storeys, central doorway with Doric pilasters, entablature and open
	DESIGNATION:	Listed Building grade II, CA	pediment. Red brick facade, with bands at first and second floors, and a cornice with plain tiled roof. The building has
	CONDITION:	Fair	distinctive Dutch gables to the side elevation.
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Charity (non-heritage)	
© London Borough of Hillingdon	LIST ENTRY NUMBER:	1358372	Contact: Ian Thynne (LPA) 01895 558326



SITE NAME: The Dower House, 393, High Two storey house with C18 brick front to an older timberframed structure, with large rebuilt CI6 chimney. The Street, Harlington house is four windows wide, built of brown brick with red DESIGNATION: Listed Building grade II brick quoins and window dressings. The building suffered severe fire damage in May 2011. In May 2018 the Council CONDITION: Very bad took enforcement action to ensure that the building is OCCUPANCY: Vacant/not in use made wind and weathertight and has a temporary roof. PRIORITY CATEGORY: A (A) OWNER TYPE: Private 1080196

© London Borou

ugh of Hillingdon	LIST ENTRY NUMBER:	TC

D

Е

Contact: Ian Thynne (LPA) 01895 558326

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

E BEEFFE	S
	C
	C
	C
	Ρ
	C

© London Borough of Hillingdon

© London Borough of Hillingdon

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

i

in building and two flanking	
The site comprises the main building and two flanking stable buildings of early C18 date. The house is vacant and in very poor condition, with no use identified. The building	
ry roof is in place. A condition to inform repairs.	
·	
ourn 07889 808145	
One of two stable buildings of early C18 date. The stable building has had work completed to the roof and interior and is being used for staff offices. Some further repairs to the exterior are required.	
) 01895 558326	
r	





	SITE NAME:	Nurses Home in grounds of Hillingdon Hospital, Pield Heath Road, Hillingdon	Early C19 house in the grounds of Hillingdon Hospital, currently used as offices, but generally in poor condition.
	DESIGNATION:	Listed Building grade II	
	CONDITION:	Poor	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Health authority	
don	LIST ENTRY NUMBER:	1080153	Contact: Ian Thynne (LPA) 01895 558326

Listed Building grade II, CA

Part occupied/part in use

Poor

C (C)

1358396

Health authority

© London Borough of Hillingdo



SITE NAME:	Harefield Grove, Rickmansworth Road, Harefield	Probably early C19 country house of three storeys. Stucco with stone cornice and parapet concealing a fairly low
DESIGNATION:	Listed Building grade II	pitched hipped slate roof. The building has a two storey modern courtyard wing for office use with an atrium link. It
CONDITION:	Fair	has been vacant for a number of years and is deteriorating. Listed Building Consent and Planning Permission have been
OCCUPANCY:	Vacant/not in use	granted for residential use but work has not yet started.
PRIORITY CATEGORY:	D (D)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	8 48	Contact: Ian Thynne (LPA) 01895 558326

© Antonio Cruz, Comer Homes Group

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Ian Thynne (LPA) 01895 558326

- CA LB
- LPA NP RPG
- Conservation Area Listed Building Local Planning Authority National Park
 - Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site



© London Borough of Hillingdon

	SITE NAME:	Mount Vernon Hospital, Rickmansworth Road, Northwood	1902-4 by FL Wheeler in Edwardian Free Style. Built as a hospital for the treatment of tuberculosis patients, and as a branch hospital of the original Mount Vernon hospital in
	DESIGNATION:	Listed Building grade II	Hampstead (built 1879-80). The building is noted for its advanced plan, including isolation wards and facilities such
	CONDITION:	Poor	as an X-ray room and dental unit. It is still in use by the hospital, but in a poor state of repair and under pressure
	OCCUPANCY:	Occupied/in use	from the redevelopment of the site.
-	PRIORITY CATEGORY:	C (C)	
25-28-5	OWNER TYPE:	Health authority	
	LIST ENTRY NUMBER:	1080083	Contact: Ian Thynne (LPA) 01895 558326

	SITE NAME:	Cellars of former Cranford House, Roseville Road, Cranford	Brick vaulted cellars to Cranford House circa 1722 (demolished). The cellars are suffering from structural weakening and their condition is deteriorating. The Local
	DESIGNATION:	Listed Building grade II, CA	Authority is working with local groups and Historic England to consider options for the future of the site.
1 B. 24	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1285115	Contact: Ian Thynne (LPA) 01895 558326



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

D

Е

use)

PRIORITY CATEGORY:

© Historic England

© Historic England



LIST ENTRY NUMBER:	1080157	Contact: Ian Thynne (LPA) 01895 558326
SITE NAME:	Benlow Works, Silverdale Road, Hayes	Orchestrelle Factory of 1909-11. Reinforced concrete frame, with brick exterior. Four storeys with a 19 bay
DESIGNATION:	Listed Building grade II	elevation. The entrance bay has a semi-circular stepped brick architrave to the doorway and segmental arched
CONDITION:	Very bad	metal casements flanked by rusticated pilasters slightly set forward and breaking the parapet. Temporary repairs have
OCCUPANCY:	Part occupied/part in use	been undertaken so that the building is weathertight.
PRIORITY CATEGORY:	C (C)	Discussions have been held with the owner, but no solution is agreed for future use as yet.
OWNER TYPE:	Private	, , , , , , , , , , , , , , , , , , ,
LIST ENTRY NUMBER:	1080121	Contact: Ian Thynne (LPA) 01895 558326

future of the site.

© London Borough of Hillingdon



© London Borough of Hillingdon

SITE NAME:	Gatehouse at Hillingdon- Uxbridge Cemetery, Uxbridge Road	Mid-C19 ga stock brick rubble with
DESIGNATION:	Listed Building grade II	wide centra condition ar condition su repairs requ
CONDITION: OCCUPANCY:	Poor	
	Vacant/not in use	
PRIORITY CATEGORY:	D (D)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1358415	Contact: lar

Cranford House Stables,

Roseville Road, Cranford

Listed Building grade II, CA

Very bad

A (A)

Vacant/not in use

Local authority

atehouse by Benjamin Ferry, with an adjacent boundary wall. The gatehouse is constructed of a stone dressings, tiled roof and five bays with a al entrance under the arch. It is in a deteriorating and vacant, and the wall has partially collapsed. ${ ilde{\mathsf{A}}}$ urvey has been completed and the extent of uired agreed, but not yet implemented.

Stables to Cranford House circa 1720, owned and

managed by the London Borough of Hillingdon. The east

block is in very poor condition and the site is in need of a

long-term use. The Local Authority is working with local groups and Historic England to consider options for the

n Thynne (LPA) 01895 558326

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site



© London Borough of Hillingdon

© His

Two barns dating from the CI6, both now collapsed. SITE NAME: Hubbard's Farm Barn and Historic timbers have been salvaged for re-use. Listed outbuildings, West Drayton Building Consent and Planning Permission have been Road, Colham Green, Úxbridge granted for a residential scheme incorporating re-use of the DESIGNATION: Listed Building grade II salvaged timbers. CONDITION: Very bad OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: B (B) OWNER TYPE: Private LIST ENTRY NUMBER: 1284866 Contact: Ian Thynne (LPA) 01895 558326

	SITE NAME:	Church of St Mary, High Street, Hayes	St Mary's has fabric from the C12 to the C16 including a fine C12 stone doorway. It has a tall square tower c1500
e v	DESIGNATION:	Listed Place of Worship grade II*, CA	on top of which is a cupola and weathervane supported on four cast iron columns. The church is largely constructed in flint with stone dressings and the upper stages of the tower
	CONDITION:	Fair	are in brick. The roofs are tiled. Much of the dressed stone, including quoins and the copings to the battlemented
	PRIORITY CATEGORY:	C (New entry)	parapet, have been refaced in a cementitious render. The
	OWNER TYPE:	Religious organisation	refacings are failing in places exposing the substructure. There is cracking around the western end, particularly
	LIST ENTRY NUMBER:	1080201	severe in the tower.
istoric England			Contact: Tracey Craig 020 7973 3756

Finded states interview latit of ritter ritting iteam leadmant (12 minuted leadmant) Instruction ited of charter) Designation: Scheduled Monument LIST ENTRY NUMBER: 1002001 condition: Generally satisfactory but with minor locallised TREND: Stable RRINDRAL VULNERABULTY: Drainage/dewatering Nov No DOWNER TYPE: Local authority CONTACT: Elizabeth Whitbourn 07889 808145 STET NAME: Manor Farm moat, Ickenham 1002006 1002006 DESIGNATION: Scheduled Monument, part in CA LIST ENTRY NUMBER: 1002006 condition: Generally satisfactory but with minor locallised TREND: Unknown DESIGNATION: Scheduled Monument, part in CA LIST ENTRY NUMBER: 1002006 condition: Generally satisfactory but with minor locallised TREND: Unknown condition: Scheduled Monument, part in CA LIST ENTRY NUMBER: No condition: Scheduled Monument, part in CA LIST ENTRY NUMBER: No condition: Scheduled Monument, part in CA LIST ENTRY NUMBER: No condition: Scheduled Monument, part in CA LIST ENTRY NUMBER: No				
CONDITION:Generally satisfactory but with minor localised problemsTREND:StableRRINCIPAL VULNERABILITY:Drainage/dewateringNOVNODOWNER TYPE:Local authorityCONTACT:Elizabeth Whitbourn 07889 808145STENAME:Manor Farm moat, IckenhamIUST ENTRY NUMBER1002006DESIGNATION:Scheduled Monument, part in CAUST ENTRY NUMBER1002006CONDITION:Generally satisfactory but with minor localised problemsINEN DI:1002006RRINCIPAL VULNERABILITY:Scheduled Monument, part in CANEW ENTRY:NoCONDITION:Generally satisfactory but with minor localised problemsINEN DI:InknownRRINCIPAL VULNERABILITY:Schull (Itste sector)CONTACT:Elizabeth Whitbourn 07889 808145STENAME:Borwell (Nestles), HayesSchull (Itste sector)NoSchull (Itste sector)CONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:In Thynne (LPA) 01895 558326CONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCONDITION:Very badNEW ENTRY:NoCOND	SITE NAME:	Moated site, west bank of River Pinn, near Ickenl	nam (1/2 mile (800m)) north west of church)
ConcernationproblemsFinal of the statutionStatutePRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY:NoDOWNER TYPE:Local authorityCONTACT:Elizabeth Whitbourn 07889 808145DESIGNATION:Scheduled Monument, part in CAUST ENTRY NUMBER1002006CONDITION:Generally satisfactory but with minor localised problemsTREND:UnknownRRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY:NoOWNER TYPE:Educational (state sector)CONTACT:Elizabeth Whitbourn 07889 808145DESIGNATION:Conservation AreaNEW ENTRY:NoOWNER TYPE:Botwell (Nestles), HayesCONTACT:Elizabeth Whitbourn 07889 808145DESIGNATION:Conservation AreaNEW ENTRY:NoCONDITION:Very badTREND:Deteriorating significantlyUNERABILITY:Bulls Bridge, HayesStructureNEW ENTRY:NoCONDITION:Very badTREND:Deteriorating significantlyUNERABILITY:MediumCONTACT:Ian Thynne (LPA) 01895 558326UNERABILITY:MediumCONTACT:Ian Thynne (LPA) 01895 558326UNERABILITY:MediumCONTACT:Ian Thynne (LPA) 01895 558326UNERABILITY:Conservation Area, LB grade IINEW ENTRY:NoCONDITION:Conservation Area, LB grade IINEW ENTRY:NoCONDITION:Conservation Area, 14 LBsNEW ENTRY:NoCONDITION:Very badTREND:No significant change<	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002001
And and the second se	CONDITION:		TREND:	Stable
STE NAME: Manor Farm moat, Ickenham DESIGNATION: Scheduled Monument, part in CA UST ENTRY NUMBER: 1002006 CONDITION: Generally satisfactory but with minor localised problems TREND: Unknown RRINCIPAL VULNERABILITY: Scrub / tree growth NEW ENTRY: No OWNER TYPE: Botwell (Nestles), Hayes Elizabeth Whitbourn 07889 808145 STE NAME: Botwell (Nestles), Hayes Elizabeth Volitoburn 07889 808145 CONDITION: Conservation Area NEW ENTRY: No CONDITION: Conservation Area NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 STE NAME: Buils Bridge, Hayes Very bad New ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 C	PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY ?:	No
Scheduled Monument, part in CA LIST ENTRY NUMBER: 1002006 CONDITION: Generally satisfactory but with minor localised problems TREND: Unknown PRINCIPAL VULNERABILITY: Scrub / tree growth NEW ENTRY?: No OWNER TYPE: Educational (state sector) CONTACT: Elizabeth Whitbourn 07889 808145 SITE NAME: Botwell (Nestles), Hayes Very bad TREND: No CONDITION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 STE NAME: Bulls Bridge, Hayes Very bad TREND: Deteriorating significantly VULNERABILITY: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 VULNERABILITY:	OWNER TYPE:	Local authority	CONTACT:	Elizabeth Whitbourn 07889 808145
CONDITION:Generally satisfactory but with minor localised problemsTREND:UnknownPRINCIPAL VULNERABILITY:Scrub/tree growthNEW ENTRY:NoOWNER TYPE:Educational (state sector)CONTACT:Elizabeth Whitbourn 07889 808145SITE NAME:Botwell (Nestles), HayesElizabeth Whitbourn 07889 808145DESIGNATION:Conservation AreaNEW ENTRY:NoCONDITION:Very badTREND:Deteriorating significantlyVULNERABILITY:HediumContact:Ian Thynne (LPA) 01895 558326DESIGNATION:Conservation Area, LB grade IINeW ENTRY:NoCONDITION:Very badTREND:Deteriorating significantlyDESIGNATION:Conservation Area, LB grade IINEW ENTRY:NoCONTACT:Ian Thynne (LPA) 01895 558326Ian Thynne (LPA) 01895 558326CONTITION:Very badTREND:Ian Thynne (LPA) 01895 558326CONTITION:KediumContact:Ian Thynne (LPA) 01895 558326CONTITION:KediumContact:Ian Thynne (LPA) 01895 558326CONTITION:KediumContact:Ian Thynne (LPA) 01895 558326Contact:FIREND:Ian Thynne (LPA) 01895 568326Contact:FIREND: <td>SITE NAME:</td> <td>Manor Farm moat, Ickenham</td> <td></td> <td></td>	SITE NAME:	Manor Farm moat, Ickenham		
Construction problems Index. Of INTRODUCT PRINCIPAL VULNERABILITY: Scrub / tree growth NEW ENTRY: No DOWNER TYPE: Educational (state sector) CONTACT: Elizabeth Whitbourn 07889 808 145 SITE NAME: Botwell (Nestles), Hayes Image: Conservation Area NEW ENTRY: No DESIGNATION: Conservation Area NEW ENTRY: No Image: Conservation graph and the sector in the	DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1002006
OWNER TYPE: Educational (state sector) CONTACT: Elizabeth Whitbourn 07889 808145 SITE NAME: Botwell (Nestles), Hayes NEW ENTRY: No DESIGNATION: Conservation Area NEW ENTRY: No CONTACT: Well Nestles), Hayes Deteriorating significantly VolumerABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Bulls Bridge, Hayes NEW ENTRY: No SUBSIGNATION: Conservation Area, LB grade II NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly VulneRABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 CONDITION: Very bad TREND: Deteriorating significantly VulneRABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 CONDITION: Very bad TREND: No STE NAME: Conservation Area, 14 LBs NEW ENTRY: No STE NAME: Very bad TREND: No significant change	CONDITION:		TREND:	Unknown
SITE NAME: Botwell (Nestles), Hayes New ENTRY: No DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Bulls Bridge, Hayes NEW ENTRY: No DESIGNATION: Conservation Area, LB grade II NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly ULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 STEE NAME: Conservation Area, LB grade II NEW ENTRY: No STEE NAME: Conservation Area, LB grade II NEW ENTRY: No STEE NAME: Conservation Area, LB grade II NEW ENTRY: No STEE NAME: Conservation Area, LB grade II NEW ENTRY: No STEE NAME: Conservation Area, LB grade II NEW ENTRY: No STEE NAME: Conservation Area, I4 LBs NEW ENTRY: No STEEND: Very bad TREND: No significant change	PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
DESIGNATION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Bulls Bridge, Hayes Very bad NEW ENTRY?: No DESIGNATION: Conservation Area, LB grade II NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 STE NAME: Conservation Area, LB grade II NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 STE NAME: Cranford Park, Cranford CONTACT: Ian Thynne (LPA) 01895 558326 STE NAME: Conservation Area, 14 LBs NEW ENTRY?: No CONDITION: Very bad TREND: No significant change	OWNER TYPE:	Educational (state sector)	CONTACT:	Elizabeth Whitbourn 07889 808145
CONDITION:Very badTREND:Deteriorating significantlyvulueraabilitY:MediumCONTACT:Ian Thynne (LPA) 01895 558326stite NAME:Bulls Bridge, HayesNew ENTRY:Nocondition:Conservation Area, LB grade IINEW ENTRY:Nocondition:Very badTREND:Deteriorating significantlyvulueraabilitY:MediumContact:Ian Thynne (LPA) 01895 558326stite NAME:KediumContact:Ian Thynne (LPA) 01895 558326stite NAME:Cranford Park, CranfordNEW ENTRY:Nostite NAME:Conservation Area, 14 LBsNEW ENTRY:Nocondition:Very badYery badTREND:No significant change	SITE NAME:	Botwell (Nestles), Hayes		
VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Bulls Bridge, Hayes NEW ENTRY?: No DESIGNATION: Conservation Area, LB grade II NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Cranford Park, Cranford CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Cranford Park, Cranford NEW ENTRY?: No DESIGNATION: Conservation Area, 14 LBs NEW ENTRY?: No CONDITION: Very bad TREND: No significant change	DESIGNATION:	Conservation Area	NEW ENTRY?:	No
SITE NAME: Bulls Bridge, Hayes DESIGNATION: Conservation Area, LB grade II NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Cranford Park, Cranford VEW ENTRY: No SITE NAME: Conservation Area, 14 LBs NEW ENTRY: No CONDITION: Very bad TREND: No significant change	CONDITION:	Very bad	TREND:	Deteriorating significantly
DESIGNATION: Conservation Area, LB grade II NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Cranford Park, Cranford VEW ENTRY: No DESIGNATION: Conservation Area, 14 LBs NEW ENTRY: No CONDITION: Very bad TREND: No significant change	VULNERABILITY:	Medium	CONTACT:	lan Thynne (LPA) 01895 558326
CONDITION: Very bad TREND: Deteriorating significantly VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Cranford Park, Cranford Image: Conservation Area, 14 LBs Designation: Conservation Area, 14 LBs NEW ENTRY: No CONDITION: Very bad TREND: No significant change	SITE NAME:	Bulls Bridge, Hayes		
VULNERABILITY: Medium CONTACT: Ian Thynne (LPA) 01895 558326 SITE NAME: Cranford Park, Cranford Example of the second secon	DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
SITE NAME: Cranford Park, Cranford DESIGNATION: Conservation Area, 14 LBs Very bad TREND: No significant change	CONDITION:	Very bad	TREND:	Deteriorating significantly
DESIGNATION: Conservation Area, 14 LBs NEW ENTRY?: No CONDITION: Very bad TREND: No significant change	VULNERABILITY:	Medium	CONTACT:	lan Thynne (LPA) 01895 558326
CONDITION: Very bad TREND: No significant change	SITE NAME:	Cranford Park, Cranford		
	DESIGNATION:	Conservation Area, 14 LBs	NEW ENTRY ?:	No
ZULNERABILITY: Low CONTACT: Ian Thynne (LPA) 01895 558326	CONDITION:	Very bad	TREND:	No significant change
	VULNERABILITY:	Low	CONTACT:	lan Thynne (LPA) 01895 558326

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

use).

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HILLINGDON / HOUNSLOW

SITE NAME:	Harlington Village, Heathrow Villages		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Ian Thynne (LPA) 01895 558326
SITE NAME:	Harmondsworth Village, Heathrow Villages		
DESIGNATION:	Conservation Area, 19 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Ian Thynne (LPA) 01895 558326
SITE NAME:	Longford Village, Heathrow Villages		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	lan Thynne (LPA) 01895 558326
SITE NAME:		wood	
SHE NAME:	Northwood Town Centre, Green Lane, North	wood	
	Conservation Area, 2 LBs	NEW ENTRY?:	No
DESIGNATION: CONDITION:			No Deteriorating
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	
DESIGNATION: CONDITION: VULNERABILITY:	Conservation Area, 2 LBs Poor	NEW ENTRY?: TREND:	Deteriorating
DESIGNATION: CONDITION: VULNERABILITY: SITE NAME:	Conservation Area, 2 LBs Poor Medium	NEW ENTRY?: TREND:	Deteriorating
DESIGNATION: CONDITION: VULNERABILITY:	Conservation Area, 2 LBs Poor Medium Old Uxbridge/ Windsor Street, Uxbridge	NEW ENTRY?: TREND: CONTACT:	Deteriorating Ian Thynne (LPA) 01895 558326
DESIGNATION: CONDITION: VULNERABILITY: SITE NAME: DESIGNATION:	Conservation Area, 2 LBs Poor Medium Old Uxbridge/ Windsor Street, Uxbridge Conservation Area, 43 LBs	NEW ENTRY?: TREND: CONTACT: NEW ENTRY?:	Deteriorating Ian Thynne (LPA) 01895 558326 No
DESIGNATION: CONDITION: VULNERABILITY: SITE NAME: DESIGNATION: CONDITION:	Conservation Area, 2 LBs Poor Medium Old Uxbridge/ Windsor Street, Uxbridge Conservation Area, 43 LBs Poor	NEW ENTRY?: TREND: CONTACT: NEW ENTRY?: TREND:	Deteriorating Ian Thynne (LPA) 01895 558326 No Deteriorating
DESIGNATION: CONDITION: VULNERABILITY: SITE NAME: DESIGNATION: CONDITION: VULNERABILITY: SITE NAME:	Conservation Area, 2 LBs Poor Medium Old Uxbridge/ Windsor Street, Uxbridge Conservation Area, 43 LBs Poor Medium	NEW ENTRY?: TREND: CONTACT: NEW ENTRY?: TREND:	Deteriorating Ian Thynne (LPA) 01895 558326 No Deteriorating
DESIGNATION: CONDITION: VULNERABILITY: SITE NAME: DESIGNATION: CONDITION: VULNERABILITY:	Conservation Area, 2 LBs Poor Medium Old Uxbridge/ Windsor Street, Uxbridge Conservation Area, 43 LBs Poor Medium The Greenway, Uxbridge	NEW ENTRY?: TREND: CONTACT: NEW ENTRY?: TREND: CONTACT:	Deteriorating Ian Thynne (LPA) 01895 558326 No Deteriorating Ian Thynne (LPA) 01895 558326

HOUNSLOW



SITE NAME:	The Keep (Armoury) to Hounslow Cavalry Barracks, Beavers Lane, Hounslow
DESIGNATION:	Listed Building grade II, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Government or agency
LIST ENTRY NUMBER:	1240633

building has been unused for some years and the top storeys are now inaccessible. This is as a result of rainwater penetration from the rooftop parapet and blockages in the flat roof drainage rainwater pipes. There are currently no plans for repairs but discussions have begun concerning the future of the wider site.

Contact: Sean Doran (LPA) 020 8583 4941

Built in 1875, consisting of three storeys with four storey

staircase towers at each end and in the centre of the south west front. Many windows retain heavy cast iron shutters with firing loops and massive bolts to the interior. The

© Historic England



	SITE NAME:	Boston Manor House, Boston Manor Park, Boston Manor Road	Built in 1623 for Lady Mary Reade, extended in the 1670s and with later additions. Stabilisation and cosmetic repairs have been completed. A Conservation Management Plan
	DESIGNATION:	Listed Building grade I, CA	(2011) and options appraisal (2015) were prepared, with funding from Historic England. The Heritage Lottery Fund
	CONDITION:	Poor	has awarded a Stage 2 grant for a refurbishment scheme to conserve the building and increase access, and works are
Î	OCCUPANCY:	Part occupied/part in use	scheduled to start in 2019.
	PRIORITY CATEGORY:	D (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1079603	Contact: Verena McCaig 020 7973 3718

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. D Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

Е

use).

obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HOUNSLOW

	SITE NAME:	21, Chiswick High Road W4	Stucco fronted early C19 three storey house which has
	DESIGNATION:	Listed Building grade II	been empty for some time. It is in a state of considerable disrepair. Planning Permission and Listed Building Consent
	CONDITION:	Poor	for its repair and extension were refused in 2016. A suitable scheme is awaited.
Tra-	OCCUPANCY:	Vacant/not in use	suitable scheme is awaited.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	189230	Contact: Sean Doran (LPA) 020 8583 4941
c 1			

© London Borough of Hounslow

© Historic England

	SITE NAME:	Feltham House, Elmwood Avenue, Feltham	Built in the mid-C18 in stock brick and modelled on other Palladian villas, extended in the late C18 with the addition of side wings. The interior has been modernised but retains C18 decorations of interest, which may partly be attributable to James Wyatt who lived at Hanworth. The building has been unused for some years, and there is extensive rot damage in the principal storey and rainwater penetration. Some ceilings have collapsed and the building is now unsafe to enter. Discussions are underway to secure its repair and re-use.
	DESIGNATION:	Listed Building grade II, CA	
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Government or agency	
	LIST ENTRY NUMBER:	1189466	Contact: Sean Doran (LPA) 020 8583 4941

Westlink House, Great West Modernistic factory building built in 1928 by Wallis, Gilbert SITE NAME: and partners. It is one of a number of factories from this Road period that line the Great West Road. The building has TT DESIGNATION: Listed Building grade II been empty for a number of years. However, most repairs 111 have now been completed and its imminent re-use is likely. CONDITION: Fair OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: D (C) OWNER TYPE: Commercial company LIST ENTRY NUMBER: Contact: Sean Doran (LPA) 020 8583 4941 1255218 © London Borough of Hounslow

	SITE NAME:	Gunnersbury Park W5	A landscape park developed in the C18 by Princess Amelia and in the C19 by Baron Lionel de Rothschild. It became a public park in 1925. The Local Authority developed a phased, 15 year masterplan: 'Gunnersbury 2026'. The phase I landscape improvements funded by the Heritage Lottery Fund/Big Lottery Fund are complete and the Local Authority is developing plans for the next phases of the restoration, including the Small Mansion, Stables and Potomac Lake which are also at risk. A Community Interest Company has been established to oversee the long-term development and management of the park.
	DESIGNATION:	Registered Park and Garden grade II*, 22 LBs, part in CA	
	CONDITION:	Generally satisfactory but with significant localised problems	
	VULNERABILITY:	Medium	
	TREND:	Improving	
	NEW ENTRY?:	No	
	OWNER TYPE:	Local authority, multiple owners	
	LIST ENTRY NUMBER:	1000808	Contact: Christopher Laine 07780 545 979



© Historic England

SITE NAME:	Archway near east entrance lodge, Gunnersbury Park, Gunnersbury Avenue, W3	Stucco pedimented archway, circa 1837, situated near to the East Lodge, on the eastern edge of Gunnersbury Park. Urgent repairs to secure the structural stability of the arch	
designation:	Listed Building grade II, RPG grade II*, CA	were undertaken in 2012, grant-aided by Historic England. Further repairs and vegetation clearance are required.	
CONDITION:	Poor		
OCCUPANCY:	N/A		
PRIORITY CATEGORY:	C (C)		
OWNER TYPE:	Local authority		
LIST ENTRY NUMBER:	1080332	Contact: Sean Doran (LPA) 020 8583 4941	

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

and a	SITE NAME:	Boundary wall at Gunnersbury Park, Gunnersbury Avenue, W3	Part of the boundary wall to the garden of the original Gunnersbury House, built 1658-63 by John Webb for Sir	
W. States	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	John Maynard. Repairs have been carried out to a large section with funding from the Heritage Lottery Fund. Further extensive sections require repair.	
a combite	CONDITION:	Poor		
	OCCUPANCY:	N/A		
	PRIORITY CATEGORY:	C (F)		
	OWNER TYPE:	Local authority		
Historic England	LIST ENTRY NUMBER:	1322060	Contact: Sean Doran (LPA) 020 8583 4941	
	SITE NAME:	East Lodge to Gunnersbury Park, Gunnersbury Avenue, W3	Entrance lodge circa 1837. All that remains are small sections of the south and west elevations. Urgent repairs to	
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	secure the structural stability of the remaining elements of the lodge have been completed, grant-aided by Historic England. Further repairs and vegetation clearance are	
	CONDITION:	Very bad	required, along with a strategy for its future development and re-use.	
	OCCUPANCY:	N/A		
	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Local authority		
Historic England	LIST ENTRY NUMBER:	1080334	Contact: Sean Doran (LPA) 020 8583 4941	
	SITE NAME:	East stables in Gunnersbury Park, Gunnersbury Avenue, W3	Stable block dating from 1835, on the eastern edge of Gunnersbury Park, to the south of the Small Mansion.	
	DESIGNATION:	Listed Building grade II*, RPG grade II*, CA	Historic England has funded a condition survey to inform potential plans for shell repairs. The Local Authority, Historic England and other stakeholders are working	
	CONDITION:	Very bad	proactively to identify and secure a new user to complete	
	OCCUPANCY:	Vacant/not in use	necessary works and occupy the building.	
	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Local authority		
Historic England	LIST ENTRY NUMBER:	1358316	Contact: Verena McCaig 020 7973 3718	

	SITE NAME:	Gothic Boathouse, Gunnersbury Park, Gunnersbury Avenue	Mid-C19 Gothic folly tower, converted from a tile kiln and situated on the southern shore of Potomac Lake. Some repair and emergency works have been undertaken, partly
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	funded by Historic England. Extensive further repairs are required and a new use needs to be secured. Discussions are continuing between stakeholders and potential new
	CONDITION:	Very bad	projects are being actively explored.
AND AND AND AND	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	89588	Contact: Sean Doran (LPA) 020 8583 4941

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / HOUNSLOW

6.3	SITE NAME:	The Small Mansion - Gunnersbury House, Gunnersbury Park, Gunnersbury Avenue W3	Built circa 1802, the smaller of the two houses on the site of Gunnersbury House which was demolished circa 1801. Historic England has funded a condition survey to inform potential repairs to stabilise the building. The ground floor
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	has recently been used as offices but this use is due to cease. The Local Authority, Historic England and other stakeholders are working proactively to identify and secur
Martin Charles	CONDITION:	Poor	a new user to complete necessary works and fully occupy the building.
	OCCUPANCY:	Part occupied/part in use	
Historic England	PRIORITY CATEGORY:	C (C)	
Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1080330	Contact: Sean Doran (LPA) 020 8583 4941
2 3	SITE NAME:	West Lodge to Gunnersbury Park, Gunnersbury Avenue	Lodge building dating from 1875 in the manner of a gate house, partly in use for residential purposes. Historic
	DESIGNATION:	Listed Building grade II, RPG grade II*	England awarded a grant towards urgent repairs to the roofs of the unoccupied part of the lodge and the archway located at the south entrance of the park. The Local
	CONDITION:	Poor	Authority is considering options for its full repair and re- use.
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (E)	
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1389619	Contact: Sean Doran (LPA) 020 8583 4941
	SITE NAME:	West stable block in Gunnersbury Park, Gunnersbury Avenue, W3	Early C19 stables situated within Gunnersbury Park. Worl to stabilise and repair the shell of the building are complet partly funded by Historic England. The Local Authority,
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	Historic England and other stakeholders are working proactively to identify and secure a new user to complete necessary works and occupy the building.
	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	E (E)	
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1096950	Contact: Sean Doran (LPA) 020 8583 4941
XVE	SITE NAME:	St Lawrence's Church (former), High Street, Brentford	Former C15 church tower, with nave dating from 1764 by Thomas Hardwick and later Victorian additions. The
	DESIGNATION:	Listed Building grade II*, CA	building has been empty since the 1960s and stripped of it fittings. Extensive stonework repairs are needed, along with
	CONDITION:	Poor	works to the roof and rainwater goods. Proposals for a wider waterside development, including repair and
	OCCUPANCY:	Vacant/not in use	restoration of the church and its re-use were approved in
11. 9 1	PRIORITY CATEGORY:	D (B)	December 2014. Repairs have stabilised the building until its full repair and conversion, expected in 2019-2020.
	OWNER TYPE:	Commercial company	
D Historic England	LIST ENTRY NUMBER:	1080302	Contact: Verena McCaig 020 7973 3718
1.1.1.1.1	SITE NAME:	Gate piers within Osterley Park, Jersey Road	Pair of gate piers with contemporaneous railings designed by Robert Adam. The railings are in need of repair.
	DESIGNATION:	Listed Building grade II, part in RPG grade II*, CA	
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Charity (heritage)	
© London Borough of Hounslow	LIST ENTRY NUMBER:	1391000	Contact: Sean Doran (LPA) 020 8583 4941
 PRIORITY CATEGORIES A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. 	 D Slow decay; solution not yet implemented E Under repair or in fa repair, but no user is under threat of vaca obvious new user (a to buildings canable 	d. (where applicable) end use o user identified; or functionally dentified; or redundant buildings with new ncy with no agreed but not yet implemen pplicable only	rr Last year's priority category is LB Listed Building y shown in brackets (otherwise, LPA Local Planning Authority y use New Entry is noted). NP National Park

- implemented. C Slow decay; no solution agreed.
- obvious new user (applicable only to buildings capable of beneficial use).

SITE NAME:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

	SITE NAME:	Roman Bridge, Jersey Road, Osterley Park	Rusticated and stone-faced bridge with one segmental arch and flanking pairs of rusticated Doric half columns, dating
	DESIGNATION:	Listed Building grade II*	from 1780, by Robert Adam. The bridge is severed from the historic park by the M4 and straddles the borough
ANNE 1	CONDITION:	Very bad	boundary between Ealing and Hounslow. It is in need of considerable repair and consolidation, and is subject to
	OCCUPANCY:	N/A	heritage crime. Vegetation and redundancy are key threats
	PRIORITY CATEGORY:	A (A)	to address. Historic England has re-opened discussions with agents for the owner in order to secure the future of this asset.
and and a start	OWNER TYPE:	Commercial company	
storic England	LIST ENTRY NUMBER:	89787	Contact: Verena McCaig 020 7973 3718

The Hermitage, 17, Upper

Sutton Lane, Heston

Very bad

A (A)

1240343

Commercial company

Listed Building grade II

Pair of cemetery chapels with central porte cochère built in Pair of chapels at Isleworth Cemetery, Park Road 1879. They were last used for a service in 1970 and subsequently used as a council store, and suffered DESIGNATION: Listed Building grade II considerable dereliction. Hounslow Men's Shed have now secured a lease on the chapels and carried out preliminary Poor works to enable their use for workshops, along with the nearby mortuary buildings. They are seeking funding to Occupied/in use carry out further repairs to the building. PRIORITY CATEGORY: C (A) Local authority LIST ENTRY NUMBER: 1272433 Contact: Sean Doran (LPA) 020 8583 4941

plans are ongoing.

development scheme.

Late C15 timber-framed house with later additions. It was

deterioration following theft of the temporary protective

roof. Discussions regarding securing the site and long-term

badly damaged by fire in 2003 and suffered further

back into full repair and re-use under an enabling

Contact: Sean Doran (LPA) 020 8583 4941

© Historic England

© His



© Historic England

	OCCUPANCY:	Vacant/not in use			
	PRIORITY CATEGORY:	A (A)			
A.A.A	OWNER TYPE: Private				
	LIST ENTRY NUMBER:	1260544	Contact: Sean Doran (LPA) 020 8583 4941		
AND ST.	SITE NAME:	Hanworth Park House, Uxbridge Road, Hanworth	Country house built after 1828 with an extension circa 1860. The building has suffered significant deterioration.		
·····································	DESIGNATION:	Listed Building grade II	Some urgent works have been undertaken to stabilise the building and a series of condition reports have been		
	CONDITION:	Very bad	produced with recommendations for repair. The owners are in discussion with Historic England and the Local		
同时 的时候	OCCUPANCY:	Vacant/not in use	Authority to agree suitable proposals to bring the house		
	OCCOLANCE.	vacant/ not in use	Authority to agree suitable proposals to bring the house		

© Historic England

SITE NAME:	Double ditched enclosure beside A30 road 500yds (460m) west of East Bedfont parish church		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002043
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	Romano-British site 1000yds (910m) west of East E	Bedfont parish chur	ch
SITE NAME: DESIGNATION:	Romano-British site 1000yds (910m) west of East E Scheduled Monument	Bedfont parish chur	ch 1002042
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002042

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

D

Е

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. obvious new user (applicable only to buildings capable of beneficial

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building CA LB

- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument SM

UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / HOUNSLOW / ISLINGTON

SITE NAME:	Grand Union Canal and Boston Manor, Brentford		
DESIGNATION:	Conservation Area, 8 LBs, part in RPG grade I	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Sean Doran (LPA) 020 8583 4941
SITE NAME:	Gunnersbury Park, Brentford W3		
SITE NAME: DESIGNATION:	Gunnersbury Park, Brentford W3 Conservation Area, 21 LBs, part in RPG grade II*	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Improving
DESIGNATION:	Conservation Area, 21 LBs, part in RPG grade II*		

ISLINGTON




	SITE NAME:	Holy Trinity Church, Cloudesley Square NI	The church was built 1826-9 to the design of Sir Charles Barry. Urgent repairs to the roof and high level stonework
Hore	DESIGNATION: Listed Building grade II*, CA	were carried out with funding from the Heritage Lottery Fund and Historic England in 2006-7. The west turrets	
	CONDITION:	Very bad	(clad in netting and scaffolded), the aisle roofs and interna plaster and lath ceilings remain in bad condition. The Diocese of London has recovered the lease from the former tenants, has commissioned surveys, and is actively seeking funding to complete the necessary internal and
	OCCUPANCY:	RITY CATEGORY: A (New entry - re-assessed)	
NVN N	PRIORITY CATEGORY:		
	OWNER TYPE:		external repairs to facilitate re-use. Currently the building is not in use as a church.
	LIST ENTRY NUMBER:	1195557	Contact: Ian Harper 020 7973 3786

© Historic England

© Historic England

© Historic England

K	SITE NAME:	Odeon Cinema, Holloway Road N7	Cinema, built as the Gaumont 1937-8, architect C Howard Crane of Chicago. Poor general condition, with cracking
-	DESIGNATION:	Listed Building grade II, CA	and damage to faience. Inappropriate modern shop fronts in poor condition undermine the design aesthetic.
	CONDITION:	Poor	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1384986	Contact: Luciana Grave (LPA) 020 7527 2389

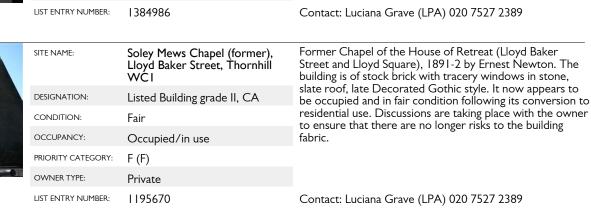

¢1	SITE NAME:	Islington War Memorial Arch, Manor Gardens N7	Listed war memorial designed by Percy Adams, formerly part of the Royal Northern Hospital. The memorial is the
-	DESIGNATION:	Listed Building grade II	archway around which the new building has been constructed. Repairs have been carried out including works
T I	CONDITION:	Fair	to the lettering and stonework, but problems remain with rising damp. The Local Authority is liaising with the owners
	OCCUPANCY:	N/A	to discuss possible next steps.
1	PRIORITY CATEGORY:	C (C)	
-	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1392555	Contact: Luciana Grave (LPA) 020 7527 2389

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; в solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / ISLINGTON

	SITE NAME:	Railings and gates to Islington Tennis Centre and King George's Field, Market Road N7	Cast iron railings and gates with elaborate piers and finials, probably designed by JB Bunning, 1854. Some cast iron finials have failed, and several have been removed and
271 AL	DESIGNATION:	Listed Building grade II	placed into store for safety reasons. A condition survey has been carried out to inform their future conservation and
© London Borough of Islington	CONDITION:	Poor	funding now needs to be identified.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (A)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1195681	Contact: Luciana Grave (LPA) 020 7527 2389

	SITE NAME:	Railings, walls, gate piers and gates to Caledonian Park, Market Road N7	Railings, walls and gates to Caledonian Market built in 1854 (market demolished). As part of the Caledonian Clock Tower Project, funded by the Heritage Lottery Fund and
di d	DESIGNATION:	Listed Building grade II	Islington Council, general repairs are in progress with two lamps and eight animal heads to be reinstated. The project
	CONDITION:	Poor	is due to be completed in autumn 2018. Further funding is required in order to reinstate all the decorative features.
	OCCUPANCY:	N/A	required in order to reinstate an the decorative leateres.
	PRIORITY CATEGORY:	F (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1208009	Contact: Luciana Grave (LPA) 020 7527 2389

-	SITE NAME:	The Clock Tower, Caledonian Park, Market Road N7	Built as the clock tower of the Caledonian Market in 1855 by John Bunstone Bunning. Works to fully repair the clock
	DESIGNATION:	Listed Building grade II*	tower and provide public access are underway, funded by the Heritage Lottery Fund and Islington Council. The
	CONDITION:	Fair	project is due to be completed in autumn 2018.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (D)	
March the second	OWNER TYPE:	Local authority	
© London Borough of Islington	LIST ENTRY NUMBER:	1298021	Contact: Verena McCaig 020 7973 3718

	SITE NAME:	Finsbury Health Centre, Pine Street ECI	Seminal Modern Movement health centre built 1935-8 to the design of Berthold Lubetkin. Whilst some urgent works
	DESIGNATION:	Listed Building grade I, CA	have been carried out, including removal of asbestos, further repairs are still required, particularly to external
	CONDITION:	Poor	walls and windows. Assessment reports are being prepared in order to inform discussions to secure full repair.
	OCCUPANCY:	Occupied/in use	
ALC SALE	PRIORITY CATEGORY:	C (C)	
A A A A A A A A A A A A A A A A A A A	OWNER TYPE:	Health authority	
	LIST ENTRY NUMBER:	1297993	Contact: Verena McCaig 020 7973 3718

© Historic England

© Historic England



	SITE NAME:	Finsbury Town Hall, Rosebery Avenue EC1	Town hall, built in 1895 to the design of C Evans Vaughan in an eclectic 'Free Renaissance' style, with a magnificent	
	DESIGNATION:	Listed Building grade II*, CA	public hall on the first floor with elaborate plasterwork i Belle Epoque manner. The building is now in use as dan studios with the main halls available for public use. The owners have undertaken some repairs, but Historic	
	CONDITION:	Poor		
	OCCUPANCY:	Occupied/in use	England is in discussion with them to secure further	
	PRIORITY CATEGORY:	C (C)	necessary external works.	
	OWNER TYPE:	Commercial company		
	LIST ENTRY NUMBER:	1293112	Contact: Verena McCaig 020 7973 3718	

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. В
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lacentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.


NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT	RISK 2018 /	LONDON	ISLINGTON

	SITE NAME:	Cells, former House of Detention, Sans Walk ECI	Part of Middlesex House of Detention built 1845-47, previously occupied as a museum. There is a problem with
	DESIGNATION:	Listed Building grade II, CA	water ingress from the car park above and management issues owing to multiple ownerships.
	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (D)	
	OWNER TYPE:	Private, multiple owners	
© Historic England	LIST ENTRY NUMBER:	1297973	Contact: Luciana Grave (LPA) 020 7527 2389

	SITE NAME:	St Paul's Church, St Paul's Road NI	Former church, built 1826-28 to the design of Sir Charles Barry in early Gothic Revival style. It was declared
	DESIGNATION:	Listed Building grade II*, CA	redundant in 1980 when the parish united with St Jude in Mildmay Park, and subsequently vandalised. It is now leased
	CONDITION:	Poor	to St Paul's Steiner Project for use as a school. Although many repairs have been undertaken, more are required,
	OCCUPANCY:	Part occupied/part in use	including the repair of the aisle roofs and internal
	PRIORITY CATEGORY:	C (C)	restoration of the nave and ceilings. Funding options are being explored.
	OWNER TYPE:	Charity (non-heritage)	
ind	LIST ENTRY NUMBER:	1208912	Contact: Ian Harper 020 7973 3786

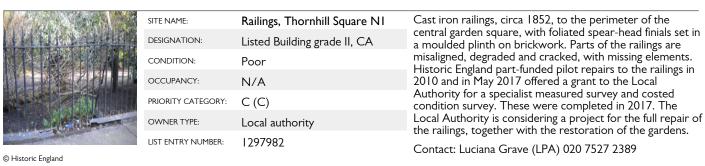

Cast iron railings of 1819-1841, in very poor condition. SITE NAME: Railings, Wilmington Square WCI Urgent works have previously been carried out, but currently no funding has been identified for a full repair DESIGNATION: Listed Building grade II, CA programme. CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: C (C) © Historic England



© Historic England

© Historic Englan

and and a	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1 195789	Contact: Luciana Grave (LPA) 020 7527 2389
5 /	SITE NAME:	Church of St James and attached railings, Clerkenwell Close, Islington EC1	The church was built by architect James Carr between 1788 and 1792 for a Methodist congregation; this was re- ordered in 1882 by Reginald Blomfield for a Church of
	DESIGNATION:	Listed Place of Worship grade II*, CA	England congregation when the altar was reset to the east and the galleries cut back. The steeple was rebuilt in 1849, and in 1900 the vaulted crypt was deepened and supported
	CONDITION:	Poor	on an iron structure. The nave parapet gutters and the glove-box roofs have recently been repaired, funded by the
	PRIORITY CATEGORY:	C (C)	Listed Places of Worship Roof Repair Fund. There are
	OWNER TYPE:	Religious organisation	cracks on the west front, decayed iron windows, and repairs needed to the steeple.
I	LIST ENTRY NUMBER:	1207786	Contact: Ian Harper 020 7973 3786

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB I PA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / ISLINGTON


	SITE NAME:	Union Chapel, Compton Terrace NI	A Congregational chapel and related buildings of 1876-7 by James Cubitt with the upper part of the tower completed
	DESIGNATION:	Listed Place of Worship grade I, CA	in 1889. Repairs to the tower and high level roofs are complete, grant-aided by the Heritage Lottery Fund and Historic England. In 2015 the church carried out repairs to
	CONDITION:	Fair	the lower level roofs funded by the Listed Places of Worship Roof Repair Fund. In 2017 the clock was also
	PRIORITY CATEGORY:	D (C)	repaired. The congregation is seeking funds for the repair
	OWNER TYPE:	Religious organisation	of the Sunday school halls.
	LIST ENTRY NUMBER:	1208365	Contact: Ian Harper 020 7973 3786
© Historic England			



	SITE NAME:	Church of St John, Duncan Terrace, Islington NI	Built in 1841 and designed by Joseph John Scoles. The towers flanking the gabled front elevation were added in
11.17	DESIGNATION:	Listed Place of Worship grade II, CA	1877 designed by Francis W Tasker. The towers have copper clad pyramidal roofs which are in poor condition. Stonework has been painted in the past and repairs carried
	CONDITION:	Poor	out in cementitious mortar, as has repointing of the brickwork. Netting has been applied to the central gable to
	PRIORITY CATEGORY:	C (D)	collect fragments of failing pointing and spalled brick.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1195583	Contact: Tracey Craig 020 7973 3756

© Historic England

MINIMUM INTERNET	SITE NAME:	Former Mecca Bingo, 161-169, Essex Road NI	Built as the Carlton Cinema in 1930 by George Coles, previously a bingo hall and now in use as a place of worship
	DESIGNATION:	Listed Place of Worship grade II*	by Resurrection Manifestations. The building has black, white and coloured faience to the Essex Road front, the
	CONDITION:	Poor	rest being of yellow brick with a slate roof. The façade to Essex Road is in Egyptian style. The church has temporary
	PRIORITY CATEGORY:	C (C)	consent for its use of the building, including the temporary division of the main auditorium. Some repairs and restoration have been carried out, but there is evidence o
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1292870	damage to the faience tiles. Proposals for re-use are currently being explored.
© Historic England			Contact: Verena McCaig 020 7973 3718

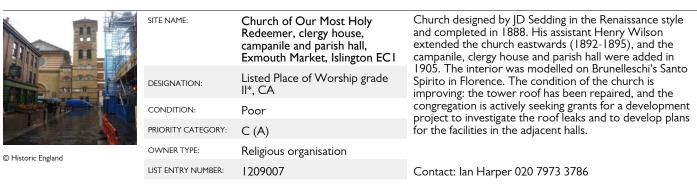



	SITE NAME:	Church of St Joseph, Highgate Hill, Islington N19	The Passionists (Roman Catholic Religious Order) acquired the site in 1858 and built a monastery and chapel. The
	DESIGNATION:	Listed Place of Worship grade II*, CA	chapel was rebuilt in 1887-9 by Albert Vicars in a Neo- Romanesque style. Some localised roof repairs were carried out in 2015 with a grant from the Listed Places of
	CONDITION:	Poor	Worship Roof Repair Fund. There are still parts of the external fabric in poor condition and a comprehensive
	PRIORITY CATEGORY:	C (C)	repair programme is needed.
ìe !	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1279729	Contact: Ian Harper 020 7973 3786

© Jim Linwood

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDO	on / Islington		
	SITE NAME:	Hope Church (former Church of St Mary Magdalene) and attached railings, Holloway Road, Islington N7	and Church in 2013; built 1812-14 by William Wickings as the way Chapel of Ease to St Mary's Islington. The church is built London yellow stock bricks with Portland stone dressing
-0-0-D	DESIGNATION:	Listed Place of Worship grade II*, CA	The east end tower has settled structurally against the aisles, and the north and south porches have settled and pulled away from the aisles. The west end and west porch
	CONDITION:	Poor	have also settled. The crypt is at risk of flooding; underground water levels, currently controlled by
	PRIORITY CATEGORY:	C (C)	permanent pumping, require investigation to achieve a
© Historic England	OWNER TYPE:	Religious organisation	sustainable solution to the settlement.
	LIST ENTRY NUMBER:	1195637	Contact: lan Harper 020 7973 3786
	SITE NAME:	Church of St Clement with St Barnabas and St Matthew, King Square EC1	Designed by Thomas Hardwick and built in the 1820s forming one side of a Georgian square now replaced with 1960s housing blocks. The interior was re-ordered by
CONTRACTOR OF	DESIGNATION:	Listed Place of Worship grade II	Norman Haines in 1953. In September 2016 the church received a first round pass from the Heritage Lottery Fund
	CONDITION:	Poor	for re-slating the nave roof along with repairs to the parapets, coping stones and the overhauling of rainwater
	PRIORITY CATEGORY:	D (D)	goods.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1366078	Contact: Tracey Craig 020 7973 3756
© Historic England			
and shall	SITE NAME:	Church of St Silas, Penton Street, Islington NI	Built in 1860, designed by SS Teulon, completed in 1863 by EP Loftus Brock and chancel added in 1884 by W White.
	DESIGNATION:	Listed Place of Worship grade II, CA	The roofs were re-slated in 2010, the south slope with photovoltaic tiles to match the slates in size and colour, along with some associated high level stone repairs.
	CONDITION:	Poor	Structural repairs to the west end, where there was significant cracking, were completed in 2016, grant-aided
THE YEST OF A	PRIORITY CATEGORY:	C (C)	by the Heritage Lottery Fund. Further stone repairs are
A LONG THE REAL PROPERTY AND INCOMENTS	OWNER TYPE:	Religious organisation	required.
	LIST ENTRY NUMBER:	1208241	Contact: Tracey Craig 020 7973 3756
© Historic England			
	SITE NAME:	Church of St Mary, Upper Street, Islington NI	This is the fourth church on this site, having been rebuilt in 1955-56 by Seely and White to replace the 1751 church
	DESIGNATION:	Listed Place of Worship grade II, CA	destroyed in the Blitz, which had replaced a C14 medieval church built on the site of a Norman church. Construction as with the C18 church, is in brick with stone quoins and
	CONDITION:	Poor	dressings. The neoclassical tower survived, along with the 1902 portico by R Blomfield. The portico has settled and
Participante P	PRIORITY CATEGORY:	C (C)	the congregation is actively exploring options for funding.

© Historic England

181

SITE NAME:	Angel NI		
DESIGNATION:	Conservation Area, 27 LBs	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rachel Godden (LPA) 020 7527 5967
SITE NAME:	Bunhill Fields, Finsbury Square EC2		
SITE NAME: DESIGNATION:	Bunhill Fields, Finsbury Square EC2 Conservation Area, 95 LBs, RPG grade I	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Deteriorating
DESIGNATION:	Conservation Area, 95 LBs, RPG grade I		

Religious organisation

1195776

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

OWNER TYPE:

LIST ENTRY NUMBER:

FFFF

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Ian Harper 020 7973 3786

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / ISLINGTON

SITE NAME:	Chapel Market NI		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	Clerkenwell ECI		
DESIGNATION:	Conservation Area, 95 LBs, SM	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	Hat and Feathers EC1		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	Holborn Union Infirmary		
designation:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Rachel Godden (LPA) 020 7527 596
GITE NAME:	Moorfields EC I		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY ?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	St John's Grove N19		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY: Medium		CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	St Lukes EC I		
DESIGNATION:	Conservation Area, 10 LBs	NEW ENTRY ?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	St Mary Magdalene N5		
DESIGNATION:	Conservation Area, 34 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Rachel Godden (LPA) 020 7527 596
SITE NAME:	Tollington Park N4		
DESIGNATION:	Conservation Area, 5 LBs	NEW ENTRY ?:	No
CONDITION: Poor		TREND:	No significant change
VULNERABILITY: High		CONTACT:	Rachel Godden (LPA) 020 7527 596

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

65

KENSINGTON AND CHELSEA 31, Brompton Square, South House dating from 1824-39, part of Brompton Square. A SITE NAME: Kensington SW3 series of Planning Permissions and Listed Building Consents have been granted for internal alterations and rear DESIGNATION: Listed Building grade II, CA extensions. Discussions are ongoing between the Local Authority and the owner to secure the full repair of the CONDITION: Poor building. OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1080723 Contact: Claire Sutton (LPA) 020 7745 6650 © Royal Borough of Kensington and Chels



~	SITE NAME:	I, Campden Hill W8	Private house built 1914-15. It represents an Edwardian
	DESIGNATION:	Listed Building grade II, CA	Arts and Crafts led interpretation of a large C17 country house in an urban setting. The building is in poor condition.
	CONDITION:	Poor	Discussions are ongoing between the Local Authority and the owner with regards to internal alterations and
	OCCUPANCY:	Vacant/not in use	extensions to the property.
m.	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1391138	Contact: Claire Sutton (LPA) 020 7745 6650

© Historic England

	SITE NAME:	Entrance Arch From Courtfield Gardens, Gaspar Mews SW5	Stucco carriage arch, c1870, with foot arches on either side. The central arch has plain piers, a central channelled
	DESIGNATION:	Listed Building grade II, CA	arch with vermiculated keystone, and pediment. The stucco has deteriorated and resultant water penetration is
	CONDITION:	Poor	damaging the structure. A sapling has disrupted one side arch, causing loss of stucco and brickwork and extensive
	OCCUPANCY:	N/A	cracking. Attempts have been made to establish ownership
	PRIORITY CATEGORY:	A (A)	but this has not been successful. Funding is now required in order to take forward the necessary repairs.
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1190812	Contact: Claire Sutton (LPA) 020 7745 6650



© Historic England

© Historic England

LIST ENTRY NUMBER:	1190812	Contact: Claire Sutton (LPA) 020 7745 6650
SITE NAME:	Kensal Green (All Souls) Cemetery W10	London's first metropolitan cemetery was designed by John William Griffith in 1833. The cemetery contains a large
DESIGNATION:	Registered Park and Garden grade I, 159 LBs, 2 CAs	number of listed monuments and structures at risk, including the Anglican Chapel and North Colonnade. The Management Plan from 2004 needs revision and a Project
CONDITION:	Generally unsatisfactory with major localised problems Board, led by a project manage future of the central Anglican	Board, led by a project manager, is working to secure the future of the central Anglican Chapel. This would have a considerable impact on the overall use and management of
VULNERABILITY:	Medium	he landscape. Recent conservation works to monuments
TREND:	Declining	are complete and there is progress on strategies for tree and vegetation management.
NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1000817	Contact: Christopher Laine 07780 545 979



Cont	Road, Kensal Green Cemetery W10 Company. Portland s Greek Doric tetra st containing marble me catacombs below. The suffering from water has been undertaken	1835-36 by John Griffith for the General Cemetery Company. Portland stone and stucco central chapel of a Greek Doric tetra style, with (now roofless) pavilions	
m.			containing marble memorial sculptures. There are large catacombs below. The building is no longer in use and is suffering from water ingress. A detailed condition survey
		Poor	has been undertaken, with funding from Historic England, and an options appraisal has been carried out. Discussions
d	OCCUPANCY:	Vacant/not in use	on the future of the building, in conjunction with key
	PRIORITY CATEGORY:	C (C)	stakeholders, remain at an early stage.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1190995	Contact: Verena McCaig 020 7973 3718

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious powy user (coplicable only D Е

obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB
- LPA NP RPG
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument SM
- UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDO	on / Kensington An	ID CHELSEA	
	SITE NAME:	The North Colonnade, Harrow Road, Kensal Green Cemetery W10	Built by John Griffith in 1833 to display tablets and monuments, with brick vaulted catacombs underneath. It is currently in poor condition, with damaged stone and
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	plasterwork. The restoration of a sample bay has been completed, part funded by Historic England but considerable further funding is required to complete the
	CONDITION:	Poor	works.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1080629	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Boundary wall to Kensal Green Cemetery, Harrow Road W10	High brick boundary wall to Harrow Road, a 100 metre section of which collapsed in 2006. Further bays were
	DESIGNATION:	Listed Building grade II, part in RPG grade I, part in CA	subsequently reduced in height due to safety concerns. Historic England awarded a grant towards the first phase c rebuilding the collapsed section which involves piling,
	CONDITION:	Very bad	casting a ground beam and rebuilding the wall as original. Repair works have been completed to five bays, with
	OCCUPANCY:	N/A	works to two more planned for 2018. However, considerable further funding is required to complete necessary works to the entire wall.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
∋ Historic England	LIST ENTRY NUMBER:	1191000	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Blumberg Mausoleum, Harrow Road, Kensal Green Cemetery W10	Large mausoleum from the mid-C19 in Carrara marble grey granite and bronze. It is in very bad condition with extensive vegetation growth, areas of collapse, and
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	showing widespread delamination. A comprehensive condition survey was produced in 2013, funded by Historic England. This monument has been prioritised for
	CONDITION:	Very bad	conservation and funding is now being sought to carry this out.
	OCCUPANCY:	N/A	out.
- Aller	PRIORITY CATEGORY:	A (A)	
) Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1245932	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Tomb of Alexander Bruce, Harrow Road, Kensal Green Cemetery W10	Two stage monument dating from 1850 consisting of a rectangular pedestal upon a tomb chest with a relief of mourning women in a tropical landscape. A deep undercut
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	at its base has led to the exposure and erosion of the vault and foundations and a slight lean of the monument. A comprehensive condition survey was produced in 2013,

© Historic England

	SITE NAME:	Tomb of Alexander Bruce, Harrow Road, Kensal Green Cemetery W10	Two stage monument dating from 1850 consisting of a rectangular pedestal upon a tomb chest with a relief of mourning women in a tropical landscape. A deep undercu
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	at its base has led to the exposure and erosion of the vau and foundations and a slight lean of the monument. A comprehensive condition survey was produced in 2013,
	CONDITION:	Poor	funded by Historic England. Works are being prioritised accordingly.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	389 88	Contact: Claire Sutton (LPA) 020 7745 6650

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

C (C)

Unknown

1358179

Cemetery W10

grade I, CA

Poor

N/A

C (C)

Unknown

Tomb of Sir Charles Newton,

Harrow Road, Kensal Green

Listed Building grade II, RPG

	SITE NAME:	Tomb of Alfred Cooke, Harrow Road, Kensal Green Cemetery W10	A limestone tomb by Thomas Milnes from the mid-C19 with a statue of a horse and infant on a pedestal. The sculpture is very badly damaged. A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised accordingly.
14 - 20 - CO.	DESIGNATION:	Listed Building grade II, RPG grade I, CA	
	CONDITION:	Poor	
A TRANSPORT	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
) Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	389 67	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Mausoleum of Andrew Ducrow, Harrow Road, Kensal Green Cemetery W10	Mausoleum erected in 1837 for Andrew Ducrow's wife from a design by George Danson, with later embellishments following Ducrow's own interment. The
	DESIGNATION:	Listed Building grade II*, RPG grade I, CA	mausoleum is in poor condition given the loss of sculptural elements and ironwork, and general erosion. A comprehensive condition survey was produced in 2013,
	CONDITION:	Poor	funded by Historic England. This monument has been prioritised for conservation and funding is now being
	OCCUPANCY:	N/A	sought to carry this out.

© Historic England

Contraction of the second

©⊦

はないへい かんかい

7



© Historic England



	LIST ENTRY NUMBER:	1389225	Contact: Claire Sutton (LPA) 020 7745 6650
1	SITE NAME:	Tomb of Daboda Dewanjee, Harrow Road, Kensal Green Cemetery W10	Indian grave marker of red sandstone from the mid-C19. The tomb has a significant lean due to severe erosion of the base. A comprehensive condition survey was produced
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	in 2013, funded by Historic England. Works are being prioritised accordingly.
	CONDITION:	Poor	
No.	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	246079	Contact: Claire Sutton (LPA) 020 7745 6650

accordingly.

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Verena McCaig 020 7973 3718

Tall Greek grave stele style headstone dating from the end of the C19. Now laid flat and very vulnerable to dirt and

organic growth. There is some erosion and cracking. A comprehensive condition survey was produced in 2013,

funded by Historic England. Works are being prioritised

- Conservation Area Listed Building Local Planning Authority National Park CA LB
- LPA
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

TANG	SITE NAME:	Tomb of Frederick Yates, Harrow Road, Kensal Green	Portland stone sarcophagus with effigy of a sleeping child in Carrara marble from around 1840. There is a slight lean to the north east, erosion of foundations and invasive
	LIST ENTRY NUMBER:	1389192	Contact: Claire Sutton (LPA) 020 7745 6650
© Historic England	OWNER TYPE:	Unknown	
	PRIORITY CATEGORY:	A (A)	sought to carry this out.
	OCCUPANCY:	N/A	prioritised for conservation and funding is now being
	CONDITION:	Very bad	comprehensive condition survey was produced in 2013, funded by Historic England. This monument has been
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	monument is in very poor condition with subsidence on the north elevation, deterioration of stonework, widening of joints, corrosion of iron, and loss of finials. A
	SITE NAME:	Tomb of Frederick Tillson, Harrow Road, Kensal Green Cemetery W10	Gothic Revival monument dating from circa 1870, consisting of a canopied tomb of Portland stone, marble and sandstone over a raised, moulded base. The

	and the second second		Cemetery WI0	the north east, erosion of foundations and invasive
		DESIGNATION:	Listed Building grade II, RPG grade I, CA	vegetation growth. The effigy of the child has been removed for safekeeping. A comprehensive condition survey was produced in 2013, funded by Historic England.
		CONDITION:	Poor	Works are being prioritised accordingly.
	Warst Ander	OCCUPANCY:	N/A	
© Historic England	Contraction of the second	PRIORITY CATEGORY:	C (C)	
	© Historic England	OWNER TYPE:	Unknown	
		LIST ENTRY NUMBER:	389 82	Contact: Claire Sutton (LPA) 020 7745 6650
		LIST ENTRY NUMBER:	1389182	Contact: Claire Sutton (LPA) 020 7745 6650

A Real	SITE NAME:	Tomb of Colonel Gideon Gorrequer, Harrow Road, Kensal Green Cemetery NW10	Elaborate military monument dating from 1841 to Colonel Gorrequer, ADC (aide-de-camp) to the Governor of St Helena during Napoleon's banishment. There is evidence
CAN T	DESIGNATION:	Listed Building grade II, RPG grade I, CA	of erosion at foundation level and architectural elements are threatened by ivy growth. A comprehensive condition survey was produced in 2013, funded by Historic England.
Computing the Second	CONDITION:	Poor	Works are being prioritised accordingly.
A LITTLE MALER	OCCUPANCY:	N/A	
Brand - Andrew	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1389244	Contact: Claire Sutton (LPA) 020 7745 6650



	OWNER TYPE:	Unknown			
	LIST ENTRY NUMBER:	1389244	Contact: Claire Sutton (LPA) 020 7745 6650		
	SITE NAME:	Tomb of Admiral Henry Collins Deacon, Harrow Road, Kensal Green Cemetery W10	Mid-C19 sculptural monument in Portland stone with cannon, flag, rope and cannon balls. Cracks and missing elements on the plinth have caused the shifting of the		
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	monument on its base and a significant lean. A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised		
	CONDITION:	Poor	accordingly.		
and and a second se	OCCUPANCY:	N/A			
	PRIORITY CATEGORY:	C (C)			
	OWNER TYPE:	Unknown			
	LIST ENTRY NUMBER:	1389226	Contact: Claire Sutton (LPA) 020 7745 6650		

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	Mausolea of Isabella Gregory and Hall, Harrow Road, Kensal Green Cemetery NW10	Two mausolea circa early 1830s, amongst the very earliest in the cemetery, one to Isabella Gregory and the other to Hall. Overgrown vegetation obscures the condition of
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	much of the Gregory mausoleum but spalled stone due to corroding iron cramps is evident. A comprehensive condition survey of the Gregory tomb was produced in
	CONDITION:	Very bad	2013, funded by Historic England. The Hall mausoleum has been cleared of vegetation but now requires a full
Read American	OCCUPANCY:	N/A	condition survey. The commissioning of this survey and
	PRIORITY CATEGORY:	C (C)	subsequent works are being considered alongside other priorities in the cemetery.
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1227650	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Mausoleum of James Morison, Harrow Road, Kensal Green Cemetery W10	Large mausoleum dated 1838 designed by Robert Shout. Several of the stone roof panels are missing, part of a pediment has collapsed and there are cracks in the stone,
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	probably due to corroding iron cramps. There are signs considerable structural movement. A comprehensive condition survey was produced in 2013, funded by Histo
SAL TO DAY	CONDITION:	Very bad	England. This monument has been prioritised for
	OCCUPANCY:	N/A	conservation and funding is now being sought to carry this out.
	PRIORITY CATEGORY:	A (A)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1246098	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Tomb of James Poole, Harrow Road, Kensal Green Cemetery W10	Slate chest tomb from the mid-C18. Structural settlement has led to compression and shearing of some slate elements. This structural movement needs to be arrested.
- The second	DESIGNATION:	Listed Building grade II, RPG grade I, CA	The tomb has also suffered from the loss of decorative features. A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being
	1		
	CONDITION:	Very bad	prioritised accordingly.
	CONDITION: OCCUPANCY:	Very bad N/A	
© Historic England	OCCUPANCY:	N/A	
© Historic England	OCCUPANCY: PRIORITY CATEGORY:	N/A C (C)	
© Historic England	OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	N/A C (C) Unknown	prioritised accordingly. Contact: Claire Sutton (LPA) 020 7745 6650 Gothic style tomb of architect John Gibson d.1859, designed by the architect himself. There is severe erosion of the upper registers and widening of joints. Tree works
© Historic England	OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	N/A C (C) Unknown 1271534 Tomb of John Gibson, Harrow Road, Kensal Green Cemetery	prioritised accordingly. Contact: Claire Sutton (LPA) 020 7745 6650 Gothic style tomb of architect John Gibson d.1859, designed by the architect himself. There is severe erosion

© Historic England

funding is now being sought to carry this out. N/A OCCUPANCY: PRIORITY CATEGORY: C (C) OWNER TYPE: Unknown LIST ENTRY NUMBER: 1080632 Contact: Claire Sutton (LPA) 020 7745 6650

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDO	ON / KENSINGTON AN	ID CHELSEA	
	SITE NAME:	Tomb of John Lucas, Harrow Road, Kensal Green Cemetery W10	Tall grey Cornish granite obelisk with Carrara marble bas- relief dating from the end of the C19. The landing stone is broken and sinking into the vault and the monument is leaning significantly. A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised accordingly.
There are	DESIGNATION:	Listed Building grade II, RPG grade I, CA	
	CONDITION:	Poor	61 67
	OCCUPANCY:	N/A	
and the second second	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1389238	Contact: Claire Sutton (LPA) 020 7745 6650
Artur	SITE NAME:	Tomb of Admiral Sir John Ross, Harrow Road, Kensal Green Cemetery W10	Marble memorial with sculpture of an anchor and cross of a tall pedestal, dating from the mid-C19. There is a significant lean to the south and risk from invasive plants. comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised accordingly.
1	DESIGNATION:	Listed Building grade II, RPG grade I, CA	
function of the second	CONDITION:	Very bad	5,
And	OCCUPANCY:	N/A	
ALPHIAN P	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1389215	Contact: Claire Sutton (LPA) 020 7745 6650
- Head	SITE NAME:	Mausoleum of Joseph Hudson, Harrow Road, Kensal Green Cemetery W10	Opulent classical mausoleum of Portland stone dating from circa 1850. Invasive vegetation and saplings are damaging the roof and the joints in the stonework are separating,
- And - Chi		Listed Building grade II. RPG	allowing further water ingress. A condition survey and

Listed Building grade II, RPG

grade I, CA

Very bad

Unknown

N/A

A (A)

	6 22 AC
	TO A PARTY
mar Ast	and the Read of the
Bhis - Children Child	2 10 10 10 10
PARTY INCOME	Party Party of
Sales and a second	- Carlos Al
A DESCRIPTION OF A DESCRIPTION OF A DESCRIPTION	A STATE OF TAXABLE PARTY OF TAXABLE PARTY.

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

© Historic England



	LIST ENTRY NUMBER:	1389190	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Monument to Joseph Allmond Cropper, Harrow Road, Kensal Green Cemetery W10	Circa 1870, tall composite monument in Portland stone and pink Peterhead granite shafts. The monument is leaning significantly and there is damage to the figure, canopy and
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	ironwork. A comprehensive condition survey was produced in 2013, funded by Historic England. This monument has been prioritised for conservation and
14	CONDITION:	Very bad	funding is now being sought to carry this out.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1389193	Contact: Claire Sutton (LPA) 020 7745 6650

specification are required.

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

e de la companya de l	SITE NAME:	Mausoleum of Martha Ross, Harrow Road, Kensal Green Cemetery W10	Gothic mausoleum in Bath and Portland stone dating from circa 1860. Some stonework has fallen off, the railings have been lost, invasive vegetation is growing from the roof and
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	there is considerable damage to windows. A comprehensive condition survey was produced in 2013, funded by Historic England. Further investigative works are
	CONDITION:	Very bad	required but this monument has been prioritised for conservation and funding is now being sought to carry this
	OCCUPANCY:	N/A	out.
	PRIORITY CATEGORY:	A (A)	
oric England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1246097	Contact: Claire Sutton (LPA) 020 7745 6650



© Histor

	SITE NAME:	Tomb of Mary Gibson, Harrow Road, Kensal Green Cemetery W10	Monumental tomb from 1856 comprising a carved coffin under an open aedicule with twelve Corinthian columns which are surmounted by four angels, each with an arm
	DESIGNATION: CONDITION:	Listed Building grade II*, RPG grade I, CA	held aloft to support a central wreath, now missing. The monument is in poor condition due to the loss of sculptural elements, sinking on the west side, widespread erosion and
		Poor	dirt accretions. À comprehensive condition survey was produced in 2013, funded by Historic England. This
	OCCUPANCY:	N/A	monument has been prioritised for conservation and
	PRIORITY CATEGORY:	C (C)	funding is now being sought to carry this out.
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1293490	Contact: Verena McCaig 020 7973 3718

Tomb of Mary, Lady Montgomerie, Kensal Green

Listed Building grade II, RPG

grade I, CA

C (New entry)

Very bad

Unknown

N/A

Cemetery, Harrow Road W10



© Historic England

© Historic England



	LIST ENTRY NUMBER:	1389241	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Tomb of the Earl of Galloway, Harrow Road, Kensal Green Cemetery W10	Large neoclassical chest tomb by JB Papworth dating from 1838. There is damage to the kerb stone, widening of joints, invasive plant growth causing extensive disruption
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	and some collapse on the east face. A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised accordingly.
	CONDITION:	Very bad	
THE WEAK	OCCUPANCY:	N/A	
and the second	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1389178	Contact: Claire Sutton (LPA) 020 7745 6650

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Massive sarcophagus of Carrara marble on a grey granite base with a frieze of paterae and fleurs de lys. It is now

completely submerged under ivy. Ash saplings further

threaten its structural stability.

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG SM
- Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

72

	SITE NAME:	Tomb of Samuel Griffith, Harrow Road, Kensal Green Cemetery W10	Portland stone altar tomb on a stepped granite base, from circa 1830. The tomb is in poor condition due to erosion and loss of detailing, corrosion of ironwork and heavy
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	overgrowth which has exacerbated the disruption of stone Railings are missing and bollards have fallen. A comprehensive condition survey was produced in 2013,
AL	CONDITION:	Poor	funded by Historic England. Works are being prioritised
A CAN	OCCUPANCY:	N/A	accordingly.
	PRIORITY CATEGORY:	C (C)	
Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	389237	Contact: Claire Sutton (LPA) 020 7745 6650
a.A.	SITE NAME:	Tomb of Duke of Somerset, Harrow Road, Kensal Green Cemetery W10	Portland stone mausoleum dating from the mid-C19. There is erosion at foundation level, and spalling stone due to rusting cramps. The entrance has been secured
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	temporarily to minimise any risk from anti-social behaviour A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised
	CONDITION:	Poor	accordingly.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
) Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	389242	Contact: Claire Sutton (LPA) 020 7745 6650
-dele	SITE NAME:	Tomb of WH Kent, Harrow Road, Kensal Green Cemetery NW10	Carrara marble pedestal surmounted by a draped urn with a relief of a dog at its base, dating from 1874. The tomb is in poor condition due to erosion of its carving,
No Internet	DESIGNATION:	Listed Building grade II, RPG grade I, CA	deterioration of the inscription, the heavy lean of the monument towards the west and encroaching vegetation which has almost obscured the monument entirely. A
Call Control	CONDITION:	Poor	comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised
	OCCUPANCY:	N/A	accordingly.
HERE CALLS AND MARKS	PRIORITY CATEGORY:	C (C)	
Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	389246	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Tomb of Major General Sir William Casement, Knight Commander of the Bath, Harrow Road, Kensal Green Cemetery W10	Portland stone base supporting a coffin chest draped with Casement's cloak and topped with his bicorn and sword, a under a stone canopy supported at each corner by an Indian bearer. There has been some disruption of stone due to ivy and the corrosion of cramps has led to part of
		, Listed Building grade II*, RPG	the cornice being removed. A comprehensive condition

© Historic England

grade I, CA CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Unknown

1293515

DESIGNATION:

LIST ENTRY NUMBER:

D

Е

Listed Building grade II*, RPG

funding is now being sought to carry this out.

survey was produced in 2013, funded by Historic England.

This monument has been prioritised for conservation and

Contact: Verena McCaig 020 7973 3718

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park

 - Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

DIGK 2010 / LONDON / KENCINICTON AND CHELCEA . -Н

	SITE NAME:	Tomb of Thomas Hardwick and Philip Hardwick, Kensal Green Cemetery, Harrow Road W10	Pair of sandstone slab tombs, circa 1870, with marble cross commemorating the architectural dynasty of Thomas, Philip and Philip Charles Hardwick. Philip (1792-1870) was
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	designer of the Euston Arch. The slabs have been subject to considerable subsidence causing the marble cross to lean significantly and progressively.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
the offer the	PRIORITY CATEGORY:	C (New entry)	
) Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1246086	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Tomb of William Price Lewis, Harrow Road, Kensal Green Cemetery W10	Portland stone obelisk with armorial and Anthemion rel from the mid-C19. The corrosion of iron cramps is caus spalling of the stone. The ground is eroded around the tomb resulting in damage to the brickwork below. A comprehensive condition survey was produced in 2013, funded by Historic England. Works are being prioritised accordingly.
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	
MAL MARKEN	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1246083	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Enclosing walls to Moravian Burial Ground, King's Road SW10	Brick walls enclosing the Moravian Burial Ground, mostly Tudor in origin with later additions. Historic repairs have used damaging cementitious mortars for pointing. Other
	DESIGNATION:	Listed Building grade II, part in CA	problems relate to structural instability and brick decay. A pilot repair project, grant-aided by Historic England, finished in April 2017. This will be used to inform the
	CONDITION:	Poor	strategy for the remaining repairs. The owners are exploring possible sources of funding.
	OCCUPANCY:	N/A	compositione sources of funding.

© Historic England

©

©



	LIST ENTRY NUMBER:	1224734	Contact: Claire Sutton (LPA) 020 7745 6650
	SITE NAME:	Tomb of Robert Coombes, Brompton Cemetery, Old Brompton Road SW10	Elongated Portland stone chest tomb on a York stone slab, of unusual design with niches at the four corners each containing a statue of an oarsman. An upturned boat
	DESIGNATION:	Listed Building grade II, RPG grade I, CA	surmounts the tomb lid, draped with a Doggett's coat and badge, the prize awarded in the annual Thames rowing race of that name. The monument commemorates a
	CONDITION:	Poor	famous rower. All niche statues have lost their heads and are covered with carbon deposits. The architectural
The Lot	OCCUPANCY:	N/A	detailing is eroding, and the stone is spalling severely in
2 Con	PRIORITY CATEGORY:	C (C)	places leading to a loss of fabric. Discussions are taking place as to how works might be approached.
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1403329	Contact: Claire Sutton (LPA) 020 7745 6650

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

PRIORITY CATEGORY:

OWNER TYPE:

C (C)

Religious organisation

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	25-26, Pembridge Square W2	Two mid-C19 stucco houses in florid classical style now
	DESIGNATION:	Listed Building grade II, CA	joined together to form a hotel. The buildings were showing signs of neglect but major works are now at an
- 1 2	CONDITION:	Fair	advanced stage.
	OCCUPANCY:	Vacant/not in use	
丁一件	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
and the second se	LIST ENTRY NUMBER:	1225869	Contact: Claire Sutton (LPA) 020 7745 6650

© Historic England

	SITE NAME:	All Saints Church, Clydesdale Road, Kensington W11	Designed by William White and completed in 1861, although the spire was never realised. All Saints is built in
	DESIGNATION:	Listed Place of Worship grade II*, CA	stone with polychromatic decoration and has slate roofs. The sanctuary has paintings by Henry Holiday. The slates are suffering from nail sickness and the gutters have many
	CONDITION:	Poor	patch repairs. Rainwater leaks are ongoing. There is cracking through the stonework at the west end of the
	PRIORITY CATEGORY:	C (C)	north aisle. Repairs are also necessary to the tower
	OWNER TYPE:	Religious organisation	stonework and to the uneven floor internally.
	LIST ENTRY NUMBER:	1080701	Contact: Tracey Craig 020 7973 3756
	OWNER TYPE:	Religious organisation	stonework and to the uneven floor internally.

© Historic England

	SITE NAME:	Church of St John the Baptist, Holland Road, Kensington W14	Early English style church dating from 1874-1911 by J Brooks and JS Atkins architects. The church has slate
	DESIGNATION:	Listed Place of Worship grade I, CA	pitched roofs, coursed rubble walling with Bath stone dressings and a large rose window at the west end. Extensive repairs to the roofs, high level masonry and
	CONDITION:	Fair	rainwater goods were completed in early 2015, grant-aid by the Heritage Lottery Fund and Historic England. Wor to repair the west end roofs and masonry, grant-aided b
	PRIORITY CATEGORY:	C (F)	
	OWNER TYPE:	Religious organisation	the Heritage Lottery Fund, were completed in 2017. Further roof repairs are required.
	LIST ENTRY NUMBER:	1080593	Contact: Tracey Craig 020 7973 3756

© Historic England

	SITE NAME:	Church of St Michael and All Angels, Ladbroke Grove, Kensington W10	Designed by J and JS Edmeston, built in 1871. Rhineland Romanesque style in London stock brick with terracotta, red Mansfield and Forest of Dean stone dressings, with clay
	DESIGNATION:	Listed Place of Worship grade II, CA	roof tiles. The roofs and rainwater disposal system are in poor condition. Some stone and brickwork is also in need of repair.
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1226579	Contact: Tracey Craig 020 7973 3756



SITE NAME:	Church of St Augustine, Queen's Gate, Kensington SW7	Large church designed by William Butterfield in Gothic style completed in 1876. Constructed in Gault brick with
DESIGNATION:	Listed Place of Worship grade II*, CA	stone and red brick banding with areas of patterned diaper work to parapets and gables and decorative carved stone panels. There is rich polychromatic decoration internally.
CONDITION:	Poor	Re-slating of the north slope of the nave and the north aisle was completed in 2011 with funding from Historic England
PRIORITY CATEGORY:	C (C)	and the Heritage Lottery Fund. The south side is in need of
OWNER TYPE:	Religious organisation	similar work, along with brick and stone repairs particularly to the west elevation where mortar re-facings of brickwork
LIST ENTRY NUMBER:	226 6	are failing.

© Historic England

Contact: Tracey Craig 020 7973 3756

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lacentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / KENSINGTON AND CHELSEA / KINGSTON UPON THAMES

SITE NAME:	Kensal Green Cemetery W10		
DESIGNATION:	Conservation Area, 154 LBs, part in RPG grade I	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Claire Sutton (LPA) 020 7745 6650

KINGSTON UPON THAMES			
	SITE NAME:	Kingston Telephone Exchange, Ashdown Road, Kingston upon Thames	Purpose built telephone exchange, built in 1907 and opened in 1908. Arts and Crafts style with an asymmetrical plan. The building has been vacant for many years. Planning
	DESIGNATION:	Listed Building grade II	Permission has been granted for a wider redevelopment, including the repair and re-use of this building and works
	CONDITION:	Poor	are underway for conversion to offices.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (D)	
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1080059	Contact: Chloe Clay (LPA) 020 8547 5418



Q.	SITE NAME:	Mortuary Chapels, Bonner Hill Road	Symmetrical gothic-style twin chapels either side of a carriageway through the cemetery. The slate roofs ar
	DESIGNATION: Listed Building grade II condition: r CONDITION: Poor r OCCUPANCY: Part occupied/part in use condition:	steeply pitched with a central stone spire and open octagonal lantern. The west chapel is still used for memorial purposes. There is general spalling to stonework and vegetation growing at high level. The east chapel is	
3			
		Part occupied/part in use	currently closed owing to signs of structural movement,
117	PRIORITY CATEGORY:	C (C)	with cracking in masonry. The Local Authority is carrying out condition and structural surveys to better understand
	OWNER TYPE:	Local authority	the extent of repair works required.
	LIST ENTRY NUMBER:	1358433	Contact: Chloe Clay (LPA) 020 8547 5418

© Historic England



SITE NAME:	Former Head Post Office, 42, Eden Street, Kingston upon Thames	Post office built in 1875. Three storeys in red brick with stone dressings. The building has been vacant for many years. Planning Permission has been granted for a wider
DESIGNATION:	Listed Building grade II	redevelopment, including the repair and re-use of this building, and works are progressing. Initially the building will
CONDITION:	Fair	include a marketing suite for the nearby development, and will later become restaurants and community space.
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	F (F)	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1080100	Contact: Chloe Clay (LPA) 020 8547 5418

© Historic England



© Historic England

	SITE NAME:	Lambeth uncovered coal store including tower and attached tunnels, Portsmouth Road, Surbiton	Uncovered coal store with tower and attached underground tunnels, built 1851-1852 to the design of James Simpson in a Romanesque style for the Lambeth Waterworks. Sited on what is now a student campus, it has
	DESIGNATION:	Listed Building grade II, CA	been unused for many years. A structural survey was carried out in 2013 and significant repairs carried out to
	CONDITION:	Poor	brickwork and copings. A new use is required in order to secure the future of the building.
E	OCCUPANCY:	Vacant/not in use	seed e die latare of the building.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Educational (state sector)	
	LIST ENTRY NUMBER:	1031864	Contact: Chloe Clay (LPA) 020 8547 5418

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / KINGSTON UPON THAMES / LAMBETH

	Å	6/	11-10	
	A.	6		14
1	TA			
	and a			
				Can I

© Historic England

SITE NAME:	Church of St Matthew, St Matthew's Avenue, Surbiton
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	D (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1184929

Designed by CL Luck in Gothic style and built in 1875 in Kentish ragstone with limestone dressings. It has a square tower crowned with a tall octagonal stone spire. The steeply pitched roofs are covered in clay tiles. The spire and tower suffer from erosion of stone and pointing and embedded ironwork has resulted in cracking of stone. The mullions to the belfry openings have had to be strapped temporarily due to loss of stone. Areas of roofing suffer from slipped and missing tiles. The church has been awarded a first round pass from the Heritage Lottery Fund for repairs to the tower and spire.

Contact: Tracey Craig 020 7973 3756

SITE NAME:	Coombe Wood		
DESIGNATION:	Conservation Area, 8 LBs, 2 SMs	NEW ENTRY ?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Chloe Clay (LPA) 0208 547 5318
SITE NAME:	Fairfield / Knights Park, Kingston Town		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY ?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Chloe Clay (LPA) 0208 547 5318
SITE NAME:	Grove Crescent, Kingston Town		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Chloe Clay (LPA) 0208 547 5318
	riedian		

LAMBETH

© Historic Englan

St.	SITE NAME:	Beaufoy Institute, 39, Black Prince Road, Vauxhall SEI I	Educational building of 1907 (architect FA Powell). The front facade is of brick and terracotta with free Baroque motifs. There is a laboratory wing to the side dating from 1930, and an assembly hall at the rear. The building was
TTT AND	DESIGNATION:	Listed Building grade II, CA	
The second	CONDITION:	Fair	vacated by the Lilian Baylis Secondary School in 1999. The building is now occupied and repair works are progressing
	OCCUPANCY:	Occupied/in use	on the whole site. The 1930s annex has now been
	PRIORITY CATEGORY:	F (F)	refurbished externally with a new roof and replacement windows.
-	OWNER TYPE:	Religious organisation	
and	LIST ENTRY NUMBER:	1358193	Contact: Elizabeth Martin (LPA) 020 7926 1213



© Historic England

	SITE NAME:	Gates, piers and railings at Western Block of Number 39 (Beaufoy School Technical Block), Black Prince Road, Vauxhall SE11	Wrought iron railings in a scalloped pattern on a granite plinth and three pairs of wrought iron gates, circa 1907. Currently in poor condition, suffering from deterioration and pigeon damage. Discussions are underway regarding the necessary repair works and funding sources.
	DESIGNATION:	Listed Building grade II, CA	
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
T	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1183436	Contact: Elizabeth Martin (LPA) 020 7926 1213

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	St Gabriel's College, Cormont Road, Lambeth SE5	Large Art Nouveau four storey building, formerly Charles Edward Brooke Girls School and listed as St Gabriel's
in a	DESIGNATION:	Listed Building grade II, CA	College. Vacant following the relocation of the school. T Local Authority commissioned a condition survey in Mar
	CONDITION:	Poor	2016. However planned works to make the building wind and weathertight have yet to be carried out. No future
	OCCUPANCY:	Vacant/not in use	user has been identified.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
on Borough of Lambeth	LIST ENTRY NUMBER:	1080484	Contact: Elizabeth Martin (LPA) 020 7926 1213



STATE OF	SITE NAME:	Dorchester Court, Herne Hill SE24	Eight blocks with 96 flats around a central landscaped courtyard, dating from 1933-4 by Leslie H Kemp and
	DESIGNATION:	Listed Building grade II	Fredérick É Tasker. There are structural problems with the balconies and general external deterioration. Discussions
	CONDITION:	Poor	are ongoing regarding a comprehensive programme of refurbishment.
	OCCUPANCY:	Occupied/in use	
1000	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1390780	Contact: Elizabeth Martin (LPA) 020 7926 1213

© Historic England

© Londo



© London Borough of Lambeth

Tudorbethan style off-licence, built circa 1929. Damage SITE NAME: Off-licence attached to the Old includes a broken window pane. Planning Permission and Red Lion public house, 44, Kennington Park Road SEI I Listed Building Consent for the erection of a three storey extension were granted on appeal in 2014. The Local DESIGNATION: Listed Building grade II Authority is currently considering the details submitted in connection with the scheme. CONDITION Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: D (D) OWNER TYPE: Private LIST ENTRY NUMBER: 1061361 Contact: Elizabeth Martin (LPA) 020 7926 1213



© London Borough of Lambeth



	SITE NAME:	Wall and piers around St Mark's Churchyard, Kennington Park Road SELI	Low, dark granite walls with tall pale granite piers at intervals with Portland stone round pedimented caps. The railings and finials are missing in places and the walls are
	DESIGNATION:	Listed Building grade II, CA	cracked and being damaged by vegetation growth.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
F	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1358301	Contact: Elizabeth Martin (LPA) 020 7926 1213

	SITE NAME:	Old Paradise Gardens, walls of former graveyard, Lambeth High Street SEI I	C18 walls of reddish brick enclosing a former burial ground. The brickwork and coping stones are in poor condition. Some repairs have been undertaken, however	
St. A.	DESIGNATION:	Listed Building grade II	the walls are still cracked and bowed in places.	
	CONDITION:	Poor		
and a	OCCUPANCY:	N/A		
	PRIORITY CATEGORY:	A (A)		
	OWNER TYPE:	Local authority		
mbeth	LIST ENTRY NUMBER:	1080371	Contact: Elizabeth Martin (LPA) 020 7926 1213	

PRIORITY CATEGORIES

© London Borough of Lam

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / LAMBETH			
K ZAR	SITE NAME:	Walls, railings and gates to Church of St Mary, Lambeth Road SEI	Mid-C19 ragstone walls and ironwork in a partial state of collapse. Planning Permission and Listed Building Consent have been granted for their repair and restoration. Work is
	DESIGNATION:	Listed Building grade II, part in RPG grade II, CA	now complete on the Garden Museum, grant-aided by the Heritage Lottery Fund, and discussions are ongoing to identify a scheme and funding for the repair of the walls,
	CONDITION:	Poor	railings and gates.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (F)	
© Historic England	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1358299	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	Reliance Arcade, Brixton Market, Market Row SW9	Covered market built 1923-5 by Andrews and Peascod, of brick and concrete construction. The market is a straight
	DESIGNATION:	Listed Building grade II, CA	narrow arcade from Electric Lane to Brixton Road. Fronting Electric Lane is a buff faience facade with Art Deco
	CONDITION:	Poor	Egyptian-style detailing, which has been poorly repaired in the past. The units within the arcade are mostly occupied,
	OCCUPANCY:	Occupied/in use	but the roof and windows are in particularly poor
	PRIORITY CATEGORY:	C (C)	condition. Funding has been secured from the Heritage Lottery Fund for the wider area and discussions between
	OWNER TYPE:	Private	the owner and the Local Authority regarding conservation and repair works are underway.
© Historic England	LIST ENTRY NUMBER:	1393881	Contact: Ellie Cook (LPA) 020 7527 2801
	SITE NAME:	Old Fire Station (South London Theatre), 2A, Norwood High Street SE27	Former fire station leased from the London Borough of Lambeth and in use as the South London Theatre. Funding was secured in 2014 from the Heritage Lottery Fund to
	DESIGNATION:	Listed Building grade II, CA	carry out a range of conservation repairs and Planning Permission and Listed Building Consent were granted for
	CONDITION:	Fair	redevelopment of the site, including new accessible theatre space, entrance foyer and lift. The major works are now
	OCCUPANCY:	Occupied/in use	complete whilst some interior renovations remain to be
	PRIORITY CATEGORY:	F (B)	done on the upper floors. This work is expected to be completed by the end of 2018.
	OWNER TYPE:	Charity (non-heritage)	
© London Borough of Lambeth	LIST ENTRY NUMBER:	1263240	Contact: Elizabeth Martin (LPA) 020 7926 1213
THE REAL PROPERTY AND A DESCRIPTION OF THE REAL PROPERTY	SITE NAME:	Augustus Ralli Mortuary Chapel, Norwood Road, West Norwood Memorial Park SE27	Doric temple mortuary chapel circa 1872, attributed to J Oldrid Scott, within the Greek Burial Ground and known as St Stephen's Chapel. Built of white and gold coloured
TERM	DESIGNATION:	Listed Building grade II*, RPG grade II*, CA	fossiliferous limestone. The chapel is in poor condition due to subsidence, collapsed steps and internal water damage. The Heritage Lottery Fund has awarded the Local
	CONDITION:	Poor	Authority a grant under the Parks for People programme which includes funds towards restoring priority
	OCCUPANCY:	N/A	monuments. Discussions are now underway regarding the
	PRIORITY CATEGORY:	C (C)	necessary repair works.
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1064989	Contact: Elizabeth Whitbourn 07889 808145

PRIORITY CATEGORIES

А

В

Immediate risk of further rapid deterioration or loss of fabric; no

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet

implemented. C Slow decay; no solution agreed.

use).

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument





SITE NAME: Catacombs beneath the Remembrance Garden, Norwood High Street, West Norwood Memorial Park SE27 Listed Building grade II, RPG DESIGNATION: grade II*, CA CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority

1263192

LIST ENTRY NUMBER:

Catacombs circa 1837; cemetery laid out circa 1837 by Sir William Tite. A temporary roof has been erected over the entrance to allow the structure to dry out before agreeing repairs. Moisture surveys are ongoing; levels appear to be stabilising/reducing. Discussions are ongoing regarding potential funding sources and long-term use.


Contact: Elizabeth Martin (LPA) 020 7926 1213

© Historic England



SITE NAME:	Tomb of C Auffrey and E O'Gorman, Norwood Road, West Norwood Memorial Park SE27	Pedestal tomb dating from 1893 with carved wreaths, faces and anchor. The tomb is leaning significantly. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes
DESIGNATION:	Listed Building grade II, RPG grade II*, CA	funds towards restoring priority monuments. Discussions are now underway regarding the necessary repair works.
CONDITION:	Very bad	
OCCUPANCY:	N/A	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Unknown	
LIST ENTRY NUMBER:	1250576	Contact: Elizabeth Martin (LPA) 020 7926 1213

© Historic England

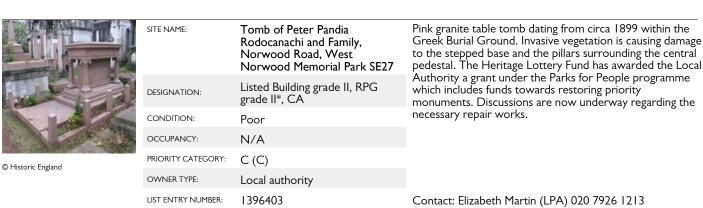



© Historic England

	SITE NAME:	Tomb of Captain John Wimble, Norwood Road, West Norwood Memorial Park SE27	Chest tomb dating from 1851 with finely carved reliefs showing ships at sea. The stone ship surmounting the tomb is subject to movement. The Heritage Lottery Fund has
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	awarded the Local Authority a grant under the Parks for People programme which includes funds towards restoring priority monuments. Discussions are now underway
	CONDITION:	Fair	regarding the necessary repair works.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1065020	Contact: Elizabeth Martin (LPA) 020 7926 1213

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM ÍΙΑ
- Unitary Authority World Heritage Site WHS

OCCUPANCY:

OWNER TYPE:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Very bad

Unknown

1250589

grade II*, CA

Very bad

Unknown

N/A

A (A)

Mausoleum of George Dodd, Norwood Road, West Norwood Memorial Park SE27

Listed Building grade II, RPG

N/A

A (A)

HERITAGE AT RISK 20187 LONDO			
	SITE NAME:	Tomb of Christopher Gabriel, Norwood Road, West Norwood Memorial Park SE27	Chest tomb in Portland stone dating from 1873 with carvings by Kelsey. There is cracking to the stone panels of the side of the tomb. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes funds towards restorin priority monuments. Discussions are now underway
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	
	CONDITION:	Poor	regarding the necessary repair works.
	OCCUPANCY:	N/A	
Ser Contraction	PRIORITY CATEGORY:	A (A)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1064988	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	Tomb of Elizabeth King, Norwood Road, West Norwood Memorial Park SE27	Statue of an angel mounted against a rough headstone over rough base, dating from 1922. In the style of the 1878 Oneto Monument by Giulio Monteverge in Genoa. The
下的	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	statue and headstone are leaning significantly. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes
	CONDITION:	Very bad	funds towards restoring priority monuments. Discussions

© Historic England

SITE NAME:
DESIGNATION:
CONDITION:
OCCUPANCY:
PRIORITY CATEGORY:

© Historic England



	LIST ENTRY NUMBER:	1325944	Contact: Elizabeth Martin (LPA) 020 7926 1213	
	SITE NAME:	Tomb of Mrs Alice Moffatt, Norwood Road, West Norwood Memorial Park SE27	An arcaded chest tomb, circa 1847. The columns and top slab have been lost, leaving the structural rods exposed. The Heritage Lottery Fund has awarded the Local	
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	Authority a grant under the Parks for People program which includes funds towards restoring priority monuments. Discussions are now underway regarding	
	CONDITION:	Very bad	necessary repair works.	
	OCCUPANCY:	N/A		
1	PRIORITY CATEGORY:	A (A)		
	OWNER TYPE:	Unknown		
	LIST ENTRY NUMBER:	1357922	Contact: Elizabeth Martin (LPA) 020 7926 1213	

repair works.

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

are now underway regarding the necessary repair works.

Mausoleum, circa 1865, by Thomas Allom. Built of white marble in a northern Italian Gothic style, with a rectangular

when listed in 1981 and has continued to deteriorate. The

plan of three bays defined by pinnacle buttresses. The mausoleum was noted as being in a poor state of repair

monument is now overgrown with vegetation. The Heritage Lottery Fund has awarded the Local Authority a

grant under the Parks for People programme which

includes funds towards restoring priority monuments.

Discussions are now underway regarding the necessary

Contact: Elizabeth Martin (LPA) 020 7926 1213

- CA
- LB I PA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

PRIORITY CATEGORY:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

ERITAGE AT RISK 2018 / LOINDO			
	SITE NAME:	Tomb of Ibbotson Family, Norwood Road, West Norwood Memorial Park SE27	Cross decorated with blue and buff ceramic tiles by Doulton of Lambeth on a pedestal with grave slab datin from 1904. Tiles are missing and cementitious repairs an
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	causing further damage. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes funds towards restoring
	CONDITION:	Poor	priority monuments. Discussions are now underway regarding the necessary repair works.
	OCCUPANCY:	N/A	regarding the necessary repair works.
	PRIORITY CATEGORY:	A (A)	
Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1250687	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	Tomb of Israel Thomas, Norwood Road, West Norwood Memorial Park SE27	Pedestal monument above a vault in the Egyptian Revival style, circa 1842. The tomb is overgrown with vegetation and the plinth is broken and open to the elements. The
			Heritage Lottery Fund has awarded the Local Authority a

Listed Building grade II, RPG

Tomb of James Kershaw, Norwood Road, West Norwood Memorial Park SE27

Listed Building grade II, RPG

grade II*, CA

Poor

N/A

D (C)

Unknown

1263196

grade II*, CA

Poor

N/A

C (C)

© Historic England

©Н



© Historic England



	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1263197	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	Tomb of James Baldwin Brown, Norwood Road, West Norwood Memorial Park SE27	Celtic cross on pedestal faced in terracotta in Romanesque/Gothic style, dating from 1885. The tomb is leaning heavily, with its side tablet disengaged and the
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	pinnacle tip missing. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes funds towards restoring
	CONDITION:	Very bad	priority monuments. Discussions are now underway regarding the necessary repair works.
	OCCUPANCY:	N/A	regarding the necessary repair works.
4	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1250584	Contact: Elizabeth Martin (LPA) 020 7926 1213

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

grant under the Parks for People programme which

Contact: Elizabeth Martin (LPA) 020 7926 1213

Chest tomb dating from 1864 in Gothic style with elaborate carving. Designed by Alfred Waterhouse

The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme

which includes funds towards restoring priority

commemorating the MP James Kershaw. The structural ironwork is corroding, causing splitting of the stone. The

railings are also being affected by movement to the plinth.

monuments. Discussions are now underway regarding the


pilot for the wider project.

necessary repair works.

includes funds towards restoring priority monuments. Emergency works have been carried out to this memorial


to make it safe and its full repair is due to start in 2018 as a

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument SM
- UA WHS
 - Unitary Authority World Heritage Site

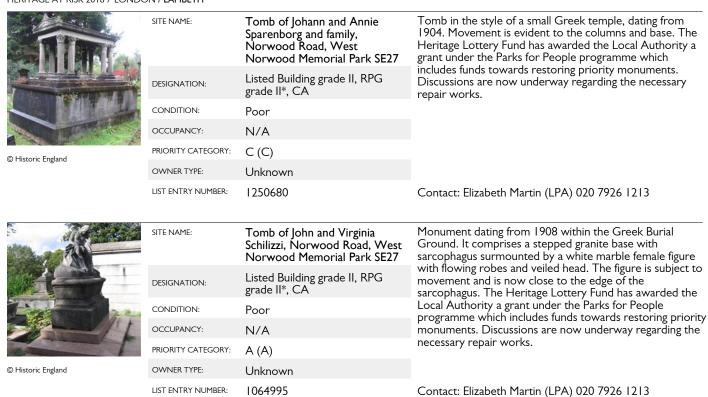



© Historic England

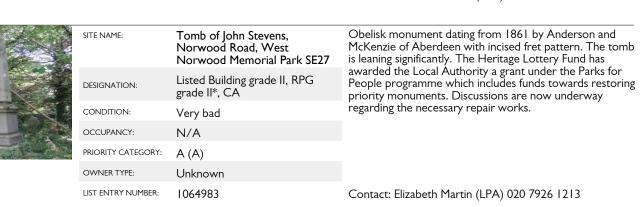



Pedestal monument and slab above a vault circa 1850. The SITE NAME: Letts Family Tomb, West Norwood Memorial Park, tomb began leaning early in 2013. The Heritage Lottery Fund has awarded the Local Authority a grant under the Norwood Road SE27 Parks for People programme which includes funds towards Listed Building grade II, RPG restoring priority monuments. Emergency works have been DESIGNATION: grade II*, CA carried out to this memorial to make it safe and its full repair is due to start in 2018 as a pilot for the wider CONDITION: Very bad project. OCCUPANCY: N/A PRIORITY CATEGORY: D (A) OWNER TYPE: Unknown LIST ENTRY NUMBER: 1263199 Contact: Elizabeth Martin (LPA) 020 7926 1213

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed. С
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

ΪA

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- Unitary Authority World Heritage Site WHS

	SITE NAME:	Tomb of Thomas De La Garde Grissell, Norwood Road, West Norwood Memorial Park SE27	Chest tomb, circa 1847. Cast iron, stucco and pink granite. The plinth is broken and parts are exposed. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes funds towards restoring priority monuments. Discussions are now underway regarding the necessary repair works.
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1065021	Contact: Elizabeth Martin (LPA) 020 7926 1213

	SITE NAME:	Tomb of William Grane, Norwood Road, West Norwood Memorial Park SE27	Tomb dating from 1856, noted in the list description as having a pink granite cross with foliated arms and vine trails to stem. This cross is missing and there is clear evidence of movement to the base of the monument. The Heritage Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes funds towards restoring priority monuments. Discussions are now underway regarding the necessary repair works.
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	
Part and a second	CONDITION:	Poor	
20 Stat 20 1	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1357900	Contact: Elizabeth Martin (LPA) 020 7926 1213

	SITE NAME:	Tomb of XE Balli Family, Norwood Road, West Norwood Memorial Park SE27	lonic temple mausoleum dating from the late C19 within the Greek Burial Ground. There is evidence of movement to the entablature and collapse of the steps. The Heritage
	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	Lottery Fund has awarded the Local Authority a grant under the Parks for People programme which includes funds towards restoring priority monuments. Discussions
	CONDITION:	Very bad	are now underway regarding the necessary repair work
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
Historic England	OWNER TYPE:	Unknown	
	Norwood Road, West Norwood Memorial Park SE27Norwood Memorial Park SE27DESIGNATION:Listed Building grade II, RPG grade II*, CAPRIORITYCONDITION:Very badOCCUPANCY:PRIORITY CATEGORY:A (A)OWNER TYPE:Unknown	Contact: Elizabeth Martin (LPA) 020 7926 1213	



	SITE NAME:	Monument to George Abell, St Leonard's churchyard, Streatham High Road, Streatham SW16	Chest tomb of circa 1826 commemorating George and Elizabeth Abell. The slab of Portland limestone with curved edged top has broken and the plinth is in a bad condition. A condition survey has been prepared, with support from	
c	DESIGNATION:	Listed Building grade II, CA	Historic England, and funding is now being sought to see the necessary repair works.	
and a	CONDITION:	Very bad		
104	OCCUPANCY:	N/A		
	PRIORITY CATEGORY:	Leonard's churchyard, Streatham High Road, Streatham SW16 Listed Building grade II, CA Very bad NCY: N/A CATEGORY: A (A) TYPE: Unknown		
	OWNER TYPE:	Unknown		
	LIST ENTRY NUMBER:	1323730	Contact: Elizabeth Martin (LPA) 020 7926 1213	
	CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Streatham High Road, Streatham SW16 Listed Building grade II, CA Very bad N/A A (A) Unknown	edged top has broken and the plinth is in a ba A condition survey has been prepared, with s Historic England, and funding is now being so the necessary repair works.	

© London Borough of Lambeth

© Hi

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LOND	ON / LAMBETH		
. Len	SITE NAME:	Monument to Joseph Hay, St Leonards churchyard, Streatham High Road, Streatham SW16	Coade stone chest tomb in railed enclosure, dated 1808 by Coade and Sealy. The railings are broken and in a poor state of repair. A condition survey has been prepared, with support from Historic England, and funding is now being
	DESIGNATION:	Listed Building grade II, CA	sought to secure the necessary repair works.
	CONDITION:	Very bad	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1323732	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	Monument to Lt. Col. William Boyce, St Leonards churchyard, Streatham High Road, Streatham SW16	Chest tomb in railed enclosure, circa 1808 by Coade and Sealy. The Coade stone is in an advanced state of decay. A condition survey has been prepared, with funding from Historic England, and discussions are now underway to
	DESIGNATION:	Listed Building grade II, CA	secure the necessary repair works.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
© Historic England	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	32373	Contact: Elizabeth Martin (LPA) 020 7926 1213
1	SITE NAME:	335-337, Wandsworth Road SW8	Pair of Regency houses, formerly undertaker's premises. The buildings are occupied and the freeholders are co- operating with the Local Authority on a phased
	DESIGNATION:	Listed Building grade II, CA	programme of repairs.
	CONDITION:	Fair	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	F (D)	
	OWNER TYPE:	Commercial company	
© London Borough of Lambeth	LIST ENTRY NUMBER:	1081047	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	Wall on the south side of St John with All Saints' churchyard, Waterloo Road SEI	Early C19 stock brick walls, spalled with cracked brickwork. The finials are broken and missing. A structural survey has been carried out and Historic England and the
	DESIGNATION:	Listed Building grade II, CA	Local Authority are in discussion regarding repairs and potential funding sources.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
@ Ulinearie England	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1068687	Contact: Elizabeth Martin (LPA) 020 7926 1213
	SITE NAME:	The Clapham Orangery, Worsopp Drive SW4	Orangery built in 1793 to the design of William Burgh, in a Palladian style. It stood in the grounds of Thornton House,
- North	DESIGNATION:	Listed Building grade II	demolished in the 1940s. Now standing in the middle of a housing estate. Discussions regarding maintenance of the
	CONDITION:	Fair	roof and rainwater goods have commenced.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
and the state of t	OWNER TYPE:	Local authority	

© Historic England

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

1068843

LIST ENTRY NUMBER:

D

Е

Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Elizabeth Martin (LPA) 020 7926 1213

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / LAMBETH / LEWISHAM

	Streatham High Road, 186 Streatham SW16 tow	Designed by J Parkin built in 1841 with chancel added in 1862; designed by Benjamin Ferrey. The lower part of the tower and the spiral stair up to the belfry date from the	
	DESIGNATION:	Listed Place of Worship grade II, CA	mid-C14. The church was burnt out in 1975, repaired and re-ordered by Douglas Feast. In 2015 the north aisle and north slope of the nave were re-slated, the flat roof north of the tower re-roofed, and stucco repairs carried out wi funding from the Heritage Lottery Fund. Repairs are currently underway for similar works to the south side of
	CONDITION:	Poor	
	PRIORITY CATEGORY:	F (D)	
	OWNER TYPE:	Religious organisation	the church grant-aided by the Heritage Lottery Fund and due to complete in 2018.
© Historic England	LIST ENTRY NUMBER:	1100267	Contact: Tracey Craig 020 7973 3756

SITE NAME:	Leigham Court Estate, Streatham SW2		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Douglas Black (LPA) 020 7926 4065
SITE NAME:	Vassall Road, Brixton SW9		
DESIGNATION:	Conservation Area, 43 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Douglas Black (LPA) 020 7926 4065
SITE NAME:	West Norwood SE27		
DESIGNATION:	Conservation Area, 75 LBs, part in RPG grade II*	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Douglas Black (LPA) 020 7926 4065

LEWISHAM

A week	SITE NAME:	Beckenham Place, Foxgrove Road, Beckenham Place Park	Mansion built circa 1773, situated within former park land currently used as a golf course. Some emergency repairs
	DESIGNATION:	Listed Building grade II*, CA	were carried out in 2012 with a grant from Historic England. The Heritage Lottery Fund awarded funding in
	CONDITION:	Fair	2016 under the Parks for People programme for the wider park which includes funding to restore the setting of the
	OCCUPANCY:	Part occupied/part in use	mansion. The mansion is currently in temporary use, whilst
	PRIORITY CATEGORY:	C (C)	the Local Authority investigates funding options for its full repair, as well as options for its long term use.
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1359317	Contact: Elizabeth Whitbourn 07889 808145

© Historic England



© Historic England

	SITE NAME:	Stable block and garden walls to Beckenham Place, Beckenham Hill Road	Late C18 stable block, which was severely damaged by fire in 2011. The Heritage Lottery Fund awarded funding in 2016 under the Parks for People programme for the wider
	DESIGNATION: CONDITION:	Listed Building grade II	park, which includes funds towards restoring the stable block. Applications for Planning Permission and Listed
Ĩ		Very bad	Building Consent were approved in 2017. Works have started to bring the building and stable yard back into use
1	OCCUPANCY:	Vacant/not in use	as a café, and educational facility and are due to complete
	PRIORITY CATEGORY:	F (A)	in 2019.
ê	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1080027	Contact: Natasha Peach (LPA) 0208 314 6049

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / LEWISHAM



SITE NAME:	Holland and Company's Distillery, 14 and 16, Deptford Bridge SE8	Former offices of the Holland and Company's Distillery, dating from the late C18. On the ground floor at the east end is a double door and a carriage entrance, framed in late
DESIGNATION:	Listed Building grade II	C19 stonework with dentil cornice and an inscription in the small pediment over: "Established 1779. Holland and Co's
CONDITION:	Poor	Distillery and Bonded Store". The building has been empty for a number of years and is deteriorating. The Local
OCCUPANCY:	Vacant/not in use	Authority has written to the owner to discuss the building's
PRIORITY CATEGORY:	C (C)	condition.
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1080000	Contact: Natasha Peach (LPA) 0208 314 6049

© Historic England



2	SITE NAME:	Old Swimming Baths, Ladywell Road SEI3	Public baths, consisting of first and second class swimming pools constructed in 1884. Designed in the Gothic style by
	DESIGNATION:	Listed Building grade II, CA	Wilson and Son and Thomas Aldwinkle. The building is unused and the second class pool hall was badly damaged
	CONDITION:	Poor	by fire in 2005. In 2011 urgent works to the roof and dry rot stabilised the building although in isolated areas some
	OCCUPANCY:	Vacant/not in use	water ingress persists. The Local Authority successfully
	PRIORITY CATEGORY:	C (C)	secured a restoration partner in 2017 and discussions are in progress regarding funding options for the full repair of
	OWNER TYPE:	Local authority	the building, its long term use and interim repairs.
	LIST ENTRY NUMBER:	39 8	Contact: Natasha Peach (LPA) 0208 314 6049

Tomb of Captain Limeburner, Lee Terrace, St Margaret's Old Churchyard SEI3

Listed Building grade II, CA

Very bad

N/A

A (A)

A stone chest tomb from the middle of the CI8

a Section 106 agreement.

commemorates Captain Limeburner of the Royal Navy and his wife. The south side has lost its central panel and the angle balusters are displaced. A condition survey has been prepared, with funding from Historic England, and funding

for repair and restoration works has been secured through

© Historic England



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

PRIORITY CATEGORY:

© Historic England



© Historic England



and the second second					
	OWNER TYPE:	Religious organisation			
	LIST ENTRY NUMBER:	1392002	Contact: Natasha Peach (LPA) 0208 314 6049		
j	SITE NAME:	Tomb of Fludyer, Lee Terrace, St Margaret's Old Churchyard SEI3	An elaborate Rococo tomb from 1769 in Portland stone and marble. Despite previous repairs, the monument is in very bad condition with widespread cracking, open joints		
	DESIGNATION:	Listed Building grade II*, CA	from vegetation growth and some collapse. A condition survey has been prepared, with funding from Historic		
	CONDITION:	Very bad	England, and funding for repair and restoration works has been secured through a Section 106 agreement.		
	OCCUPANCY:	N/A			
	PRIORITY CATEGORY:	A (A)			
	OWNER TYPE:	Religious organisation			
	LIST ENTRY NUMBER:	1391993	Contact: Elizabeth Whitbourn 07889 808145		

	SITE NAME:	Tomb of Jeremiah Crutchley, Lee Terrace, St Margaret's Old Churchyard SE13	Elegant composition formed by a chest tomb over a smaller sarcophagus with lion's feet and elaborate carving of garlanded cherub's head dating from 1752. The
	DESIGNATION:	Listed Building grade II, CA	monument has lost its railings, back plates and inscription panels and vegetation growth is causing further damage. A
	CONDITION:	Poor	condition survey has been prepared, with funding from Historic England, and funding for repair and restoration
	OCCUPANCY:	N/A	works has been secured through a Section 106 agreement.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1391998	Contact: Natasha Peach (LPA) 0208 314 6049

PRIORITY CATEGORIES

© Historic England

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA LB

- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM

UA Unitary Authority WHS World Heritage Site

HERITAGE AT	RISK 2018 /	I ONDON /	I FWISHAM
	111311 2010 /	LOINDOIN	

	DESIGNATION:	Tomb of John Crutchley, Lee Terrace, St Margaret's Old Churchyard SE13	Raised ledger stone from 1727. Ground subsidence has caused some sinking and movement to the ledger which is now set at an angle. A condition survey has been prepared
		Listed Building grade II, CA	with funding from Historic England, and funding for repair and restoration works has been secured through a Section
	CONDITION:	Poor	106 agreement.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1392012	Contact: Natasha Peach (LPA) 0208 314 6049
	SITE NAME:	Tomb of John Hosier, Lee Terrace, St Margaret's Old Churchyard SE13	Stone chest tomb erected in 1767. The tomb is badly damaged by vegetation growth through open joints. A condition survey has been prepared, with funding from
	DESIGNATION:	Listed Building grade II, CA	Historic England, and funding for repair and restoration works has been secured through a Section 106 agreement.
	CONDITION:	Poor	
A MAR	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1392013	Contact: Natasha Peach (LPA) 0208 314 6049
	SITE NAME:	Tomb of Lord Dacre, Lee Terrace, St Margaret's Old Churchyard SEI3	This composite urn monument to Lord Dacre dates from 1794. All the elements now lie disassembled on the ground. The monument needs urgent attention to avoid
Contra La	DESIGNATION:	Listed Building grade II, CA	further damage or loss of its components. A condition survey has been prepared, with funding from Historic
	CONDITION:	Very bad	England, and funding for repair and restoration works has
	OCCUPANCY:	N/A	been secured through a Section 106 agreement.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1392008	Contact: Natasha Peach (LPA) 0208 314 6049
	SITE NAME:	Tomb of Rev. Thomas Negus, Lee Terrace, St Margaret's Old Churchyard SE13	Chest tomb from 1765, badly damaged from vegetation which has infiltrated through open joints and cracked the ledger slab. One angle baluster has been lost and there is a
	DESIGNATION:	Listed Building grade II, CA	risk of further collapse. A condition survey has been prepared, with funding from Historic England, and funding
	CONDITION:	Very bad	for repair and restoration works has been secured through a Section 106 agreement.
A CONTRACTOR	OCCUPANCY:	N/A	a section too agreement.
the states	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1392011	Contact: Natasha Peach (LPA) 0208 314 6049
	SITE NAME:	Tomb of Thomas Butler, Lee Terrace, St Margaret's Old Churchyard SE13	Chest tomb from 1733. The panels on both sides and on one end have collapsed exposing brickwork and making th monument vulnerable to rapid deterioration. A condition
	DESIGNATION:	Listed Building grade II, CA	survey has been prepared, with funding from Historic England, and funding for repair and restoration works has
	CONDITION:	Very bad	been secured through a Section 106 agreement.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1392003	Contact: Natasha Peach (LPA) 0208 314 6049

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)


use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / LEWISHAM

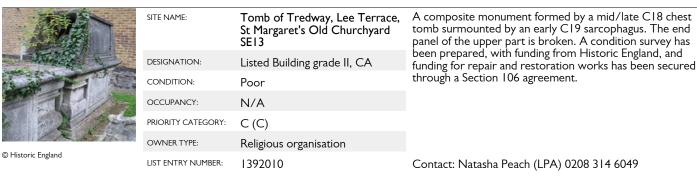

Rileys (former Temperance Billiard Hall), 233-241.

Lewisham High Street SEI3


Listed Building grade II

Vacant/not in use

Religious organisation

Poor

F (D)

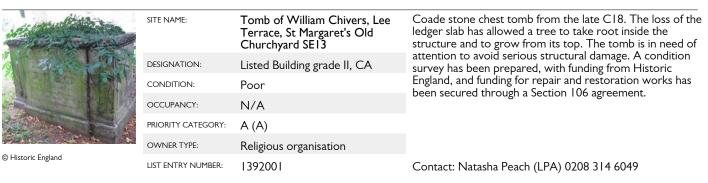



© London Borough of Lewisham



© London Borough of Lewisham

	LIST ENTRY NUMBER:	1392397	Contact: Natasha Peach (LPA) 0208 314 6049
D II	SITE NAME:	Hall attached to the rear of the Fellowship Inn public house, Randlesdown Road, Bellingham SE6	Two storey entertainment hall attached to the rear of the public house built in 1923-4 by FG Newnham for the brewery Barclay Perkins and Co. to serve the former London County Council's Bellingham Estate. The hall has
	DESIGNATION:	Listed Building grade II	been unoccupied for some time and has suffered from vandalism and neglect. In spring 2015 the owner secured a
	CONDITION:	Poor	grant from the Heritage Lottery Fund for its refurbishment and future use as a pub, micro-brewery, cinema, café and
5	OCCUPANCY:	Vacant/not in use	community space. Planning Permission and Listed Building
	PRIORITY CATEGORY:	F (D)	Consent were granted in 2017, work is currently in progress and is due to complete in late 2018.
	OWNER TYPE:		
	LIST ENTRY NUMBER:	1413050	Contact: Natasha Peach (LPA) 0208 314 6049

	SITE NAME:	Church of St Swithun, Hither Green Lane, Lewisham SEI3	This church was completed in 1893 to the designs of Ernest Newton, with an extension in 1905. A small mission church
	DESIGNATION:	Listed Place of Worship grade II	of 1884 survives at the east end. Built of red Wrotham brick, Bath stone is used for windows and dressings, and
	CONDITION:	Poor	Portland stone for copings, all under slated roofs. A
	PRIORITY CATEGORY:	C (C)	west end was completed in 2015, grant-aided by the
	OWNER TYPE:	Religious organisation	Heritage Lottery Fund and Historic England. Further repairs are required.
	LIST ENTRY NUMBER:	1192516	Contact: Ian Harper 020 7973 3786
	PRIORITY CATEGORY: OWNER TYPE:	C (C) Religious organisation	programme of repairs to windows and masonry at the west end was completed in 2015, grant-aided by the Heritage Lottery Fund and Historic England. Further repairs are required.

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

A temperance billiard hall built 1909-10, originally

incorporating a café, lounge and shops facing Lewisham High Street. Listed as a well-surviving example of an

a number of years. It has been gutted internally and is showing signs of neglect. There is water ingress on the

upper floor. Planning Permission and Listed Building Consent were granted in 2017 for conversion to a church,

building, and work is currently in progress.

uncommon building type. The building has been empty for

with associated changes to restore and change parts of the

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ΪA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / LEWISHAM / LONDON LEGACY (MDC)

	SITE NAME:	Church of St Mary the Virgin, Lewisham High Street, Lewisham SEI 3	This unusual Georgian church, raised over a crypt, was completed in 1774 by George Gibson Jr; it replaced a medieval church and incorporated the original tower. The
	DESIGNATION:	Listed Place of Worship grade II*, CA	nave was re-modelled and the chancel added in 1882 by William Blomfield. The chancel was re-ordered in 1995-96. The nave re-roofing and drainage project was completed in
	CONDITION:	Poor	2016 with a grant from the Heritage Lottery Fund. The congregation is actively exploring options for funding for a
	PRIORITY CATEGORY:	C (C)	second phase of roofing repairs to the tower and chancel.
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1193297	Contact: Ian Harper 020 7973 3786
© Historic England	LIST ENTRY NUMBER:	1193297	Contact: Ian Harper 020 7973 3786

SITE NAME:	Deptford High Street SE8		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Natasha Peach (LPA) 0208 314 6049

LONDON LEGACY (MDC)

	SITE NAME:	Abbey Mills Pumping Station (Station C) with associated Valve House, Abbey Lane E15	Pumping station 1910-14, white stock brick with terracotta and moulded stone dressings. The internal pumping floor is sunk deep below ground level. There are no long-term
	DESIGNATION:	Listed Building grade II, CA	proposals for the re-use of the building at this stage, although options are being discussed.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Utility	
© Historic England	LIST ENTRY NUMBER:	1392550	Contact: Planning Officer (LPA) 020 3288 8820

©۲

	SITE NAME:	Bases of pair of chimneystacks at Abbey Mills Pumping Station, Abbey Lane E15	Two chimney bases built in 1865 by Bazalgette. Elaborate pedimented porches to battered brick plinths crowned by stone bases of octagonal stacks (demolished). The brick
	DESIGNATION:	Listed Building grade II, CA	and stonework is being severely damaged by invasive plant growth, although this is now being monitored and removed
	CONDITION:	Very bad	regularly. The stonework porches have suffered partial collapse. A survey has been carried out to enable Thames
	OCCUPANCY:	N/A	Water to consider options for repair.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Utility	
Historic England	LIST ENTRY NUMBER:	1357995	Contact: Planning Officer (LPA) 020 3288 8820



Lodge to pumping station, built circa 1865. Whilst some SITE NAME: Gate lodge at Abbey Mills Pumping Station, Abbey Lane external repairs have been carried out, more are needed and the interior is in poor condition. Thames Water is E15 considering options for its repair and re-use. DESIGNATION: Listed Building grade II, CA CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C) OWNER TYPE: Utility LIST ENTRY NUMBER: 1080982 Contact: Planning Officer (LPA) 020 3288 8820

© Historic England

PRIORITY CATEGORIES

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building Local Planning Authority National Park CA LB
- LPA
- NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / LONDON LEGACY (MDC) / MERTON

PRIORITY CATEGORY:

OWNER TYPE:

C (C)

Utility

		. ,	
	SITE NAME:	Stores Building at Abbey Mills Pumping Station, Abbey Lane E15	Storage building circa 1865 by Sir Joseph Bazalgette. There has been previous damage due to water ingress although the building is now wind and watertight. It has been
49 04	DESIGNATION:	Listed Building grade II, part in CA	returned to use for storage and Thames Water is considering options for full repair.
	CONDITION:	Poor	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Utility	
	LIST ENTRY NUMBER:	1080980	Contact: Planning Officer (LPA) 020 3288 8820
	SITE NAME:	Ancillary Pump House at Abbey Mills Pumping Station (Station B), Abbey Road E15	Pump house circa 1868, probably by Bazalgette and Cooper, built in a similar style to the main pumping station. There is some evidence of water ingress and the design of
	DESIGNATION:	Listed Building grade II, CA	the exterior downpipes makes them vulnerable to plant growth and blockages. The building is vacant and has no
	CONDITION:	Poor	identified use.
	OCCUPANCY:	Vacant/not in use	

© Historic England



	LIST ENTRY NUMBER:	1357994	Contact: Planning Officer (LPA) 020 3288 8820
1	SITE NAME:	Tide Mill (known as the House Mill), Three Mill Lane E3	Tide Mill dating from 1776 and last used in 1941. Much of the building fabric has been repaired, but work is needed
	DESIGNATION:	Listed Building grade I, CA	to the undershot water wheels and surviving machinery. The River Lea Tidal Mill Trust continues to work towards a
	CONDITION:	Fair	sustainable strategy for repair of machinery, along with improvements to education and community facilities.
	OCCUPANCY:	Part occupied/part in use	inprovements to education and community facilities.
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1080970	Contact: Verena McCaig 020 7973 3718

© Historic England

SITE NAME:	Sugar House Lane, Stratford E15		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Ben Hull (LPA) 020 3373 9574
SITE NAME:	Three Mills, Stratford/Bow E15		
SITE NAME: DESIGNATION:	Three Mills, Stratford/Bow E15 Conservation Area, 12 LBs	NEW ENTRY?:	Νο
		NEW ENTRY?: TREND:	No Improving significantly
DESIGNATION:	Conservation Area, 12 LBs		

MERTON



SITE NAME:	Garden wall enclosing four sides of playing field, Church Lane, Merton Park SW19	Garden alteratic inappro
DESIGNATION:	Listed Building grade II, CA	remove repair h
CONDITION:	Poor	previou around
OCCUPANCY:	N/A	for safe
PRIORITY CATEGORY:	C (C)	control
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1286387	Contact

n wall dating from the C16 to C17, with later ions. There are many areas of eroded brick and opriate past repair. Damaging vegetation has been ed and a comprehensive survey with specification for has been prepared. The Local Authority has usly carried out rebuilding and repairs to a section the entrance gateway which had been dismantled ety reasons, but further works are needed, including l of vegetation.

ct: Jill Tyndale (LPA) 020 8545 3041

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. D Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

Е

obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site


	SITE NAME:	Tomb of Thomas Stanly, St Peter and St Paul's Churchyard, Church Road, Mitcham	Table tomb over large podium erected in the early C18. The podium is severely damaged by vegetation. A condition survey has been carried out, funded by Historic
	DESIGNATION:	Listed Building grade II, CA	England, and funding will be sought to enable the necessary works to be carried out.
	CONDITION:	Very bad	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
© Historic England	LIST ENTRY NUMBER:	1080949	Contact: Jill Tyndale (LPA) 020 8545 3041

	SITE NAME:	Burn Bullock Public House, 315, London Road	Public house, formerly the Kings Head Hotel, with C16 interior and exterior features and C18 front. No longer
	DESIGNATION:	Listed Building grade II, CA	operating as a public house, it had been illegally occupied as a House in Multiple Occupation and has suffered
	CONDITION:	Poor	associated deterioration. Essential repairs have been carried out to make the building weatherproof, and it has
	OCCUPANCY:	Part occupied/part in use	been externally decorated. No plans for development and
	PRIORITY CATEGORY:	C (C)	re-use of the building have been submitted by the owner.
	OWNER TYPE:	Commercial company	
Historic England	LIST ENTRY NUMBER:	9339	Contact: Jill Tyndale (LPA) 020 8545 3041
0			
	SITE NAME:	Dovecote adjacent to pond to south east of The Canons, Madeira Road, Mitcham	The dovecote was built in 1511, being the oldest building in Merton. It is a square structure of chalk blocks and red brick quoins with a hipped tiled roof. There are nesting
	SITE NAME: DESIGNATION:	south east of The Canons,	Merton. It is a square structure of chalk blocks and red brick quoins with a hipped tiled roof. There are nesting boxes on the inside of the walls. Funding has been awarded
·		south east of The Canons, Madeira Road, Mitcham	Merton. It is a square structure of chalk blocks and red brick quoins with a hipped tiled roof. There are nesting boxes on the inside of the walls. Funding has been awarded for The Canons by the Heritage Lottery Fund and the Big Lottery under the Parks for People programme, and the
•	DESIGNATION:	south east of The Canons, Madeira Road, Mitcham Listed Building grade II, CA	Merton. It is a square structure of chalk blocks and red brick quoins with a hipped tiled roof. There are nesting boxes on the inside of the walls. Funding has been awarded for The Canons by the Heritage Lottery Fund and the Big
•	DESIGNATION: CONDITION:	south east of The Canons, Madeira Road, Mitcham Listed Building grade II, CA Fair	Merton. It is a square structure of chalk blocks and red brick quoins with a hipped tiled roof. There are nesting boxes on the inside of the walls. Funding has been awarded for The Canons by the Heritage Lottery Fund and the Big Lottery under the Parks for People programme, and the
	DESIGNATION: CONDITION: OCCUPANCY:	south east of The Canons, Madeira Road, Mitcham Listed Building grade II, CA Fair N/A	Merton. It is a square structure of chalk blocks and red brick quoins with a hipped tiled roof. There are nesting boxes on the inside of the walls. Funding has been awarded for The Canons by the Heritage Lottery Fund and the Big Lottery under the Parks for People programme, and the

© Historic England

©Н



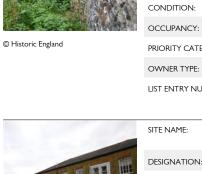

SITE NAME:	Portion of wall on the west side of River Pickle between Merton High Street and Merantun Way, High Street, Wimbledon Village SW19	Formerly consistin wall are vegetatio significar
DESIGNATION:	Listed Building grade II, part in CA	towards improve conjunct
CONDITION:	Very bad	Merton Vegetati
OCCUPANCY:	N/A	whilst th
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Charity (heritage)	
LIST ENTRY NUMBER:	1358009	Contact

Ravensbury Mill (North Wing),

245, Morden Road, Morden

Listed Building grade II, CA

Part occupied/part in use

Commercial company

1080904

LIST ENTRY NUMBER:

CONDITION:

OCCUPANCY:

OWNER TYPE:

D

Е

use).

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

ly part of the precinct wall to Merton Priory, ng of medieval flint and rubblestone. Sections of the in poor condition and have collapsed due to on growth. The National Trust has progressed with nt clearance works and has developed a plan s its conservation and long-term maintenance, with ed public access. This has been achieved in tion with Historic England, the Local Authority, Local History Society and Merton Priory Trust. ion management is being maintained by the Trust hey seek funding for long-term works.

t: Jill Tyndale (LPA) 020 8545 3041

Contact: Jill Tyndale (LPA) 020 8545 3041

C18 and C19 snuff mill powered by water. The north wing is subject to a Section 106 agreement. There is slow progress towards resolving outstanding planning obligations, enabling a lease for the occupation of the north wing by Wandle Industrial Museum. Discussions are ongoing to resolve these outstanding issues.

Contact: Jill Tyndale	(LPA) 020 8545 3041
-----------------------	---------------------

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Fair

C (C)

1080857

- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ŬA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDO	ON / MERTON		
	SITE NAME:	Mausoleum of Sir Joseph William Bazalgette, St Mary's Churchyard, St Mary's Road, Wimbledon SW19	Portland stone mausoleum from the end of the C19. Bazalgette was the designer of the main London trunk sewer system and the builder of the Victoria and Albert Embankments in the 1860s. The ironwork requires repair
	DESIGNATION:	Listed Building grade II, CA	and the gates are missing. Water ingress is causing gradual collapse of the internal brickwork to the roof. A condition
	CONDITION:	Poor	survey has been carried out, funded by Historic England, and funding will be sought to enable the necessary works
	OCCUPANCY:	N/A	to be carried out.
	PRIORITY CATEGORY:	A (A)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1080887	Contact: Jill Tyndale (LPA) 020 8545 3041
	SITE NAME:	Tomb of Gerard De Visme 10 Feet to north of west tower of Chapel in Churchyard of St Mary, St Mary's Road, Wimbledon SW19	Stone tomb of Gerard de Visme who died in 1797, consisting of a square plan, rusticated pyramid with corner acroteria to the base. An acroterion has fallen due to movement in the stone blocks, and another is dislodged. Slow deterioration continues. A condition survey has been
Non and the	DESIGNATION:	Listed Building grade II, CA	carried out, funded by Historic England, and funding will be sought to enable the necessary works to be carried out.
	CONDITION:	Poor	
1. 30	OCCUPANCY:	N/A	
© Historic England	PRIORITY CATEGORY:	C (C)	
- 0	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1080883	Contact: Jill Tyndale (LPA) 020 8545 3041
	SITE NAME:	Tomb of Bankes, St Mary's Churchyard, St Mary's Road, Wimbledon SW19	Table tomb from the mid-C18 with inset panels and baluster profiled corners. The tomb is suffering from continued waste dumping activity. It has been previously
	DESIGNATION:	Listed Building grade II, CA	subject to poor quality repairs. A condition survey has been carried out, funded by Historic England, and funding
A RITE C	CONDITION:	Poor	will be sought to enable the necessary works to be carried out.
	OCCUPANCY:	N/A	out.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
© Historic England	LIST ENTRY NUMBER:	1080888	Contact: Jill Tyndale (LPA) 020 8545 3041
	SITE NAME:	Tomb of Elizabeth Johnson, St Mary's Churchyard, St Mary's Road, Wimbledon SW19	Table tomb, tapered to the base, erected around 1800. The side panels have collapsed and vegetation has rooted in the monument and on its pedestal. A condition survey
	DESIGNATION:	Listed Building grade II, CA	has been carried out, funded by Historic England, and funding will be sought to enable the necessary works to be
	CONDITION:	Poor	carried out.
	OCCUPANCY:	N/A	
CAR TO CAR	PRIORITY CATEGORY:	C (C)	
Olitaria Endud	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1193775	Contact: Jill Tyndale (LPA) 020 8545 3041

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / MERTON

© Historic England

	SITE NAME:	Tomb of John Lawson, St Mary's Churchyard, St Mary's Road, Wimbledon SW19	Table tomb on a stepped podium, dating from circa 1704. There is evidence of joints widening and the plinth collapsing. A condition survey has been carried out, funded
	DESIGNATION:	Listed Building grade II, CA	by Historic England, and funding will be sought to enable the necessary works to be carried out.
the second	CONDITION:	Poor	
STATES IN THE STATES	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
I	LIST ENTRY NUMBER:	1080886	Contact: Jill Tyndale (LPA) 020 8545 3041

	SITE NAME:	Electricity Substation at junction with Sunnyside Passage, Sunnyside SW19	Late C19 cast iron cylindrical electricity substation with three rows of moulded cast iron patterned panels, projecting cornice, and foliated finial. Ownership has not
	DESIGNATION:	Listed Building grade II, CA	been established. The structure has not been properly maintained with an appropriate paint finish; there is visible rust. A custodian has taken responsibility for its restoratic and some funding has been earmarked. A specification for works is required.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
© Historic England	LIST ENTRY NUMBER:	1358028	Contact: Jill Tyndale (LPA) 020 8545 3041





© Historic England



Fragment of medieval, and probably later, precinct wall of SITE NAME: Wall to rear of flats, 27-33 the former Merton Priory. Constructed from flint and (consecutive), Windsor Avenue, Colliers Wood SW19 rubble stone, it is being damaged by vegetation growing out of the wall structure. DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: A (A) OWNER TYPE: Private LIST ENTRY NUMBER: 1080856 Contact: Jill Tyndale (LPA) 020 8545 3041 Fragments of medieval and probably later precinct wall of SITE NAME: Wall to rear of the block of flats the former Merton Priory. Constructed from flint and west of easternmost block, 9, rubble stone, they are being damaged by vegetation 11, 15 and 17, Windsor Avenue growing out of the wall structure, now nearly obscuring it. SW19 DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: N/A

© Historic England

LIST ENTRY NUMBER:

D

Е

PRIORITY CATEGORY:

OWNER TYPE:

Contact: Jill Tyndale (LPA) 020 8545 3041

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.

Slow decay; solution agreed but not yet implemented. Under repair or in fair to good

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

A (A)

Private

1194014

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building CA LB
- I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG SM
- ÍΙΑ
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / MERTON

©

	SITE NAME:	Wimbledon Park SW19	A remnant of the C18 landscape by Lancelot 'Capability'
	DESIGNATION:	Registered Park and Garden grade II*, 2 CAs	Brown for the 1st Earl Spencer's manor house at Wimbledon, itself developed from a C16 estate. The Local Authority manages Brown's lake and land to the east as a
	CONDITION:	Generally unsatisfactory with major localised problems	municipal park with an emphasis on sport, with land to the west in private ownership as golf and sports clubs. The divided ownership results in discordant landscape management. A masterplan now exists for the municipal park, but a shared vision for the whole landscape is required. The Local Authority, with the other landowner
	VULNERABILITY:	High	
	TREND:	Declining	
and a second second second	NEW ENTRY?:	No	is developing a project for works to the lake.
© Historic England	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1000852	Contact: Christopher Laine 07780 545 979

DeskGNATION Scheduled Monument, part in CA UKTENTRY NUMBER 1001976 CONDITION Generally satisfactory but with significant localised problems TREND Declining RIRICATEL VULNERABLIY: Development requiring planning permission Nev ENTRY: No OWNER TYPE: Local authority, multiple owners CONTACT: Elizabeth Whitbourn 07889 808 145 STEE NAME: Bathgate Road SW19 No No DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABULY: High CONTACT: jill Tyndale (LPA) 020 8545 3041 STEE NAME: Drax Avenue New ENTRY: No DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VULNERABUTY: High CONTACT: jill Tyndale (LPA) 020 8545 3041 STE NAME: The Broadway No Contact: jill Tyndale (LPA) 020 8545 3041 STE NAME: Upper Morden NeVENTRY: No Contact:				
Generally satisfactory but with significant localised problems for polens of problems frequing planning permission NEW ENTRY: No No NoNER TYPE: Local authority, multiple owners CONTACT: Elizabet Whitbourn 07889 808145 STE NAME: Batgate Road SW19 CONTACT: Deteriorating Control Very bad Conservation Area New ENTRY: No Concortant Very bad Conservation Area New ENTRY: No Conservation	SITE NAME:	Merton Priory (site of), Merantun Way, Colliers W	/ood SW19	
Construction problemis Construction Detailining PRINCIPAL VLINERABULTY: Development requiring planning permission New ENTRY: No OWNER TYPE: Local authority; multiple owners CONTACT: Elizabeth Whitbourn 07889 808145 STE NAME: Bathgate Road SW19 No No DESIGNATION: Conservation Area New ENTRY: No CONDITION: Very bad TERNO: Deteriorating VILINERABULTY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Drax Avenue No No CONDITION: Conservation Area NEW ENTRY: No CONDITION: Conservation Area, 21.Bs NEW ENTRY: No CONDITION: Poor INER ENTRY: No CONDITION: Conservation Area, 21.Bs NEW ENTRY: No CONDITION: Poor INER ENTRY: No CONDITION: Fair No No CONDITION: Fair No No CONDITION: Fair	DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1001976
CONTRET TPELocal authority, multiple ownersCONTACT:Elizabeth Whitbourn 07889 808145STIT NAME:Bathgate Road SW19NoDERSINATION:Conservation AreaNEW ENTRY:NoCONDITION:Very badTREND:DeterioratingVULNERABULTY:HighCONTACT:jill Tyndale (LPA) 020 8545 3041STIT NAME:Drax AvenueNoSTIT NAME:Conservation AreaNEW ENTRY:NoCONDITION:PoorIREND:DeterioratingVULNERABULTY:HighCONTACT:jill Tyndale (LPA) 020 8545 3041STIT NAME:PoorIREND:DeterioratingCONDITION:PoorIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:The BroadwayCONTACT:jill Tyndale (LPA) 020 8545 3041STIT NAME:NoContact:jill Tyndale (LPA) 020 8545 3041STIT NAME:Onservation Area, 2 LBSNEW ENTRY:NoCONDITION:PoorIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:Upper MordenIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:Upper MordenIREND:DeterioratingSTIT NAME:Upper MordenIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:Upper MordenIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:Vimbledon ChaseIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:Vimbledon ChaseIREND:Jill Tyndale (LPA) 020 8545 3041STIT NAME:Vimbledon ChaseIREND:Ji	CONDITION:		TREND:	Declining
STRE NAME: Bathgate Road SW19 DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating WULNERABULT: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STRE NAME: Drax Avenue No Stre NAME: No DESIGNATION: Conservation Area NEW ENTRY: No Stre NAME: DESIGNATION: Conservation Area NEW ENTRY: No Stre NAME: Deteriorating VULNERABULT: High Contract: Jill Tyndale (LPA) 020 8545 3041 Stre NAME: No STRE NAME: Poor TREND: Deteriorating Stre NAME: No STRE NAME: High Conservation Area, 2 LBS NEW ENTRY: No Stre NAME: Upper Morden Stre NAME: Upper Morden Stre NAME: No Stre NAME: No Stre NAME: No Stre NAME: No Stre NAME: Jill Tyndale (LPA) 020 8545 3041 Stre NAME: Jill Tyndale (LPA) 020 8545 3041 Stre NAME: Stre NAME: Stre NAME:	PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
DESIGNATION:Conservation AreaNEW ENTRY:NoCONDITION:Very badTREND:DeterioratingVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Drax AvenueJill Tyndale (LPA) 020 8545 3041DESIGNATION:Conservation AreaNEW ENTRY:NoCONDITION:PoorTEEND:DeterioratingVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:The BroadwayCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Conservation Area, 2 LBsNEW ENTRY:NoVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Conservation Area, 2 LBsNEW ENTRY:NoVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Upper MordenCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Upper MordenEREND:DeterioratingVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Very badCONTACT:Jill Tyndale (LPA) 020 8545 3041STE NAME:Very badTEEND:DeterioratingSTE NAME:Very badContact:Jill Tyndale (LPA) 020 8545 3041STE NAME:Vimbledon	OWNER TYPE:	Local authority, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Drax Avenue NEW ENTRY: No DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Poor TREND: Deteriorating VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: The Broadway CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Upper Morden TREND: Deteriorating VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Upper Morden CONTACT: Deteriorating	SITE NAME:	Bathgate Road SW19		
VULNERABULITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Drax Avenue NEW ENTRY: No DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VULNERABULITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: The Broadway CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown VULNERABULITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Upper Morden TREND: Unknown STEE NAME: Upper Morden No CONTACT: STEE NAME: Upper Morden STEE NAME: No CONDITION: Fair STEE NAME: No CONDITION: Conservation Area, 9 LBs, SM NEW ENTRY: No STEE NAME:	DESIGNATION:	Conservation Area	NEW ENTRY?:	No
STE NAME Drax Avenue DESIGNATION: Conservation Area NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VULNERABLITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: The Broadway No DESIGNATION: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown VULNERABLITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown VULNERABLITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Upper Morden STE NAME: No CONDITION: Fair TREND: Deteriorating VULNERABLITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STE NAME: Veinbledon Chase Steriorating STE NAME: Veinbledon Hill Road TREND: Deteriorating <t< td=""><td>CONDITION:</td><td>Very bad</td><td>TREND:</td><td>Deteriorating</td></t<>	CONDITION:	Very bad	TREND:	Deteriorating
Designation Conservation Area NEW ENTRY: No Designation: Poor TREND: Deteriorating VULNERABILITY: High CONDITION: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: The Broadway NEW ENTRY: No SITE NAME: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown CONDITION: Poor TREND: Unknown SITE NAME: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown VULNERABILITY: High Constract: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: Upper Morden Conservation Area, 9 LBs, SM New ENTRY: No CONDITION: Fair TREND: Deteriorating VULNERABILITY: High No Stress STE NAME: Wimbledon Chase Stress Jill Tyndale (LPA) 020 8545 3041 STE NAME: Very bad TREND: Deteriorating VULNERABILITY:	VULNERABILITY:	High	CONTACT:	Jill Tyndale (LPA) 020 8545 3041
CONDITION:PoorTREND:DeterioratingVULNERABILITY:PighContract:jill Tyndale (LPA) 020 8545 3041SITE NAME:The BroadwayContract:jill Tyndale (LPA) 020 8545 3041DESIGNATION:Conservation Area, 2 LBsNEW ENTRY:NoCONDITION:PoorTREND:UnknownCONDITION:PoorTREND:UnknownSITE NAME:Upper MordenCONTACT:jill Tyndale (LPA) 020 8545 3041SITE NAME:Upper MordenNoStreme:SITE NAME:Upper MordenNoStreme:SITE NAME:Upper MordenNoStreme:SITE NAME:Conservation Area, 9 LBs, SMNEW ENTRY:NoCONDITION:FairTREND:DeterioratingSITE NAME:Vimbledon ChaseStreme:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Vimbledon ChaseStreme:Streme:SITE NAME:Vimbledon ChaseStreme:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Vimbledon ChaseStreme:Streme:SITE NAME:Vimbledon Hill RoadStreme:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Wimbledon Hill RoadStreme:Streme:SITE NAME:Vimbledon Hill RoadNEW ENTRY:NoSITE NAME:PoorStreme:NoSITE NAME:PoorStreme:Streme:SITE NAME:Streme:Streme:Streme:SITE NAME:Vimbledon Hill RoadStreme:NoSITE NAME:Poo	SITE NAME:	Drax Avenue		
VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: The Broadway No DESIGNATION: Conservation Area, 2 LBs NEW ENTRY: No CONDITION: Poor TREND: Unknown VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Upper Morden CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Upper Morden No CONDITION: STEE NAME: Conservation Area, 9 LBs, SM NEW ENTRY: No CONDITION: Fair TREND: Deteriorating VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Conservation Area, 9 LBs, SM NEW ENTRY: No STEE NAME: Vimbledon Chase Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Vimbledon Chase Deteriorating VULNERABILITY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Vimbledon Hill Road STEE NAME: No STEE NAME: Vimbledon Hill Road STEE NEW ENTRY: No	DESIGNATION:	Conservation Area	NEW ENTRY?:	No
SITE NAME: The Broadway DESIGNATION: Conservation Area, 2 LBs Conservation Area, 9 LBs, SM Conservation Area Conservation Conservation Area Conservation Conservation Area Conservation Area Conservation Conservation Area Conservation Conservati Conservati	CONDITION:	Poor	TREND:	Deteriorating
DESIGNATION: Conservation Area, 2 LBs NEW ENTRY?: No condition: Poor TREND: Unknown vulnerabilitY: High Contact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Upper Morden Stre NAME: No condition: Gonservation Area, 9 LBs, SM NEW ENTRY?: No condition: Fair TREND: Deteriorating vulnerabilitY: High Contact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Conservation Area, 9 LBs, SM NEW ENTRY?: No condition: Fair TREND: Deteriorating vulnerabilitY: High Contact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Chase Very bad No condition: Very bad REND: Deteriorating stre NAME: Wimbledon Hill Road Sontact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Hill Road Sontact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Hill Road Sontact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Sonservation A	VULNERABILITY:	High	CONTACT:	Jill Tyndale (LPA) 020 8545 3041
CONDITION:PoorTREND:UnknownVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Upper MordenSite NAME:NoDESIGNATION:Conservation Area, 9 LBS, SMNEW ENTRY?NoCONDITION:FairTREND:DeterioratingvulneRABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Winbledon ChaseIten NoSITE NAME:Conservation AreaNEW ENTRY?:NoDESIGNATION:Conservation AreaNEW ENTRY?:NoCONDITION:Very badTREND:DeterioratingVULNERABILITY:Wimbledon Hill RoadCONTACT:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Wimbledon Hill RoadTREND:DeterioratingSITE NAME:Wimbledon Hill RoadNEW ENTRY?:NoSITE NAME:Conservation Area, 9 LBSNEW ENTRY?:NoDESIGNATION:PoorTREND:Deteriorating	SITE NAME:	The Broadway		
VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: Upper Morden New ENTRY? No DESIGNATION: Conservation Area, 9 LBs, SM NEW ENTRY? No CONDITION: Fair TREND: Deteriorating vulnerabilitY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Chase CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Conservation Area NEW ENTRY? No Stre NAME: Conservation Area NEW ENTRY? No CONDITION: Very bad TREND: Deteriorating vulnerabilitY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Chase NEW ENTRY? No condition: Kery bad TREND: Deteriorating vulnerabilitY: Medium Contact: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Hill Road NEW ENTRY: No DESIGNATION: Conservation Area, 9 LBs NEW ENTRY: No CONDITION: Poor TREND: Dete	DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
SITE NAME: Upper Morden DESIGNATION: Conservation Area, 9 LBs, SM NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating vulnerABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Chase Strend: No DESIGNATION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: Medium Conservation Area NEW ENTRY?: No STEE NAME: Very bad TREND: Deteriorating stre NAME: Wimbledon Hill Road Contact: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Wimbledon Hill Road Contact: Jill Tyndale (LPA) 020 8545 3041 DESIGNATION: Conservation Area, 9 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating	CONDITION:	Poor	TREND:	Unknown
DESIGNATION: Conservation Area, 9 LBs, SM NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: Wimbledon Chase Very bad NEW ENTRY?: No CONDITION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Very bad TREND: Deteriorating STEE NAME: Wimbledon Hill Road CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Wimbledon Hill Road CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Wimbledon Hill Road CONTACT: Jill Tyndale (LPA) 020 8545 3041 STEE NAME: Very bad NEW ENTRY: No STEE NAME: Very bad NEW ENTRY: No STEE NAME: Poor NEW ENTRY: No	VULNERABILITY:	High	CONTACT:	Jill Tyndale (LPA) 020 8545 3041
CONDITION:FairDeterioratingVULNERABILITY:HighCONTACT:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Wimbledon ChaseNEW ENTRY?NoCONDITION:Conservation AreaNEW ENTRY?DeterioratingVULNERABILITY:MediumCONTACT:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Wimbledon Hill RoadCONTACT:Jill Tyndale (LPA) 020 8545 3041DESIGNATION:Conservation Area, 9 LBSNEW ENTRY?NoCONDITION:PoorTREND:Deteriorating	SITE NAME:	Upper Morden		
VULNERABILITY: High CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Chase NEW ENTRY?: No DESIGNATION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating vulnerabilitY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Very bad TREND: Deteriorating vulnerabilitY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Hill Road CONTACT: Jill Tyndale (LPA) 020 8545 3041 design attion: Conservation Area, 9 LBs New ENTRY?: No CONDITION: Poor TREND: Deteriorating	DESIGNATION:	Conservation Area, 9 LBs, SM	NEW ENTRY?:	No
SITE NAME: Wimbledon Chase DESIGNATION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating vULNERABILITY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: Vimbledon Hill Road NEW ENTRY?: No DESIGNATION: Conservation Area, 9 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating	CONDITION:	Fair	TREND:	Deteriorating
DESIGNATION: Conservation Area NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating vulnerABILITY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 stre NAME: Wimbledon Hill Road VULNERABILITY: No DESIGNATION: Conservation Area, 9 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating	VULNERABILITY:	High	CONTACT:	Jill Tyndale (LPA) 020 8545 3041
CONDITION:Very badTREND:DeterioratingVULNERABILITY:MediumCONTACT:Jill Tyndale (LPA) 020 8545 3041SITE NAME:Wimbledon Hill RoadVery server	SITE NAME:	Wimbledon Chase		
VULNERABILITY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041 SITE NAME: Wimbledon Hill Road DESIGNATION: Conservation Area, 9 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating	DESIGNATION:	Conservation Area	NEW ENTRY?:	No
SITE NAME: Wimbledon Hill Road DESIGNATION: Conservation Area, 9 LBs CONDITION: Poor TREND: Deteriorating	CONDITION:	Very bad	TREND:	Deteriorating
DESIGNATION: Conservation Area, 9 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating	VULNERABILITY:	Medium	CONTACT:	Jill Tyndale (LPA) 020 8545 3041
CONDITION: Poor TREND: Deteriorating	SITE NAME:	Wimbledon Hill Road		
	DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
VULNERABILITY: Medium CONTACT: Jill Tyndale (LPA) 020 8545 3041	CONDITION:	Poor	TREND:	Deteriorating
	VULNERABILITY:	Medium	CONTACT:	Jill Tyndale (LPA) 020 8545 3041

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / NEWHAM

NEWHAM

	SITE NAME:	West Ham Pumping Station Engine House, Abbey Road EI5	Engine house, built in 1897, containing original Lilleshall Company beam engines. The building is currently in use as
	DESIGNATION:	Listed Building grade II	a training facility. Discussions are ongoing regarding the future of this site.
	CONDITION:	Fair	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Utility	
© Historic England	LIST ENTRY NUMBER:	1357997	Contact: Ben Hull (LPA) 020 3373 9574



SITE NAME:	Dukes Head public house, 593, Barking Road, East Ham E6	Impressive corner public house dating from 1900. The ground and first floor function rooms are being used for
DESIGNATION:	Listed Building grade II	weddings and parties. The flats on the upper floors are vacant. Restoration works were undertaken following fire
CONDITION:	Fair	damage. There is some unauthorised signage and repairs are needed to the cornice and string courses.
OCCUPANCY:	Part occupied/part in use	are needed to the connect and string courses.
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1392558	Contact: Ben Hull (LPA) 020 3373 9574
	DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Barking Road, East Ham E6DESIGNATION:Listed Building grade IICONDITION:FairOCCUPANCY:Part occupied/part in usePRIORITY CATEGORY:C (C)OWNER TYPE:Commercial company

SITE NAME:

DESIGNATION:

PRIORITY CATEGORY:

OWNER TYPE:

© Historic England

© Historic England



conversion for educational purposes, this has fallen through CONDITION: Poor and currently the building has no identified future use. OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C) OWNER TYPE: Government or agency LIST ENTRY NUMBER: Contact: Ben Hull (LPA) 020 3373 9574 1253087 Three storey C18 public house, yellow brick with red brick SITE NAME Coach and Horses public house, arches and reveals. The interior has been extensively 100, High Street, Plaistow E13 damaged. Works are being carried out to stabilise the DESIGNATION: Listed Building grade II interior structurally and allow for debris clearance. Discussions have commenced towards repair and re-use of CONDITION: Very bad the building. OCCUPANCY: Vacant/not in use

Police Station, with walls and

gatepiers to side, High Street

Listed Building grade II, CA

South, E6

A (A)

Commercial company

© Historic England



	LIST ENTRY NOMBER:	1080323	Contact: Ben Hull (LPA) 020 3373 9574
	SITE NAME:	Chimney to Beckton Sewage Works, Jenkins Lane, Beckton E6	Chimney dating from 1887 to 1889, designed by Joseph Bazalgette, as part of the improvements to the northern outfall of the London drainage network. Listed Building
-	DESIGNATION:	Listed Building grade II	Consent has been granted for works to facilitate the Lee Tunnel and Beckton extension works. The chimney has
Y	CONDITION:	Poor	been dismantled and is in storage, pending re-erection following completion of the tunnelling works. Regular
E BY	OCCUPANCY:	N/A	surveys are carried out to review its condition.
hr	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Utility	
	LIST ENTRY NUMBER:	1393160	Contact: Ben Hull (LPA) 020 3373 9574

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ntaati Dan Liuli (I DA) 020 2272 0574

ABBREVIATIONS

WHS

Red brick police station with Portland stone dressings and

bands and a slate roof. 1904, by John Dixon Butler for the

Metropolitan Police. The building has been vacant since 2013. Repairs have been carried out to the roof and basic

maintenance is ongoing. However, whilst acquired for

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ŬA
 - Unitary Authority World Heritage Site

	SITE NAME:	Silo D, North Woolwich Road, Canning Town E16	Grain silo, 1920, built of reinforced concrete. Vegetation threatening the building has been mostly cleared but pigeor
1901 - A	DESIGNATION:	Listed Building grade II	ingress remains an issue. Discussions are ongoing as to how the building might be brought back into use as part of the
	CONDITION:	Poor	overall development of the wider site but there are
111	OCCUPANCY:	N/A	currently no specific plans.
	PRIORITY CATEGORY:	C (C)	
-6 want - 1 - 2	OWNER TYPE:	Unknown	
D Historic England	LIST ENTRY NUMBER:	1245030	Contact: Ben Hull (LPA) 020 3373 9574
	SITE NAME:	North Woolwich Station including turntable and platform lamp standards, Pier Road, North Woolwich E16	Former railway station, 1847. Extensive works are needed to the roof, and the rear canopy has been dismantled following partial collapse. The building is in the process of being sold and new owners are expected to undertake
	DESIGNATION:	Listed Building grade II	remedial works as a matter of urgency, and this is being monitored closely by Historic England and the Local
Allonon	CONDITION:	Very bad	Authority.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
) Historic England	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1376229	Contact: Ben Hull (LPA) 020 3373 9574
	SITE NAME:	Earl of Essex public house, 616, Romford Road, Newham E12	Impressive Edwardian public house by Henry Poston and WE Trent, dating from 1902, on a prominent corner site.
	DESIGNATION:	Listed Building grade II	The ground floor is empty and boarded up, with no future use identified. The upper floors are occupied. Repairs are
	CONDITION:	Fair	needed, particularly to external architectural details. I appropriate scheme has been proposed since the pre
	OCCUPANCY:	Part occupied/part in use	Planning Permission expired.
A COLUMN ST	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
D Historic England	LIST ENTRY NUMBER:	1357990	Contact: Ben Hull (LPA) 020 3373 9574
1	SITE NAME:	Central buffet at Custom House, Royal Albert Dock E16	Restaurant, built in 1883 to the design of Vigers and Wagstaffe in a free classical style. Now owned by the
	DESIGNATION:	Listed Building grade II	London Development Agency and part of Royals Business Park. Security has been improved and some emergency
	CONDITION:	Fair	repairs undertaken. Planning Permission and Listed Building
	OCCUPANCY:	Vacant/not in use	Consent have been granted for restoration and use as a restaurant as part of the wider Royals Business Park
	PRIORITY CATEGORY:	F (F)	development of Albert Dock.
	OWNER TYPE:	Commercial company	
Historic England Archive	LIST ENTRY NUMBER:	1380201	Contact: Ben Hull (LPA) 020 3373 9574
	SITE NAME:	Central offices at Custom	Offices, built in 1883 to the design of Vigers and Wagstaffe
	DECIGNIATION	House, Royal Albert Dock E16	in the manner of Norman Shaw. Now owned by the London Development Agency and part of Royals Business
	DESIGNATION: CONDITION:	Listed Building grade II	Park. Security has been improved and some emergency repairs undertaken. Planning Permission and Listed Building
		Fair	Consent have been granted for restoration and use as a
and the second second second	OCCUPANCY:	Vacant/not in use	restaurant as part of the wider Royals Business Park development of Albert Dock.
			-
	PRIORITY CATEGORY:	F (F)	
	PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	Commercial company	Contact: Ben Hull (LPA) 020 3373 9574

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / NEWHAM / REDBRIDGE

	SITE NAME:	Spotted Dog public house, 212, Upton Lane E7	Weatherboarded C15 timber-framed public house. The property has remained vacant for some years. Urgent
	DESIGNATION:	Listed Building grade II	repairs have been carried out to stabilise the building. Discussions towards its repair and re-use are progressing.
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1191297	Contact: Ben Hull (LPA) 020 3373 9574

	SITE NAME:	West Ham Court House, West Ham Lane E15	Court house built in 1884 to the design of Lewis Angell. Having been vacant for many years, and suffering from theft
	DESIGNATION:	Listed Building grade II, CA	and vandalism, the building sustained serious fire damage in 2014. Floors and ceilings have collapsed and much historic fabric has been lost. The building is in an extremely bad condition. Historic England and the Local Authority have discussed the need for immediate essential repairs as well as options for its long-term future. Surveys are being carried out to assess the extent of damage in order to
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Local authority	carry out these urgent works.
© Historic England	LIST ENTRY NUMBER:	1080974	Contact: Ben Hull (LPA) 020 3373 9574

	SITE NAME:	Northern block and courtyard walls of Alice Billings House, Stratford E15	A block of firemen's accommodation built for the West Ham Fire Brigade c1905-06; a rare example of the incorporation of a practice hose/drying tower separate
	DESIGNATION:	Listed Building grade II, part in CA	from the fire station building. The building was used for offices from the 1980s. It has since been vacant and slowly deteriorating for many years. The Local Authority is
	CONDITION:	Poor	exploring options for its re-use.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1443788	Contact: Ben Hull (LPA) 020 3373 9574

REDBRIDGE

1....

8

1	SITE NAME:	831, High Road, Ilford	Shop with circa 1900 interior, featuring striking glazed
	DESIGNATION:	Listed Building grade II	decorative wall tiling and Minton floor tiling. The tiles have been severely damaged by nailed studwork and
	CONDITION:	Poor	plasterboard to the wall, and cement screeding of the floor The building is in need of major tile repairs and
	OCCUPANCY:	Occupied/in use	replacements to restore the interior. Following the refusal
	PRIORITY CATEGORY:	C (C)	of an application for Listed Building Consent in 2017, the Local Authority and Historic England are working together
	OWNER TYPE:	Private	to agree an appropriate approach to bring forward restoration of the property.
	LIST ENTRY NUMBER:	1271968	Contact: Bruce Edgar (LPA) 0208 708 2013
an dan Danausk of Dadhuidea			3 ()

© London Borough of Redbridge



SITE NAME:	6 and 8, High Street EI I	Late C18/early C19 pair of cottages with much internal
DESIGNATION:	Listed Building grade II, CA	historic fabric intact. Since late 2017 the Local Authority and Historic England have worked with the owner to agree
CONDITION:	Poor	a programme of repairs, enabling the partial implementation of extant permissions. Many of the interior
OCCUPANCY:	Vacant/not in use	and exterior repairs are complete; the roof has been
PRIORITY CATEGORY:	F (A)	reinstated with slates and pantiles and the rain water goods replaced. Elements of works requiring Planning Permission
OWNER TYPE:	Private	and Listed Building Consent are being considered by the Local Authority whilst building work continues on site.
LIST ENTRY NUMBER:	1300533	Contact: Bruce Edgar (LPA) 0208 708 2013

© London Borough of Redbridge

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / REDBRIDGE

1	SITE NAME:	Dr Johnson public house, Longwood Gardens, llford	Moderne-style public house dating from 1937-8 by H Reginald Ross, built to serve the large new estates in
	DESIGNATION:	Listed Building grade II	Barkingside. The building has been vacant and boarded up since 2010. Enforcement action undertaken by the Local
	CONDITION:	Very bad	Authority with the support of Historic England has ensured that urgent works have been carried out by the owners to
	OCCUPANCY:	Vacant/not in use	make the building wind and water-tight, and secure.
	PRIORITY CATEGORY:	D (A)	Planning Permission and Listed Building Consent have been granted for conversion into flats and retail premises and
and the second s	OWNER TYPE:	Commercial company	works are expected to commence during 2018.
England	LIST ENTRY NUMBER:	1392792	Contact: Bruce Edgar (LPA) 0208 708 2013

© Historic En




Sec. 2	SITE NAME:	Garden Temple in garden of Temple House, 14, The Avenue, Wanstead E11	Garden temple, circa 1730-40, with lonic pedimented portico. The structure once formed part of the Wanstead Grove Estate. Extensive repairs to the roof and one of the
	DESIGNATION:	Listed Building grade II*, CA	columns have been carried out, grant-aided by Historic England. Further repairs are needed to the remaining
	CONDITION:	Poor	columns, which are showing signs of significant decay, as well as the decorative finishes. Structural and condition
	OCCUPANCY:	N/A	surveys were prepared in 2016 to inform these repairs,
	PRIORITY CATEGORY:	A (A)	with funding from Historic England. The Local Authority and Historic England are working together to explore
<u>.</u>	OWNER TYPE:	Private	options for the full repair of the structure.
	LIST ENTRY NUMBER:	1357974	Contact: Verena McCaig 020 7973 3718

© Historic England



© Historic England

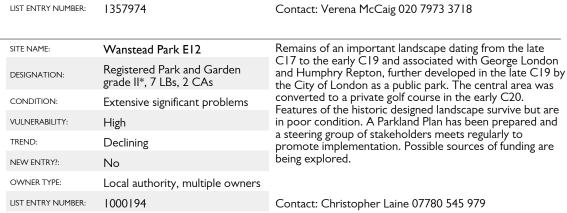

North Contraction of the Institute of th	SITE NAME:	The Grotto, Wanstead Park EII	Ruined grotto boathouse of circa 1762. It consists of a large honeycomb rockwork facade of segmental plan with
102	DESIGNATION:	Listed Building grade II, RPG grade II*, CA	several arches at lake level, and window openings above. The area is fenced off from public access. The grotto has been managed as a ruin for many decades and has had a
	CONDITION:	Poor	number of different repair interventions. However, there are areas of mortar failure and further loss of rockwork,
	OCCUPANCY:	N/A	and self-sown vegetation threatens to cause further
	PRIORITY CATEGORY:	F (New entry)	instability. The City of London commissioned a survey in 2017 and the works identified are now being carried out.
	OWNER TYPE:	Local authority	, i i i i i i i i i i i i i i i i i i i
© Historic England	LIST ENTRY NUMBER:	1183624	Contact: Bruce Edgar (LPA) 0208 708 2013



SITE NAME:	Church of St Mary, Overton Drive, Wanstead EI I	This church of 1790 was designed by architect Thomas Hardwick. The plan is rectangular with nave and aisles, and
DESIGNATION:	Listed Place of Worship grade I, RPG grade II*, CA	projecting chancel, designed around a monument to Sir Josiah Child. The west portico is in the Doric style, and the hipped slated roof carries a wooden clock tower with open
CONDITION:	Poor	belfry and cupola. The interior has been redecorated but retains all original furnishings. The Portland stone masonry
PRIORITY CATEGORY:	B (A)	is spalling due to rusting cramps, and the woodwork of the
OWNER TYPE:	Religious organisation	clock tower is deteriorating. A first phase of repair, part funded by the Heritage Lottery Fund, is due to start in
LIST ENTRY NUMBER:	1081008	2018.

Contact: lan Harper 020 7973 3786

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB I PA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / REDBRIDGE / RICHMOND UPON THAMES

SITE NAME:	Wanstead Park EII		
DESIGNATION:	Conservation Area, 8 LBs, part in RPG grade II*	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Bruce Edgar (LPA) 0208 708 2013
SITE NAME:	Mayfield, Ilford		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Bruce Edgar (LPA) 0208 708 2013
SITE NAME:	Woodford Bridge, Bridge		
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Bruce Edgar (LPA) 0208 708 2013

RICHMOND UPON THAMES

a lating	SITE NAME:	Boathouse and deep-water dock, riverside landing stage, steps, balustrade and gates, Thames Eyot, Cross Deep, Twickenham	Built in the 1870s as part of Frederick Chancellor's remodelling of the house and grounds of Poulett Lodge for William Punchard. The boathouse and dock are disused and falling into disrepair, with encroaching vegetation threatening the masonry. The balustrade is structurally
	DESIGNATION:	Listed Building grade II, CA	compromised and shows evidence of cracking and leaning. This also affects the landing stage and gates. Discussions
A PARTICIPAL	CONDITION:	Poor	towards a solution are at an early stage with the owners.
	OCCUPANCY:	Vacant/not in use	
© Historic England	PRIORITY CATEGORY:	C (C)	
O motorie znana	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	1400159	Contact: Nicolette Duckham (LPA) 020 8891 7335

	SITE NAME:	Loggia in the grounds of Thames Eyot, Cross Deep, Twickenham	Stone loggia of nine Doric columns, probably C18, situated in the grounds of Thames Eyot, a block of 1930s flats on the bank of the Thames. The roof has suffered partial
	DESIGNATION:	Listed Building grade II, CA	collapse and structural movement has caused distortion to the colonnade. An options appraisal was completed in
	CONDITION:	Very bad	2011 but not taken forward. A structural survey has now been carried out with cost estimates. The freeholder is
	OCCUPANCY:	N/A	expected to undertake temporary propping works with
	PRIORITY CATEGORY:	A (A)	due urgency following further discussions with Historic England and the Local Authority.
	OWNER TYPE:	Private, multiple owners	
Historic England	LIST ENTRY NUMBER:	1401819	Contact: Nicolette Duckham (LPA) 020 8891 7335



The second secon	SITE NAME:	Grotto or shell house in grounds of Thames Eyot, Cross Deep, Twickenham	Later C18 or early C19 grotto or shell house, altered in the mid-C19, now in the grounds of Thames Eyot, a block of 1930s flats on the bank of the Thames. The grotto is
	DESIGNATION:	Listed Building grade II*, CA	decorated in a precise geometric pattern to resemble a coffered vault which is separated by a deep horizontal band
	CONDITION:	Poor	from the more randomly decorated vertical walls. Considerable amounts of the shellwork have been lost or
	OCCUPANCY:	N/A	damaged and it is in need of conservation to prevent
	PRIORITY CATEGORY:	C (C)	further deterioration. Historic England, the Local Authority, leaseholders, and the freeholder continue to discuss how
1	OWNER TYPE:	Private, multiple owners	to progress the necessary works.
	LIST ENTRY NUMBER:	1080812	Contact: Verena McCaig 020 7973 3718

© Historic England

©⊦

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

100

HERITAGE AT RISK 2018 / LONDON / RICHMOND UPON THAMES

	SITE NAME:	Pope's Grotto in grounds of Radnor House School, Cross Deep (east side), Twickenham	Grotto with rusticated arched entrance facing the river, with a long passage and two 'chapels', one on either side of the entrance. The grotto is seen as the 'locus classicus' of
	DESIGNATION:	Listed Building grade II*, RPG grade II, CA	English C18 garden history. The structural condition is sound, but much of the decorative lining is loose or missing. Conservation and cleaning of the statuary, grant-
	CONDITION:	Fair	aided by Historic England, was carried out in 2016. A pilot project on the South Chamber was completed in 2017,
	OCCUPANCY:	N/A	funded with a grant from the Heritage Lottery Fund, and
	PRIORITY CATEGORY:	D (F)	discussions are underway to secure funding for the gro full conservation.
) Historic England	OWNER TYPE:	Educational (independent)	
	LIST ENTRY NUMBER:	1192178	Contact: Elizabeth Whitbourn 07889 808145



© Gould and Company

© Histo

©⊦

SITE NAME:	Garrick's Villa, Hampton Court Road, Hampton	Villa by Robert Adam built in 1756 and remodelled in 1773 The building was converted into nine apartments in the	
DESIGNATION:	Listed Building grade I, RPG grade II, CA	1960s and severely damaged by fire in 2008. External works are complete and the internal fit-out is now progressing on an individual flat-by-flat basis.	
CONDITION:	Fair		
OCCUPANCY:	Part occupied/part in use		
PRIORITY CATEGORY:	F (F)		
OWNER TYPE:	Private		
LIST ENTRY NUMBER:	1193477	Contact: Verena McCaig 020 7973 3718	

T	SITE NAME:	Norfolk House, 8, Montpelier Row	C18 plain brown brick house with red window arches and many remaining original internal features. Vacant for some
	DESIGNATION:	Listed Building grade II*, CA	year's, a major water leak has caused considerable damage to the rear sections of the house, leading to problems with
	CONDITION:	Very bad	rot and damp. Initial works have been carried out to the rear section of the roof through enforcement action by the
	OCCUPANCY:	Vacant/not in use	Local Authority. Historic England and the Local Authority
	PRIORITY CATEGORY:	A (A)	are making efforts to engage the absentee owners in order to ensure that appropriate works are carried out.
	OWNER TYPE:	Private	
coric England	LIST ENTRY NUMBER:	1065390	Contact: Verena McCaig 020 7973 3718

	SITE NAME:	Building number 14, Platts Eyot, Hampton	Late C19 office building in stock brick with an ogee-shaped cupola, formerly with a wooden balcony. It possibly once
	DESIGNATION:	Listed Building grade II, CA	housed electric works and a boathouse to the ground floor. It has been in a poor state of repair and empty, but is
	CONDITION:	Fair	now refurbished for re-use. Unauthorised works have been undertaken and the Local Authority is taking enforcement
	OCCUPANCY:	Part occupied/part in use	action to rectify this. Long-term solutions for this building
	PRIORITY CATEGORY:	C (C)	will be discussed as part of the expected overall strategy for Platts Eyot island on which it is located.
	OWNER TYPE:	Commercial company	
nd	LIST ENTRY NUMBER:	1254430	Contact: Nicolette Duckham (LPA) 020 8891 7335

Timber-framed boathouse clad in corrugated zinc with a Belfast truss roof. It was constructed in 1916 by Augustine Boathouse 2, Platts Eyot, Hampton Alban Hamilton Scott for the Thorneycroft firm to build fast launches carrying torpedoes for the Admiralty. The roof and zinc sheeting are failing in places and the windows are broken. A comprehensive approach to repair is required. Solutions for this structure will be discussed as part of the expected overall strategy for Platts Eyot island on which the boathouse is located.

© Historic England

© Historic England

DESIGNATION: Listed Building grade II, CA CONDITION: Poor OCCUPANCY. Occupied/in use PRIORITY CATEGORY: C (C) OWNER TYPE: Commercial company LIST ENTRY NUMBER: 1254428

Contact: Nicolette Duckham (LPA) 020 8891 7335

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

SITE NAME:

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Boathouse 4, Platts Eyot, Hampton	Timber-framed boathouse clad in corrugated zinc with a Belfast truss roof. It was constructed in 1916 by Augustine
ELE	DESIGNATION:	Listed Building grade II, CA	Alban Hamilton Scott for the Thorneycroft firm to build fast launches carrying torpedoes for the Admiralty. The
	CONDITION:	Very bad	roof and zinc sheeting are failing badly in places and the
the state	OCCUPANCY:	Occupied/in use	north wall is propped. Whilst patch repairs appear to have been undertaken previously, a comprehensive approach is
Max Sound and the	PRIORITY CATEGORY:	C (C)	required. Solutions for this structure will be discussed as part of the expected overall strategy for Platts Eyot island
	OWNER TYPE:	Commercial company	on which the boathouse is located.
) Historic England	LIST ENTRY NUMBER:	1261295	Contact: Nicolette Duckham (LPA) 020 8891 7335
	SITE NAME:	Boathouse 5 (easternmost 13 bays), Platts Eyot, Hampton	Timber-framed boathouse built in 1917 by Augustine Alba Hamilton Scott for the Thorneycroft firm to build torpedo
	DESIGNATION:	Listed Building grade II, CA	boats for the Admiralty. A full measured survey of the remaining structure has been completed, but it is in very
· TS	CONDITION:	Very bad	bad condition with a large area of collapse. Solutions for
- Washing	OCCUPANCY:	Vacant/not in use	this structure will be discussed as part of the expected overall strategy for Platts Eyot island on which the
	PRIORITY CATEGORY:	A (A)	boathouse is located.
	OWNER TYPE:	Commercial company	
) Historic England	LIST ENTRY NUMBER:	1254429	Contact: Nicolette Duckham (LPA) 020 8891 7335
	SITE NAME:	Wick House, Richmond Hill, Richmond	Designed by Sir William Chambers circa 1772 for Sir Joshua Reynolds. Planning Permission has been granted to
	DESIGNATION:	Listed Building grade II, CA	convert the building from a nurses' home to a single residence. Agreed stabilisation works have taken place to
	CONDITION:	Poor	address significant cracks but further works are planned to
	OCCUPANCY:	Vacant/not in use	fully address this issue and ensure that conversion can be completed. The Local Authority and Historic England are
	PRIORITY CATEGORY:	D (D)	discussions with the owner to ensure these works are completed.
	OWNER TYPE:	Private	completed.
Historic England	LIST ENTRY NUMBER:	1263475	Contact: Nicolette Duckham (LPA) 020 8891 7335
	SITE NAME:	Doughty House, 142, Richmond Hill. Richmond	C18 house with C19 alterations made by the Cook family Planning Permission and Listed Building Consent have bee
CHE B	DESIGNATION:	,	granted to retain the main property as a single dwelling ar
	CONDITION:	Listed Building grade II, CA Poor	to convert the gallery to ancillary accommodation, along with re-instating Doughty Cottage as the link between the
	OCCUPANCY:		house and gallery. Works stalled on site owing to access issues which have now been resolved. The Local Authorit
	PRIORITY CATEGORY:	Vacant/not in use	is in discussion with the owner to ensure that works can
	OWNER TYPE:	D (D)	now be completed.
	LIST ENTRY NUMBER:	Private 1249955	Contact: Nicolette Duckham (LPA) 020 8891 7335
) London Borough of Richmond on hames		1217755	Contact. Pricolette Duckham (El 77) 020 0071 7555
	SITE NAME:	The Gallery at Doughty House, 142, Richmond Hill, Richmond	Gallery built 1880 for Sir Francis Cook, extended 1915 by Brewer Smith, comprising eleven bays in giant lonic order
	DESIGNATION:	Listed Building grade II, CA	with balustrade, the lower order containing door and window openings between Doric pilasters. Works are
	CONDITION:	Poor	needed to the roof, balustrade and rainwater goods. Wo to convert the gallery to ancillary accommodation to the
	OCCUPANCY:	Vacant/not in use	main house, along with re-instating Doughty Cottage as a
	PRIORITY CATEGORY:	D (D)	link between the house and gallery had stalled due to access issues. These have now been resolved and the Loc
		Di	Authority is in discussion with the owner to ensure that

© London Borough of Richmond on Thames

	142, Richmond Hill, Richmond	Brewer Smith, comprising eleve
DESIGNATION:	Listed Building grade II, CA	with balustrade, the lower orde window openings between Dor
CONDITION:	Poor	needed to the roof, balustrade to convert the gallery to ancilla
OCCUPANCY:	Vacant/not in use	main house, along with re-insta
PRIORITY CATEGORY:	D (D)	link between the house and gall access issues. These have now
OWNER TYPE:	Private	Authority is in discussion with t works can now be completed.
LIST ENTRY NUMBER:	1387232	Contact: Nicolette Duckham (I

olette Duckham (LPA) 020 8891 7335

discussion with the owner to ensure that

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

D

Е

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / RICHMOND UPON THAMES / SOUTHWARK

	SITE NAME:	Air Raid Shelter, St Leonard's Court, St Leonard's Road, East Sheen SW14	Air raid shelter, probably built in 1938 to serve St Leonard's Court which was built in 1934-38 by local builder Mr FG Fox. It was designed to hold 48 people; at
	DESIGNATION:	Listed Building grade II	the time there were 83 flats. The Environment Trust commissioned a structural survey leading to minor works,
	CONDITION:	Poor	and funding is being sought for further repairs and use as an educational resource.
A	OCCUPANCY:	N/A	educational resource.
storic England	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	1395422	Contact: Nicolette Duckham (LPA) 020 8891 7335
	SITE NAME:	Church of St Michael and St George, Wilcox Road	Built in 1913 and designed by John Standen Adkins. Slate covered pitched roofs with walls externally and internally in
	DESIGNATION:	Listed Place of Worship grade II	red and stock brick with stone dressings. The church was closed in 2000 but is now being used for Church of England
	CONDITION:	Poor	worship again. The Lady Chapel has been repaired and made fit for worship as has the nave. The congregation is
	PRIORITY CATEGORY:	C (C)	investigating how to get the rest of the building back into
	OWNER TYPE:	Religious organisation	beneficial use.
	LIST ENTRY NUMBER:	1393730	Contact: Tracey Craig 020 7973 3756


© Historic England

© Hist

SITE NAME:	Platt's Eyot, Hampton		
DESIGNATION:	Conservation Area, 5 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Nicolette Duckham (LPA) 020 8891 7335

SOUTHWARK

	SITE NAME:	Railings and gates to Caroline	Iron railings to the Licensed Victuallers' Almshouse
oric England	LIST ENTRY NUMBER:	1376521	Contact: Shanali Counsell (LPA) 020 7525 1770
(OWNER TYPE:	Private	
SIN	PRIORITY CATEGORY:	A (A)	
	OCCUPANCY:	Occupied/in use	support and advice to the owner.
	CONDITION:	Very bad	particularly to the porch. The Local Authority has been working to prioritise necessary repairs, and provide
	DESIGNATION:	Listed Building grade II, CA	considerable water ingress owing to faulty rainwater goods, and there are signs of some structural movement,
	SITE NAME:	Number 8, Addington Square and attached railings SE5	One of a pair of early C19 houses in the Addington Square Conservation Area. The house has suffered from

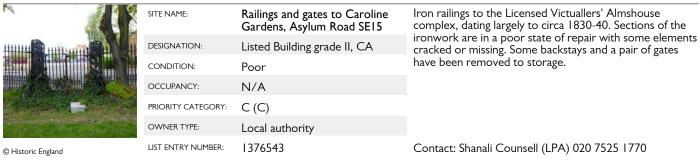

© Histor

2

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT	RISK 2018	I ONDON /	SOUTHWARK

1	SITE NAME:	Licensed Victuallers Almshouses: Chapel, Asylum Road SE15	Former almshouse chapel, dating from 1827-31. The building is leased by the Local Authority to a local artists' group. The building suffered bomb damage in World War
	DESIGNATION:	Listed Building grade II, CA	II. Full condition and structural surveys identified urgent repairs which have since been carried out, jointly funded by
	CONDITION:	Poor	the Local Authority and Historic England. Historic England, the Architectural Heritage Fund and the Local Authority
	OCCUPANCY:	Occupied/in use	are working closely with the leaseholders to develop a
	PRIORITY CATEGORY:	C (A)	long-term strategy.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1376538	Contact: Shanali Counsell (LPA) 020 7525 1770
	SITE NAME:	Chest tomb, St Mary Magdalene Churchyard, Bermondsey Street SEI	Chest tomb from 1815 with original railings. Overgrowth has caused damage to the stone and ironwork. Historic England has funded a condition survey and specification for
	DESIGNATION:	Listed Building grade II, SM, CA	works to the tomb but identified works have not yet been carried out.



	SITE NAME:	Table tomb, St Mary Magdalene Churchyard, Bermondsey Street SEI	Unusual C18 table tomb under a stone canopy with tapered, fluted columns. There is some deterioration to the stone elements and railings. Historic England has
	DESIGNATION:	Listed Building grade II, CA	funded a condition survey and specification for works to the tomb but identified works have not yet been carried
© Historic England	CONDITION:	Fair	out.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (D)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1376578	Contact: Shanali Counsell (LPA) 020 7525 1770

	SITE NAME:	Tomb of John Sargeant, St Mary Magdalene Churchyard, Bermondsey Street SEI	C18 stone chest tomb. The monument has been damaged by erosion and cementitious repairs in the past. Historic England has funded a condition survey and specification for
	DESIGNATION:	Listed Building grade II, CA	works to the tomb but identified works have not yet been carried out.
	CONDITION:	Fair	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (D)	
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1376580	Contact: Shanali Counsell (LPA) 020 7525 1770

D

Е

SITE NAME:	Presbyterian Chapel, 109, Borough Road SEI	Former Presbyterian chapel, 1846. Consent was granted in 2006 for facade retention and the conditions discharged,
DESIGNATION:	Listed Building grade II, CA	but works ceased. South Bank University is now in discussion with the Local Authority and Historic England to
CONDITION:	Very bad	develop appropriate plans for redevelopment of the building for student and community use. Applications for
OCCUPANCY:	Vacant/not in use	Planning Permission and Listed Building Consent are being
PRIORITY CATEGORY:	A (C)	considered. The Chapel is to be incorporated into the wider campus redevelopment.
OWNER TYPE:	Educational (state sector)	
LIST ENTRY NUMBER:	1378375	Contact: Shanali Counsell (LPA) 020 7525 1770

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / SOUTHWARK

	SITE NAME:	Gate piers and railings to the churchyard of the former Church of St John, Fair Street SE1	Early to mid-C19 wrought iron railings and gates, with Portland stone piers and plinth. They are a good example of late Georgian ironwork but have started to corrode. Listed Building Consent has been granted for a full
	DESIGNATION:	Listed Building grade II, CA	conservation and repair scheme. Repairs are due to start 2018.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	D (D)	
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1393615	Contact: Shanali Counsell (LPA) 020 7525 1770
	SITE NAME:	Monument to Charles Waters, Camberwell Old Cemetery, Forest Hill Road, Forest Hill SE23	Monument circa 1910 to Charles Waters. Marble group of a seated woman with book/bible in her lap embracing a small child on a battered plinth. The monument has been returned to an upright position and stabilised. However,

		SE23	returned to an upright position and stabilised. However,
	DESIGNATION:	Listed Building grade II	the figures have been damaged through cleaning processes and require assessment for further repair.
	CONDITION:	Poor	
A	OCCUPANCY:	N/A	
the second second second	PRIORITY CATEGORY:	C (D)	
nd	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1385530	Contact: Shanali Counsell (LPA) 020 7525 1770

	Horniman, Car Cemetery, For	Monument to Rebekah Horniman, Camberwell Old Cemetery, Forest Hill Road, Forest Hill SE23	Monument circa 1895 to Rebekah, wife of FS Horniman. It prominent bronze tablet depicting a figure of an angel is missing, presumed stolen. Historic England and the Local Authority are exploring options for its restoration.
	DESIGNATION:	Listed Building grade II	
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1385533	Contact: Shanali Counsell (LPA) 020 7525 1770



	SITE NAME:	38, Glengall Road, Peckham SEI5	Semi-detached house dating from 1843-1845 by the Brighton architect Amon Henry Wilds. In particular, the
-	DESIGNATION:	Listed Building grade II, CA	lonic entrance porch is in very bad condition, and the roof is not watertight to the rear.
I	CONDITION:	Poor	-
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1385563	Contact: Shanali Counsell (LPA) 020 7525 1770

© Historic England

© Historic England



LIST ENTRY NUMBER:	1385563	Contact: Shanali Counsell (LPA) 020 7525 1770
SITE NAME:	55, Great Suffolk Street SEI	Unaltered mid-C19 warehouse. The building is in a poor
DESIGNATION:	Listed Building grade II	condition having been vacant for a number of years. The Local Authority is in discussion with the owners regarding
CONDITION:	Poor Vacant/not in use its future Listed Bu considere mixed-us	its future use and associated alterations. Applications for Listed Building Consent and Planning Permission are being considered for change of use from warehouse use to a mixed-use scheme comprising offices at ground floor level with flats above.
OCCUPANCY:		
PRIORITY CATEGORY:		
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1393123	Contact: Shanali Counsell (LPA) 020 7525 1770

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / SOUTHWARK

	SITE NAME:	133, Kennington Park Road SEI1	Late C18 terraced house. The building is occupied but no repairs have been undertaken for some years. Planning
	DESIGNATION:	Listed Building grade II, CA	Permission and Listed Building Consent have been secured for full repair and conversion to flats. Works have now
	CONDITION:	Poor	commenced on site.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1385634	Contact: Shanali Counsell (LPA) 020 7525 1770



© Historic England

© Historic England

	SITE NAME:	Nunhead Cemetery (All Saints) SE15	An important public cemetery designed by J Bunstone Bunning and consecrated in 1840. The layout of the
	DESIGNATION:	Registered Park and Garden grade II*, 13 LBs, part in CA	cemetery skilfully exploits the undulating topography to create picturesque effects and vistas. Vegetation and self- sown saplings are disrupting historic monuments and
A PARTY AND	CONDITION:	Generally unsatisfactory with major localised problems	obscuring the legibility of the landscape. The Local Authority is developing plans to restore the East Lodge, which is a longstanding building at risk, and has
	VULNERABILITY:	High	commissioned a comprehensive tree survey and memorial
	TREND:	Declining	risk assessment to inform an updated Conservation Management Plan for the whole of the designed landscape.
	NEW ENTRY?:	No	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1000824	Contact: Christopher Laine 07780 545 979

user.

One of a pair of gate lodges dating from 1840, by James

Bunstone Bunning, adjacent to the main entrance gates.

The lodge is in a ruinous condition. Vegetation has been

cleared and the scaffold renewed by the Local Authority.

Condition and structural surveys have been undertaken, along with a feasibility study, both jointly funded by Historic

England and the Local Authority to inform options for the building's future. The Local Authority has identified funding

to fully repair and conserve the building and discussions

have begun to identify the optimum approach and end

Contact: Shanali Counsell (LPA) 020 7525 1770



SITE NAME:

DESIGNATION:

CONDITION

OCCUPANCY:

OWNER TYPE:


PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England



© Historic England

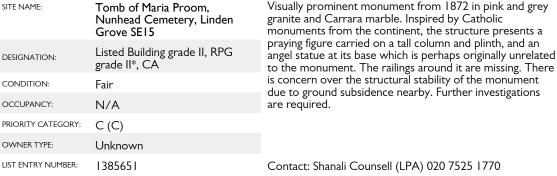

East Lodge to Nunhead

grade II*, CA

Vacant/not in use

Local authority

Very bad

A (A)

1385647

Cemetery, Linden Grove SEI5

Listed Building grade II, RPG



	SITE NAME:	St Peter's Church Hall, 522, Lordship Lane, East Dulwich SE22	Situated adjacent to St Peter's Church, the hall was constructed in 1899. Both buildings are believed to be by Charles Barry Junior. The building is currently vacant and is
	DESIGNATION:	Listed Building grade II, CA	suffering from structural movement and lack of maintenance. Historic England has provided advice on
	CONDITION:	Very bad	urgent repairs required; however these have not been carried out. The Local Authority and Historic England are
	OCCUPANCY:	Vacant/not in use	discussing further steps to secure the repair and
	PRIORITY CATEGORY:	A (A)	conservation of the building.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1385671	Contact: Shanali Counsell (LPA) 020 7525 1770

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet
- implemented. C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBI	REVIATI	ONS
~ •	~	

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / SOUTHWARK	ć


	SITE NAME:	Former fire station, 306-312 (even), Old Kent Road SE1	Fire station built 1903-4 by the London County Council Architects Department. Red brick with Portland stone
	DESIGNATION:	Listed Building grade II	dressings. Shop fronts have been installed without appropriate authorisation. Following provision of a grant
	CONDITION:	Good	from the Empty Homes Agency, the upper floors have been converted into residential units and are now
	OCCUPANCY:	Occupied/in use	occupied. Listed Building Consent has been secured for
THE PARTY CANADA	PRIORITY CATEGORY:	D (F)	alterations required to make good unauthorised works to the ground floor premises.
	OWNER TYPE:	Commercial company	G 1
© Historic England	LIST ENTRY NUMBER:	1385738	Contact: Shanali Counsell (LPA) 020 7525 1770



F	SITE NAME:	The Kentish Drovers public house, 720, Old Kent Road, Peckham SE15	Mid-C19 public house, now partly in use as a restaurant. Enforcement is pending on unauthorised alterations to the building's fabric and the installation of UPVC windows, and
	DESIGNATION:	Listed Building grade II	investigation continues into further breaches.
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1385740	Contact: Shanali Counsell (LPA) 020 7525 1770

© London Borough of Southwark



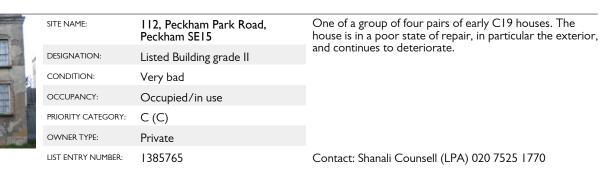

Former fire station built circa 1867 by Edward Cresy Junior SITE NAME: Former Peckham Fire Station, which later became part of the Kennedy's sausage factory. 82, Peckham Road SE5 The remainder of the factory has been demolished. The DESIGNATION: Listed Building grade II building had been vacant for some time and was in a poor state of repair, with water ingress and widespread rot. The CONDITION: Poor South London Gallery secured grants from the Heritage OCCUPANCY: Vacant/not in use Lottery Fund and the Mayor's London Regeneration Fund for the restoration of the building to expand the Gallery's PRIORITY CATEGORY: F (F) activities. Works are now underway. OWNER TYPE: Charity (non-heritage) LIST ENTRY NUMBER: 1392995 Contact: Shanali Counsell (LPA) 020 7525 1770 © Historic England

	SITE NAME:	40, Queens Road, Peckham SEI5	Early C19 terraced building. The building is in poor condition and has suffered from extensive unauthorised
	DESIGNATION:	Listed Building grade II	works.
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1385796	Contact: Shanali Counsell (LPA) 020 7525 1770

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 /	LONDON / SOUTHWARK

	SITE NAME:	Former Clare College Mission Church, Southwark Park SEI6	Former mission church of circa 1900 and 1911-1912, by John W Simpson and Maxwell Ayrton, built for Clare
	DESIGNATION:	Listed Building grade II	College, Cambridge in Italianate style. The walls are ferro- concrete with shallow pitched tiled roofs. Following
	CONDITION:	Poor	refurbishment, the building is used as gallery space by the Bermondsey Artists' Group following a Big Lottery grant
	OCCUPANCY:	Occupied/in use	under the Community Assets Programme, Whilst Historic
	PRIORITY CATEGORY:	C (C)	England and the Local Authority have previously funded roof repairs, further repairs are required to the walls.
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1385919	Contact: Shanali Counsell (LPA) 020 7525 1770



	SITE NAME:	Number I and attached railings, I, Stamford Street SEI	Mid-C19 red brick building that occupies a prominent position looking towards Blackfriars Bridge. Works to
No.	DESIGNATION:	Listed Building grade II	convert the building to offices are at an advanced stage. An application for Listed Building Consent has been submitted
	CONDITION:	Fair	for extensive repairs and repointing to the flank wall. Other ongoing works are due for completion in late 2018.
	OCCUPANCY:	Vacant/not in use	ongoing works are due for completion in face 2010.
	PRIORITY CATEGORY:	F (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1385933	Contact: Shanali Counsell (LPA) 020 7525 1770

© Historic England




SITE NAME:

DESIGNATION:

CONDITION:

© Historic England

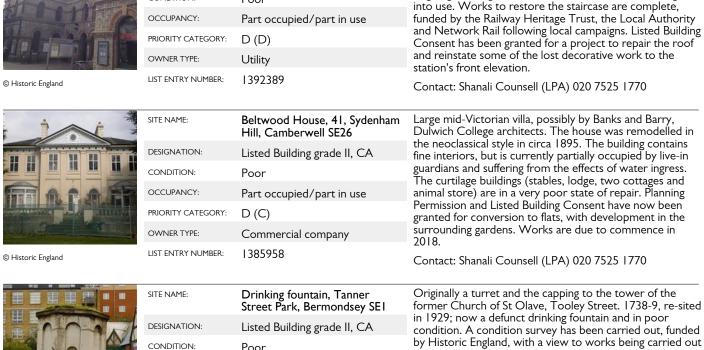

Peckham Rye Station, Station Way, Peckham SEI5

Listed Building grade II, 2 CAs

Poor

© Historic England

Poor as part of a new landscaping scheme for the park. The OCCUPANCY: N/A Local Authority will be funding and commissioning works based on this survey and these are expected to commence PRIORITY CATEGORY: D (D) in summer 2018. OWNER TYPE: Local authority LIST ENTRY NUMBER: 1385959

Contact: Shanali Counsell (LPA) 020 7525 1770

The station is an H-shaped building, built in 1864-65 by

refurbished and brought back into use. Discussions are ongoing to bring the vacant areas in the southern wing back

East Coast Railway. The northern wing has been

Charles Henry Driver for the London, Brighton and South

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).


ABBREVIATIONS

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG SM
- ΪA

WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK	2018 / LONDC	N / SOUTHWARK

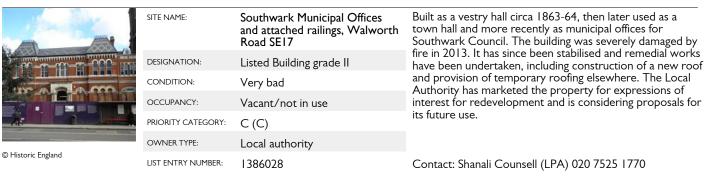

2002	SITE NAME:	Kennedy, 305, Walworth Road, Walworth SE17	Former Kennedy sausages shop, circa 1923. A well- preserved example of a 1920s shop. Considerable works
	DESIGNATION:	Listed Building grade II	have been undertaken to bring the shop back into use. Applications for Planning Permission and Listed Building
	CONDITION:	Fair	Consent have been submitted to convert it into a new restaurant. It is currently vacant.
	OCCUPANCY:	Vacant/not in use	
THE.	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1392595	Contact: Shanali Counsell (LPA) 020 7525 1770



© Historic England

	SITE NAME:	Former office to Denmark Hill Station, Windsor Walk SE5	The former office to Denmark Hill Station dates from 1864-66. The building is in a poor condition following a fire.
	DESIGNATION:	Listed Building grade II, CA	Planning Permission has been granted to convert the building to a café but this has not yet been implemented.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
1	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Utility	
	LIST ENTRY NUMBER:	1386053	Contact: Shanali Counsell (LPA) 020 7525 1770

	SITE NAME:	2, Woods Road	Late C17 house, altered circa 1820 and later. The building
	DESIGNATION:	Listed Building grade II	has been most recently used as offices, but is now vacant. The interior has original timber beams, and wainscoted and
	CONDITION:	Poor	panelled rooms. The building was in very bad repair and suffering from vegetation damage, rot, and cracking. Planning Permission and Listed Building Consent have bee
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (F)	granted for its conversion for residential use and works are at an advanced stage.
	OWNER TYPE:	Commercial company	5
	LIST ENTRY NUMBER:	1386054	Contact: Shanali Counsell (LPA) 020 7525 1770

© Historic England



Church dating from 1734-1736 to designs by John Price, altered by William Hedger in 1807-1808, and restored in SITE NAME: Church of St George the Martyr, Borough High Street, 1951-1952 following war damage. Construction is in red Bermondsey SEI brick with Portland stone dressings under a slated roof. In Listed Place of Worship grade 2005-2006 the building was re-roofed and underpinned. In ed out to the external elevations, ets, grant-aided by the Heritage epairs are needed to the belfry. 0 7973 3786

© Historic England

	DESIGNATION:	II*, CA	10	2018 repairs were carrie
The second	CONDITION:	Fair		the cornices and parapet Lottery Fund. Further re
	PRIORITY CATEGORY:	C (D)		
	OWNER TYPE:	Religious organisatior	ı	
	LIST ENTRY NUMBER:	1378366		Contact: Ian Harper 020

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB LPA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / SOUTHWARK



	ermondsey Queen Anne ar London base fo	This church was built as a Presbyterian chapel in 1888 with Queen Anne and Romanesque influences. It is now the London base for the church of the Brotherhood of the
ION: Listed Place of Wo	rship grade II brickwork with	It is constructed of red brick and gauged stone dressings under a slated roof. The
N: Poor		y survives internally, and the stained glass is he external fabric is in need of repair,
CATEGORY: C (C)	including the bo	oundaries, the brickwork, rainwater goods
rPE: Religious organisat	on and the stained seeking funding	glass windows. The congregation is actively to help develop its project.
(NUMBER: 1385523	Contact: Ian Ha	arper 020 7973 3786
	Falmouth Road, Be ON: Listed Place of Wo N: Poor CATEGORY: C (C) "PE: Religious organisation	Falmouth Road, Bermondsey SE I Queen Anne at London base for Cross and Star. brickwork with complete galler good quality. T including the bo and the stained seeking funding

© Historic England



A	SITE NAME:	Church of St Augustine, Honor Oak Park, Camberwell, Southwark SE23	The church was completed in 1873 by William Oakley, in Kentish ragstone with ashlar details and slated roofs. Underpinning was carried out in two phases, in 1993 and
Z	DESIGNATION:	Listed Place of Worship grade II	2010. Also in 2010 repairs were carried out to masonry and high level roofs. The latest phase of stonework and
	CONDITION:	Poor	tower re-roofing was completed in 2014, with funding from the Heritage Lottery Fund and Historic England. Monitoring
	PRIORITY CATEGORY:	C (C)	of the structure continues and further repairs will be
1 11	OWNER TYPE:	Religious organisation	required in the near future.
	LIST ENTRY NUMBER:	1385617	Contact: Ian Harper 020 7973 3786

© Historic England



Work started on this church, by Charles Barry Jnr, in 1873 SITE NAME Church of St Peter, Lordship on land gifted by Dulwich College for a new parish formed Lane, Camberwell SE22 from St Giles Camberwell. The tower and spire were Listed Place of Worship grade II, completed in 1875 and the vestry enlarged in 1893. The DESIGNATION: CA Church of England closed the church in 1984 and sold it to Worth Abbey who then sold it to the Deeper Life Bible CONDITION: Very bad Church. Masonry is in Kentish ragstone with Bath stone PRIORITY CATEGORY: A (A) dressings, with banded London stock and red brick bire de

© Historic England

	OWNER TYPE:	Religious organisation 1385670	internally. Slated roofs of the nave and timber-framed spire are in bad condition. There is settlement on the north side aisle and the parish hall is derelict. Contact: Ian Harper 020 7973 3786
/	SITE NAME:	Church of St James, Thurland Road, Bermondsey SE16	St James's church was designed in the neoclassical style by James Savage and completed in 1829. The body of the
	DESIGNATION:	Listed Place of Worship grade II*	church is in stock brick while the portico, spire and window dressings are in Bath stone. The plan is rectangular. The
100	CONDITION:	Poor	aisles were closed off in 1965 for rented income to save the church from closure. The nave roof was repaired in
	PRIORITY CATEGORY:	F (C)	2017 with a grant from the Listed Places of Worship Roof
	OWNER TYPE:	Religious organisation	Repair Fund. The external masonry of the spire, portico and clerestory walls is being repaired, grant-aided by the

Heritage Lottery Fund.

Contact: Ian Harper 020 7973 3786

© Historic England

SITE NAME:Roman boat at New Guy's House, Bermondsey SEIDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1001979cONDITION:Generally satisfactory but with significant localised problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:NoOWNER TYPE:Health authorityCONTACT:Elizabeth Whitbourn 07889 808145SITE NAME:The Rose Theatre, Rose Court, Southwark SEIIST ENTRY NUMBER:1012707DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012707CONDITION:Extensive significant problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:NoOWNER TYPE:Commercial company, multiple ownersCONTACT:Elizabeth Whitbourn 07889 808145				
CONDITION:Generally satisfactory but with significant localised problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:NoOWNER TYPE:Health authorityCONTACT:Elizabeth Whitbourn 07889 808145SITE NAME:The Rose Theatre, Rose Court, Southwark SEIISTE NAME:IO12707DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012707CONDITION:Extensive significant problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:No	SITE NAME:	Roman boat at New Guy's House, Bermondsey SE	I	
CONDITION:problemsproblemsPrincipal vulnerability:Drainage/dewateringNew ENTRY?:NoPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:NoOWNER TYPE:Health authorityCONTACT:Elizabeth Whitbourn 07889 808145SITE NAME:The Rose Theatre, Rose Court, Southwark SE1Elizabeth Whitbourn 07889 808145DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012707CONDITION:Extensive significant problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001979
OWNER TYPE: Health authority CONTACT: Elizabeth Whitbourn 07889 808145 SITE NAME: The Rose Theatre, Rose Court, Southwark SE1 VIIII ENTRY NUMBER: 1012707 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1012707 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Drainage/dewatering NEW ENTRY?: No	CONDITION:		TREND:	Unknown
SITE NAME: The Rose Theatre, Rose Court, Southwark SEI DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1012707 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Drainage/dewatering NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1012707CONDITION:Extensive significant problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:No	OWNER TYPE:	Health authority	CONTACT:	Elizabeth Whitbourn 07889 808145
CONDITION:Extensive significant problemsTREND:UnknownPRINCIPAL VULNERABILITY:Drainage/dewateringNEW ENTRY?:No				
PRINCIPAL VULNERABILITY: Drainage/dewatering NEW ENTRY?: No	SITE NAME:	The Rose Theatre, Rose Court, Southwark SEI		
			LIST ENTRY NUMBER:	1012707
OWNER TYPE: Commercial company, multiple owners CONTACT: Elizabeth Whitbourn 07889 808145	DESIGNATION:	Scheduled Monument		
	DESIGNATION: CONDITION:	Scheduled Monument Extensive significant problems	TREND:	Unknown

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

D

Е

use).

LIST ENTRY NUMBER:

1385962

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA

- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM

UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2018 / LONDON / SOUTHWARK / SUTTON

SITE NAME:	Nunhead Cemetery, Nunhead SE15		
DESIGNATION:	Conservation Area, 13 LBs, part in RPG grade II*	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Catherine Jeater (LPA) 020 7525 5375
SITE NAME:	Walworth Road, Walworth		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
00110111011	very bad		inipi oving
VULNERABILITY:	Low	CONTACT:	Catherine Jeater (LPA) 020 7525 5375

SUTTON



SITE NAME:	Boundary walls to Beddington Place along east side of churchyard and along Church Lane, Church Road	Substantial length of C16 or C17 wall of red brick with battered coping and roll moulding, with dentil course and plinth. Sections have been buttressed. The brickwork is in need of substantial repairs, including extensive repointing,
DESIGNATION:	Listed Building grade II, CA	replacement of damaged brickwork, and repair of buttresses. Tree growth threatens stability and vegetation
CONDITION:	Very bad	is causing further damage to the coping. There is extensive graffiti on some sections. A structural engineer's report has
OCCUPANCY:	N/A	been produced and an application has been submitted for
PRIORITY CATEGORY:	A (A)	Listed Building Consent in order to carry out necessary repairs.
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1357592	Contact: Dean James (LPA) 0208 770 5000

© Historic England



SITE NAME: Circa C19 walls of dressed flint with rounded tops, with Churchyard walls, Church Road pilasters and brick quoins at intervals. Vegetation and DESIGNATION: Listed Building grade II, CA mechanical damage caused some sections to collapse, and mortar failure has led to the loss of flints from others. The CONDITION: Fair church has undertaken full repair of extensive sections of the flint wall and these are now in good condition. OCCUPANCY: N/A However, there remain some localised areas where mortar PRIORITY CATEGORY: C (C) has deteriorated leading to the loss of flints, and brick sections require vegetation clearance, mortar and OWNER TYPE: Religious organisation brickwork repair. LIST ENTRY NUMBER 1065671

© Historic England




D

Е

© Historic England



SITE NAME:	Garden walls at Beddington Place (Carew Manor Special School) to north of Orangery walls, Church Road	C17 to C18 garden walls. The east, south and part of the north walls to the east of Beddington Park Cottages are of brick with battered coping; the west wall is of a later date with plain capping. Damage has been largely caused by
DESIGNATION:	Listed Building grade II, CA	vegetation, and upper brick courses have been completely dislodged in some sections. The brickwork is in need of
CONDITION:	Very bad	substantial repairs, including extensive repointing and rebuilding of upper sections.
OCCUPANCY:	N/A	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1200792	Contact: Dean James (LPA) 0208 770 5000

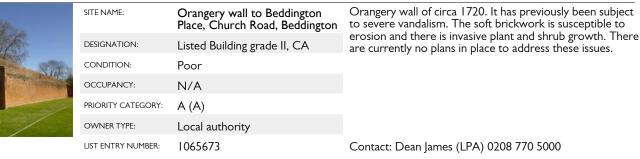

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

F

- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Dean James (LPA) 0208 770 5000

- Conservation Area Listed Building CA LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UÁ
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / SUTTON / TOWER HAMLETS

Alexan	SITE NAME:	Grotto in Carshalton Park, Ruskin Road, Carshalton	Early C18 grotto in Carshalton Park. The exterior of the grotto has symmetrical curved walls of brick, ramped up
	DESIGNATION:	Listed Building grade II, CA	gradually to a central peak. The grotto is vulnerable to vandalism and graffiti and is currently threatened by
	CONDITION:	Poor	significant vegetative growth. Survey work has been carried out to assess the extent of repairs needed, and Historic
	OCCUPANCY:	N/A	England and the Local Authority are discussing potential
All and a second se	PRIORITY CATEGORY:	C (A)	funding for further surveys necessary to specify repair works.
Prof. and States	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1065628	Contact: Dean James (LPA) 0208 770 5000

SITE NAME:	Sutton Town Centre High Street Crossroads, Sutt	ton	
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Dean James (LPA) 0208 770 5000

TOWER HAMLETS

	SITE NAME:	Front wall, gate piers and gates at St Clements Hospital, Bow Road, Bow E3	Decorative gates and railings forming the front boundary to the redundant St Clements Hospital. The freehold has been transferred to the Greater London Authority.
	DESIGNATION:	Listed Building grade II, CA	Planning Permission and Listed Building Consent have been granted for the conversion of the former hospital to
	CONDITION:	Poor	housing, and works have started on site with expected completion in 2018.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Government or agency	
© Historic England	LIST ENTRY NUMBER:	1065276	Contact: Andrew Hargreaves (LPA) 020 7364 5576



	SITE NAME:	St Clements Hospital, Bow Road, Bow E3	Redundant hospital, formerly City of London infirmary. Impressive Italianate main block fronting Bow Road. The
	DESIGNATION:	Listed Building grade II, CA	freehold has been transferred to the Greater London Authority. Planning Permission and Listed Building Consent
	CONDITION:	Very bad	have been granted for the conversion of the former hospital to housing, and works are now well underway with
	OCCUPANCY:	Vacant/not in use	expected completion in 2018.
	PRIORITY CATEGORY:	F (F)	
前	OWNER TYPE:	Government or agency	
	LIST ENTRY NUMBER:	1251493	Contact: Andrew Hargreaves (LPA) 020 7364 5576

© Historic England



© Historic England

1	SITE NAME:	2 bollards (between statue of Gladstone and St Mary's churchyard entrance), Bow Road, Bromley-By-Bow E3	Two C19 bollards which formed a group along with St Mary's Church, its gates and railings and the statue of WE Gladstone. One of the bollards has been removed. The Local Authority is working towards reinstatement of the
	DESIGNATION:	Listed Building grade II, CA	missing bollard.
1	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1262757	Contact: Andrew Hargreaves (LPA) 020 7364 5576

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site
- 112

|--|

1.F	SITE NAME:	Gentlemen's public convenience, Bow Road, Bromley-By-Bow E3	Underground gentlemen's public convenience, constructed by the Board of Works and opened in 1899. There are curved entrance steps designed to fit around the statue of
	DESIGNATION:	Listed Building grade II, CA	WE Gladstone. The decorative interior finish includes russet marble urinals. The public convenience has been
	CONDITION:	Very bad	disused for many years and the decorative iron gates have been damaged. The interior is also subject to vandalism.
LURINE AND MANAGEMENT OF STREET, ST.	OCCUPANCY:	Vacant/not in use	The Local Authority is aiming to work with strategic
terris in the second state of the second state	PRIORITY CATEGORY:	A (A)	partners to find a way forward.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1392968	Contact: Andrew Hargreaves (LPA) 020 7364 5576
123 E	SITE NAME:	Former Bromley Hall School, Bromley Hall Road, London E14	Former school for physically disabled children, built in 1967-8 by the Greater London Council's Architects'
TRANSFER OF	DESIGNATION:	Listed Building grade II	Department and extended in 1978-9. The building has a distinctive architectural form which reflects the local
	CONDITION:	Poor	industrial vernacular. It has been vacant for several years
	OCCUPANCY:	Vacant/not in use	following changes in educational requirements. The Local Authority is considering options for the re-use of the
	PRIORITY CATEGORY:	C (D)	building.
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1402561	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	How Memorial Gateway, Bromley High Street E3	Gabled stone Gothic arch with double buttresses at each side, circa 1893. Formerly an entrance to St Mary's
	DESIGNATION:	Listed Building grade II	Churchyard. The gateway is suffering from stonework decay. The Local Authority is currently undertaking a
	CONDITION:	Poor	feasibility study for the regeneration of the former
	OCCUPANCY:	N/A	churchyard, to include a scheme for repair of the listed gateway.
	PRIORITY CATEGORY:	C (C)	
The second secon	OWNER TYPE:	Unknown	
© Historic England	LIST ENTRY NUMBER:	1065281	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	Limehouse District Library, Commercial Road, Limehouse E14	Former Passmore Edwards Library. Built in 1900 by Messrs Clarkson Architects. The library is closed and the building vacant and boarded up. Planning Permission and Listed
	DESIGNATION:	Listed Building grade II, CA	Building Consent have been granted to convert the building to student accommodation with associated educational and
LETT THE	CONDITION:	Fair	ancillary facilities. Works were subject to delay, but have
	OCCUPANCY:	Vacant/not in use	recently resumed.
In AAA II II	PRIORITY CATEGORY:	F (F)	
150	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1357807	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	Former Caird & Rayner Ltd Warehouse, 777-783, Commercial Road E14	Former sail makers and ship chandler's warehouse, 1869. A rare survival consisting of a brick skin enclosing a timber structure. The building was fire damaged, resulting in the
	DESIGNATION:	Listed Building grade II, CA	loss of its roof covering. Urgent works were completed in April 2010. Applications for Planning Permission and Listed
	CONDITION:	Very bad	Building Consent have been submitted which include
	OCCUPANCY:	, Vacant/not in use	conversion of the building to office use.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1385372	Contact: Andrew Hargreaves (LPA) 020 7364 5576

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / TOWER HAMLETS

HERITAGE AT RISK 2018 / LONDO	ON / TOWER HAMLETS	6	
	SITE NAME:	Star of the East Public House, 805 and 805A, Commercial Road E14	Originally one building although now occupied as two (805A is a public house and 805 is residential). It has three storeys of red brick and tile with a central hipped slate
	DESIGNATION:	Listed Building grade II, CA	roof. The public house is currently empty and boarded up. Enforcement notices have been served on both owners for
	CONDITION:	Poor	front façade improvements, including the lamp standards.
	OCCUPANCY:	Part occupied/part in use	Discussions between the owners and the Local Authority regarding its future use are ongoing.
	PRIORITY CATEGORY:	C (New entry)	
© Historic England	OWNER TYPE:	Commercial company, multiple owners	
	LIST ENTRY NUMBER:	1240184	Contact: Andrew Hargreaves (LPA) 020 7364 5576
un	SITE NAME:	Three Lamp Standards in front of the Star of the East Public House, Commercial Road E14	Three C19 lamp standards on the pavement in front of the Star of the East Public House. Cast iron decorative lanterns bearing the inn name with poor and defective paintwork.
TT TT MILLING TO A.	DESIGNATION:	Listed Building grade II, CA	The lamps do not currently work and one lantern is missing but is being stored. Enforcement notices have been served
	CONDITION:	Poor	on the owner for works which include the lamp standards.
	OCCUPANCY:	N/A	Discussions between the owner and the Local Authority are ongoing.
	PRIORITY CATEGORY:	C (New entry)	
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1065199	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	Oxford House, Derbyshire Street, Bethnal Green E2	A three storey building built in 1892 to the designs of Arthur Blomfield in Tudor Revival style. The attic chapel contains a painting by Alfred Soord, set into a Gothic
	DESIGNATION:	Listed Building grade II	reredos. A temporary roof was erected in 2016, with
	CONDITION:	Fair	funding from Historic England. Planning Permission and Listed Building Consent were granted in 2016 for
	OCCUPANCY:	Occupied/in use	comprehensive repairs, including the chapel and communal
而而带带。	PRIORITY CATEGORY:	F (B)	space. The Heritage Lottery Fund awarded a grant in 2017 and the Local Authority is considering making a Historic
	OWNER TYPE:	Charity (non-heritage)	Buildings Grant offer. Works are scheduled to begin in 2018 and are due for completion in 2019.
© Historic England	LIST ENTRY NUMBER:	1396458	Contact: Andrew Hargreaves (LPA) 020 7364 5576
T	SITE NAME:	Drinking fountain (on pavement outside 31-74 Mile End Road), Mile End Road, Stepney E1	Late C19 polished granite drinking fountain, with a short column on a plinth. The drinking fountain has an inscription commemorating its erection by the Metropolitan Cattle
CATTERTE	DESIGNATION:	Listed Building grade II, CA	Trough and Drinking Fountain Association. The bowl has been removed. The Local Authority is working towards a
e and	CONDITION:	Very bad	repair scheme which will include the reinstatement of the missing elements.
Constant De	OCCUPANCY:	N/A	missing elements.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1065113	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	Accumulator Tower and	Octagonal accumulator tower and chimney stack built in
		Chimney, Mill Place E14	1869 by William Armstrong, inventor of the hydraulic
	DESIGNATION:	Listed Building grade II, CA	crane. It is the last surviving accumulator tower built in Regent's Canal Dock (now known as Limehouse Basin).
	CONDITION:	Fair	They were originally connected to a pumping station, now demolished. The tower is built of stock brick with a cornice
	OCCUPANCY:	N/A	and parapet, white brick and stone dressings and has slit
	PRIORITY CATEGORY:	F(C)	window openings to three elevations. The tower has had problems with water ingress, vegetation growth and graffiti.
	OWNER TYPE:	Commercial company	Listed Building Consent was granted in 2016, and a scheme
© Historic England	LIST ENTRY NUMBER:	1242312	of repair is underway.
o			Contact: Andrew Hargreaves (LPA) 020 7364 5576

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / TOWER HAMLETS

	SITE NAME:	Drinking Fountain, Stepney Green El	Red and grey granite drinking fountain with a large red bowl, trefoil headed plaques and a small truncated spire.
	DESIGNATION:	Listed Building grade II, CA	Erected in 1884 at Rutland Street School (now demolished) in memory of Leonard Montefiore, East End philanthropist,
	CONDITION:	Poor	and moved to its current location in 1939. The fountain is not functioning and has missing architectural details from
	OCCUPANCY:	N/A	the top of the spire. The Local Authority is working
	PRIORITY CATEGORY:	C (New entry)	towards a repair scheme.
	OWNER TYPE:	Local authority	
) London Borough of Tower Hamlets	LIST ENTRY NUMBER:	1065062	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	34, Mount Terrace, Whitechapel EI	Late C18/early C19 stock brick end of terrace house of three storeys with a basement, mansard roof and round
	SITE NAME: DESIGNATION:		
		Whitechapel EI	three storeys with a basement, mansard roof and round headed door with a fanlight. This was originally part of a more extensive development of two rows of 17 houses constructed by local tradesmen for the City Corporation.
	DESIGNATION:	Whitechapel EI Listed Building grade II, CA	three storeys with a basement, mansard roof and round headed door with a fanlight. This was originally part of a more extensive development of two rows of 17 houses constructed by local tradesmen for the City Corporation. The building is empty and is suffering from neglect with some structural cracking visible in the brickwork on the
	DESIGNATION: CONDITION:	Whitechapel EI Listed Building grade II, CA Very bad	three storeys with a basement, mansard roof and round headed door with a fanlight. This was originally part of a more extensive development of two rows of 17 houses constructed by local tradesmen for the City Corporation. The building is empty and is suffering from neglect with
	DESIGNATION: CONDITION: OCCUPANCY:	Whitechapel E1 Listed Building grade II, CA Very bad Vacant/not in use	three storeys with a basement, mansard roof and round headed door with a fanlight. This was originally part of a more extensive development of two rows of 17 houses constructed by local tradesmen for the City Corporation. The building is empty and is suffering from neglect with some structural cracking visible in the brickwork on the
Historic England	DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY:	Whitechapel EI Listed Building grade II, CA Very bad Vacant/not in use A (A)	three storeys with a basement, mansard roof and round headed door with a fanlight. This was originally part of a more extensive development of two rows of 17 houses constructed by local tradesmen for the City Corporation. The building is empty and is suffering from neglect with some structural cracking visible in the brickwork on the

© Historic England

C۲

	SITE NAME:	St Saviours Church, Northumbria Street, Poplar E14	Former church dating from 1873-4 to the design of Frederick J and Horace Francis. The building was severely	
2	DESIGNATION: Listed Building grade II		damaged by fire in May 2007 and is currently propped by scaffolding. Following detailed negotiations, Planning	
	CONDITION:	Very bad	Permission and Listed Building Consent have been granted for residential conversion. All pre-commencement planning	
	OCCUPANCY:	Vacant/not in use	conditions have now been discharged.	
	PRIORITY CATEGORY:	B (B)		
10.5	OWNER TYPE:	Religious organisation		
	LIST ENTRY NUMBER:	1242275	Contact: Andrew Hargreaves (LPA) 020 7364 5576	

	SITE NAME:	19, Princelet Street, Spitalfields E1
	DESIGNATION:	Listed Building grade II*, CA
	CONDITION:	Poor
	OCCUPANCY:	Part occupied/part in use
	PRIORITY CATEGORY:	C (C)
	OWNER TYPE:	Charity (heritage)
storic England	LIST ENTRY NUMBER:	1260421

© Historic England



SITE NAME: 113, Redchurch Street, Tower Hamlets E2 DESIGNATION: Listed Building grade II, CA CONDITION: Very bad OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1393497

Terraced house of 1719 by Samuel Warrall, builder, with added synagogue of 1869 by a Mr Hudson. The building combines a well preserved Spitalfields Huguenot merchant's house with weaving garrets, and a rare surviving small synagogue. The Local Authority is working with the owners to develop a scheme that will secure the full repair of the building. Possible sources of funding are also being explored.

Contact: Elizabeth Whitbourn 07889 808145

Weavers' tenement house, built circa 1735 by William Farmer, a local builder. The building is of interest as a rare and early survival of a building type that once dominated Spitalfields. The building is derelict and has structural problems. The façade has recently been braced to prevent further movement and the building is now wind and water tight. The Local Authority is liaising with the owner and is anticipating Planning and Listed Building Consent applications in due course.

Contact: Andrew Hargreaves (LPA) 020 7364 5576

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

use).

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM

UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Tomb of Joseph Westwood, Southern Grove, Tower Hamlets Cemetery E3	One of the most prominent monuments within the cemetery given its design and location, this stone cross dates from circa 1883. It is in poor condition due to genera
	DESIGNATION:	Listed Building grade II, CA	decay and the loss of parts of its low railings, tiles, finials and other detailing. The Local Authority is working with
	CONDITION:	Poor	the Friends Group to consider options for funding a
	OCCUPANCY:	N/A	condition survey of the cemetery and the necessary repairs.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Local authority	
) Historic England	LIST ENTRY NUMBER:	1378758	Contact: Andrew Hargreaves (LPA) 020 7364 5576
	SITE NAME:	St Pauls Mission Room and Infant Nursery, Wellclose Square El	Gothic style structure built in 1874 to designs by Reuben Greatorex. The building is of stock brick with a red brick eaves cornice and red and blue brick bands. It has stone
AA 3	DESIGNATION:	Listed Building grade II, CA	dressings to the doors and windows, a steeply pitched tilec roof with cresting, and a stone banded chimney. The
	CONDITION:	Poor	building is empty and boarded up. The owner is
	OCCUPANCY:	Vacant/not in use	considering options for re-use or conversion of the building.
	PRIORITY CATEGORY:	C (C)	S.
	OWNER TYPE:	Religious organisation	
) Historic England	LIST ENTRY NUMBER:	1242432	Contact: Andrew Hargreaves (LPA) 020 7364 5576
			ð 、 /
	SITE NAME:	Braithwaite Viaduct, Bishopsgate Goods Yard, Wheler Street / Brick Lane EI	Early railway viaduct built in 1840 by John Braithwaite for the Eastern Counties Railway, formerly set within an extensive brick vaulted goods yard circa 1880, partially
	DESIGNATION:	Listed Building grade II	demolished in 2003. Previous Planning and Listed Building Consent proposals for the site were under consideration
	CONDITION:	Poor	by the Greater London Authority, but an alternative proposal is now being developed.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
-	OWNER TYPE:	Utility	
) Historic England	LIST ENTRY NUMBER:	1063895	Contact: Andrew Hargreaves (LPA) 020 7364 5576
KER	SITE NAME:	Drinking fountain set in wall of former St Mary's Churchyard, Whitechapel Road EI	Drinking fountain with pink marble basin and plaque set in Norman style arch. Erected in 1860 but moved to its present position in 1879. The Local Authority is working
	DESIGNATION:	Listed Building grade II, CA	towards repairs of the fountain and reinstatement of the water supply with the help of external funding.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
© Historic England	LIST ENTRY NUMBER:	1357512	Contact: Andrew Hargreaves (LPA) 020 7364 5576
19 5	SITE NAME:	Royal London Hospital - front block, Whitechapel Road, Whitechapel El	Fine C18 yellow brick hospital building fronting Whitechapel Road. The building, which became redundant following development of new facilities to the rear, has
	SITE NAME: DESIGNATION:	block, Whitechapel Road, Whitechapel El	Whitechapel Road. The building, which became redundant following development of new facilities to the rear, has been purchased by Tower Hamlets Council. Plans to
		block, Whitechapel Road, Whitechapel E1 Listed Building grade II, CA	Whitechapel Road. The building, which became redundant following development of new facilities to the rear, has been purchased by Tower Hamlets Council. Plans to convert the building into a Civic Centre are progressing, as part of the new masterplan for Whitechapel. Planning
	DESIGNATION:	block, Whitechapel Road, Whitechapel E1 Listed Building grade II, CA Fair	Whitechapel Road. The building, which became redundant following development of new facilities to the rear, has been purchased by Tower Hamlets Council. Plans to convert the building into a Civic Centre are progressing, as part of the new masterplan for Whitechapel. Planning
	DESIGNATION: CONDITION: OCCUPANCY:	block, Whitechapel Road, Whitechapel E1 Listed Building grade II, CA Fair Vacant/not in use	Whitechapel Road. The building, which became redundant following development of new facilities to the rear, has been purchased by Tower Hamlets Council. Plans to convert the building into a Civic Centre are progressing, as part of the new masterplan for Whitechapel. Planning
	DESIGNATION: CONDITION:	block, Whitechapel Road, Whitechapel E1 Listed Building grade II, CA Fair	Whitechapel Road. The building, which became redundant following development of new facilities to the rear, has been purchased by Tower Hamlets Council. Plans to convert the building into a Civic Centre are progressing, as

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.


- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / TOWER HAMLETS

	SITE NAME:	2, Wilkes Street EI	Early CI8 terraced house. Three storeys with basement
	DESIGNATION:	Listed Building grade II, CA	and attic in painted brick. Some repair works have been undertaken through enforcement action, but further work
	CONDITION:	Poor	is required. The building has recently been put up for sale.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1242278	Contact: Andrew Hargreaves (LPA) 020 7364 5576

© Historic England Archive

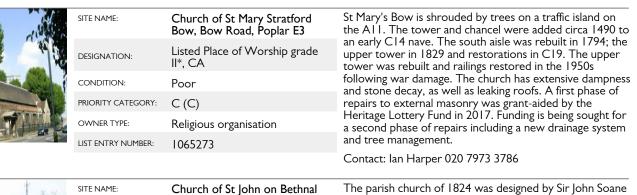



© Historic England

© Historic England



	SITE NAME:	Church of St John on Bethnal Green, Cambridge Heath Road, Bethnal Green E2	The parish church of 1824 was designed by Sir John Soane and heavily restored and extended in the C19 by William Munday and GF Bodley. The church is built of London		
	DESIGNATION:	Listed Place of Worship grade I, CA	stock brick with artificial stone dressings and bell tower. Repairs to high level stonework were grant-aided by Historic England and the Heritage Lottery Fund and		
1	CONDITION:	Poor	completed in 2014. Funding is being sought for a further phase of repairs to the aisle roofs, the interior of the		
	PRIORITY CATEGORY:	C (C)	narthex and the church steps.		
	OWNER TYPE:	Religious organisation			
	LIST ENTRY NUMBER:	1065245	Contact: Ian Harper 020 7973 3786		
HUH	SITE NAME:	St Anne's Limehouse Parish Church, Commercial Road, Stepney E14	St Anne's Church was designed by Nicholas Hawksmoor in the English Baroque style. It was completed in 1730 and consecrated in 1733. The church is built of Portland stone		
辛手			and the western tower was used as a "sea-mark" for naval		
主	DESIGNATION:	Listed Place of Worship grade I, CA	purposes. The interior was restored by Philip Hardwick following a serious fire in 1851. Further work to the roof		
主	DESIGNATION: CONDITION:		purposes. The interior was restored by Philip Hardwick following a serious fire in 1851. Further work to the roof structure was carried out between 1983 and 1993. The		
ま		CA	purposes. The interior was restored by Philip Hardwick following a serious fire in 1851. Further work to the roof		
Ŧ	CONDITION:	CA Poor	purposes. The interior was restored by Philip Hardwick following a serious fire in 1851. Further work to the roof structure was carried out between 1983 and 1993. The classical interior is much damaged by water leakage from		

© Historic England



© Historic England

LIST ENTRY NUMBER: 1357808 Contact: lan Harper 020 7973 3786 The church, hall and offices, arranged around a courtyard, SITE NAME: Calvary Charismatic Baptist Church (former Trinity were built in the 1950s as part of the live architectural exhibition of the 1951 Festival of Britain by Cecil Handisyde Methodist Church), including and D Rogers Stark. The roof to the church and its attached hall and church rooms, East India Dock Road, Poplar exposed concrete frame were repaired in 2017 with a grant from Historic England. Further phases of repair are F14 required to the remaining roofs and external fabric. Listed Place of Worship grade II, DESIGNATION: CA CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1376625 Contact: Ian Harper 020 7973 3786

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

D

Е

use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. obvious new user (applicable only to buildings capable of beneficial

NOTE

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2018 / LONDON / TOWER HAMLETS

HERITAGE AT RISK 2018 / LONDO	ON / TOWER HAMLETS	5		
	SITE NAME:	New Testament Church of God (former Holy Trinity), Morgan Street, Bethnal Green E3	dressings, design and 1839. Repair	ted of London stock brick with stone ed by G Austin and built between 1836 s to the roofs and stonework were
L Den P	DESIGNATION:	Listed Place of Worship grade II, CA	the Heritage Lot	07 with a grant from Historic England and tery Fund. Internal repairs are needed to nd wall plasters. The nave ceiling is
	CONDITION:	Very bad	currently netted	as a precaution against further falls of
	PRIORITY CATEGORY:	C (C)	funding.	gregation is actively exploring options for
Tuesday - State - Stat	OWNER TYPE:	Religious organisation		
© Historic England	LIST ENTRY NUMBER:	1065118	Contact: lan Har	per 020 7973 3786
i i	SITE NAME:	Church of the English Martyrs, Prescott Street, Stepney El	A town church by EW Pugin with rich internal decora completed after his death in 1875 by his brothers. It	
	DESIGNATION:	Listed Place of Worship grade II		er mission set up in 1864. The high altar n 1930 as a shrine to the English Martyrs.
THE COL	CONDITION:	Poor		1940 destroyed the pulpit. The nave roof d but the church has various defects,
	PRIORITY CATEGORY:	C (C)	including stone d	ecay to the belfry, leaking aisle roofs, poor
	OWNER TYPE:	Religious organisation		and unresolved dampness which is I decorations. The church is investigating
	LIST ENTRY NUMBER:	1241734	sources of fundin	
© Historic England			Contact: Ian Har	per 020 7973 3786
	SITE NAME:	Sandy's Row Synagogue, Sandys Row, Bethnal Green El	Former Huguenot chapel which was altered in the minimum a synagogue. The building has slate roofs and stor brick walling with red brick dressings. Major re-roofing	
	DESIGNATION:	Listed Place of Worship grade II, CA	high level brick repairs were completed in 2011 with funding from the Heritage Lottery Fund and Historic	epairs were completed in 2011 with Heritage Lottery Fund and Historic
	CONDITION:	Poor	England. At the same time emergency works were carr out to temporarily restrain the bowing narrow brick pi to the front elevation windows until funding for permar repairs can be resolved. The flat roofs over the wester end of the synagogue were not replaced in 2011 and an now in need of attention.	
	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Religious organisation		
© Historic England	LIST ENTRY NUMBER:	1260323		
			Contact: Tracey	Craig 020 7973 3756
SITE NAME:	Priory and Hospi	tal of St Mary Spital, Steward Stree	t El	
DESIGNATION:		nent, 11 LBs, part in CA	LIST ENTRY NUMBER:	1001982
CONDITION:		tory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Public utilities		NEW ENTRY ?:	No
OWNER TYPE:	Commercial com	pany, multiple owners	CONTACT:	Elizabeth Whitbourn 07889 808145
SITE NAME:	London Hospital,	Stepney EI		
DESIGNATION:	Conservation Are		NEW ENTRY?:	No
CONDITION:	Very bad		TREND:	No significant change
VULNERABILITY:	Medium		CONTACT:	Andrew Hargreaves (LPA) 020 7364 5576
SITE NAME:	St Anne's Church	n El 4		
DESIGNATION:	Conservation Are		NEW ENTRY?:	No
CONDITION:	Very bad		TREND:	No significant change
				Andrew Hargreaves (LPA) 020 7364
VULNERABILITY:	Low		CONTACT:	5576

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / TOWER HAMLETS / WALTHAM FOREST

SITE NAME:	Tower Hamlets Cemetery, Bow E3		
DESIGNATION:	Conservation Area, 19 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Andrew Hargreaves (LPA) 020 7364 5576
SITE NAME:	Wentworth Street, Bethnal Green El		
	Wentworth Street, Beuniar Green Er		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Andrew Hargreaves (LPA) 020 7364 5576
SITE NAME:	Whitechapel High Street, Aldgate El		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Andrew Hargreaves (LPA) 020 7364 5576

WALTHAM FOREST

With the second seco	SITE NAME:	Wall to south east of St Mary's Churchyard, Church End E17	C18 walls, formerly belonging to a house, now demolished, on the adjacent site. A dense covering of ivy is damaging
	DESIGNATION:	Listed Building grade II, part in CA	the brickwork which is in need of repair. Efforts are being made to clarify ownership in order that necessary works can be discussed and eventually secured.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1357602	Contact: Mike Fox (LPA) 020 8496 6737

	SITE NAME:	Walnut Tree House, 500, High Road E10	Mid-C16 timber-framed property formerly used as the Conservative Club, but now a community centre. Works
	DESIGNATION:	Listed Building grade II*	connected with a previously approved Listed Building Consent have been completed satisfactorily. Further
	CONDITION:	Fair	discussions are expected with the Local Authority and Historic England concerning additional repairs, and works
	OCCUPANCY:	Occupied/in use	to the rear of the building.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Other not for profit group	
© Historic England	LIST ENTRY NUMBER:	1065586	Contact: Verena McCaig 020 7973 3718

	SITE NAME:	698a, High Road Leytonstone, Leytonstone EI I	One of a surviving terrace of three Georgian houses, probably late C18, for many years the home of the local
	DESIGNATION:	Listed Building grade II	British Legion branch. Planning Permission and Listed Building Consent have been secured for conversion into
	CONDITION:	Very bad	flats.
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Private	
© London Borough of Waltham Forest	LIST ENTRY NUMBER:	1357632	Contact: Mike Fox (LPA) 020 8496 6737

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / WALTHAM FOREST

	SITE NAME:	Granada Cinema, 186, Hoe Street, Walthamstow E17	Built 1929-30 as the Granada Cinema to the design of Cecil Masey with fine Art Deco and Moorish style interiors by
	DESIGNATION:	Listed Building grade II*	Theodore Komisarjevsky. The Local Authority is taking steps to secure the future of this building and discussions
	CONDITION:	Poor	are ongoing with Historic England regarding plans for its repair and re-use. The foyer and part of the cinema is in
	OCCUPANCY:	Part occupied/part in use	use as a temporary bar.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1065590	Contact: Verena McCaig 020 7973 3718

	SITE NAME:	Chestnuts House, 398, Street E17
	DESIGNATION:	Listed Building grade II*
	CONDITION:	Poor
	OCCUPANCY:	Occupied/in use
	PRIORITY CATEGORY:	C (C)
	OWNER TYPE:	Local authority
© Historic England	LIST ENTRY NUMBER:	1191062

Substantial detached house of circa 1745-7 in stock red brick with red dressings. Elaborate stucco interiors survive along with original panelling and cornices. The house fell out of use several years ago and has since been occupied by live-in guardians. However, the condition of the roof and rainwater goods is deteriorating, with consequences for the walls and plasterwork, and extensive vegetation to the rear threatens further damage. The Local Authority is developing plans for the repair and re-use of the building and is in discussion with Historic England.

Contact: Verena McCaig 020 7973 3718

© Historic England	SITE NAME:	Chapel to south of main hospital block, Langthorne Road El I	Closed chapel to a hospital (formerly a workhouse), 1840. The building is wind and weathertight but in need of moderate repair to bring it back into use. Discussions have
	DESIGNATION:	Listed Building grade II	begun between the owners, the Local Authority, and Historic England to identify an appropriate future use.
	CONDITION:	Poor	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Health authority	
	LIST ENTRY NUMBER:	1357634	Contact: Mike Fox (LPA) 020 8496 6737

House, 398, Hoe

	SITE NAME:	Lodge south of main hospital block, Langthorne Road El I	1840 lodge to a hospital (formerly a workhouse). Considerable ivy growth is now covering most of the
	DESIGNATION:	Listed Building grade II	building requiring urgent management. Discussions have begun between the owners, the Local Authority, and
	CONDITION:	Very bad	Historic England to identify an appropriate future use and secure the necessary repairs.
	OCCUPANCY:	Vacant/not in use	secure the necessary repairs.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Health authority	
ic England	LIST ENTRY NUMBER:	1293493	Contact: Mike Fox (LPA) 020 8496 6737

© Historic

© Historic England

© Historic England



	LIST ENTRY NUMBER:	1293493	Contact: Mike Fox (LPA) 020 8496 6737
	SITE NAME:	Chingford Mill Pumping Station, Lower Hall Lane E4	Pumping station built in 1895 for East London Water Works, in a variant of the style popularised by Norman
DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Listed Building grade II	Shaw. The building is in two ownerships. Part of the building has been converted for residential use; part	
	Poor	remains for utility use. The roof to the tower section is in very poor condition and rainwater goods require repair.	
	Occupied/in use	Enforcement action for unauthorised works is ongoing. The	
	C (D)	Local Authority and Historic England are liaising with the owners to improve the condition and management of the	
	Mixed, multiple owners	buildings and wider site.	
	LIST ENTRY NUMBER:	1250896	Contact: Mike Fox (LPA) 020 8496 6737

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT	RICK 2018	ΜΔΙ ΤΗΔΜ	FOREST
TERITAGE AT	KISK ZUIO	VVALIDAM	FOREST

HERITAGE AT RISK 2018 / LONDO	ON / WALTHAM FORE	T	
	SITE NAME:	Water Turbine House, Chingford Mill Pumping Station, Lower Hall Lane E4	Water turbine house to pumping station built in 1895 for East London Water Works. Planning Permission and Listed Building Consent for residential use were granted in 2007
	DESIGNATION:	Listed Building grade II	and subsequently renewed, subject to a Section 106 agreement. The building is in very poor condition, with
The second second	CONDITION:	Very bad	damage to rainwater goods, windows, and plasterwork. Enforcement action for unauthorised works is ongoing. The
	OCCUPANCY:	Vacant/not in use	Local Authority and Historic England are liaising with the
	PRIORITY CATEGORY:	C (D)	owners to identify and secure urgent remedial works.
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1065574	Contact: Mike Fox (LPA) 020 8496 6737
	SITE NAME:	133, Whipps Cross Road, Leytonstone ETI	One of six survivors from an original terrace of 12 'middle- class' three storey houses called Assembly Row, built in
	DESIGNATION:	Listed Building grade II, CA	1767. The building has been illegally converted into flats and construction of an extension commenced without
	CONDITION:	Poor	consent. Render and brickwork on the flank wall have suffered from considerable water ingress. Roof coverings
	OCCUPANCY:	Occupied/in use	are inadequate and windows require restoration. Historic
	PRIORITY CATEGORY:	C (C)	England and the Local Authority have advised the owner on necessary repair works, and the Local Authority is
	OWNER TYPE:	Private	taking enforcement action regarding the unauthorised works.
© Historic England	LIST ENTRY NUMBER:	1357621	Contact: Mike Fox (LPA) 020 8496 6737
Î	SITE NAME:	Church of St Saviour, Markhouse Road, Walthamstow E17	The church was built in 1874 of squared coursed Kentish ragstone to the design of TF Dolman, and has a 1980s narthex by Purcell. The roofs of the church were renewed
	DESIGNATION:	Listed Place of Worship grade II	after post-war fire damage to a lower pitch and finished in corrugated asbestos, later changed to asbestos slates. The
	CONDITION:	Poor	leaking gutters have caused damage to internal plaster and
	PRIORITY CATEGORY:	D (D)	decorations. The church was awarded a grant from the Heritage Lottery Fund in 2018 for repairs to the nave and
N ANT	OWNER TYPE:	Religious organisation	aisle roofs, rainwater goods and drainage.
© Historic England	LIST ENTRY NUMBER:	1065595	Contact: Ian Harper 020 7973 3786
	SITE NAME:	St Michael and All Angels Church, Palmerston Road, Walthamstow E17	This church has an imposing interior augmented by stained glass windows by Hardman and the highest nave roof of any church in the Chelmsford Diocese. It was designed in
	DESIGNATION:	Listed Place of Worship grade II	the Gothic style by JM Bignall and opened in 1885. It is constructed of London stock yellow brick with a mixture of
	CONDITION:	Poor	red brick and stonework dressings. The original cast iron
	PRIORITY CATEGORY:	C (New entry)	rainwater goods are in very poor condition and inadequate in capacity to cater for storm rainfall. The consequent
05	OWNER TYPE:	Religious organisation	regular wetting of the soft red bricks is causing them to spall and decay. In addition, the vestry roof is felted over
	LIST ENTRY NUMBER:	1191154	and needs renewal.
© Historic England			Contact: Ian Harper 020 7973 3786
	SITE NAME:	Church of St Peter and St Paul, The Green, Chingford E4	The church, with tower and spire of 1844, is by Lewis Vulliamy; the chancel and north and south aisle chapels are by Sir Arthur Blomfield dating from 1903. The Lady Chapel
	DESIGNATION:	Listed Place of Worship grade II*, CA	was extended and re-ordered in 1936 by NF Cachemaille- Day. Primary construction is in cream-coloured gault brick
	CONDITION:	Poor	with flint chequer-board flushwork. All dressings are in Bath stone. The slated roofs are sound but the deficient
	PRIORITY CATEGORY:	B (B)	and defective parapet gutters and sumps are causing
	OWNER TYPE:	Religious organisation	serious internal leaks. The church has been awarded a first round pass from the Heritage Lottery Fund to address
	LIST ENTRY NUMBER:	1065582	these issues.
© Historic England			Contact: Ian Harper 020 7973 3786

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / WALTHAM FOREST / WANDSWORTH



SITE NAME:	St Peter in the Forest, Woodford New Road, Walthamstow E17	1887 and further extended and repaired in 1951 and Located in a woodland setting, the church is built of y		Church of 1840 by John Shaw Jnr extended westwards in 1887 and further extended and repaired in 1951 and 1958 Located in a woodland setting, the church is built of yellow
DESIGNATION:	Listed Place of Worship grade II	stock brick with stone dressings under a pitched slate roof, and there is a projecting tower on the south elevation. The		
CONDITION:	Very bad	1951 extension is pulling away from the west wall of the church which is itself settling and cracked. The		
PRIORITY CATEGORY:	A (A)	congregation is actively exploring possible sources of		
OWNER TYPE:	Religious organisation	funding.		
LIST ENTRY NUMBER:	1393232	Contact: Ian Harper 020 7973 3786		

© Historic England

	SITE NAME:	Church of St Margaret of Antioch and attached railings, Woodhouse Road, Leyton El I	A late C19 basilica style church by architect JT Newman commenced in 1892, replacing an iron mission church. The Lady Chapel was added in 1910. There are fine decorations
	DESIGNATION:	Listed Place of Worship grade II	and wall paintings internally. Only the north transept and aisle roofs remain to be repaired but this work is urgent as
	CONDITION:	Very bad	the paintings and parquet floor are being damaged by inadequate rainwater goods and drainage. The
	PRIORITY CATEGORY:	A (A)	contemporary railings and adjacent halls are also in need of
	OWNER TYPE:	Religious organisation	repair. The congregation is actively exploring options for funding the repairs.
	LIST ENTRY NUMBER:	1390581	Contact: Ian Harper 020 7973 3786

© Historic England

WANDSWORTH

© London Borough of War

	SITE NAME:	Battersea Park Station, Battersea Park Road SW8	Italianate style railway station built circa 1865 for the London, Brighton and South Coast Railway. Alterations to
	DESIGNATION:	Listed Building grade II, CA	the train service mean that the historically and architecturally significant platform 1 is now redundant.
	CONDITION:	Fair	Repair works are now complete, but the building remains underused. A study carried out in 2014 looked at options
	OCCUPANCY:	Part occupied/part in use	for improving the station. Discussions took place between
	PRIORITY CATEGORY:	E (E)	the Local Authority and Network Rail in 2017 concerning more extensive works. An initial legal agreement with
	OWNER TYPE:	Utility	Network Rail over a scheme of works was secured in 2018.
andsworth	LIST ENTRY NUMBER:	1357652	Contact: Barry Sellers (LPA) 020 8871 7564

	SITE NAME:	Former St Mark's Infant School, Battersea Rise SWII	Church School of 1866-67 designed by Benjamin Ferrey. The building is currently vacant and is wind and
	DESIGNATION:	Listed Building grade II, CA	weathertight. The owners carried out maintenance and repairs to the roof and rainwater goods and structural
	CONDITION:	Poor	support to the north wall early in 2018. Discussions are ongoing between the Local Authority, Historic England and
	OCCUPANCY:	Vacant/not in use	the owners regarding the re-use, extension, and alteration
	PRIORITY CATEGORY:	C (A)	of the building.
	OWNER TYPE:	Religious organisation	
England	LIST ENTRY NUMBER:	389 36	Contact: Barry Sellers (LPA) 020 8871 7564

© Historic En



	SITE NAME:	Battersea Power Station, Cringle Street SW8	Power station built from 1932 onwards, closed and vacated in 1983. Planning and Listed Building Consent
	DESIGNATION:	Listed Building grade II*	applications were approved in 2011, subject to a legal agreement, for restoration, extension and conversion to
	CONDITION:	Very bad	provide mixed use facilities. Rebuilding of the chimneys was completed in 2017. Structural repairs to the fabric are
	OCCUPANCY:	Vacant/not in use	underway. Ongoing discussions about repairs are being
	PRIORITY CATEGORY:	F (F)	dealt with through a Conservation Steering Group with representation from Historic England and Wandsworth
	OWNER TYPE:	Commercial company	Council.
	LIST ENTRY NUMBER:	1357620	Contact: Elizabeth Whitbourn 07889 808145

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

use).

D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2018 / LONDON / WANDSWORTH

	SITE NAME:	Springfield Hospital (main building), Glenburnie Road SW17	Former psychiatric hospital built in 1840 in Tudor Gothic style as the Surrey County Asylum. Planning Permission and Listed Building Consent for the redevelopment of the site
	DESIGNATION:	Listed Building grade II, RPG grade II	and demolition of curtilage listed buildings were granted of appeal in 2012. Phase 1 of the re-development has been approved and the listed buildings' strategy was approved in April 2017. The Hospital Trust has appointed a development partner to progress a phased programme of works for the site and bring forward details of the conversion of the listed buildings.
FILME COLUMN (F	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
JEL	PRIORITY CATEGORY:	D (D)	
© Historic England	OWNER TYPE:	Health authority	
	LIST ENTRY NUMBER:	1065553	Contact: Barry Sellers (LPA) 020 8871 7564



The second second	SITE NAME:	Paggen table tomb, Huguenot Place, Huguenot Burial Ground SW18	Stone faced table tomb dating from 1769. One of five table tombs. The strategy for its conservation and repair is being discussed with the Local Authority and Historic England. The Local Authority has registered the land with the Land Registry. Funding is in place for the works of restoration which are expected to take place in 2018-19.
	DESIGNATION:	Listed Building grade II, CA	
- HARAN PROVIDE	CONDITION:	Poor	
	OCCUPANCY:	N/A	
- had	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Unknown	
© London Borough of Wandsworth	LIST ENTRY NUMBER:	1065536	Contact: Barry Sellers (LPA) 020 8871 7564



© Historic England

© Histor

© Historic



Stone faced table tomb, dating from 1720, with a deep SITE NAME: Table tomb to Errington Ward, moulded plinth. One of five table tombs. The strategy for Huguenot Place, Huguenot its conservation and repair is being discussed with the Local Burial Ground SW18 Authority and Historic England. The Local Authority has DESIGNATION: Listed Building grade II, CA registered the land with the Land Registry. Funding is in place for the works of restoration which are expected to CONDITION: Poor take place in 2018-19. N/A OCCUPANCY: PRIORITY CATEGORY: A (A) OWNER TYPE: Unknown Contact: Barry Sellers (LPA) 020 8871 7564 LIST ENTRY NUMBER: 1184219

	SITE NAME:	Table tomb to John Gilham, Huguenot Place, Huguenot Burial Ground SW18	Stone faced table tomb dating from 1728, with a deep moulded plinth. Similar to the Samuel John tomb. One of five table tombs. The strategy for its conservation and
	DESIGNATION:	Listed Building grade II, CA	repair is being discussed with the Local Authority and Historic England. The Local Authority has registered the
ALCO P	CONDITION:	Poor	land with the Land Registry. Funding is in place for the works of restoration which are expected to take place in
	OCCUPANCY:	N/A	2018-19.
Carlos and	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Unknown	
oric England	LIST ENTRY NUMBER:	1065537	Contact: Barry Sellers (LPA) 020 8871 7564

	SITE NAME:	Table tomb to Samuel John, Huguenot Place, Huguenot Burial Ground SW18	Stone faced table tomb, dating from the early to mid-C18 with a deep moulded plinth. One of five table tombs. The strategy for its conservation and repair is being discussed
LA DE	DESIGNATION:	Listed Building grade II, CA	with the Local Authority and Historic England. The Local Authority has registered the land with the Land Registry.
2-2/2-7	CONDITION:	Poor	Funding is in place for the works of restoration which are expected to take place in 2018-19.
and the	OCCUPANCY:	N/A	expected to take place in 2010-17.
	PRIORITY CATEGORY:	C (C)	
Est	OWNER TYPE:	Unknown	
ic England	LIST ENTRY NUMBER:	1357644	Contact: Barry Sellers (LPA) 020 8871 7564

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site
- 123

HERITAGE AT RISK 2018 / LONDON / WANDSWORTH



SITE NAME:	Tomb of Cotterell and Allen, Huguenot Place, Huguenot Burial Ground SW18	Table tomb from 1843. The moulded top slab is cracked in the middle and vegetation is growing through it. One of five table tombs. The strategy for its conservation and repair is
DESIGNATION:	Listed Building grade II, CA	being discussed with the Local Authority and Historic England. The Local Authority has registered the land with
CONDITION:	Poor	the Land Registry. Funding is in place for the works of restoration which are expected to take place in 2018-19.
OCCUPANCY:	N/A	restoration which are expected to take place in 2010 17.
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Unknown	
LIST ENTRY NUMBER:	1184206	Contact: Barry Sellers (LPA) 020 8871 7564



	SITE NAME:	Putney Vale Cemetery Gates, Kingston Road SW15	Iron cemetery gates circa 1890 in Gothic style, badly corroded and in poor condition. The Local Authority has
	DESIGNATION:	Listed Building grade II, RPG grade II	drawn up a detailed specification and a local Community Infrastructure Levy (CIL) bid was approved in 2017 for the repair works. Applications for Planning Permission and
	CONDITION:	Poor	Listed Building Consent were approved in March 2018. Works are due to be implemented 2018-19.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	B (A)	
	OWNER TYPE:	Local authority	
© London Borough of Wandsworth	LIST ENTRY NUMBER:	8426	Contact: Barry Sellers (LPA) 020 8871 7564



© Historic England

©

		1101201	Contact. Darry Selers (EFA) 020 0071 7301
	SITE NAME:	Temple in the grounds of Mount Clare, Minstead Gardens SW15	2017. The site has been re-secured and a planning
	DESIGNATION:	Listed Building grade II*, CA	application for more secure perimeter fencing, received in May 2018, is under consideration. Discussions between the
	CONDITION:	Very bad	Local Authority and Roehampton University are ongoing concerning the future of this building in the wider context
	OCCUPANCY:	N/A	of the Mount Clare site.
	PRIORITY CATEGORY:	A (A)	
5	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1065545	Contact: Elizabeth Whitbourn 07889 808145

	SITE NAME:	Former White Lion, 14-16, Putney High Street SW15	Former White Lion public house built in 1887. The buildin is unoccupied following its closure in 2015 and is in poor
	DESIGNATION:	Listed Building grade II, CA	condition, with access problems. Planning Permission and Listed Building Consent were granted in 2016, subject to
	CONDITION:	Poor	conditions, for alterations to use it as a public house and hotel. After liaison with the Local Authority new
	OCCUPANCY:	Vacant/not in use	applications for Planning Permission and Listed Building Consent are expected in 2018.
	PRIORITY CATEGORY:	C (D)	
	OWNER TYPE:	Commercial company	
© London Borough of Wandsworth	LIST ENTRY NUMBER:	1184658	Contact: Barry Sellers (LPA) 020 8871 7564



SITE NAME:	Queenstown Road Station, Queenstown Road SW8	Station built in 1877. Repairs are needed to the doors, windows and floors of the disused areas of this unattended
DESIGNATION:	Listed Building grade II, CA	station. The former station ticket office has been re-used as a cafe and redecoration of the lobby area carried out. The
CONDITION:	Poor	owners have confirmed that funding is in place for repair works and further discussions were held in 2017 regarding
OCCUPANCY:	Part occupied/part in use	a more extensive scheme of works.
PRIORITY CATEGORY:	D (D)	
OWNER TYPE:	Utility	
LIST ENTRY NUMBER:	1389413	Contact: Barry Sellers (LPA) 020 8871 7564

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2018 / LONDON / WANDSWORTH / WESTMINSTER, CITY OF

	SITE NAME:	100, Tooting Bec Road SW17	Early C19 stucco lodge. Planning Permission and Listed Building Consent were granted in 2012 to use the building for retail and ancillary office space, together with a separate new building for use as a café and car sales. A Repairs Notice was served in 2015 and works to comply with the
	DESIGNATION:	Listed Building grade II	
1	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	notice were completed in November 2017. An
0	PRIORITY CATEGORY:	F (F)	enforcement notice has been served in respect of hoardings around site and applications for Planning
	OWNER TYPE:	Private	Permission and Listed Building Consent are anticipated regarding change of use and boundary works in 2018.
N	LIST ENTRY NUMBER:	35766	Contact: Barry Sellers (LPA) 020 8871 7564

© London Borough of Wandsworth

WESTMINSTER, CITY OF

	SITE NAME:	Bow Street Magistrates Court and Police Station, Bow Street WC2	Court and Police Station, built in 1879-80. Greco Romar style with Vanbrughian details. Planning Permission and Listed Building Consent have been granted for the
	DESIGNATION:	Listed Building grade II, CA	refurbishment of the site and re-use as a hotel, museum and interpretive centre. Preparatory works have started.
	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (D)	
	OWNER TYPE:	Commercial company	
nster City Council	LIST ENTRY NUMBER:	1066393	Contact: David Clegg (LPA) 020 7641 3014



House dating from the mid-C19, with a stuccoed facade 19, Cavendish Avenue NW8 SITE NAME: and central Tuscan porch with a balcony above. The DESIGNATION: Listed Building grade II, CA property is unoccupied and in a poor condition. The stucco is failing in places, plants have taken root at eaves level, and CONDITION: Poor there are signs of water ingress internally. Planning OCCUPANCY: Vacant/not in use Permission and Listed Building Consent were granted in November 2017 for the full repair of the building and PRIORITY CATEGORY: D (C) alterations to provide a single family dwelling. OWNER TYPE: Private LIST ENTRY NUMBER: 1066300 Contact: Alistair Taylor (LPA) 020 7641 2979

© Historic England

© Westmins

	SITE NAME:	21, Charles Street WI	Terraced town house circa 1750-53. Some unauthorised
	DESIGNATION:	Listed Building grade II, CA	works have taken place. Planning Permission and Listed Building Consent were granted in July 2008 for various
	CONDITION:	Poor	works including demolition and rebuilding of the mews building to the rear. The street elevation was cleaned and repaired in 2011-12.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1357294	Contact: Robert Ayton (LPA) 020 7641 2978

© Historic England



	SITE NAME:	112, Eaton Square SW1	Grand terraced house, circa 1825. The building is suffering
	DESIGNATION:	Listed Building grade II*, CA	from neglect, water ingress and a serious outbreak of dry rot. Discussions with the owner are ongoing. Planning
	CONDITION:	Poor	Permission and Listed Building Consent were granted in August 2017 for the full repair of the building as a single
	OCCUPANCY:	Vacant/not in use	family dwelling, but have not yet been implemented.
	PRIORITY CATEGORY:	D (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1066851	Contact: Rebecca Barrett 020 7973 3716

© Westminster City Council

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; в solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

use).

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	94 and 100, Gloucester Place WI	Terraced houses built circa 1800 for the Portman Estate. Listed Building Consent was granted in July 2009 for the internal refurbishment and alterations to No. 100. Work have yet to be implemented.
	DESIGNATION:	Listed Building grade II, CA	
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
ster City Council	LIST ENTRY NUMBER:	1066788	Contact: Susanna Miller (LPA) 020 7641 2459

	SITE NAME:	10-11, Lancaster Gate W2	Grand terrace of houses dating from 1865, attributed to
	DESIGNATION:	Listed Building grade II, CA	John Johnson. The building is three bays wide with four storeys plus attic and basement. It has excellent classical
	CONDITION:	Very bad	detailing. The condition of the existing building is very po owing to water leakage and a lack of maintenance over many years. The building has, however, been temporarily secured following enforcement action, and discussions ar ongoing with regards to its long-term use and repair.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1221694	Contact: Alistair Taylor (LPA) 020 7641 2979

© Westminster City Council

© Westminst

	SITE NAME:	90-93, Piccadilly WI	Corner block of shops and chambers dating from 1883.
	DESIGNATION:	Listed Building grade II, CA	Red brick with stucco ornament and dressings, slate roofs in an eclectic High Victorian design. Part of the former
	CONDITION:	Poor	private club complex with 94 and 95 Piccadilly. Planning Permission and Listed Building Consent were granted in March 2018 for a scheme including the adjacent listed buildings (94 and 95 Piccadilly). Works include the full repair of the buildings for hotel use, with 7 residential unit
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1226747	Contact: Robert Ayton (LPA) 020 7641 2978

© Historic England

5.1	SITE NAME:	94, Piccadilly WI	Town Mansion of 1756-1760 by Matthew Brettingham for
	DESIGNATION:	Listed Building grade I, CA	Lord Egremont, with 1822 and later alterations. Naval and Military Club from 1866 until 1999. Planning Permission
E E	CONDITION:	Poor	and Listed Building Consent were granted in March 2018 for a scheme including the adjacent listed buildings (90-93
	OCCUPANCY:	Vacant/not in use	and 95 Piccadilly). Works include the full repair of the
	PRIORITY CATEGORY:	D (D)	buildings for hotel use, with 7 residential units.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1226748	Contact: Rebecca Barrett 020 7973 3716

© Historic England

	SITE NAME:	95, Piccadilly WI	Town house dating from 1886, forming part of a larger site
JADAC.	DESIGNATION:	Listed Building grade II, CA	with the Former Naval and Military Club. Planning Permission and Listed Building Consent were granted in
Constant of the local division of the local	CONDITION:	Poor	March 2018 for a scheme including the adjacent listed
	OCCUPANCY:	Vacant/not in use	buildings (90-93 and 94 Piccadilly). Works include the full repair of the buildings for hotel use, with 7 residential units
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1265696	Contact: Robert Ayton (LPA) 020 7641 2978

© Historic England

- А
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. В
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	26, Portland Place WI	Main house circa 1770s, with some C18 interiors. Works
	DESIGNATION:	Listed Building grade II*, CA	have commenced on site and are nearing completion.
	CONDITION:	Fair	
NO.	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	E (E)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1227024	Contact: Rebecca Barrett 020 7973 3716

© Westminster City Council

© Historic England Archive



THE COLUMN	SITE NAME:	Wharf side shelter and store to rear of builders' merchants, 22, Praed Street W2	Wharf side shelter and store circa 1840. Brick ground floor with timber first floor with large slated hipped roof. Part of the redevelopment scheme for Paddington Basin. The
ł	DESIGNATION:	Listed Building grade II	shelter is currently being stored off-site and will be re- erected as part of the final landscaping proposals.
A DECEMBER OF THE OWNER OWNE	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1248366	Contact: Tom Burke (LPA) 020 7641 2357



© Historic England

	LIST ENTRY NOMBER:	1248366	Contact: Tom Burke (LPA) 020 7641 2357
	SITE NAME:	Snowdon Aviary London Zoo, Regents Park NW1	Aviary designed by Lord Snowdon and Cedric Price in 1962-5 as part of a wider expansion of London Zoo. The
D	DESIGNATION:	Listed Building grade II*, RPG grade I, CA	Aviary is an aluminium and steel structure on concrete foundations, accessed via a cantilevered concrete bridge. Funding has been secured from the Heritage Lottery Fund
	CONDITION:	Poor	for the full repair of the Aviary, and Planning Permission and Listed Building Consent were granted in September
and	OCCUPANCY:	Part occupied/part in use	2017. Works will include the replacement of the aluminium
	PRIORITY CATEGORY:		mesh and alterations to the concrete bridge and entrance pods. Further investigative works are underway, partly
	OWNER TYPE:	Charity (non-heritage)	funded by Historic England.
	LIST ENTRY NUMBER:	1323695	Contact: Rebecca Barrett 020 7973 3716

	SITE NAME:	140, Westbourne Terrace W2	Detached villa dating from 1843-8 in an Italianate style.
	DESIGNATION:	Listed Building grade II, CA	Occupied as a number of bedsits. Planning Permission and Listed Building Consent were refused in November 2011
	CONDITION:	Good	for a scheme seeking to retain the use of the building as seven self-contained flats and associated unauthorised works. This is being investigated as an enforcement mat Some repairs have, however, been carried out.
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1267518	Contact: John Wilman (LPA) 020 7641 2561

© Historic England



SITE NAME:	Church of St Mark, Hamilton Terrace, Paddington NW8	Gothic church dating from 1846-7 by Thomas Cundy Senior with spire by Thomas Cundy Junior and chancel in
DESIGNATION:	Listed Place of Worship grade II*, CA	1878 by EB Ferrey. It has slate covered pitched roofs and Kentish ragstone walling with ashlar dressings. The nave roof was re-slated in 2013, with funding from Historic
CONDITION:	Poor	England and the Heritage Lottery Fund. A further grant was awarded towards masonry repairs to the tower and spire
PRIORITY CATEGORY:	C (F)	and works were completed in 2017. The nave parapets and the chancel roof remain in poor condition.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1066681	Contact: Tracey Craig 020 7973 3756

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user latentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	Church of St Augustine, Kilburn Park Road, Paddington NW6	Designed by JL Pearson, built in 1877. The building has slated pitched roofs and red brick walling with Bath stone dressings. Internally the walls are covered in wall paintings by Clayton & Bell. The south aisle roof was re-slated in 2013, with funding from Historic England and the Heritage Lottery Fund. A new heating system has more recently been installed. Other roofs, particularly the nave, chancel and transepts remain in poor condition.
Ale	DESIGNATION:	Listed Place of Worship grade I	
TEA	CONDITION:	Poor	
1 303	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1221320	Contact: Tracey Craig 020 7973 3756

© Historic England



	SITE NAME:	Buddhist Temple, Margaret Street, Marylebone WI	Former Parish School and Church House to All Saints Margaret Street dating from 1868-70 by William Butterfield. The building is in full-time occupation and used for worship, library and residential accommodation. The roofs and external facades are in poor condition. Works are currently underway to repair the roofs, masonry and rainwater goods to the former Church House, grant-aided by the Heritage Lottery Fund, and are due to complete in
	DESIGNATION:	Listed Place of Worship grade II*, CA	
	CONDITION:	Poor	
	PRIORITY CATEGORY:	F (D)	
	OWNER TYPE:	Religious organisation	2018.
	LIST ENTRY NUMBER:	1273611	Contact: Tracey Craig 020 7973 3756

© Historic England



Built c1818, designed by T Hardwick with chancel remodelled in 1884 by T Harris. Classical design with Church of St Mary, Marylebone SITE NAME: Road, Marylebone WI Corinthian portico and tower surmounted by a domed Listed Place of Worship grade I, cupola supported by golden caryatids. Built in Portland DESIGNATION: CA stone with metal roofs and tiled roofs to the transepts. Crypt converted for use as NHS health centre and CONDITION: Poor counselling centre. There are problems with the timber PRIORITY CATEGORY: roof structure and roof coverings, and erosion to stone. In D (New entry) 2016 the church was awarded a grant from the Heritage Religious organisation Lottery Fund for their Changing Lives project which will include the essential repairs to the church fabric. 1239817

© Historic England



OWNER TYPE: LIST ENTRY NUMBER: Contact: Tracey Craig 020 7973 3756 SITE NAME: Built 1878 by GE Street, with crypt chapel of St Sepulchre Church of St Mary Magdalene, by Sir Ninian Comper 1895. High Victorian church with complete internal decorative scheme. Roof repairs were Rowington Close, Paddington W2 completed with funding from the Heritage Lottery Fund Listed Place of Worship grade I, and Historic England in 2008, and further funding saw the DESIGNATION: CA replacement of electrics and drainage repairs in 2012. The church is undergoing major external fabric repairs with CONDITION Poor cleaning and new lighting to the interior, grant-aided by the Heritage Lottery Fund, due to complete 2018. The St PRIORITY CATEGORY: D (C) Sepulchre Chapel is undergoing environmental monitoring

Religious organisation

1235288

© Historic England



	SITE NAME:	Church of St Gabriel, Warwick Square, Westminster SWI	Church dating from 1851-3 by the architect Thomas Cund II with his son Thomas Cundy III. The external walling is generally Kentish ragstone with Bath stone dressings. The tower has been repaired, grant-aided by the Heritage Lottery Fund and Historic England. However, some roofs and masonry in other areas remain in poor condition.	
	DESIGNATION:	Listed Place of Worship grade II*, CA		
	CONDITION:	Poor		
	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Religious organisation		
τiλ.	LIST ENTRY NUMBER:	1357369	Contact: Tracey Craig 020 7973 3756	

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

OWNER TYPE:

LIST ENTRY NUMBER:

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

prior to any conservation works.

Contact: Tracey Craig 020 7973 3756

ABBREVIATIONS

ÍΙΑ

WHS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
 - Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Church of St Stephen, Westbourne Park Road, Westminster W2	Built adde ragst
DESIGNATION:	Listed Place of Worship grade II, CA	spire beca Prog
CONDITION:	Poor	crack are c
PRIORITY CATEGORY:	F (B)	to re
OWNER TYPE:	Religious organisation	by th 2018
LIST ENTRY NUMBER:	1267651	Cont

in 1856, designed by F & H Francis. The apse was ed in 1900. Externally the building is of coursed tone with limestone dressings and slate roofs. The e was taken down after World War II. The church ame near derelict and underwent major repair in 1995. gressive structural instability is exhibited in extensive king and splitting of stone in the nave arcading. Works currently underway to address the structural issues and epair the cracked and damaged stonework, grant-aided he Heritage Lottery Fund, and due to complete in 8.

ntact: Tracey Craig 020 7973 3756

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

This document is one in a series of publications produced as part of Historic England's national **Heritage at Risk** programme. More information about **Heritage at Risk** and other titles in the series can be found at **HistoricEngland.org.uk/har**

Heritage at Risk Published November 2018 4th Floor, Cannon Bridge House 25 Dowgate Hill London EC4R 2YA © Copyright Historic England 2018 Product code: 52097



London Register 2018