Heritage at Risk



Contents

The Register	III
Content and criteria	III
Key statistics	V
Key to the entries	VI
Entries on the Register by local planning authority	VIII
Bath and North East Somerset (UA)	1
Bournemouth Christchurch and Poole (UA)	3
Bristol, City of (UA)	5
Cornwall (UA)	9
Devon	47
Dartmoor (NP) East Devon Exeter Exmoor (NP) Mid Devon North Devon South Hams Teignbridge Torridge West Devon	47 71 78 78 80 82 87 94 96
Dorset (UA)	107
Gloucestershire	145
Cheltenham Cotswold Forest of Dean Gloucester Stroud Tewkesbury Isles of Scilly (UA)	145 145 150 153 154 157
North Somerset (UA)	165
Plymouth, City of (UA)	167
Somerset	171
Exmoor (NP) Mendip Sedgemoor Somerset West and Taunton South Somerset	171 174 180 184 188
South Gloucestershire (UA)	193
Swindon (UA)	195
Torbay (UA)	197
Wiltshire (UA)	199

II

THE REGISTER

The Heritage at Risk Register includes historic buildings and sites at risk of being lost through neglect, decay or deterioration.

It includes all types of designated heritage assets, including Conservation Areas, which are designated and assessed by Local Planning Authorities.

The aim of the Register is to focus attention on those places in greatest need. Historic England, in partnership with others, is able to help tackle heritage at risk. We work with owners, friends groups, developers and other stakeholders to find imaginative solutions for historic places and sites at risk across England.

More information about our role, the advice and funding available, and useful <u>publications</u> and <u>guidance</u> is available on our <u>website</u>.

Criteria for inclusion on the Register

RISK ASSESSMENTS

Heritage assets included on the Register are assessed according to the nature of the site. The risk assessment methodologies outlined below are based on factors which can threaten the different types of heritage assets and lead to them becoming at risk.

BUILDINGS AND STRUCTURES

To be considered for inclusion on the Register, buildings or structures must be:

- listed on the National Heritage List for England;
- in secular (non-worship) use.

And either:

- a grade I or II* listed building, or
- a grade II listed building in London, or
- a structural scheduled monument with upstanding remains,

Buildings or structures are assessed on the basis of condition and, where applicable, occupancy (or use) reflecting the fact that a building which is occupied is generally less vulnerable than one that is not.

Occupancy (or use) is assessed as 'vacant', 'part-occupied', 'occupied', 'not applicable', or occasionally, 'unknown'.

Many structures fall into the 'not applicable' category, for example: ruins, walls, gates, headstones or boundary stones.

Condition is assessed as 'very bad', 'poor', 'fair' or 'good'. The condition of buildings or structures on the Register is typically very bad or poor, but can be fair or, very occasionally, good. This reflects the fact that some buildings or structures are vulnerable because they are empty, underused or face redundancy without a new use to secure their future. Assessing vulnerability in the case of buildings in fair condition necessarily involves judgement and discretion. A few buildings remain on the Register in good condition, having been repaired or mothballed, but still awaiting a new use or occupancy.

Buildings or structures are removed from the Register when they are fully repaired/consolidated, and their future secured either through occupation and use, or through the adoption of appropriate management.

PLACES OF WORSHIP

To be considered for inclusion on the Register, places of worship must be listed grade I, grade II* or grade II on the National Heritage List for England, and be used as a public place of worship at least six times a year.

Places of worship are assessed on the basis of condition only. If a place of worship is in very bad or poor condition, it is added to the Register. This includes places of worship which are generally in fair or good condition but have major problems with one key element, like the tower.

Once on the Register, places of worship can move through the condition categories (e.g. from very bad to poor, to fair, even good) as repairs are implemented and the condition improves, until they are fully repaired and can be removed from the Register. This means that there are some places of worship in good condition on the Register but with outstanding issues still to be resolved at the time when they were assessed.

ARCHAEOLOGY

To be considered for inclusion on the Register, archaeological sites must be listed as scheduled monuments and included on the National Heritage List for England.

Archaeology assessments cover scheduled earthworks and buried archaeology.

The risk assessment is based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability. A site's condition is expressed in terms of the scale and severity of adverse effects on it, ranging from 'extensive significant problems' to 'minor localised problems'.

Archaeological entries are removed from the Register once sufficient progress has been made to address the identified issues, and a significant reduction in the level of risk has been demonstrated.

PARKS AND GARDENS

To be considered for inclusion on the Register, parks and gardens must be listed as grade I, grade II* or grade II and included on the National Heritage List for England. Parks and gardens are assessed in terms of condition and vulnerability. Steps being taken by owners to address problems are also taken into consideration.

Parks and gardens assessed as being at risk are typically affected by development and neglect. They have frequently been altered by development or are faced with major change. The original function of these landscapes has often changed and divided ownership leads to the loss of their cohesive historic design.

Park and garden entries are removed from the Register once steps have been taken to address issues and positive progress is being made.

BATTLEFIELDS

To be considered for inclusion on the Register, battlefields must be listed and included on the National Heritage List for England. Battlefields deemed to be at risk of loss of cultural significance are included on the Register.

The principal risks and threats are:

- development pressure e.g. encroachment of buildings;
- pressures of particular use within the site e.g. arable cultivation;
- damage e.g. unregulated metal detecting.

Battlefields are removed from the Register either when damaging activities cease/are managed, or when threats recede due to effective planning.

WRECK SITES

To be considered for inclusion on the Register, wrecks must be listed and included on the National Heritage List for England.

Wreck sites are assessed based on their current condition, vulnerability and the way they are being managed.

Wrecks are vulnerable to both environmental and human impacts. Risks that contribute to inclusion on the Register range from unauthorised access to erosion and fishing damage. The monitoring process ensures that the significance of the site is identified and maintained. In spite of the inherent difficulties in caring for this type of site, careful management must be maintained.

Wrecks are removed from the Register once an appropriate management and monitoring regime is operational.

CONSERVATION AREAS

Once a year Historic England asks every local authority in England to consider the state of its conservation areas and fill in (and update as appropriate) risk assessment questionnaires for those that cause concern, or are believed to no longer be at risk.

Conservation areas that are deteriorating, or are in very bad or poor condition and not expected to change significantly in the next three years, are defined as being at risk.

The approach taken to assess conservation areas at risk has been refined since the first survey in 2008/2009. An overall category for condition, vulnerability and trend is included for each conservation area on the Heritage at Risk Register. Conservation areas identified as at risk in 2009, but not reassessed since using the revised methodology, are included on the Register but with limited information.

Conservation areas are removed from the Register once plans have been put in place to address the issues that led to the conservation area being at risk, and once positive progress is being made.

Key statistics

BUILDINGS AND STRUCTURES

- Nationally, 748(3.3%) of grade I and II* listed buildings (excluding places of worship) are on the Register. In the South West the percentage is 2.8% (148listed secular buildings).
- 4 building or structure entries have been removed from the 2018 South West Register because their futures have been secured, and 12 have been added.
- 67.4% of buildings or structures (124) on the South West baseline 1999 Register have been removed because their futures have been secured compared with the national figure of 65.3%.

PLACES OF WORSHIP

- Nationally, 6.2% of listed places of worship are on the Register. In the South West, 5.1% (149) are on the Register.
- 21 places of worship have been removed from the South West Register following repair work, and 8 have been added.

ARCHAEOLOGY

- 2,412 (12.1%) of England's 19,861 scheduled monuments are on the Register. 1,095 (15.7%) of the South West's 6,980 scheduled monuments are on the Register.
- 31 archaeology entries have been removed from the 2018 South West Register for positive reasons, and 27 have been added.
- 41.9% of archaeology entries (595) on the South West baseline 2009 Register have been removed for positive reasons, compared with the national figure of 50.2%.
- Nationally, damage from arable cultivation is

the greatest cause of risk affecting 37.6% of archaeological entries on the Register. In the South West the proportion is 31.9%. The greatest risk to entries on the South West Register, affecting 34.1% of them, is from unrestricted plant, scrub and tree growth. The national figure for plant, scrub and tree growth is 26.3%.

PARKS AND GARDENS

- 102(6.1%) of England's 1,669 registered parks and gardens are on the Register. Of the 304 registered parks and gardens in the South West, 17 (5.6%) are on the Register.
- No park and garden entries have been removed from the 2018 South West Register, and Lentry has been added.

BATTLEFIELDS

- Of the 47 registered battlefields in England, 3(6.4%) are on the Register.
- Of the 10 registered battlefields in the South West, I was on the Register in 2018 and has been removed from it.

WRECK SITES

• Of the 53 protected wreck sites around England's coast, 3 (5.7%) are on the Register. None of the South West's 27 protected wreck sites are on the Register.

CONSERVATION AREAS

- There are currently 501 Conservation Areas on the Heritage at Risk Register. Of these 26 are in the South West.
- 5 conservation areas have been removed from the 2018 South West Register for positive reasons, and none have been added.

HISTORIC ENGLAND FUNDING

• £1.51 million in grant was spent on 100 entries on the South West Register during 2018/19.

Risk assessments of heritage assets are based on the nature of the site. Buildings and structures include listed buildings (excluding listed places of worship) and structural scheduled monuments; archaeology assessments cover earthworks and buried archaeology.

Key to the entries

The Register includes the following risk assessment types:

• Building or structure

(grade I and II* listed buildings, grade II listed buildings in London and structural scheduled monuments)

Place of worship

(grade I, II* and II listed buildings)

Archaeology

(scheduled monuments – earthworks and buried archaeology)

Park and garden

(Registered parks and gardens)

Battlefield

(Registered battlefields)

Wreck site

(Protected wreck sites)

Conservation area

(Conservation areas)

Details are given here for all risk assessment types even if entries are not present in the Regional Register.

ORDER

Entries are grouped and ordered alphabetically, first by County (dark grey bands) or Unitary Authority (light grey bands), and then by Local Planning Authority (National Park/Unitary Authority/District or Borough).

A blank band denotes the end of a county and the beginning of a unitary authority.

Sites that straddle more than one local planning authority are included under the lead authority.

Within each planning authority, entries are grouped by risk assessment type in the following order:

- Buildings or structures
- · Places of worship
- Archaeology
- Parks and gardens
- Battlefields
- Wreck sites
- Conservation areas

Within each risk assessment type, entries are ordered alphabetically by parish, locality and street/site name (except for conservation areas and protected wreck sites which are ordered by site name only).

LISTING

The principal listing type is noted for each entry and includes:

- Listed Building (LB) grade I or II*
- Listed Place of Worship grade I, II* or II
- Scheduled Monument (SM)
- Registered Park and Garden (RPG) grade I, II* or II
- Registered Battlefield (RB)
- Protected Wreck Site (PWS)
- Conservation Area (CA)

Other listing types that apply to a given site, including location within a World Heritage Site (WHS), are also noted.

If an entry is a dual list entry (both listed and scheduled), 'and' rather than a comma is used (eg 'Scheduled Monument and Listed Building grade I'). If a scheduled monument entry is a dual list entry with a number of listed buildings, each is separated by a semicolon.

The National Heritage List Entry Number is included for all entries (except conservation areas). If a site has dual list entries, all relevant List Entry Numbers are noted.

CONDITION

For buildings (including places of worship), condition is graded as: 'very bad', 'poor', 'fair' and 'good'.

For sites that cover areas (scheduled monuments – archaeology assessments, parks and gardens, battlefields and wreck sites) one overall condition category is recorded. The category may relate only to the part of the site or monument that is at risk and not the whole site:

- extensive significant problems
- generally unsatisfactory with major localised problems
- generally satisfactory but with significant localised problems
- generally satisfactory but with minor localised problems
- optimal
- unknown (noted for a number of scheduled monuments that are below-ground and where their condition cannot be established)

For conservation areas, condition is categorised as: 'very bad', 'poor', 'fair' and 'optimal'.

If a site has suffered from heritage crime it is noted in the summary. Heritage crime is defined as any offence which harms the heritage asset or its setting and includes arson, graffiti, lead theft and vandalism.

OCCUPANCY/USE

For buildings (excluding places of worship) that can be occupied or have a use, the main vulnerability is vacancy or under-use. Occupancy (or use) is noted as follows:

- vacant
- part occupied
- occupied
- unknown
- not applicable

VULNERABILITY

Principal vulnerability is noted for archaeology assessments and may relate only to the part of the site that is at risk, and include:

- animal burrowing
- arable ploughing
- coastal erosion
- collapse
- deterioration in need of management
- scrub/tree growth
- visitor erosion

For parks and gardens, battlefields, wreck sites and conservation areas, vulnerability is noted as high, medium or low.

PRIORITY CATEGORY

Priority for action is assessed on a scale of A to F, where 'A' is the highest priority for a site which is deteriorating rapidly with no solution to secure its future, and 'F' is the lowest priority.

For buildings and structures and places of worship the following priority categories are used as an indication of trend and as a means of prioritising action:

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented
- C Slow decay; no solution agreed
- D Slow decay; solution agreed but not yet implemented
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- F Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented

For battlefields and wreck sites the following priority categories are used as a means of prioritising action:

- A No action/strategy identified or agreed (where trend is declining or unknown)
- B Action/strategy agreed but not yet implemented (where trend is declining or unknown)
- C No action/strategy identified or agreed (where trend is stable or improving)
- D Action/strategy agreed but not yet implemented (where trend is stable or improving)
- E Monitoring as appropriate (any trend)
- F Action implemented/strategy underway/scheme in progress (any trend)

Previous year priority categories are given in brackets, otherwise 'New entry' is noted.

'New entry - re-assessed' indicates an existing site on the Register that has been re-assessed using a different risk assessment methodology and is included on this year's Register under the new assessment type.

TREND

Trend for archaeology entries, parks and gardens, battlefields and wreck sites may relate only to the part of the site that is at risk and is categorised as:

- declining
- stable
- improving
- unknown

For conservation areas trend is categorised as:

- deteriorating
- deteriorating significantly
- no significant change
- improving
- improving significantly
- unknown

OWNERSHIP

A principal ownership category is given for each entry, and if sites are in divided ownership, a 'multiple' ownership category is noted.

CONTACT

This is the member of the Historic England local team who acts as a first point of contact for the case, and to whom enquiries should be addressed.

For conservation areas, the contact is the conservation/planning officer at the relevant local planning authority (indicated by 'LPA').

We are not in any sense agents for the owners of the sites included, but we will endeavour to put people in touch with them where appropriate.

ABBREVIATIONS

CA Conservation Area HE Historic England HLF Heritage Lottery Fund LB Listed Building

LPA Local Planning Authority

NP National Park

PWS Protected Wreck Site RB Registered Battlefield **RPG**

Registered Park and Garden

SM Scheduled Monument UA Unitary Authority WHS World Heritage Site

Entries on the Register by local planning authority

Local planning authority	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
BATH AND NORTH EAST S	OMERSET (UA)						
Bath and North East Somerset (UA)	4	0	8	I	0	0	3
BOURNEMOUTH CHRISTC	HURCH AND PO	OLE (UA)					
Bournemouth Christchurch and Poole (UA)	0	5	4	0	0	0	2
BRISTOL, CITY OF (UA)							
Bristol, City of (UA)	9	4	4	0	0	0	1
Bristol, City of (UA) / Bath and North East Somerset (UA) [†]	0	0	0	ı	0	0	0
CORNWALL (UA)					ı		
Cornwall (UA)	37	21	184	I	0	0	
DEVON							
Dartmoor (NP)	2	3	158	0	0	0	0
East Devon	4	3	36	ı	0	0	0
Exeter	0	2	I	0	0	0	0
Exmoor (NP)	0	2	7	0	0	0	0
Mid Devon	2	0	16	0	0	0	3
North Devon	3	7	16	0	0	0	1
South Hams	9	11	22	0	0	0	0
Teignbridge	2	4	7	2	0	0	1
Torridge	3	9	34	0	0	0	0
West Devon	7	3	9	0	0	0	0
DORSET (UA)							
Dorset (UA)	23	5	229	I	0	0	5
GLOUCESTERSHIRE							
Cheltenham	0	2	0	0	0	0	0
Cotswold	3	4	22	0	0	0	0
Forest of Dean	4	7	7	0	0	0	0
Gloucester	3	0	0	0	0	0	2
Stroud	5	7	5	0	0	0	2
Tewkesbury	7	4	7	0	0	0	1
ISLES OF SCILLY (UA)							
Isles of Scilly (UA)	2	0	30	0	0	0	0
NORTH SOMERSET (UA)							
North Somerset (UA)	3	I	2	0	0	0	0
PLYMOUTH, CITY OF (UA)		1					
Plymouth, City of (UA)	14	I	12	0	0	0	0
SOMERSET		1					
Exmoor (NP)	2	0	18	0	0	0	0
Mendip	5	10	17	0	0	0	0
Sedgemoor	2	8	12	I	0	0	0
Somerset West and Taunton	7	2	15	I	0	0	I
South Somerset	8	11	4	2	0	0	0
SOUTH GLOUCESTERSHIRE	(UA)						
South Gloucestershire (UA)	6	2	3	2	0	0	2
SWINDON (UA)							
Swindon (UA)	1	I	11	0	0	0	0
TORBAY (UA)							
Torbay (UA)	4	<u>I</u>	I	2	0	0	1
Torbay (UA) / South Hams [†]	0	0	0	I	0	0	0
WILTSHIRE (UA)		1					
Wiltshire (UA)	14	9	146	I	0	0	0

Local planning authority	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
Wiltshire (UA) / New Forest (NP) [†]	0	0	1	0	0	0	0
TOTAL	195	149	1048	17	0	0	26

 $^{^{\}dagger}$ Sites that cross local planning authority boundaries

LIST ENTRY NUMBER:

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

BATH AND NORTH EAST SOMERSET (UA)



© Historic England

SITE NAME:	Beckford's Tower, Bath		
DESIGNATION:	Listed Building grade I, RPG grade II, CA, WHS		
CONDITION:	Poor		
OCCUPANCY:	Vacant/not in use		
PRIORITY CATEGORY:	B (New entry)		
OWNER TYPE:	Charity (heritage)		

1394133

Beckford's Tower was built by William Beckford in 1826-7 as a personal retreat which functioned both as an observatory and as a treasure chest filled with his collections of art, furniture and books. It was connected with his home at 19 & 20 Lansdown Crescent by a milelong garden known as Beckford's Ride, parts of which survive. Between 1997-2000, the tower and lantern structure underwent a programme of significant structural repairs. There is currently water ingress within the lantern.

Contact: Sarah Ball 0117 975 0666

	- 53	1	41
10 An	-	NAME OF TAXABLE PARTY.	Sept.

© Historic England Archive

SITE NAME:	King Edward's School, Broad Street, Bath
DESIGNATION:	Listed Building grade II*, CA, WHS
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)

1395027

Commercial company

School dating from 1752. A scheme for hotel use was submitted but withdrawn in 2006. Works to repair the roof have been successfully completed. The threat of decay has diminished but the building remains vacant. Permission for hotel use (granted in 2010 and renewed in 2013) has been implemented and Historic England engaged in further pre-app discussion to explore amendments to consent before comprehensive works begin (May 2019).

Contact: Samuel Souter 0117 975 0690




© Jim Warren

SITE NAME:	Cleveland Baths, Hampton Row Bath
DESIGNATION:	Listed Building grade II*, CA, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Local authority

1396146

Dating from 1815, Cleveland Baths are believed to be the oldest surviving public outdoor swimming pools in England. A diminutive Georgian crescent houses the changing rooms and Caretaker's Cottage. Listed Building Consent was granted in April 2017 for a scheme of repair and renovation works that will enable the baths to be reopened for use. The Cleveland Pools Trust have confirmed a successful grant from the National Lottery Heritage Fund and aim to complete the works for re-opening in Spring 2021.

Contact: Stephen Guy 0117 975 0725

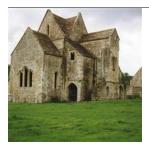

© Historic England

SITE NAME:	Hinton Priory, Hinton Charterhouse
DESIGNATION:	Scheduled Monument and Listed Buildings - 3 grade I, LB grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

Private 1007014 and 1136191; LIST ENTRY NUMBER: 1320809: 1129461

Early C13 Carthusian monastery, chapter house and refectory still standing. Later stables, coach house and garden buildings incorporate earlier material and follow original complex layout of cloister and cells. All structures in use except chapter house, which is the area at risk. Some parts are in need of a condition assessment.

Contact: Sarah Ball 0117 975 0666

SITE NAME:	Wansdyke: section 1230 yards (1120 metres) eastwards from Burnt House Inn, Southstoke				
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1007003		
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Gardening	NEW ENTRY?:	No		
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345		

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

SITE NAME:	Camerton Romano-British town and associated pr Norton-Radstock	ehistoric and early	medieval monuments, Camerton /			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013881			
CONDITION:	Extensive significant problems	TREND:	Stable			
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No			
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345			
SITE NAME:	Roman road 720 yards (660 metres) long, north of	Roman road 720 yards (660 metres) long, north of Abbey Farm, Hinton Charterhouse				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005421			
CONDITION:	Extensive significant problems	TREND:	Declining			
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No			
OWNER TYPE:	Commercial company	CONTACT:	Alessandra Perrone 0117 975 1345			
SITE NAME:	Stantonbury camp and adjacent sections of Wansd	yke, Marksbury				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002487			
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining			
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No			
OWNER TYPE:	Crown	CONTACT:	Alessandra Perrone 0117 975 1345			
SITE NAME:	Lansdown Roman camp, North Stoke					
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005422			
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining			
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No			
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345			
SITE NAME:	Little Down camp, North Stoke					
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1004677			
CONDITION:	Extensive significant problems	TREND:	Declining			
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No			
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345			
SITE NAME:	Wansdyke: south east of Newbarn Farm, Norton I	Malreward				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003066			
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining			
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No			
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345			
SITE NAME:	Roman villa at Upper Hayes, Wellow					
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007002			
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining			
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No			
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345			

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS



© Historic England

A cemetery consecrated in 1848, incorporating features of a former pleasure ground and ride created by William Beckford and the architect Henry Edmund Goodridge in c1825-7. Key design features have been neglected and are in declining condition including the Grotto Tunnel. The landscape has become fragmented as a result of different ownership. Beckford's Tower (listed II*) has also been placed on Historic England's Heritage at Risk register for 2019. The Beckford Tower Trust are currently drawing up plans for an application for National Lottery Heritage Fund grant.

Contact: Jo McAllister 0117 975 0696

SITE NAME:	Keynsham		
DESIGNATION:	Conservation Area, 53 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Adrian Neilson (LPA) 01225 477020
SITE NAME:	Midsomer Norton and Welton, Norton-I	Radstock	
DESIGNATION:	Conservation Area, 37 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Adrian Neilson (LPA) 01225 477020
SITE NAME:	Paulton (including Paulton Basin)		
DESIGNATION:	Conservation Area, 17 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Adrian Neilson (LPA) 01225 477020

BOURNEMOUTH CHRISTCHURCH AND POOLE (UA)

LIST ENTRY NUMBER:



	4	/64
© Historic England		

SITE NAME:	Church of St John the Evangelist, Christchurch Road, Bournemouth
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1152799

Flint-clad Victorian church. A Listed Places of Worship Roof Repairs Grant was awarded and stage I repairs to the roof and cast-iron rainwater goods completed in 2017. The west end and tower are also in a poor state, with crumbling stone and falling masonry, and funding is currently sought for this second phase.

Contact: Katy Hoskyn 0117 975 1311



© Historic England

SITE NAME:	Church of St Michael, Poole Road, Bournemouth
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1324732

Substantial Victorian church with very large tower. This tower has significant problems and is difficult to access for maintenance. The rainwater goods are not taking water away and interior wall paintings are vulnerable to water ingress.

Contact: Katy Hoskyn 0117 975 1311

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



SITE NAME:	Church of St Clement, St Clement's Road, Bournemouth
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1324751

A large Victorian church set in a public park. The tower roof is leaking badly and needs to be replaced. The rainwater goods are inadequate to carry water away from the building and the masonry is showing signs of damp.

Contact: Katy Hoskyn 0117 975 1311

© Historic England



SITE NAME:	Church of St Stephen, St Stephen's Road, Bournemouth
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

Monumental Victorian church with a faceted east end, set within a small, restricted site. There is some water penetration, and there have been falls of interior masonry due to rusting ferramenta (iron fittings). The church has been subject to heritage crime in recent years.

LIST ENTRY NUMBER: 1324756 Contact: Katy Hoskyn 0117 975 1311 © Historic England

@ Boroug	h of Poo	lo Cou	ncil

SITE NAME: Church of St Dunstan (formerly St Osmund), Bournemouth Road, Poole DESIGNATION: Listed Place of Worship grade II* CONDITION: Poor PRIORITY CATEGORY: D (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1273602

Former parish church now in use by Greek Orthodox congregation. Constructed largely of red brick in 1904 by GAB Livesay in the free Byzantine style, and completed by ES Prior in partnership with Arthur Grove between 1913 and 1914. Dome was partially rebuilt in 1922-4 by Sidney Tugwell. Suffering extensively from failure of guttering, drainage and roof maintenance, there has been a substantial impact on the internal decoration and integrity of the brick work. National Lottery Heritage Fund Grant for Places of Worship Project development works completed. Repair funding applied for Spring 2019.

Contact: Sarah Ball 0117 975 0666

SITE NAME:	Two round barrows 300 yards (270 metres) nort	h west of Double D	ykes, Hengistbury Head
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002397
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow cemetery on Barrow Hill 150 meti	res south west of Br	ookvale Farm, Poole
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018029
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow on East Parley Common 610 metres	s south west of Fir C	Grove Farm, Hurn
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016092
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Katy Hoskyn 0117 975 1311

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

SITE NAME:	Two bowl barrows at Gibbet Firs, 950 metres so Works, Hurn	outh west and 1080 m	netres south west of Palmers Ford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016091
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Churchill Gardens, Boscombe		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Caroline Peach (LPA) 01202 451323
SITE NAME:	Town Centre, Poole		
DESIGNATION:	Conservation Area, 162 LBs, 3 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Margo Teasdale (LPA) 01202 633914

BRISTOL, CITY OF (UA)

	anand
STANK I	n j
T. Mû	d mar
	A-1 N

SITE NAME:

Church of St Peter, Castle Park, Bristol

DESIGNATION:

Listed Building grade II*, CA

CONDITION:

Poor

OCCUPANCY:

Vacant/not in use

PRIORITY CATEGORY:

A (New entry)

OWNER TYPE:

Local authority

Large Early Perpendicular Gothic church, with elements surviving from C12 and C15 and extensive later rebuilding and remodelling. Damaged and reduced to a roofless shell during the first bombing raid on the City of Bristol in 1940, it has been maintained as a memorial to those lost in war. High level stonework is deteriorating and large areas of internal paving are in need of attention.

1763, by Robert Mylne. Square pedimented ashlar lodges, flanking a central square pond and attached to a garden

wall. The buildings have been vacant for a number of years

© Historic England LIST ENTRY NUMBER: 1282177 Contact: Alessandra Perrone 0117 975 1345



© Historic England

Two lodges and attached garden walls opposite former Kings Weston stables, Napier Miles Road

DESIGNATION: Listed Building grade II*, RPG grade II, CA

CONDITION: Poor

OCCUPANCY: Vacant/not in use

and are in poor condition. Damaged rainwater goods have led to water ingress and deterioration of some areas of ashlar stonework. The pond is suffering from water loss, extensive vegetation growth and damage to its lining.

PRIORITY CATEGORY: C (C)

OWNER TYPE: Educational (state sector)

LIST ENTRY NUMBER: | 187186 Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME:

Mortimer House, Clifton Down Road, Bristol

DESIGNATION:

Listed Building grade II*, CA

CONDITION:

Fair

OCCUPANCY:

Vacant/not in use

PRIORITY CATEGORY:

F (F)

OWNER TYPE:

Private

LIST ENTRY NUMBER:

1202096

Imposing mid-C18 Palladian suburban villa, until recently in hospital use, now vacant. A scheme of repair and conversion was granted consent in 2013, and works to the exterior of the main building are largely complete. The house was sold to a new owner in November 2015. Permission has been granted for conversion to an office and works are still underway as of May 2019.

Contact: Stephen Guy 0117 975 0725

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

ABBREVIATIONS

CA Conservation Area
Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

© Historic England

SITE NAME:	Swing Bridge over North Entrance Lock, Cumberland Basin, Bristol
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority

1202186

Wrought iron bridge with tubular supporting members built c | 844 by |K Brune| Moved to current location in | 1873. It has been redundant and decaying on the dock since the construction of Plimsoll Bridge in C20. Since 2014 a number of surveys on the condition of the fabric and some trial repairs have been carried out with the help of grant funding from Historic England. In 2019 investigations and repairs have focussed on the condition and functionality of the rotational mechanism.

Contact: Alessandra Perrone 0117 975 1345



© Historic England Archive

SITE NAME:	Stair turret (Holy Cross), Inns Court Vicarage, Inns Court Green, Knowle, Bristol
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

C15 stair turret attached to C20 building. Situated in the middle of a housing estate. The house the turret is attached to changed hands in 2014 and the roof of the stair turret was repaired when improvement works were undertaken to the house.

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Church of St Michael and attached railings, St Michael's Hill, Bristol
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
	A (A)

1202314

CONDITION: Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: A (A)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: 1282109

Church, rebuilt between 1775 and 1777 in a Gothic style, but retaining the mid-C15 tower. The interior is divided in three aisles by classical colonnades and has some late C19 fittings. The church was last in use in the late 1990s, and the roofs of the nave and north aisle were damaged by fire in October 2016. In April 2018 Bristol DAC announced a buyer for the church, although a further sale of the church has recently been confirmed. The new owner intends to convert the church to an events space and is in discussion with stakeholders.

Contact: Stephen Guy 0117 975 0725



© Historic England

SITE NAME:	28, Portland Square, St Pauls, Bristol
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F(D)
OWNER TYPE:	Commercial company

1202444

One of a terrace of seven houses located in a largely complete Georgian square, c1789-1820. Limestone ashlar, brick stacks, slate mansard roofs, double-depth plan. Late Georgian style, four storeys with attic and basement. As of May 2019, works for repair and conversion to hotel use are still in progress.

Contact: Alessandra Perrone 0117 975 1345



© Historic England Archive

SITE NAME:	31 and 32, Portland Square, St Pauls, Bristol
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Commercial company

1208879

Terraced houses, built from 1789 to 1820. Emergency repairs to the roof were carried out with Historic England grant aid in 1996. Further damage occurred in 2005 when part of the facade collapsed. The buildings have been vacant for over 20 years and conditions continue to deteriorate. A planning permission for repairs and residential conversion has been submitted in 2019.

Contact: Alessandra Perrone 0117 975 1345

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site

LIST ENTRY NUMBER:



© Historic England Archive

	, ,
SITE NAME:	Carriage Works, 104, Stokes Croft, Bristol
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private

1025273

Carriage works, 1862. A notable building in a manner recognised as particular to the city. Large and complex site including 4, Ashley Road (grade II), also in very bad condition. Planning permission for a mixed use redevelopment of the site was granted in October 2015 and the site was sold to new owners in summer 2017. Work on site to deliver the approved development are ongoing.

Contact: Stephen Guy 0117 975 0725



© Historic England

SITE NAME:	Church of All Hallows, All Hallows Road, Bristol
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1201954

Large Decorated Gothic Revival church of c1900 by Bristol architect Sir George Oatley. Plan and form are a creative fusion of congregational and liturgical style. Site was a former clay quarry and the foundations rest on filled ground at differing levels. The building suffered from differential settlement and was monitored for structural movement. A National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship was accepted in 2012 for surface water drainage works and structural repairs. Repairs completed 2014. Some roofing and drainage issues have yet to be addressed.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Church of St Mary the Virgin, Church Close, Bristol
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1205113

C13 church with C19 restoration. Roof coverings and rainwater goods are all in poor condition and there is vegetation growing out of the eroding masonry. Areas of mortar erosion and cement render are in need of replacement. This building has been subject to heritage crime.

Contact: Katy Hoskyn 0117 975 1311



© Bill Wood

SITE IVALIE.	Road, Bristol
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1205207

Chunch of Ct Boton Chunch

Norman Revival style parish church, completed in 1842 by SC Fripp. Squared lias rubble with limestone ashlar dressings. Short, square chancel tower with a pyramidal roof. Significant areas of stone decay to the south elevation and southern face of the tower. Some areas of falling masonry. A programme of repairs to stonework and rainwater goods is planned for summer 2019.

Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME:	Roman Catholic Church of St Bernadette, Wells Road, Bristol
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Very bad
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1436044

Parish church designed in 1967 by James Leask of Kenneth Nealon, Tanner & Partners to accompany the Catholic school built on the centenary of the apparitions at Lourdes. Bold and innovative in design and materials, it features a double hyperbolic paraboloid roof carried on projecting concrete piers on a rotated square plan. Some of the original materials are now showing signs of deterioration and this has led to serious issues of water ingress through the roof coverings, affecting the ceiling and the roof structure. Some episodes of vandalism have also taken

Contact: Alessandra Perrone 0117 975 1345

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

	3		
SITE NAME:	Anti-aircraft gun site, Purdown		
DESIGNATION:	Scheduled Monument, RPG grade II, CA	LIST ENTRY NUMBER:	1004531
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Civil War earthworks on Brandon Hill		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1006989
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Heavy Anti-aircraft battery 520 metres east of Hol	les Mouth	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021291
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	St Mary-le-Port Church, High Street		
DESIGNATION:	Scheduled Monument, LB grade II, CA	LIST ENTRY NUMBER:	1021385
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Stokes Croft		
DESIGNATION:	Conservation Area, 19 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Kingsley Fulbrook (LPA) 0117 922 2966

BRISTOL, CITY OF (UA) / BATH AND NORTH EAST SOMERSET (UA)

LIST ENTRY NUMBER:



© Historic England

	` '
SITE NAME:	Brislington House
DESIGNATION:	Registered Park and Garden grade II*, 4 LBs, CA
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Stable
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners

1001529

One of the first and most influential asylum landscapes in Britain. Now subdivided between a sixth form college, private residential development, commercial sports facilities, industrial units and a management training centre. Despite this, some elements of the designed landscape survive. Its designation was re-evaluated by Historic England in 2017. Some adjustment to the boundary was made but no change to the grade. Part of the park is within Bath and North East Somerset Unitary Authority.

Contact: Jo McAllister 0117 975 0696

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SI

CORNWALL (UA)



© Historic England

ITE NAME:	Scraesdon	Fort,	Anton
	oc. acodon	,	,

DESIGNATION: Scheduled Monument and Listed Building grade II

CONDITION: Poor

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: C (C)

LIST ENTRY NUMBER:


OWNER TYPE: Government or agency

LIST ENTRY NUMBER: 1004347 and 1140707

Built 1868, used for military training purposes. Vegetation is being kept under reasonable control. Works have been undertaken to stop water ingress and repairs to metalwork throughout site. Drawbridge and main gate repairs were completed in 2014. The ditch was cleared in 2015.

Fort, built 1858-1865. The fort is vacant, with no end use identified. The interior of the keep is in poor condition, notably the wooden floors. New external doors and windows have been fitted. Interior partitions are still awaiting re-installation. Elsewhere in the fort, the barracks accommodation is no longer used full time with interiors deteriorating in places due to moisture penetration. A section of the counterscarp wall has collapsed. Significant localised problems remain to be tackled elsewhere on the

Contact: Annie Evans 0117 975 0673

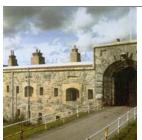

© Ministry of Defence

SITE NAME:	Tregantle Fort, Antony
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Government or agency

1004346 and 1159255

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Medieval chapel of St Thomas Becket 45 metres east of the church, Priory Road, Bodmin
DESIGNATION:	Scheduled Monument, LB grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)

The monument is the roofless ruin of a C14 chapel, located within the churchyard of St Petroc's church. The building suffers ivy growth on the walls, vandalism and anti-social use of the crypt.

PRIORITY CATEGORY: B (B)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: 1002937

ER: 1002937 Contact: Ann Preston-Jones 07917 642388



© Historic England

SITE NAME:	Rosewarne House (Gladys Holman House), Tehidy Road, Camborne
DESIGNATION:	Listed Building grade II*, CA, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private

1142639

Large early C19 H-plan granite town house in its own grounds. Latterly a residential home but vacant for some time. Lack of maintenance and vandalism resulted in rapidly increasing deterioration. Repairs agreed in 2012 and a revised scheme approved in 2013. The building has been secured and made weathertight. Work continues to be implemented with the coach house and new builds now occupied. Awaiting the submission of revised planning application for repairs following further investigation that has established a greater extent of decay within the internal fabric of the house (2019).

Contact: Rhiannon Rhys 0117 975 0685



© Historic England

SITE NAME:	Former Carharrack Methodist Church, Church Street, Carharrack
DESIGNATION:	Listed Building grade II*, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1160248

2017 following its redundancy as a place of worship. Water ingress through the deterioration of the roof cover and under-sized rainwater goods has resulted in structural issues with the window lintels and floor of gallery. Damage has been caused to the gallery box pews which are some of the oldest remaining in Cornwall. Positive discussions continue with the owner and local planning authority regarding future use.

Grade II* Methodist chapel built in 1815, was purchased in

Contact: Catherine Marlow 0117 975 0732

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category shown in brackets (otherwise

New Entry is noted).

	ABBREVIATIONS	
	CA	Conservation Area
is	LB	Listed Building
e,	LPA	Local Planning Authority
	NP	National Park
	RPG	Registered Park and Garden
	SM	Scheduled Monument
	UA	Unitary Authority
	WHS	World Heritage Site



© Historic England

SITE NAME:	Marlborough House, Silverdale Road, Falmouth
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Commercial company

1270002

Grade II* former country house now in suburbs of Falmouth. Building was vacant and in poor condition. Discussions with the owner over its repair and use have since taken place. A listed building application for its refurbishment as a single dwelling was made in 2016. A subsequent consent was granted in 2017 and was completed in May 2017, however work continues on the property.

Contact: Catherine Marlow 0117 975 0732



Church of St Rumon, Ruan Major, Grade-Ruan

DESIGNATION: Listed Building grade I

CONDITION: Poor

OCCUPANCY: Vacant/not in use

LIST ENTRY NUMBER:

SITE NAME:

LIST ENTRY NUMBER:

Medieval former parish church. Roof removed shortly after closure in 1963. The Diocese has undertaken consolidation to the low walls but not to the tower which has a tree growing out of it at high level. Discussions for the future of the ruin are ongoing.

© Historic England

© Historic England

PRIORITY CATEGORY: C (C)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: | |4|9|5

Contact: Chris Miners 0117 975 1355



DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004361

Chapel at Hall, Lanteglos

Site consists of walls and well-preserved bell turret of a C14 manorial chapel. Re-use as a farm building in the C19 caused modifications to the structure which still retained its original oak wagon roof until the 1960s. Conservation in the 1990s helped to stabilise the structure but now water seeping into the rear wall has built up causing it to become unstable. Scaffolding funded by Historic England in 2015 was urgently needed to save the wall from falling and remedial works were carried out in 2017 to sections of wall. Further long term measures are required to protect the ruin from decay.

Contact: Chris Miners 0117 975 1355




© Cornwall Council

SITE NAME:	13, High Street, Launceston
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Commercial company

1206510

Jettied and timber-framed corner house, prominent on town's market square. Roof structure and upper level party wall in poor condition. Vacant upper levels have deteriorated badly due to a lack of maintenance. Roofs, gutters and slate hung walls have also A new owner is developing a scheme of repairs.

Contact: Chris Miners 0117 975 1355

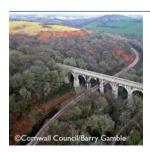

0	Cornwall	Council
---	----------	---------

SITE NAME:	Treffry Viaduct, Luxulyan / Lanlivery
DESIGNATION:	Scheduled Monument, WHS
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1007279

Combined viaduct and aqueduct. Granite built ten-arched bridge with a span approximately 200 metres, standing up to 27 metres above the valley floor. Water had been gushing from the leat within the structure, so water flow over the viaduct has been stopped. Leaks became evident at abutments and locations within the main spans of the structure. A solution to the leaking channel has now been agreed. The Cornwall Heritage Trust is working with Historic England to develop an investigation project to finalise the solution to the high level leakage problems of the leats within the viaduct.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair or in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Historic England

SITE NAME:	Maker Heights Barracks Block, Maker-with-Rame
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1375582

Built 1804-1808 as a barracks for a line of earlier redoubts built to protect Devonport Dockyard in 1782. The two-storey block was altered in the mid C19 when the formerly tile-hung first floor was rebuilt in brick. It is the most complete small garrison barracks from this significant period. Partially repaired and in use as a community art centre. A phased scheme of window repairs is now being undertaken with Historic England grant aid.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Maker Heights Guard House, boundary wall and attached ancillary buildings, Maker-with- Rame
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1329099

Built in 1804-1808 as a barracks for a line of earlier redoubts built to protect Devonport Dockyard in 1782. Altered in mid C19. Guard House in good condition and used as offices but several of the other buildings are in poor to bad condition, in particular the Straw Store, Wash House and Caponier. Now in seperate private ownership from the Barrack Block that forms the raison d'etre for this group of buildings.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	English Garden House, Maker- with-Rame
DESIGNATION:	Listed Building grade II*, RPG grade I
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (New entry)
OWNER TYPE:	Local authority, multiple owners
LIST ENTRY NUMBER:	1140619

An early C18 Classical garden house, located within Mount Edgcumbe Estate, now a Country Park. Originally a banquetting house, subsequently extended to include a sunken marble bath and additional rooms. A garden building for entertaining and leisure. Water ingress has caused damage to historic fabric, including plasterwork and wall paper. The building is currently used for storage, although there are plans to refurbish it.

Contact: Chris Miners 0117 975 1355



© Vickery Holman Ltd

SITE NAME:	Boundary wall to Lanherne Carmelite Convent, Mawgan-in- Pydar
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation

C16 or C17 boundary park wall. Substantial loam bonded random rubble masonry wall almost one metre thick standing up to four metres in places. Neglected, heavily overgrown with ivy and partially collapsed in places. Condition survey needed to understand and monitor decay and to prioritise repairs.



© Historic England

SITE NAME:	Remains of Carclew House, Mylor
LIST ENTRY NUMBER:	1137593
OWNER TYPE:	Religious organisation
PRIORITY CATEGORY:	A (A)
	1 1// / (

Contact: Annie Evans 0117 975 0673

SITE NAME:	Remains of Carclew House, Mylor
DESIGNATION:	Listed Building grade II*, RPG grade II, WHS
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private, multiple owners
LIST ENTRY NUMBER:	1160291

The remains of Carclew House are the formal centre of a Registered park and garden also at risk. Started in 1720 by Samuel Kemp, this palladian style house was one of Cornwall's finer C18 country houses but was partly burned down in 1934. It is now a ruin, overgrown and neglected. Vegetation management is now ongoing with a program of repairs in development. A steering group has been established with the owners of Carclew House and a brief drawn up under Historic England's guidance to prepare a Conservation Statement for the site.

Contact: John Ette 0117 975 0687

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Historic England

Dry sand and green sand shop, Perran Foundry, Perran Wharf, Mylor

DESIGNATION: Listed Building grade II*, CA, WHS

CONDITION: Very bad
OCCUPANCY: N/A

PRIORITY CATEGORY: F(F)

LIST ENTRY NUMBER:

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: | 141603

Early to mid C19 mould and casting buildings. This is the main furnace building, an impressive and intact structure. Urgent repairs carried out early 2005. Listed Building Consent and Planning Permission for repair and conversion granted 2008, with subsequent variations on that consent also pending consent. The buildings have been reroofed but the consented scheme for reuse has not yet been implemented.

Contact: Catherine Marlow 0117 975 0732



© Historic England

SITE NAME:

Engineers' Shop, Perran Foundry, Perran Wharf, Mylor

DESIGNATION:

Listed Building grade II*, CA, WHS

CONDITION:

Very bad

OCCUPANCY:

Vacant/not in use

PRIORITY CATEGORY:

D (D)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: | |4|643

Engineers' shop, boring mill and pattern shop, early-mid C18. Listed Building Consent and Planning Permission for repair and conversion of whole Perran Foundry site granted 2008 and now being implemented in a phased manner. Revised scheme currently under consideration, but not yet consented or implemented.

Contact: Catherine Marlow 0117 975 0732



© Historic England

SITE NAME:

Threshing barn on north side of yard at Trebartha Barton, North Hill

DESIGNATION:

Listed Building grade II*

CONDITION:

Poor

OCCUPANCY:

Vacant/not in use

PRIORITY CATEGORY:

C (C)

OWNER TYPE:

Charity (heritage)

1250152

Mid C19 threshing barn forming one side of the farmyard to Trebartha Barton Farm. Two-storey 'E' plan with projecting midstryes infilled with first floor lean-to, forming impressive elevation to the yard. Rubble walls with granite dressings. Rag slate covered king post trussed roofs with slate hung infill walls. Slates are slipped or missing causing structural decay. There is harmful vegetation growth. First floor boarding is decayed and unsafe.



© Historic England

Entrance gate and flanking walls forming mock fortifications to east of Prideaux Place, Padstow

Listed Building grade I, RPG grade II

CONDITION: Poor

OCCUPANCY: Occupied/in use

PRIORITY CATEGORY: C (New entry)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1289743

Late C16 reused Catacleuse arched gateway with C18 flanking turrets, decorated with crenellations. Slate stone. Narrow blind arrow slits. Capping failure has led to water penetration through the piers (which are thought to be solid and not hollow). There is cracking of stone, movement of archway, bulging stone plinth and washed out mortar joints. Advice and suggested way forward has been given with action planned for mid 2019.

Contact: Chris Miners 0117 975 1355

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Trenearne, Padstow
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1211508

House, now farmhouse, circa early C17, possibly remodelled in 1660 (datestone) for 'PW'. The house only survives in part and was probably of overall 'H' shaped plan. It has been a tenanted farm for a number of years but a lack of maintenance had left all the buildings in a poor state of repair. The estate which owns Trenearne has been granted listed building consent to refurbish the house including much needed repairs, as well as the conversion of farm buildings.

Contact: Catherine Marlow 0117 975 0732

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Full ladar repair on in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category shown in brackets (otherwis

New Entry is noted).

ory is wise,	CA LB LPA NP RPG SM UA WHS	Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site
	VVH2	vvorid Heritage Site

ABBREVIATIONS

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

SITE NAME:



© Historic England

SITE NAME:	Anchor Studio, 4, The Meadow, Penzance
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	B (New entry)
OWNER TYPE:	Charity (heritage)

1390877

Anchor Studio was built in 1888 by Arthur Bateman for Stanhope Forbes RA with rubble and weatherboarded timber frame walls and a scantle slate roof. It is a good example of a late Victorian purpose-built artist's studio. One of a group of studios built nearby for the Newlyn School artists, it is in a very fragile condition needing constant repairs. There are bad leaks with large sections of slate roofing starting to slip, parts of the external timber cladding in poor condition, the lower floor area blocked off suffering from extensive damp. National Lottery Heritage Fund repair grant awarded.

Contact: Chris Miners 0117 975 1355



© Historic England Archive

SITE NAME:	Market Building, Market Place, Penzance
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Commercial company

1221062

Built c1820. Altered 1925. Partially occupied; the western half by Lloyds Bank, the eastern half is vacant. The roof was repaired approximately five years ago although some leaks persist. Vulnerable historic interiors have had plaster falls on the vacant eastern half. Outbreaks of timber decay persist in the unventilated interiors.

Contact: Chris Miners 0117 975 1355



@ Penwith District Council

SITE NAME:	Trinity Methodist Chapel, Chywoone Hill, Newlyn, Penzance
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1386515

Former Nonconformist Wesleyan chapel c1834, enlarged 1866. One of the most complete early C19 chapels in Cornwall. No longer used for religious worship. It is planned to re-submit a National Lottery Heritage Fund bid for multi-purpose community use, however nothing has yet happened and the building remains empty.

Contact: Chris Miners 0117 975 1355



SITE NAME:	Tolgus Calciner, New Portreath Road, Redruth
DESIGNATION:	Scheduled Monument, LB grade II, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1021240

Redruth

Sara's Foundry, Tolgus Place,

Remains of a calciner used in the production of arsenic. It has been vacant for many years and is vulnerable with a damaged main roof and a collapsed adjoining tin-roofed extension. The main hipped slate roof of the building has been damaged through vandalism and there is an urgent need for weather proofing.

Contact: Ann Preston-Jones 07917 642388



	DESIGNATION:	Listed Building grade II*, WHS
	CONDITION:	Very bad
	OCCUPANCY:	N/A
	PRIORITY CATEGORY:	A (A)
	OWNER TYPE:	Private
	LIST ENTRY NUMBER:	1142573

C19 and C20 iron foundry and engineering works, containing associated machinery. Buildings continue to deteriorate and are now in a very vulnerable condition. Discussions with Cornwall Council to identify an appropriate strategy to secure the building and prevent further deterioration have continued.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

© Cornwall Council

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

SITE NIAME



© Historic England

SITE NAME:	Market House, Market Street, St. Austell
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Charity (non-heritage)

1289697

Large town centre Market House built in 1844. It is formed of a town hall facing the church with an imposing street frontage and with a large glazed market area behind. Leaks and other rainwater system faults to the town hall and especially to the glazed market area are getting steadily worse. Occupancy rates in both areas have fallen as a result. Major repairs to all parts of the building are now needed before the building becomes beyond repair. A project is now being developed for which consents have been applied for.

Contact: Chris Miners 0117 975 1355



© Cornwall Council

SITE NAME:	Charlestown Methodist Church, Charlestown Road, St. Austell Bay
DESIGNATION:	Listed Building grade II*, CA, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private

1144292

Former Wesleyan chapel (1827) and attached schoolroom (mid C19), now closed for worship. A revised Listed Building Consent was granted in May 2018. Works have now commenced on site and the roof of both the main chapel and school rooms have now been completed. Works to the repair of the main chapel windows are underway and the school room clerestory windows are in the process of being installed to make the building weather proof.

Contact: Rhiannon Rhys 0117 975 0685



© Historic England

SITE INAPIE:	Turntable, St Blazey Road, St. Blaise
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Government or agency

1289905

Engine Shade Stack and

Locomotive turntable associated with adjacent roundhouse is deteriorating through lack of maintenance having been taken out of service in 2002. The roundhouse building is in light industrial use. A community interest group has been formed to develop a project to restore the site and bring it into more sympathetic uses. A Coastal Communities Fund grant was awarded in 2016 to develop the project.

Contact: Catherine Marlow 0117 975 0732



© Historic England

SITE NAME:	Hockings House Bible Christian Chapel, St. Cleer
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1311103

Chapel dated 1846. Good interior with gallery and original fittings including leaders' pew. Separated from the small Sunday school and damaging partial conversion works preceded its sale in 2012. Negotiations with owner are sporadic and relate to the possible extent of an acceptable conversion scheme. The building has deteriorated in the interim with its roof falling into a very poor state, with consequential damage occurring to the interior. Listed Building Consent was granted in 2015 for roof repairs, completed in 2017.

Contact: Catherine Marlow 0117 975 0732



© Cornwall Council

SITE NAME:	Flanking walls and gateway to the bridge over moat about 8 metres east of Old Rectory, Old Rectory Drive, St. Columb Major
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1144097

Mid C19, part of William White's layout for the Bishop's Palace which became a Rectory and latterly a hotel. Obscured and threatened by dense vegetation. White's wrought iron gate, referred to in the List description, is not at present hung and its whereabouts is unknown. Vegetation clearance has taken place to allow for conservation of the moat.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise.

New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



© Cornwall Council

Old Bishop's Palace, Old SITE NAME: Rectory Drive, St. Columb Maior DESIGNATION: Listed Building grade II*

CONDITION:

Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: A(A)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1144096

1851 by William White. Picturesque Gothic Revival country gentleman's rectory, a classic of the type. In very poor state of repair caused by lack of maintenance, vandalism, vegetation, inappropriate finishes and unlived-in state. Water ingress has resulted in dry rot and damage to historic fabric. Statutory action by Local Planning Authority on hold. Vegetation clearance has taken place and is being maintained.

Contact: Chris Miners 0117 975 1355



© Cornwall Council

SITE NAME: Calf House at Lithiack and stable adjacent to north, Port Eliot Estate, St. Germans Listed Building grade II*, RPG DESIGNATION: grade I CONDITION: Poor

Private

OCCUPANCY: Occupied/in use

PRIORITY CATEGORY: C (C) OWNER TYPE:

LIST ENTRY NUMBER: 1140518

Late C18/early C19 estate agricultural building. Attributed to Soane for the Port Eliot Estate. In low key use but condition remains very poor. Currently tenanted by a roofing company who are undertaking localised repairs. Condition improving.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME: Little Trethewey Methodist Chapel, Little Trethewey, St. DESIGNATION: Listed Building grade II* CONDITION: Very bad OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: A(A)

OWNER TYPE: Private LIST ENTRY NUMBER: 1311918

Built as Wesleyan Chapel in 1868. Small chapel with stuccoed Italianate front. Modest and complete interior with closed box pews. The chapel is in a bad condition with holes in the roof. The downpipes are blocked and external render is failing. Front gable is unstable and resulted in damage to the interior. Chapel closed April 2013. The condition continues to deteriorate. Historic England grant aided repairs in 2015 that covered the roof with a temporary sheet covering. The chapel has been sold and Historic England looks forward to discussing its future with the new owner.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME: Gunpowder works at Kennall Vale, Stithians / St. Gluvias Scheduled Monument, 9 LBs, DESIGNATION: CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: B (B) OWNER TYPE: Charity (non-heritage)

1020143

This large scheduled area is centred on a steep sided, wooded valley, which contains remains of ruined buildings, mills, leats and bridges associated with a C19 gunpowder works. After years of abandonment, the many ruined structures on the site are at risk from tree and vegetation growth, water and footpath erosion and collapse. Recently, the most 'at risk' structures and leats were consolidated through a Natural England Stewardship scheme but there remain many outstanding management needs.

Contact: Ann Preston-Jones 07917 642388

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



© Historic England

ITE NAME:	Holmbush Mine: Windsor Lane rotative engine house with adjacent boiler house, loadings and platform, Stokeclimsland
DESIGNATION:	Scheduled Monument, LB grade II, WHS
ONDITION:	Vonchad

Vacant/not in use

ONDITION: Very bad

Crown

PRIORITY CATEGORY: C (C)

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER: 1020327

This is a substantial mine engine house in deteriorating condition. The building is densely covered in ivy and surrounded by trees. The roof is mostly collapsed but still retains a few slates and roof timbers which are vulnerable to further damage. Timber fittings are deteriorated and rotten. Arched window openings have slipped bricks.

Contact: Ann Preston-Jones 07917 642388

Site includes well preserved remains of china clay

processing works displayed as part of a museum. There are a range of features, including drying sheds, water wheels, settling tanks, machinery. It is maintained to a basic level with repairs undertaken as needed but there had been little capital investment in the site for a long time. However a Conservation Management Plan and structural survey have recently identified a number of significant weaknesses in the structures and this has led to an application to the National Lottery Heritage Fund to repair and restore one of the big



© Historic England

SITE NAME:	Part of the china clay works known as Wheal Martyn, Treverbyn
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Commercial company

Contact: Ann Preston-Jones 07917 642388

driers.



© Historic England

SITE NAME:	Wesleyan Chapel, Porkellis, Wendron
DESIGNATION:	Listed Building grade II*, WHS
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Other not for profit group

1003265

Former Wesleyan Methodist chapel, built 1866. The congregation has moved into the Sunday school and the chapel was sold to a private buyer. New owner has addressed the most serious roof leaks and obtained Listed Building Consent for conversion to residential use from Cornwall Council. The repairs are ongoing.

LIST ENTRY NUMBER: | 162569

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Church of St Protus and St Hyacinth, Blisland
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1142367

Large parish church on the south of the village green, high on the edge of Bodmin Moor. Three aisles, C15 formed from C12 cruciform plan and with projecting south transept and north tower. Rubble stone walling for the early work and granite ashlar for the later. Restored by FC Eden 1896. Graduated Cornish slate roofs. Internal damp problems persist although rainwater goods have been repaired.

Contact: Chris Miners 0117 975 1355



© Historic	England
------------	---------

SITE NAME:	Church of St Julitta, Lanteglos, Camelford
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Very bad
PRIORITY CATEGORY:	E (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1142729

Large rural parish church, historically serving Camelford two miles to the east. Norman origins with rubble stone nave, chancel and north transept. Slate walled west tower added in C14 and the granite ashlar south aisle and porch added C15. Cornish rag slate roofs. There is excessive vegetation growth in the damp walls on the north side. The slates have slipped and fractured. The gutters are undersized, leaking and part fallen and there are symptoms of valley gutter leaks. A National Lottery Heritage Fund Grant has been successfully applied for which has enabled repairs to start.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



SITE NAME:	Church of St Crewen, Crowan
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1160230

Large rural parish church in the centre of a small village. Cornish three-aisle church with a tall west tower. C14 and C15 restored 1872, with a C20 south organ chamber. All granite ashlar and Cornish slate roofs. The rainwater system has had some repair. A leaking valley gutter has caused interior damage. The window masonary needs repairs.

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Cuby, Cuby
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1291868

Small parish church. The tower is C14, of slate. The rest of the church is of rubble with granite dressings and has medieval origins but mostly displays the 1828 rebuilding with the 1899 St Aubyn restoration. Cornish slate roofs. The church is in fair condition overall but the tower has major problems with its drainage resulting in a wet north wall with harmful excessive vegetation growth.

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Grade, Grade- Ruan
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1141938

Small church in an isolated site. Plan of tower, nave and east chancel. C14 origins. The roof needs repair and the tower has excessive damp and vegetation growth.

© Historic England



SITE NAME:	Church of St Nivet, Lanivet
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1158241

Large Anglican parish church in the centre of a large village. Classic Cornish pattern plan of three aisles with tall west tower. Granite and slate roofed mostly C15. The rainwater system is under-sized, rusted and part displaced. High level stonework needs repair and some roofs need reslating.

Contact: Chris Miners 0117 975 1355

Contact: Chris Miners 0117 975 1355

© Historic England



0	Historic	England

SITE NAME:	Church of St Stephen, St Stephen's Hill, Launceston
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1297830

Large urban parish church and the mother church for Launceston. Norman core with many additions finishing with the C16 tower. Restored 1883. Granite ashlar tower and outer walls to the west and south, the rest slatestone rubble with granite or greenstone dressings. The roof leaks and needs extensive renewal and repair.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair on in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LOCAL Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Historic England

SITE NAME: Church of the English Martyrs and attached walls and steps, St Stephen's Hill, Launceston

Listed Place of Worship grade DESIGNATION: II*, CA

CONDITION: Poor

PRIORITY CATEGORY: C (C)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: 1297829

Small Roman Catholic parish church designed by Arthur Langdon in a blend of Byzantine and Romanesque styles. It was built in 1911 and constructed of dressed stones including Slate stone and Polyphant stone, to give a polychrome effect. The Polyphant stone masonry is now decaying badly. The roofs now need urgent repair as they are leaking.

Contact: Chris Miners 0117 975 1355



SITE NAME:	Church of St Martin, Lewannick
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1277508

Small parish church with tall tower. Plan of three parallel aisles with opposing north and south gabled porches and a west tower. Mostly granite ashlar with slate roofs. Extensively rebuilt late C19. The tower has serious faults at high level on the north side. The bell opening and the parapet above have serious structural faults. A crack on the projecting stair turret appears to be active.

Contact: Chris Miners 0117 975 1355




SITE NAME: Church of St Torney, North Hill DESIGNATION: Listed Place of Worship grade I CONDITION: Fair PRIORITY CATEGORY: C(C)OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1249982

Large parish church on the eastern edge of Bodmin Moor. There are structural problems in the tower where the floors are unsafe for use. The rainwater goods are rusted and leaking. There are major damp problems in the east end and structural problems in the tower. The church is in the process of closing with no agreed future use.

Contact: Chris Miners 0117 975 1355

© Historic England

© Historic England

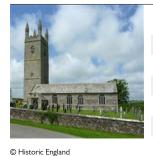

SITE NAME:	Church of St Denis, North Tamerton
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1142437

A parish church set in a hillside churchyard. Plan of twin aisles with south porch, north vestry and west tower. Early C15 with C19 north vestry added in 1875 restoration. Rubble stone with granite dressings, complete ashlar tower and porch. Cornish slate roofs, some pitches rag slate. The rainwater goods are in poor condition and the slate roofs have slipped with fractured slates needing replacement.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Church of St Mary, Sheviock
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1140579

Large parish church in the centre of a small village. Twin aisle plan with a transept and a slender west tower. This tower has a thin spire which has severe wet ingress problems through open joints and eroded stonework. This damp has caused decay in the timber floors of the tower below. There is also fallen plaster from the nave ceiling. Repairs are now underway grant aided by the National Lottery Heritage Fund.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



(0)	Historic	Fngland

SITE NAME:	Church of St Mary, St Blazey Gate, St. Blaise
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	E (B)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1212089

Rural parish church built in 1844 by GE Street in the early Gothic style. Local stone rubble with Pentewan stone dressings. Plan of nave/chancel and a south aisle with a projecting tower and spire. The tower and spire have structural defects that date back to poor initial design with the spire shedding stonework. A National Lottery Heritage Fund Grant for Places of Worship has been awarded and repair work has now started.

Contact: Chris Miners 0117 975 1355

© Eric Berry

SITE NAME:	Ponsanooth Methodist Church, including forecourt walls, steps and gate piers, Chapel Hill, St. Gluvias
DESIGNATION:	Listed Place of Worship grade II*, WHS
CONDITION:	Good
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation

Large Methodist chapel with intact horseshoe galleried interior, along with early pews. Congregation has moved to newly refurbished associated hall and chapel is no longer used. Currently on the market.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Methodist Chuch (former Wesleyan Chapel), Chapel Road, St. Just
DESIGNATION:	Listed Place of Worship grade II*, CA, WHS
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1159101

Large and prominent chapel at the edge of the small town of St Just. Granite walled with slate roof. Generally plain with large multi-paned arch headed windows but with a grand portico on the street front. Complete galleried interior. Serious rain ingress is affecting the interior especially around the organ chamber at the back end, together with falls of gutters. Some repairs to this area have now taken place. Coastal Revival Fund grant has been announced for the regeneration of the chapel.

SITE NAME: Parish Church of St Just, Church Street, St. Just Listed Place of Worship grade II, DESIGNATION:

CA, WHS

Poor

1143291

CONDITION:

LIST ENTRY NUMBER

LIST ENTRY NUMBER:

PRIORITY CATEGORY: D (D) OWNER TYPE:

Religious organisation

LIST ENTRY NUMBER: 1159637

Large parish church in the centre of the most westerly town in England. Classic Cornish pattern church of three aisles and a tall west tower. C13 cruciform church remodelled in the early C15 creating the outer aisles and tower. C19 restoration created the current roofs. All of granite ashlar with Cornish slate roofs. The slate roofs are failing and have caused the fall of ceiling plaster. Rainwater goods are rusted and failing. A National Lottery Heritage Fund Grant for Places of Worship has been awarded and the project is in development.

Contact: Chris Miners 0117 975 1355

Contact: Chris Miners 0117 975 1355



© Historic England

	***	3
No. of the last of		
		7

© Historic England

SITE NAME:	Church of St Pynnochus, St. Pinnock
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1140308

Small parish church. Norman cruciform origins with C15 north aisle and nave rebuilds, the tower of C14, C16 south porch. Coursed rubble with granite dressings. Cornish slated roofs with some slates slipped. Damp tower with much vegetation growth and problem downpipe on the north side. The church is now closed for worship with possible alternative uses being discussed between Historic England, Truro DAC and Cornwall Council.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise.

New Entry is noted).

I PA ΝP RPG

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



SITE NAME:	Church of St Gregory, Treneglos
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Fair
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1310214

Small parish church high on the North Cornish plateau. Two aisles and a high west tower are from the CI5, heavily restored 1858. Tower rebuilt 1871. A Listed Places of Worship Roof Repair Grant was awarded in 2016 for roof and rainwater repairs. However the outer roof slopes and the timber floor of the tower still need urgent repair.

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Werburgh, Warbstow
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1161531

Small parish church. Nave and chancel of Norman origin and of rubblestone, coursed slate tower and granite ashlar north aisle added in CI5 and north porch in 1601. Restored 1861. Cornish slate roofs which have slipped slates, especially the porch. The rainwater system needs overhauling.

Contact: Chris Miners 0117 975 1355

© Historic England

© Historic England



SITE NAME:	Church of St Gwendron, Wendron
DESIGNATION:	Listed Place of Worship grade I, WHS
CONDITION:	Poor
PRIORITY CATEGORY:	F (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1328447

Small rural parish church. Plan of nave/chancel with south aisle and north transept with west tower. C13 origins and restored 1868. Granite walls with slate roofs. The tower roof together with the outer roof pitches and the valley gutters are in a poor condition. The rainwater system and the low level drainage also need renewal. A National Lottery Heritage Fund Grant for Places of Worship has been awarded and repair work is now underway.

Contact: Chris Miners 0117 975 1355

SITE NAME:	Parish Church of St Anne, Whitstone Head, Whitstone
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1142426

Large parish church with a C13 core with C15 upper tower and three-aisle plan. The porch and the chancel originate from the 1882 restoration. Mostly slatestone rubble with granite dressings. Cornish slate roofs. In fair condition overall but very bad damp in the tower due to a leaking downpipe on the north side. Unguttered pitches on the north and south eaves. Slates are starting to slip from the roof pitches.

Contact: Chris Miners 0117 975 1355

© Historic England

SITE NAME:	Deserted medieval settlement and field system with incorporated prehistoric settlement and field system and post-medieval farmhouse north west of Tresibbet Farm, Altarnun		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007775
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

HENTIAGE AT KISK 2019 / 3OC	JTH WEST / CORNWALL (UA)		
SITE NAME:	Prehistoric coaxial field system, incorporated and a medieval settlement on Fox Tor and Treburland Fa	adjacent hut circles arm, Altarnun	, stone setting, linear boundaries and
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008245
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric irregular field system and hut circle set deserted settlement south east of Tresibbet Farm,		ent medieval regular field system and
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007776
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric stone alignment 1 kilometre SSE of East	tmoorgate, Altarnu	ın
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012228
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Nine Stones stone circle 1.03 kilometres NNW of	Bowhayland Farm,	Altarnun / North Hill
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008631
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
ITE NAME:	Scraesdon Fort, Antony		
DESIGNATION:	Scheduled Monument and Listed Building grade II	LIST ENTRY NUMBER:	1004347 and 1140707
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Annie Evans 0117 975 0673
ITE NAME:	Hut circle group and enclosure north east of Carw	ven, Blisland	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004659
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Castle Pencaire hillfort, two rounds and a field syst	tem, Tregonning Hi	ill, Breage / Germoe
DESIGNATION:	Scheduled Monument, LB grade II, CA, WHS	LIST ENTRY NUMBER:	1007293
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Group of round barrows south east of Middle Tap	house, Broadoak	
DESIGNATION:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1004433
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Group of round barrows south of Penadlake, Broa	doak	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004436
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round barrows west of West Taphouse, Broadoak		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004617
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two round barrows north west of Middle Taphous	se, Broadoak	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003077
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round barrow 310 yards (280 metres) south of Ki	mansag, Broadoak	/ St. Pinnock
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004434
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Binhamy moat 500 yards (460 metres) west of Binh	namy Farm, Bude-S	tratton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004655
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Gunnislake Clitters copper, tin, arsenic and wolfra	n mine, Calstock	
DESIGNATION:	Scheduled Monument, LB grade II, WHS	LIST ENTRY NUMBER:	1017088
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Okeltor C19 arsenic, copper and tin mine, Calstoc	k	
DESIGNATION:	Scheduled Monument, LB grade II, WHS	LIST ENTRY NUMBER:	1019440
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prince of Wales Mine at Harrowbarrow, Calstock		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1021411
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Tamar Canal, Gunnislake, Calstock		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1007302
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	The remains of the Chapel of St la and adjacent cel	l, Camborne	
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1441204
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Cardinham Castle, Cardinham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004443
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Council Barrow, Cardinham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004476
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Carn Brea Castle, Carn Brea		
DESIGNATION:	Scheduled Monument, 2 LBs, CA, WHS	LIST ENTRY NUMBER:	1006704
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
	C	NEW ENTRY?:	No
PRINCIPAL VULNERABILITY:	Scrub/tree growth		110
PRINCIPAL VULNERABILITY: OWNER TYPE:	Local authority	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JTH WEST / CORNWALL (UA)		
SITE NAME:	Wheal Busy, Chacewater		
DESIGNATION:	Scheduled Monument, LB grade II, WHS	LIST ENTRY NUMBER:	1021392
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Melangoose camp, Colan		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004426
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Killibury Castle later prehistoric hillfort, Egloshayle	1	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010439
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Jewish and Congregationalist cemeteries at Ponsha	rden, Falmouth / Po	enryn
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020815
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round barrow 120 metres south east of Parkwood	d Hill, Feock	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019087
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	An early Christian memorial stone 380 metres sou	th east of Worthy	vale Manor, Forrabury and Minster
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018701
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Flooding	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Group of round barrows north of Hayle Kimbro P	ool, Grade-Ruan /	Mullion
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003082
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

STE NAME: Grambla Roman camp, Gweek DEGGNATION: Scheduled Monument Extensive significant problems TREND: Declining REMINITAL YAUNINEARIUM: Stock erosion - moderate NEW DATEM: COMPINENTIFE: ROUND BATTER: RECTANGUL CAMPAGNITY: Arable ploughing REMINITAL YAUNINEARIUM: CONDITION Generally unsatisfactory with major localised problems RECTANGUL CAMPAGNITY: Private RECTANGUL CAMPAGNITY: ROUND BATTER: RECTANGUL CAMPAGNITY: ROUND BATTER: RECTANGUL CAMPAGNITY: ROUND BATTER: RECTANGUL CAMPAGNITY: ROUND BATTER: RECTANGUL CAMPAGNITY: REPROCESSION BATTER: ROUND BATTER: RECTANGUL CAMPAGNITY: ROUND BATTER: ROUND	HERITAGE AT RISK 2019 / SOL	JTH WEST / CORNWALL (UA)		
CONDITIONS Generally unsatisfactory with major localised problems PRINCIPLA VULNEMARUTY: Coastal erosion New ENTER: Charity (heritage) Contract: Ann Preston-Jones 07917 642388 Scheduled Monument UST ENTRYNUMBER: Declining PRINCIPLA VULNEMARUTY: Scheduled Monument UST ENTRYNUMBER: Declining PRINCIPLA VULNEMARUTY: CONDITION: Scheduled Monument UST ENTRYNUMBER: CONDITION: Commercial company Contract: Ann Preston-Jones 07917 642388 SILENAME: CORDITION: Scheduled Monument UST ENTRYNUMBER: Declining PRINCIPLA VULNEMARUTY: No CONTRACT: Ann Preston-Jones 07917 642388 SILENAME: DEGIGNATION: Scheduled Monument UST ENTRYNUMBER: Declining PRINCIPLA VULNEMARUTY: Ann Preston-Jones 07917 642388 SILENAME: RECANDISION: Private CONTRACT: Ann Preston-Jones 07917 642388 SILENAME: REctangular camp south west of Trevarion Round, Gwinear-Gwithian DECIGNATION: Scheduled Monument UST ENTRYNUMBER: Declining PRINCIPLA VULNEMARUTY: Anable ploughing NEW ENTRY: Private Rectangular camp south west of Trevarion Round, Gwinear-Gwithian DECIGNATION: Scheduled Monument UST ENTRYNUMBER: Declining PRINCIPLA VULNEMARUTY: Arable ploughing NEW ENTRY: No CONTRACT: Ann Preston-Jones 07917 642388 STENAME: ROSEWORTH:	SITE NAME:	Cliff castle west of Gunwalloe Church, Gunwallo	oe .	
problems Primiting Voluntification Primiting	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004265
CONTACT: Ann Preston-Jones 07917 642388 STENAME Grambla Roman camp, Gweek DESIGNATION Scheduled Monument IIST ENTRY NUMBER 1003078 DECIDING Extensive significant problems ITRED Deciling SCONDIGN Extensive significant problems ITRED Deciling PRINCIPLY QUINEMBULY: Scock erosion - moderate New ENTRY: No CONTACT: Ann Preston-Jones 07917 642388 STENAME ROund barrow 20 yards (18 metres) north west of Tolvan Cross, Gweek DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1004269 CONDITION Generally unsatisfactory with major localised Problems Private CONTACT: Ann Preston-Jones 07917 642388 STENAME Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1004468 GETENAME Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1004468 GENERAL VUINEMBULY: Arabie ploughing New ENSIRY: No CONTACT: Ann Preston-Jones 07917 642388 STENAME ROSEWONTHY Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1021418 DESIGNATION: Generally unsatisfactory with major localised problems STENAME ROSEWONTHY Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1021418 DECINITION: Declining STENAME ROSEWONTHY Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1021418 DECINITION: Declining DECINITION: No OWNER TYPE: Private, multiple owners Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1006696 DECINITION: Ann Preston-Jones 07917 642388 STENAME Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1006696 DECINITION: Ann Preston-Jones 07917 642388 STENAME Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument UST ENTRY NUMBER 1006698 DECINITION: No Declining DECINITION: No Declining DECINITION: No Declining DECINITION: No	CONDITION:		TREND:	Declining
Grambla Roman camp, Gweek DESIGNATION: Scheduled Monument LET ENTRY NUMBER: 1003078 DECINITION Extensive significant problems TREND: Declining PRENCIPAL YULNIERABILITY: Stock erosion - moderate NEVENTATE: No COWNER TITTE: Stock erosion - moderate NEVENTATE: No COWNER TITTE: Commercial company COWNERT TITLE. ROUND barrow 20 yards (18 metres) north west of Tolvan Cross, Gweek DESIGNATION Scheduled Monument LIST ENTRY NUMBER: 1004269 CONDITION Generally unsatisfactory with major localised problems PRENCIPAL YULNERABILITY: Arabie ploughing New ENTRY: No COWNER TITTE: Private CONTACT: Ann Preston-Jones 07917 642388 STET NAME Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRENCIPAL YULNERABILITY: OF Commercial company CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arabie ploughing NEW ENTRY: No CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of Contact: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY Arsenic Works, 700 metres west of CONTACT: Ann Preston-Jones 07917 642388 STET NAME ROSWORTHY ARSENICATION ROSWORTHY NUMBER: 1006696 CONTACT: Ann Preston-Jo	PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1003078 CONTRICTOR Extensive significant problems TRING: Declining RERICHAR VULNERABILITY: Stock erosion - moderate NEW UNIVER: No COMMERTYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 CESSIGNATION: Scheduled Monument Scheduled Monument CONDITION: Generally unsatisfactory with major localised TRING: Declining Private Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument CONDITION: Generally unsatisfactory with major localised TRING: Ann Preston-Jones 07917 642388 STENAME: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised TRING: Declining PRIVATE: No CONDITION: Generally unsatisfactory with major localised TRING: Declining TRINGINAL VULNERABILITY: Anable ploughing NEW UNINTS: No CONNET TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 STENAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised TRING: Declining PRIVATE: No CONNET TYPE: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONNET TYPE: Ann Preston-Jones 07917 642388 STETNAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument CONNET TYPE: No CONNET	OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
EXTENSIVE Significant problems TREND: Declining REPRICIPAL VULNERABILITY: Stock erosion - moderate REPRICIPAL VULNERABILITY: Stock erosion - moderate ROWNER TYPE: No COMMERT TYPE: No COMMERT TYPE: No COMMERT TYPE: ROund barrow 20 yards (18 metres) north west of Tolvan Cross, Gweek DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems PRENCIPAL VULNERABILITY: Anable ploughing NEW ENTERY: No CONTRACT: Ann Preston-Jones 07917 642388 STENAMIC: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems PRENCIPAL VULNERABILITY: No CONDITION: Scheduled Monument Generally unsatisfactory with major localised problems PRENCIPAL VULNERABILITY: No COMMERT TYPE: Commercial company CONTRACT: Ann Preston-Jones 07917 642388 STENAMIC: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems Scheduled Monument Generally unsatisfactory with major localised problems PRENCIPAL VULNERABILITY: No CONTRACT: Ann Preston-Jones 07917 642388 STENAMIC: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems PRENCIPAL VULNERABILITY: No CONTRACT: Ann Preston-Jones 07917 642388 STENAMIC: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument USI ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems REND: No CONTRACT: Ann Preston-Jones 07917 642388 STENAMIC: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument USI ENTRY NUMBER: 1006698 CONDITION: Extensive significant problems REND: Declining PRENCIPAL VULNERABILITY: No Declining PRENCIPAL VULNERABILITY: No Declining PRENCIPAL VULNERABILITY: No Declining PRENCIPAL VULNER	SITE NAME:	Grambla Roman camp, Gweek		
RENICIPAL VULNERABILITY: Stock erosion - moderate NEW ENTRY: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 STEINAME: Round barrow 20 yards (18 metres) north west of Tolvan Cross, Gweek DERIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004269 CONDITION: Generally unsatisfactory with major localised problems RENICIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: Ann Preston-Jones 07917 642388 STEINAME: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DERIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 STEINAME: Roseworthy Arsenic Works, 700 metres west of Cornhall Farm, Gwinear-Gwithian DERIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021418 DERIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse RENINCIPAL VULNERABILITY: Ocilapse RENINCIPAL VULNERABILITY: No Declining RENINCIPAL VULNERABILITY: No D	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003078
Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME ROUND darrow 20 yards (18 metres) north west of Tolvan Cross, Gweek DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004269 CONDITION: Generally unsatisfactory with major localised problems PRINCIPLA VULNERABILITY: Arable ploughing NEWENTRY: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPLA VULNERABILITY: Arable ploughing NEWENTRY: No CONNIBATYPE: No CONNIBATYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021418 CONDITION: Scheduled Monument UST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPLA VULNERABILITY: No CONNIBATYPE: No CONTRACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems Private, multiple owners CONTRACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems RENDIA REND: Declining Private, multiple owners CONTRACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006688 DESIGNATION: S	CONDITION:	Extensive significant problems	TREND:	Declining
ROUND BATTON: Scheduled Monument Generally unsatisfactory with major localised problems FRENDIANCE: Arable ploughing RECONDITION: Scheduled Monument Generally unsatisfactory with major localised problems FRENDIANCE: Ann Preston-Jones 07917 642386 STENAME: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems FRENDIANCE: Rendiance Generally unsatisfactory with major localised problems FRENDIANCE: Ann Preston-Jones 07917 642386 TREND: Declining FRENDIANCE: ROSEWORTHYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642386 STENAME: ROSEWORTHYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642386 STENAME: ROSEWORTHY Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems FRENDIANCE: CONTACT: Ann Preston-Jones 07917 642386 STENAME: ROSEWORTHY WITH MAJOR INSAMELY INSAMELY CONDITION: Generally unsatisfactory with major localised problems FRENDIANCE: CONTACT: Ann Preston-Jones 07917 642386 STENAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: CONTACT: Ann Preston-Jones 07917 642386 STENAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: CONTACT: Ann Preston-Jones 07917 642386 STENAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: CONTACT: Ann Preston-Jones 07917 642386 STENAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: CONTACT: Ann Preston-Jones 07917 642386 STENAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: CONTACT: Ann Preston-Jones 07917 642386 STENAME: CONTACT: Ann Preston-Jones 07917 642386 STENAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006698 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006698 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006698 DESIGNATIO	PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004269 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing RENNICIPAL VULNERABILITY: Arable ploughing RECTANGE RECTANGULAR CAMP SOUTH WEST OF Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems RENNICIPAL VULNERABILITY: Arable ploughing RENNICIPAL VULNERABILITY: Collapse RENNICIPAL VULNERABILITY: Declining RENNICIPAL VULNERABILITY: Collapse RENNICIPAL VULNERABILITY: Collapse RENNICIPAL VULNERABILITY: Collapse RENNICIPAL VULNERABILITY: Collapse RENNICIPAL VULNERABILITY: Declining RENNICIPAL VULNERABILITY: Arable ploughing RENNICIPAL VULNERABILITY: Declining RENNICIPAL VULNERABILITY: RENNICIPAL VULNERABILITY: No RENNICIPAL VULNERABILITY: No RENNICIPAL VULNERABILITY: No RENNICIPAL VULNERABILITY: No RENNICIPAL	OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse NEW ENTRY: No DOWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DOWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining NEW ENTRY: No DOWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 DESIGNATION: Scheduled Monument LIST ENTRY NUMB	SITE NAME:	Round barrow 20 yards (18 metres) north west	of Tolvan Cross, Gw	eek
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE Private CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse NEW ENTRY: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONTITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 DESIGNATION: Scheduled Monument NUMBER: 1006688 DESIGNATION: Scheduled Monument NUMBER: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004269
Private Private CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DEBIGNATION: Scheduled Monument UST ENTRY NUMBER 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DEBIGNATION: Scheduled Monument UST ENTRY NUMBER 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse NEW ENTRY?: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006696 CONDITION: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006688 EXTENSIVE USENIERLY NUMBER: 1006688 EXTENSIVE Significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY: No	CONDITION:		TREND:	Declining
Rectangular camp south west of Trevarnon Round, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse NEW ENTRYP: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006696 CONDITION: Arable ploughing NEW ENTRYP: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1006688 CONDITION: Scheduled Monument UST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Designation: Scheduled Monument LIST ENTRY NUMBER: 1004468 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse NEW ENTRY: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: With major localised problems Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 TREND: Declining PRINCIPAL VULNERABILITY: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Number: 1006688 Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY: No	OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
Generally unsatisfactory with major localised problems Generally unsatisfactory with major localised problems NEW ENTRYP: No OWNER TYPE: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse NEW ENTRYP: No DWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Contract: Ann Preston-Jones 07917 642388 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No Declining PRINCIPAL VULNERABILITY: No Permitted development NEW ENTRYP: No	SITE NAME:	Rectangular camp south west of Trevarnon Rou	nd, Gwinear-Gwithiar	1
problems Problems Problems New Entry?: No Description: Anable ploughing New Entry?: No Description: Commercial company CONTACT: Ann Preston-Jones 07917 642388 SETE NAME: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian Designation: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems Principal Vulnerability: Collapse New Entry?: No Designation: Contact: Ann Preston-Jones 07917 642388 SETE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument DESIGNATION: Scheduled Monument Extensive significant problems Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 DESIGNATION: Scheduled Monument DESIGNATION: Declining PRINCIPAL VULNERABILITY: No DEVINER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SETE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument DESIGNATION: Declining PRINCIPAL VULNERABILITY: No DESIGNATION: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 DESIGNATION: Scheduled Monument DESIGNATION: New ENTRY): No DESIGNATION: New ENTRY): No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004468
Commercial company Contact: Ann Preston-Jones 07917 642388 Strename: Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian Designation: Scheduled Monument Designation: Scheduled Monument Designation: Ust entry number: 1021418 Condition: Generally unsatisfactory with major localised problems Principal vulnerability: Collapse New Entry: No Owner type: Private, multiple owners Contact: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian Designation: Scheduled Monument Designation: Extensive significant problems PRINCIPAL VULNERABILITY: No Owner type: Private, multiple owners Contact: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle Designation: Scheduled Monument Designation:	CONDITION:		TREND:	Declining
Roseworthy Arsenic Works, 700 metres west of Cornhill Farm, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument DESIGNATION: Extensive significant problems PRINCIPAL VULNERABILITY: Arable ploughing PRINCIPAL VULNERABILITY: Arable ploughing PRINCIPAL VULNERABILITY: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No Declining PRINCIPAL VULNERABILITY: No NEW ENTRY: No Declining PRINCIPAL VULNERABILITY: No NEW ENTRY: No NEW ENTRY: No Declining PRINCIPAL VULNERABILITY: No NEW ENTRY: No NEW ENTRY: No Declining PRINCIPAL VULNERABILITY: Nermitted development NEW ENTRY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1021418 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRYP: No	OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Collapse Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument CONDITION: Extensive significant problems PRINCIPAL VULNERABILITY: Arable ploughing OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY: No	SITE NAME:	Roseworthy Arsenic Works, 700 metres west o	f Cornhill Farm, Gwir	near-Gwithian
problems PRINCIPAL VULNERABILITY: Collapse Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: I 006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021418
OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	CONDITION:		TREND:	Declining
Trevarnon Round, Gwithian, Gwinear-Gwithian DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006696 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
Extensive significant problems TREND: Declining NEW ENTRY?: No OWNER TYPE: Private, multiple owners Castle Kayle (earthwork), Phillack, Hayle Designation: Scheduled Monument LIST ENTRY NUMBER: CONDITION: Extensive significant problems TREND: Declining No No No No No No No No No N	SITE NAME:	Trevarnon Round, Gwithian, Gwinear-Gwithian		
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006696
OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388 SITE NAME: Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	CONDITION:	Extensive significant problems	TREND:	Declining
Castle Kayle (earthwork), Phillack, Hayle DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1006688 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	SITE NAME:	Castle Kayle (earthwork), Phillack, Hayle		
PRINCIPAL VULNERABILITY: Permitted development NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006688
	CONDITION:	Extensive significant problems	TREND:	Declining
OWNER TYPE: Private, multiple owners CONTACT: Ann Preston-Jones 07917 642388	PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
	OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

meni age at kisk 2019 / SOU	JTH WEST / CORNWALL (UA)		
SITE NAME:	Carvannel cliff castle, Illogan		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004390
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	'Headon Barrow' near Headon Cross, Jacobstow		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005434
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round barrow 650 metres east of Carrine, Kea		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019086
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round 200 metres north west of Penventinnie, Ke	nwyn	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1016063
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	The Castles, Kilkhampton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003079
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Five bowl barrows 480 metres and 510 metres no	rth of Hendra Farm	ı, Ladock
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019021
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round and annexe 720 metres WSW of Tregear, I	_adock	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020179
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

	JTH WEST / CORNWALL (UA)	1 1	
SITE NAME:	Neolithic settlement and hut circle on Helman To	· ·	1007207
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007306
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Giants Hedge, Lerryn to Lanreath, Lanreath / St. Veep		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006681
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Mabel Barrow, Lansallos		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006683
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Earlier prehistoric hillfort, two cairns, medieval po transhumance huts on Stowe's Hill, Linkinhorne	und and adjacent pi	rehistoric field systems, hut circles and
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1012352
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Early medieval transhumance hut 740 metres west	of Blackcoombe Fa	arm, Linkinhorne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011899
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric funerary cist 1.275 kilometres north west of Wardbrook Farm, Linkinhorne		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012043
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Flooding	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn with central cist on Bearah Common,	1.106 kilometres n	north of Wardbrook Farm, Linkinhorn
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010411
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Daniel Bashford 07824 103102

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial lists). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two adjacent transhumance huts on Caradon Hill,	450 metres north	of East Caradon Farm, Linkinhorne
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1011900
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two cairns, centred 82 metres and 110 metres so	uth west of Carado	n Hill summit, Linkinhorne
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1011810
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth - General	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Neolithic long cairn, prehistoric regular and irregul enclosure 625 metres west of Blackcoombe Farm,	ar aggregate field s Linkinhorne / Nort	ystems, linear boundaries and mediev th Hill
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010221
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Medieval and post-medieval tin and copper mines v northern slopes of Caradon Hill, Linkinhorne / St. (system on the middle and lower
DESIGNATION:	Scheduled Monument, 2 LBs, part in CA, WHS	LIST ENTRY NUMBER:	1020942
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
ITE NAME:	Castle an Dinas, Ludgvan		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1006725
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
ITE NAME:	Round 450 yards (405 metres) north west of Lowe	er Chellew Farm, L	udgvan
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004262
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
ITE NAME:	Innis Downs earthwork, Luxulyan		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006684
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Ancient village and fields at Boswarva Carn, Madre	on	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004466
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Courtyard houses north east of Newmill, Madron	ı	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004356
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Hut circles with associated field system 400 yards	(360 metres) south	west of Little Higher Bosullow, Madr
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1004316
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round 300 yards (270 metres) north east of New	mill, Madron	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004627
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Settlement 450 yards (400 metres) north west of	Middle Carnaquidde	en, Madron
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003100
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	St Madron Well 500 yards (460 metres) south eas	st of Boswarthen, M	adron
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004310
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Flooding	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Village settlement north of Bodrifty, Madron		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004481
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Barrow 800 yards (730 metres) WNW of Boswen	s Farm, Madron / S	t. Just
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004286
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Cawsand Fort, Maker-with-Rame		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1016102
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Earthwork redoubts Nos. 1, 2 and 3, Maker-with-F	Rame	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004254
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Grenville Battery 550 yards (500 metres) SSW of N	Maker Farm, Maker	-with-Rame
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1003114
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Incomplete Palmerstonian fort 650 yards (600 met	res) west of Forder	, Maker-with-Rame
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007299
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Mount Edgcumbe round barrow, Maker-with-Rame	2	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004496
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	No. 5 redoubt 450 yards (410 metres) north west	of Maker Farm, Ma	ker-with-Rame
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1004255
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102

- implemented.

 C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial like). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Hillfort at Blacketon Farm, Menheniot		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007296
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Inswork Chapel, Millbrook		
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1003095
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round barrow on Bin Down, Morval		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006651
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Group of four round barrows east of Bottaboroug	h, Morwenstow / K	Cilkhampton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004402
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Group of round barrows south west of Penhale, M	ullion	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004444
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Trevelgue promontory camp and two barrows, Ne	wquay	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006712
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Battens Cross, one of three medieval wayside cros	ses 70 metres sout	h west of Trebartha Hall, North Hill
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012045
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- deterioration or loss of labric; is solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Hut circle settlement 975 metres north east of Tre	ewortha Farm, Nor	th Hill
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009806
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric co-axial and regular aggregate field syst on Bastreet Downs, south of Bowda Farm, North	ems with incorpora	ated and adjacent hut circle settlemen
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011558
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Maen (or Mayon) Castle, Sennen		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006757
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	Yes
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round cairn 1,175 metres WSW of East Castick Fa	arm, North Hill	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010412
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Stone hut circle 1,225 metres WSW of East Castio	k Farm, North Hill	
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1010414
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Three adjoining prehistoric linear boundaries on B Farm, North Hill	earah Tor, 687 met	res south west of Nodmans Bowda
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010220
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Three stone hut circles 1.06 kilometres north east	of Trewortha Farn	n, North Hill
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1009807
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two stone hut circles and adjacent prehistoric boundary wall 575 metres west of West Berriow Farm, No Hill			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010218	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388	
SITE NAME:	Unenclosed hut circle settlement and adjacent pre Farm, North Hill	historic linear boun	dary 800 metres SSE of Trewortha	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008958	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Unknown	CONTACT:	Ann Preston-Jones 07917 642388	
SITE NAME:	Unenclosed hut circle settlement with incorporate Farm, North Hill	d enclosure 1.5 kild	ometres north west of Wardbrook	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008954	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No	
OWNER TYPE:	Unknown	CONTACT:	Ann Preston-Jones 07917 642388	
SITE NAME:	Two adjacent prehistoric coaxial field systems inco and medieval fields on East Moor and Ridge, North		eld systems, stone hut circles, cairns	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008439	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388	
SITE NAME:	Three barrows 550 metres ENE of Cansford, Otte	erham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005463	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388	
SITE NAME:	Roundago, hut circle and field system on Castallac	c Carn, Paul		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004654	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388	
SITE NAME:	Bake Rings later prehistoric-Roman round with att	ached enclosure an	d outwork, Pelynt	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017682	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Group of three round barrows north of Hendra, P	elynt	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004621
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Hall Rings, Pelynt		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006682
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Ten barrows south of Wilton Mill, Pelynt		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004465
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Glasney College, Penryn		
DESIGNATION:	Scheduled Monument, LB grade II, part in CA	LIST ENTRY NUMBER:	1007260
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Lescudjack Castle, Penzance		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003270
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	St Piran's Oratory and associated early medieval ce	metery, Perranzabi	uloe
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1018955
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Flooding	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	The Tolgus arsenic works 80 metres south east of	East Tolgus House,	, Redruth
DESIGNATION:	Scheduled Monument, LB grade II, WHS	LIST ENTRY NUMBER:	1021240
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
	Other	NEW ENTRY?:	No
PRINCIPAL VULNERABILITY:	Other		110
PRINCIPAL VULNERABILITY: OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- deterioration or loss of labric; is solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

	JTH WEST / CORNWALL (UA)		
SITE NAME:	Botrea barrows, Sancreed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004467
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Caer Bran, Sancreed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006717
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Enclosed hut circle settlement and field system, 50	0 metres north we	st of Jericho Farm, Sancreed
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1418283
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Field system on Boswens Common, Sancreed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007268
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Hut cluster Chirgwidden Vean, Sancreed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006715
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Boslow Cross 550 yards (500 metres) north west	of Boslow Farm, Sa	ncreed / St. Just
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1003110
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Bolster Bank, St. Agnes		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1016444
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

	JTH WEST / CORNWALL (UA)		
SITE NAME:	Wheal Kitty C20 tin processing works, St. Agnes		1031174
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1021164
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Promontory fort and Civil War battery, Little D	ennis Head, St. Antho	ny-in-Meneage
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004431
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Black Head promontory fort, St. Austell Bay		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004391
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Stone circle on Emblance Common, St. Breward		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004459
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Camp 900 yards (820 metres) south east of St B	uryan village, St. Bury	an
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1004483
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round barrow 200 yards (180 metres) north of	the Merry Maidens, S	t. Buryan
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004358
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Bowl barrow 130 metres south east of Penglaze,	, St. Erme	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016887
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Embanked platform cairn with central mound 375 i	metres north west	of Trewalla Farm, St. Cleer
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1015976
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Kerbed platform cairn with kerbed central mound Cleer	and outer bank 600	O metres east of Trewalla Farm, St.
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1010323
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric cist, cairns and cairnfield on north east Smallacoombe Tor, St. Cleer	Smallacoombe Dov	wns, 570 metres north west of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018630
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric enclosure 325 metres west of Trewalla	Farm, St. Cleer	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1010434
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric enclosure and field system, two hut circ east of Sparretts Farm, St. Cleer	cles and parts of a 1	medieval field system 350 metres sou
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1013216
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric irregular aggregate field system with inc Farm, St. Cleer	corporated stone h	ut circles 375 metres SSE of Sparrett
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1008765
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric irregular and regular aggregate field sys of Siblyback Farm, St. Cleer	tems with incorpor	rated stone hut circles 750 metres El
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1011315
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric irregular and regular aggregate field sys boulder 750 metres ESE of Siblyback Farm, St. Clee	er	one nut circles, calfillelu anu kerbe
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1010060
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric regular aggregate field system with inco enclosure 550 metres WSW of Trewalla Farm, St.	orporated and adjac Cleer	ent stone hut circles and an adjacen
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1009731
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric to post-medieval field systems, boundar north eastern Siblyback Moor, St. Cleer	ries, settlements an	d railway at Smallacoombe Parks an
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018631
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn 450 metres east of Sparretts Farm, St.	. Cleer	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1009838
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn 525 metres east of Trewalla Farm, St.	Cleer	
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1012041
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn 740 metres SSW of Caradon Hill sum	mit, St. Cleer	
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1011774
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn and shelters 812 metres SSW of Cara	don Hill summit, St	Cleer
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1011784
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Public utilities	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	JTH WEST / CORNWALL (UA)	V of Compdeted 199	it St Class
DESIGNATION:	Round cairn with peripheral berm 402 metres SSV	V of Caradon Hill SI LIST ENTRY NUMBER:	IOI 1822
	Scheduled Monument, CA, WHS Generally satisfactory but with significant localised		
CONDITION:	problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	South Caradon C19 copper mine, St. Cleer		
DESIGNATION:	Scheduled Monument, 2 LBs, part in CA, WHS	LIST ENTRY NUMBER:	1020614
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Stone hut circle 750 metres ESE of Trewalla Farm,	St. Cleer	
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1011909
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	The Tinners' Dyke 160 yards (150 metres) in lengt	h south of Henders	grove Wood, St. Cleer
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004364
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Tor cairn with adjacent sub-rectangular hut 650 m	etres SSW of Cara	don Hill summit, St. Cleer
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1011793
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two adjacent stone hut circles 265 metres WNW	of Trewalla Farm,	St. Cleer
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1009738
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two adjacent stone hut circles 290 metres west or	f Trewalla Farm, St.	Cleer
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1009703
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial like). use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric to medieval settlements, field systems, railway on north east Smallacoombe Down, St. Cle	enclosures and cair eer / Altarnun	ns, with post-medieval boundary an
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018629
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric round cairn on Caradon Hill, 310 metr	es west of Heather	House, St. Cleer / Linkinhorne
DESIGNATION:	Scheduled Monument, CA, WHS	LIST ENTRY NUMBER:	1020939
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	The Nine Maidens stone alignment, The Fiddler sta Columb Major / St. Issey	ınding stone and tw	vo Bronze Age round barrows, St.
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021223
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Bury camp, St. Dominick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004393
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Medieval transhumance hut on Draynes Common, 500 metres south west of Westerlake Farm, St. No.		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007779
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - limited/localised	NEW ENTRY?:	Yes
OWNER TYPE:	Unknown	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Warren's Barrow, St. Erme		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016888
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Enclosures east of Gurlyn, St. Erth		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1007282
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric regular aggregate field system with inco NNW of Lamelgate Farm, St. Neot	orporated enclosure	e and stone hut circles 550 metres
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007474
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Redcliff Castle, later prehistoric cliff castle 550 met	tres south west of l	Bedruthan, St. Eval
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1021006
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Promontory fort north of village, St. Gennys		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003097
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Gunpowder storage complex at Kennall Vale, St. G	Gluvias	
DESIGNATION:	Scheduled Monument, 3 LBs, WHS	LIST ENTRY NUMBER:	1020441
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Camp 500 yards (460 metres) west of Trenance, S	t. Issey	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004235
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Cadson Bury hillfort, St. Ive		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004494
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Hut circles, Higher Bussow, St. Ives		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006689
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Whitesand Bay (or Tregonhawke) battery, St. John		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004664
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Bartine Castle, St. Just		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006716
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Chambered barrow 100 yards (90 metres) east of	Kerrow Farm, St. J	ust
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004637
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Geevor Mine, St. Just		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1021361
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Russell 0117 975 0671
SITE NAME:	Nanjulian Farm courtyard house, St. Just		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004498
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Standing cross at High Cross, 30 metres west of Tr	ruro Cathedral, Tri	uro
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1020557
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	Yes
OWNER TYPE:	Local authority	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Numphra Common tin streamworking complex, St	t. Just	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007272
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Standing stone 200 yards (180 metres) west of Ch	ycarne, St. Just	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003116
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Veryan Castle multiple enclosure fort and annexe	500 metres south w	vest of Churchtown Farm, Veryan
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019746
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Chapel enclosure 150 yards (140 metres) south of	Trelease Farm, St.	Keverne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004334
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Settlement sites 500 yards (460 metres) SSE of Tre	ebarveth, St. Keverr	ne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004319
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	St Levan Chapel site, St. Levan		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007285
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Treryn Dinas fort, St. Levan		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006733
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Westcott Cross, 480 metres south east of Westco	ott Lodge, St. Mellic	on / St. Dominick
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1018019
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Daniel Bashford 07824 103102

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOC	JTH WEST / CORNWALL (UA)		
SITE NAME:	Cliff castle at Winecove Point, St. Merryn		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004234
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	St Constantine's chapel and holy well, St. Merryn		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1018569
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round 790 metres north east of Trebollack, St. Mi	chael Penkevil	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019612
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	The Rumps promontory fort, St. Minver Highlands		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004625
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Hobbs Hill tin mine, openwork and lodeback tinwo Chyseger Farm, St. Neot	Hobbs Hill tin mine, openwork and lodeback tinwork 530 metres east and 160 metres north east of Chyseger Farm, St. Neot	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021410
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Hut circle village 330 yards (300 metres) west of V	Vest Northwood F	arm, St. Neot
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004662
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Prehistoric field systems, enclosure, hut circles and field system on Higher Langdon Farm, St. Neot	Prehistoric field systems, enclosure, hut circles and rounds, with adjacent medieval settlement, longhouse ar field system on Higher Langdon Farm, St. Neot	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007475
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 Slow decay; solution agreed but for tyet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial lise) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric settlements and field system with adjastreamworks on the Brown Gelly Downs, St. Ne	icent medieval settle ot	ment, field systems, boundaries and t
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007770
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn 1.062 kilometres south west of High	er Langdon Farm, St	Neot
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007476
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Round cairn 1.17 kilometres south west of Highe	r Langdon Farm, St.	Neot
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007477
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Castle Dore (camp), St. Sampson / Tywardreath	and Par	
DESIGNATION:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1006691
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Tregargus stone grinding mill No. 2, St. Stephen-i	n-Brannel	
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1003101
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Other not for profit group	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Round barrow north east of Kernick, St. Stephen	s By Launceston Rur	ral
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003272
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Two round barrows north east of Fairy Cross, So	Winnow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004439
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Daniel Bashford 07824 103102

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

	JTH WEST / CORNWALL (UA)		
SITE NAME:	New Consols Mine: surface, buried and undergrou		
DESIGNATION:	Scheduled Monument, 5 LBs, part in CA, WHS	LIST ENTRY NUMBER:	1409595
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Condolden Barrow, Tintagel		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004652
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	The Ballast Pond, Torpoint		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1007261
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Carne Beacon round barrow 320 metres north of	Carne Farm, Verya	n
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019745
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Ancient village south of Carburrow Tor, Warlegga	n	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003073
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Chapel Jane medieval chapel 600 yards (550 metre	s) NNW of Treen,	Zennor
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004631
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Hut circle settlement at Sperris Croft 500 yards (4	60 metres) south e	ast of Tregerthen Cottage, Zennor
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004307
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial like). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Treen Common barrows, Zennor		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004473
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388



© Historic England

SITE NAME:	Carclew, Mylor
DESIGNATION:	Registered Park and Garden grade II, 5 LBs, WHS
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners
LIST ENTRY NUMBER:	1000544

Mid-C18 formal terraced and water gardens, together with an C18 landscape park. The main house burned down in 1934 and the site is now in divided ownership. Infill residential development has taken place in the park belts, substantial areas of woodland have been cleared and many individual parkland trees have been lost. The ruins of Carclew House, a II* listed building, were added to the HAR Register in 2017. A steering group has been established with the owners of Carclew House and a brief drawn up under Historic England's guidance to prepare a Conservation Statement for the site.

Contact: Jo McAllister 0117 975 0696

SITE NAME:	Bodmin		
DESIGNATION:	Conservation Area, 96 LBs, SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Alyson Cooper (LPA) 01872 323603

DEVON

DARTMOOR (NP)



SITE NAME:	Higher Sigford, Sweet's Sigford, Ilsington, Teignbridge
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private

A rare example of a longhouse derivative in a farmstead context which has been used for agricultural storage in more recent years. Conditional consents for reoccupation of the house have been granted. Historic England has met with the owner and repair works are now proceeding.

LIST ENTRY NUMBER: 1389617 Contact: Annie Evans 0117 975 0673 © Historic England



© Historic England Archive

SITE NAME:	Gunpowder factory at Powder Mills, a partially enclosed stone hut circle settlement and round cairn, Dartmoor Forest, West Devon
DESIGNATION:	Scheduled Monument, 2 LBs
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Crown
LIST ENTRY NUMBER:	1016635

Devon's only C19 gunpowder factory dates to 1844 and comprises at least 18 buildings involved in the production, storage and management of gunpowder. These buildings are now vacant and neglected, and there are unmanaged trees growing across the site. As a result of Historic England grant and match funding from the Duchy of Cornwall, repair works to the collapsed southern gable end of Building 9 have been undertaken. The grant will also fund arboreal works to remove trees and tree limbs that pose a wind blow threat. Tree works will be undertaken in August 2019 after the end of nesting season.

Contact: Andy Crabb 01626 832093

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Church of St Petrock, Church Street, South Brent, South Hams
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor

PRIORITY CATEGORY: D (D)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: | | 147794

LIST ENTRY NUMBER:

C12 parish church of which the west tower (formerly at the crossing) of the originally cruciform church survives. The west end was demolished early C14 when the present nave was rebuilt with two transepts. North and south aisles of early C15, restored late C19. The congregation was awarded a National Lottery Heritage Fund Grant for Places of Worship and in 2016-17 the tower was grouted and repointed and the vestry roof was repaired. As of 2019, the nave roof remains in poor condition.

Contact: Annie Evans 0117 975 0673



SITE NAME:

Church of St Thomas à Becket, Bridford, Teignbridge

DESIGNATION:

Listed Place of Worship grade I

CONDITION:

POOR

PRIORITY CATEGORY:

C (C)

OWNER TYPE:

Religious organisation

LIST ENTRY NUMBER:

1097825

A medieval granite church in an exposed location on the southern fringe of Dartmoor National Park. The pointing on the tower is failing and falling, and this is allowing water ingress into the fabric. The church was awarded a Listed Places of Worship Roof Repair Grant but further work is still needed.

Contact: Annie Evans 0117 975 0673



© Historic England

© Historic England

SITE NAME:	Parish Church of Holy Trinity, Church Hill, Buckfastleigh, Teignbridge
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1209920

Former parish church. Sited on a high hill. C13 tower; chancel and transepts possibly also C13 in origin; C15 aisles and chancel chapels. Thorough restoration in 1844-1845. Left gutted and roofless after fire on 20 July 1992. The stonework, especially the window tracery, needs further repair. Despite the fire damage, services are still held at the church.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Enclosure on the west side of the Erme valley belo	w Stalldown, Corn	wood, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012767
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	The southern of three enclosures north of Ford W	/aste, Cornwood, S	South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012700
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Three unenclosed stone hut circles on the west sid South Hams	de of the Erme Valle	ey, north of Lower Piles, Cornwood,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012768
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Lindon repair on in fair to good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Two hut circles on the south east slope of Stalldov	vn, Cornwood, Sou	th Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012766
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Unenclosed stone hut settlement north east of Yao	dsworthy, Cornwoo	od, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012771
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure and hut circles east of Huntingdon Ford,	Dean Prior, South	Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002536
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Agglomerated enclosure with hut circles, south of	Lower Piles, Harfor	rd, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009578
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Blowing house at junction of Hook Lake and River	Erme, Harford, Sou	uth Hams
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1002605
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Blowing house north of Dry Lake, Harford, South I	Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002609
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure with hut circles east of Addicombe, Hard	ord, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012484
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Enclosure with hut circles east of Addicombe, Har	ford, South Hams	
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1017609
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure with hut circles in Higher Piles newtake,	Harford, South Ha	ms
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013110
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure with hut circles to the north east of Pile	s Copse, Harford, S	South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013106
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circles and enclosure to south of Left Lake, Ha	arford, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004574
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circles in Erme Pound east of River Erme, Har	ford, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002604
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Stone row, cairn and enclosures near Hook Lane,	Erme Valley, Harfor	rd, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002493
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Unenclosed stone hut settlement on the east side Hams	of the Erme Valley,	North Harford Moor, Harford, South
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012747
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093

- C Slow decay; no solution agreed.
- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed but F not yet implemented.

 Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Unenclosed stone hut settlement with enclosures	north of Piles Cops	e, Harford, South Hams
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1012765
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosed prehistoric settlement and three round c Hams	airns 870 metres so	outh east of Horn's Cross, Holne, Sout
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020096
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Four cairns 560 metres east of Hapstead Ford and cemetery in the Mardle Valley, Holne, South Hams	1660 metres east o	of Ryder's Hill, forming part of a cairn
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019270
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Part of the Dartmeet coaxial field system and othe west of Venford Reservoir, Holne, South Hams	er archaeological rei	mains on Holne Moor west and north
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020487
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Partially enclosed stone hut circle settlement 350 i	metres south west	of Horn's Cross, Holne, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019274
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Partially enclosed stone hut circle settlement 420 i Holne, South Hams	metres north west	and 440 metres west of Horn's Cross,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020185
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric fields and settlements north east of Ve system, Holne, South Hams	nford Reservoir for	ming part of the Dartmeet coaxial fiel
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020091
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric fields, settlements and cairn south east field system, Holne, South Hams	of Ventord Reserv	oir forming part of the Dartmeet coa
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020092
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Medieval farmstead and field system, post-medieva west of Gibby Coombe, Holne / West Buckfastleig	l tinworks, prehisto h, South Hams	oric settlements and cairns north and
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019591
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Barrow near Shaugh Cross, Shaugh Prior, South H	ams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003824
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cross Dyke reave, Shaugh Prior, South Hams		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010811
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosed stone hut circle settlement and three rou	ınd cairns on Giant	's Hill, Shaugh Prior, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019081
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circles west of Saddlesborough, Shaugh Prior,	South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002520
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Multi-period remains at Hentor Warren, Shaugh P	rior, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019082
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	One of a number of cairns with cists south of Shav	ercombe Brook, Sh	augh Prior, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012172
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	One of a number of cairns with cists south of Shav	ercombe Brook, Sh	augh Prior, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012214
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	One of three stone hut circles 500 metres SSE of I	egis Tor, Shaugh P	rior, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012631
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 100 metres south east of Great Tro Shaugh Prior, South Hams	wlesworthy Tor, fo	rming part of Trowlesworthy Warren,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014666
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 160 metres south west of Great Tro Shaugh Prior, South Hams	owlesworthy Tor, fo	orming part of Trowlesworthy Warren
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014665
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 270 metres south east of Ditsworth Prior, South Hams	y Warren House fo	orming part of Hentor Warren, Shaugh
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014477
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 610 metres SSW of Ditsworthy Wa Prior, South Hams	rren House forming	g part of Willings Walls Warren, Shaug
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014469
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Pillow mound 620 metres ESE of Legis Tor forming	part of Willings W	/alls Warren, Shaugh Prior, South Han
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014457
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 790 metres NNE of Blackaton Cross South Hams	, forming part of T	rowlesworthy Warren, Shaugh Prior,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014662
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 860 metres NNW of Blackaton Cros South Hams	ss, forming part of	Trowlesworthy Warren, Shaugh Prior
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014664
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pillow mound 860 metres SSE of Trowlesworthy V Shaugh Prior, South Hams	Varren House, forn	ning part of Trowlesworthy Warren,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014616
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Pound and hut circles north of Hawk's Tor, Shaugh	Prior, South Hams	3
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002516
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Rectangular building 420 metres north west of Her Prior, South Hams	Tor, forming an o	utlying part of Hentor Farm, Shaugh
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020011
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Stone hut circle north east of Hentor Brook, Shaug	h Prior, South Har	ns
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012175
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
	Dl to	NEW ENTRY?:	No
PRINCIPAL VULNERABILITY:	Plant growth	TALTY LITTINI	INO

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 Slow decay; solution agreed but for tyet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial lise) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CITE NAME			
SITE NAME:	Stone hut circle north of Hentor Brook, Shaugh Pr	ior, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012083
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Three pillow mounds and a linear gully 200 metres Trowlesworthy Warren, Shaugh Prior, South Ham	north of Great Tr	owlesworthy Tor forming part of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014481
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two pillow mounds and a small area of tin streamy forming part of Willings Walls Warren, Shaugh Pric	vork 510 metres so or, South Hams	outh west of Ditsworthy Warren House
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014467
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two pillow mounds and a small area of tin streamy forming part of Trowlesworthy Warren, Shaugh Pr	vork earthworks 7	70 metres north of Blackaton Cross,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014663
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Vermin trap 350 metres south west of Great Trow Shaugh Prior, South Hams	lesworthy Tor for	ming part of Trowlesworthy Warren,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014475
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Vermin trap 510 metres WSW of Great Trowlesw Prior, South Hams	orthy Tor forming	part of Trowlesworthy Warren, Shaugh
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014465
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Vermin trap 520 metres SSW of Trowlesworthy V Shaugh Prior, South Hams	varren House form	ing part of Trowlesworthy Warren,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014466
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Vermin trap 800 metres south east of Trowleswor Warren, Shaugh Prior, South Hams	rthy Warren House	e forming part of Trowlesworthy
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014464
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
ITE NAME:	Cist with a retaining kerb north west of Corringdo	on Ball, South Brent	, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010180
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure and hut circle north of Old Hill, South B	Brent, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003200
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure south east of Dockwell Hole, South Bre	nt, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002665
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure with hut circles and rectangular pens, so	outh of Bala Brook,	South Brent, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012775
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure with hut circles north of Bala Brook inta	ake, South Brent, So	outh Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012776
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HEKITAGE AT RISK 2019 / SOU	JTH WEST / DARTMOOR (NP)		
SITE NAME:	Enclosure with hut circles north of Bala Brook inta		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012783
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosures and hut circles at Petre's Pits Bottom, S	South Brent, South	Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004557
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circle and fields, Bishop's Mead, South Brent, S	South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002537
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut enclosure north of Old Hill, South Brent, South	th Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002664
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	One of several stone hut circles north of Corringd	lon Ball, South Brer	nt, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010202
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Rider's Rings (The Rings), South Brent, South Ham	s	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002502
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Three enclosed hut groups, Black Tor, Shipley Brid	lge, South Brent, Sc	outh Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002505
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two conjoined huts between two enclosures no	rth of Bala Brook inta	ake, South Brent, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012778
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two hut circles on the right bank of Red Brook,	South Brent, South H	Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013035
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosure with hut circles north of Scad Brook, l	Jgborough, South Ha	ıms
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012485
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hembury Castle, West Buckfastleigh, South Ham	s	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003859
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	Yes
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cist on Whitehorse Hill, 910 metres south east of	of Taw Head, Dartmo	oor Forest, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020871
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	Yes
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	One of a number of cairns at Black Pool, Ugboro	ugh, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012232
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two double stone alignments, cairn and standing stone 700 metres south west of Laughter Hole Farm, Dartmoor Forest, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021047
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JTH WEST / DARTMOOR (NP)		
SITE NAME:	One of a number of cairns at Black Pool, Ugborou	gh, South Hams	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012285
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Stone alignment and cairn south east of Western E	Beacon, Ugborough	, South Hams
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017604
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairn 240 metres north of Crownley Parks, Ilsington, Teignbridge		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019588
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Other not for profit group	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Settlement on Smallacombe Rocks, Ilsington, Teign	bridge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002531
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Settlement west of Holwell Tor, Ilsington, Teignbr	idge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002529
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric and medieval settlements and their field	d systems at Hound	Tor, Manaton, Teignbridge
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016255
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Medieval strip fields, tinworks, prehistoric settleme Down, Manaton / Widecombe in the Moor, Teignb	ents, and a cairn on oridge	the lower western slopes of Hamel
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021394
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

HERITAGE AT RISK 2019 / SOU	THE WEST / DAKTHOOK (NF)		
SITE NAME:	Enclosure south west of Hingston Rocks, Moreton	nhampstead, Teignb	ridge
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002496
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circles on Hedge Down, Widecombe in the M	loor, Teignbridge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002620
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two cairns on Cator Common, Widecombe in the	e Moor, Teignbridge	2
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003297
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Round cairn on Standon Hill, Peter Tavy, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016253
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	Yes
OWNER TYPE:	Government or agency	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	A double stone hut circle and enclosure 280 metro	es south of Deadlak	e Foot, Dartmoor Forest, West Devor
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011569
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Camp 325 yards (300 metres) south east of Arche	rton, Dartmoor Fo	rest, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002636
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Coaxial fields, prehistoric settlement, two cairns a metres south east of Stannon Tor, Dartmoor Fore		nt in Little Stannon Newtake, 900
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021339
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Medieval settlement 470 metres east of Hartyland,	Dartmoor Forest,	West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021338
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric enclosed settlement 740 metres north	west of Hartland T	or, Dartmoor Forest, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021335
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circle and field system north west of Saddle Br	idge, Dartmoor Fo	rest / Holne, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002601
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prestonbury Castle (hillfort), Drewsteignton, West	Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003861
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Chambered cairn 430 metres south of Buttern, Gio	dleigh, West Devor	1
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021217
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Chambered cairn 830 metres south of Buttern, Gio	dleigh, West Devor	1
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021216
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Part of a coaxial field system, prehistoric settlemen	its and cairns on Bu	uttern Hill, Gidleigh, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021215
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Stone hut circle 380 metres north west of North C Scheduled Monument Generally satisfactory but with significant localised problems Plant growth Private Stone hut circle and field system 580 metres north system on Buttern Hill, Gidleigh, West Devon Scheduled Monument	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	West Devon 1021220 Declining No Andy Crabb 01626 832093	
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Generally satisfactory but with significant localised problems Plant growth Private Stone hut circle and field system 580 metres north system on Buttern Hill, Gidleigh, West Devon	TREND: NEW ENTRY?: CONTACT:	Declining No	
PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	problems Plant growth Private Stone hut circle and field system 580 metres north system on Buttern Hill, Gidleigh, West Devon	NEW ENTRY?: CONTACT:	No	
OWNER TYPE: SITE NAME:	Private Stone hut circle and field system 580 metres north system on Buttern Hill, Gidleigh, West Devon	CONTACT:		
SITE NAME:	Stone hut circle and field system 580 metres north system on Buttern Hill, Gidleigh, West Devon		Andy Crabb 01626 832093	
	system on Buttern Hill, Gidleigh, West Devon	west of North Cre		
DESIGNATION:	Scheduled Monument	Stone hut circle and field system 580 metres north west of North Creaber, forming part of a coaxial field system on Buttern Hill, Gidleigh, West Devon		
		LIST ENTRY NUMBER:	1021219	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Two stone hut circles and field system, 590 metres south of Buttern, forming part of a coaxial field system Buttern Hill, Gidleigh, West Devon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021218	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Enclosure, two stone hut circles and an alignment of upright stones 780 metres north west of Little Links Tor, Lands common to the Parishes of Bridestowe and Sourton, West Devon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007648	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Hut circles and a length of enclosure wall, forming part of a stone hut circle settlement 600 metres east of Nodden Gate, Lands common to the Parishes of Bridestowe and Sourton / Lydford, West Devon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008638	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Stone hut circle 530 metres ESE of Nodden Gate forming an outlying part of a stone hut circle settlement, Lydford, West Devon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008639	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Stone hut circle 610 metres ESE of Nodden Gate f	orming an outlying	part of a stone hut circle settlement
DESIGNATION:	Lydford, West Devon Scheduled Monument	LIST ENTRY NUMBER:	1008656
CONDITION:	Generally satisfactory but with significant localised	TREND:	Declining
DDINICIDAL VI II NIEDADII ITV.	problems	NIEVA/ ENITEV).	C
PRINCIPAL VULNERABILITY: OWNER TYPE:	Plant growth Crown	NEW ENTRY?: CONTACT:	No Andy Crabb 01626 832093
	Clown		7 (ildy Crabb 01020 032073
SITE NAME:	Four round barrows on Wigford Down, Meavy, W	est Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002522
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Greenwell Girt socket stone 600 metres SSW of L	ovaton hamlet, Me	avy, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008929
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hut circles south east of Brisworthy, Meavy, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004585
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric enclosures on Dewerstone Hill, 500 me Devon	etres south east of	Dewerstone Cottage, Meavy, West
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020241
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Settlement on Wigford Down, Meavy, West Devo	n	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002550
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Settlement on Wigford Down south of Durance, N	1eavy, West Devor	<u> </u>
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002523
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Three hut circles north west of Cadworthy, Meavy	, West Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003057
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two hut circles south of Catstor Down, Meavy, W	est Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002548
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	An enclosed stone hut circle settlement, three rou Tor, Peter Tavy, West Devon	ınd cairns and a len	gth of reave 650 metres WSW of Ger
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008711
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairnfield and two stone hut circles 490 metres and 550 metres south west of Cox Tor, Peter Tavy, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020004
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Coaxial field system and prehistoric settlement 410	0 metres west of C	ox Tor, Peter Tavy, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020090
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric settlement 610 metres south west of C	Cox Tor, Peter Tav	y, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020002
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Stone hut circle and a short length of boundary wa settlement on the north east slope of Cox Tor, Pe	III forming part of a ter Tavy, West De	n unenclosed stone hut circle von
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011432
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Stone alignment, five cairns, two stone hut circles a Walkhampton, West Devon	a longui oi i ca	. o oso med es nordi east of Fiorseyea
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019566
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairnfield 460 metres south east of Cox Tor, Pete	r Tavy / Whitchur	ch, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020005
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairn east of Scout Hut, Sheepstor, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011993
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairn south west of Lower Hartor Tor, Sheepstor,	, West Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012293
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairn with a cist north of Drizzlecombe stone align	nments, Sheepstor,	West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010654
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Cairn with cist north of Gutter Tor, Sheepstor, W	est Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012473
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Enclosed stone hut settlement south west of Gutte	er Tor, Sheepstor,	West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012251
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Enclosure north west of Gutter Tor, Sheepstor, W	est Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012032
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Part of Eylesbarrow reave, Sheepstor, West Devor	ı	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011958
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric enclosed settlement 950 metres north Devon	Prehistoric enclosed settlement 950 metres north east of Ditsworthy Warren House, Sheepstor, West Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021058
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two stone alignments and a round cairn 390 metres north west of Sharpitor, Walkhampton, West Devo		arpitor, Walkhampton, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007422
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	Yes
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Prehistoric settlement, three round cairns and a post-medieval rabbit warren at Legis Tor, Sheepstor, Wes Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019876
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Round cairn east of Whittenknowles Rocks, 960 m	etres ENE of Gutt	er Tor, Sheepstor, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021052
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two enclosures and a length of the Eylesbarrow w Sheepstor, West Devon	atershed reave 800) metres WSW of Eylesbarrow,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013474
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOL	JTH WEST / DARTMOOR (NP)		
SITE NAME:	Unenclosed stone hut settlement south west of Gu	ıtter Tor, Sheepsto	or, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012239
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Warren at Sheeps Tor, 520 metres north of Chubs	stone Cottage, She	epstor, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021391
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Agglomerate enclosure and 15 stone hut circles 560 metres west of Cawsand Beacon, South Tawton, Wes Devon		Cawsand Beacon, South Tawton, West
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010791
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Agglomerate enclosure and ten stone hut circles 500 metres west of Cawsand Beacon, South Tawton, Wes		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010790
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	An agglomerated enclosed settlement 480 metres	west of Stoneyhurs	t, South Tawton, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017285
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	A prehistoric settlement complex, length of reave, tin streamwork and stamping mill on the western slopes Cosdon Hill, South Tawton / Dartmoor Forest, West Devon		d stamping mill on the western slopes o
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015760
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Coaxial field system, associated and later remains a Gidleigh, West Devon	t Throwleigh Com	mon and Kennon Hill, Throwleigh /
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018916
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 Slow decay; solution agreed but F not yet implemented.

 Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial slow decay; no solution agreed but F not yet implemented. use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

HERITAGE AT RISK 2019 / SOC	THE VEST / BARTHOOK (NI)		
SITE NAME:	A length of the Great Western Reave, a prehistoric Walkhampton Common, Walkhampton, West Dev	c settlement, three von	cairns and two field systems on
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019589
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	An enclosed stone hut circle settlement and later tin working earthworks, 540 metres south east of Down Tor, Walkhampton, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009088
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	An enclosure, attached stone hut circle and length West Devon	of reave 180 metre	es NNE of Leather Tor, Walkhampto
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1011248
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	An enclosure containing one stone hut circle 460 metres west of Cross Gate, Walkhampton, West Dev		ss Gate, Walkhampton, West Devor
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009091
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	An enclosure, six stone hut circles, a length of reave and several prospecting pits 170 metres north east Leather Tor, Walkhampton, West Devon		pecting pits 170 metres north east of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011247
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Eleven stone hut circles, a length of boundary wall settlement on the north east slope of Sharpitor, W	Eleven stone hut circles, a length of boundary wall and a field system forming part of an unenclosed settlement on the north east slope of Sharpitor, Walkhampton, West Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007435
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
	Diame	NEW ENTRY?:	Na
PRINCIPAL VULNERABILITY:	Plant growth	INEVV EINTIKTE.	No

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 Slow decay; solution agreed but for tyet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial like) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Enclosure and stone hut circle 320 metres north e settlement, Walkhampton, West Devon	ast of Sharpitor for	ming part of a stone hut circle
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007434
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
ITE NAME:	Enclosure and stone hut circle 700 metres west of	Sharpitor, Walkhai	mpton, West Devon
esignation:	Scheduled Monument	LIST ENTRY NUMBER:	1019590
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
ITE NAME:	Medieval settlement on Peek Hill, 240 metres and West Devon	280 metres north e	east of Lowery Tor, Walkhampton,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020237
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
ITE NAME:	Prehistoric coaxial field system and cairns, an historic enclosure and part of RAF Sharpitor, situated on ar around Peek Hill, Walkhampton, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020238
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
ITE NAME:	Round cairn 340 metres ESE of Norsworthy Bridge	e, Walkhampton, V	Vest Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008651
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Stone alignment, two round cairns and a length of Walkhampton Common reave lying in a valley between Sharpitor and Leeden Tor, Walkhampton, West Devon		nmon reave lying in a valley between
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007433
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
ITE NAME:	Stone hut circle 155 metres east of Sharpitor, Wal	khampton, West D	Pevon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007421
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Stone hut circle 240 metres south of Down Tor, V	Valkhampton, Wes	t Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008641	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Stone hut circle 315 metres north east of Sharpito Walkhampton, West Devon	r forming part of a	stone hut circle settlement,	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007436	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Stone hut circle 350 metres north east of Sharpito Walkhampton, West Devon	Stone hut circle 350 metres north east of Sharpitor forming part of a stone hut circle settlement, Walkhampton, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007437	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Stone hut circle 370 metres north east of Sharpitor forming part of a stone hut circle settlement, Walkhampton, West Devon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007438	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Stone hut circle settlement 250 metres east of Cuckoo Rock, Walkhampton, West Devon			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021057	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Stone hut circle settlement, irregular aggregate fiel medieval field system 700 metres SSW of Black To	d system, two long or, Walkhampton, V	houses and a medieval and post- Vest Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011170	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	
SITE NAME:	Tinworks and other archaeological remains in the Tor, Walkhampton, West Devon	Tinworks and other archaeological remains in the Meavy valley at Stanlake, Black Tor, Hart Tor and Crambe Tor, Walkhampton, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020129	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

SITE NAME:	Two stone hut circles 570 metres south west of Down Tor, Walkhampton, West Devon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019572
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two stone hut circles, a reave, round cairn and she	elter south east of S	Sharpitor, Walkhampton, West Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011167
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Andy Crabb 01626 832093
	Enclosure and stone hut circle 770 metres south of Cox Tor, Whitchurch, West Devon		
SITE NAME:	Enclosure and stone hut circle 770 metres south of	f Cox Tor, Whitch	urch, West Devon
SITE NAME: DESIGNATION:	Enclosure and stone hut circle 770 metres south of Scheduled Monument	f Cox Tor, Whitch	urch, West Devon 1020006
DESIGNATION:	Scheduled Monument Generally satisfactory but with significant localised	LIST ENTRY NUMBER:	1020006
DESIGNATION: CONDITION:	Scheduled Monument Generally satisfactory but with significant localised problems	LIST ENTRY NUMBER: TREND:	1020006 Declining
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Scheduled Monument Generally satisfactory but with significant localised problems Plant growth	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	I 020006 Declining No Andy Crabb 01626 832093 with other archaeological remains on
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Scheduled Monument Generally satisfactory but with significant localised problems Plant growth Crown Eluvial tin streamworks and prehistoric coaxial field	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	I 020006 Declining No Andy Crabb 01626 832093 with other archaeological remains on
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Scheduled Monument Generally satisfactory but with significant localised problems Plant growth Crown Eluvial tin streamworks and prehistoric coaxial field Whitchurch Common, Whitchurch / Peter Tavy / Scheduler (1988)	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: d system together v Sampford Spiney, V	1020006 Declining No Andy Crabb 01626 832093 with other archaeological remains on Vest Devon
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Scheduled Monument Generally satisfactory but with significant localised problems Plant growth Crown Eluvial tin streamworks and prehistoric coaxial field Whitchurch Common, Whitchurch / Peter Tavy / Scheduled Monument Generally satisfactory but with significant localised	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: d system together v Sampford Spiney, V LIST ENTRY NUMBER:	I 020006 Declining No Andy Crabb 01626 832093 with other archaeological remains on Vest Devon I 020089

EAST DEVON



SITE NAME: Church of St Michael, Honiton DESIGNATION: Listed Building grade II* CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (New entry - re-assessed) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1306112

Former parish church, latterly a chapel of ease, and now closed for worship. Dates mainly from late C15. Interior destroyed by fire and rebuilt 1912. Metal corroding internally in arcaded capital heads. Leaking due to blocked valley gutters. The church was closed and, in early 2019, was handed to the Diocesan Board of Finance which is now arranging for urgent repairs to be undertaken. Historic England is in discussion with the diocese regarding the future of the building.

Contact: Annie Evans 0117 975 0673

© Historic England



© Historic England

SITE NAME:	Poltimore House, Poltimore
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1098310

C16 country house with later additions. Acquired by a trust with funding from Historic England and the Local Planning Authority in 1997. Urgent works carried out in 1998 to make the building wind/weathertight. Emergency roof cover erected 2006. A feasibility study was undertaken in 2007 with grant-aid from the Architectural Heritage Fund and Historic England. Historic England is offering technical advice to the trust to help find a repair solution for the house. This is developing, but as of 2019 a comprehensive plan for the house is still required.

Contact: John Ette 0117 975 0687

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:



© Historic England

SITE NAME:	Stable block at Bishop's Court, Clyst St Mary, Sowton
DESIGNATION:	Listed Building grade I
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)

Private

1333998

Long early C16 range of stables attached to Bishop's Court tithe barn. Site is not in use. Historic England funded a feasibility study, which was completed in 2011.

Large mid-C14 barn with arch-braced base-cruck roof of seven bays, and long early C16 range of stables. The site is unused with a temporary corrugated roof. The owners undertook a Historic England grant-aided feasibility study

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Tithe barn at Bishop's Court, Clyst St Mary, Sowton
DESIGNATION:	Listed Building grade I
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1164637

Contact: Sarah Ball 0117 975 0666

Contact: Annie Evans 0117 975 0673

into potential uses, completed 2011.



Church of St Michael and All SITE NAME: Angels, Awliscombe DESIGNATION: Listed Place of Worship grade I CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1098097

Parish church. Largely late C15/early C16, mostly rebuilt in 1846 by Robert Medley Fulford. Mostly local flint with Beerstone dressings and a slate roof. Medieval and C19 features. Tower roof and valley gutter in a poor condition. Some other minor areas of concern.

© Historic England



© Historic England

SITE NAME:	Church of Holy Trinity, Dunkeswell
DESIGNATION:	Listed Place of Worship grade II, SM
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1308999

Parish church, built on the site of Dunkeswell Abbey Church in 1842. Local stone and flint rubble with Hamstone dressings and detail and a slate roof. The roofs have had substantial leaks which have caused significant water ingress. This has damaged the internal plaster. The congregation reroofed the church in 2015, but considerable interior work is still required and glazing is also in poor condition. Discussions over the future of the church are continuing with the Dunkeswell Abbey Preservation Trust.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Paul, High Street, Honiton
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1116954

Parish church. Completed 1838 by architect Charles Fowler. Romanesque style with apse. Seven bays with round-arched aisle and clerestorey windows. Galleries. Restored 1849. Stone and plaster falling internally. Beerstone hoodmoulds aremade of cement on nails which is causing decay problems. Windows are in need of repair and there are cracks in the tower.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

SITE NAME:	Newenham Abbey, Axminster		
DESIGNATION:	Scheduled Monument, 3 LBs	LIST ENTRY NUMBER:	1011671
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Hawkesdown Camp and associated outwork, Axm	outh	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017775
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	The Axe Boat, 22 metres north of the Axmouth Ro	oad Bridge, Axmou	th
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1433819
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 400 metres north east of Common F	arm, Aylesbeare	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017770
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 210 metres north east of Starved Oa	k Cross, Brampfor	d Speke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010633
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow in Long Plantation, 610 metres north east of Starved Oak Cross, Brampford Speke		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010636
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow in Long Plantation, 680 metres north	east of Starved Oa	k Cross, Brampford Speke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010634
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 320 metres north east of Starved Oa	k Cross, Brampfor	d Speke / Upton Pyne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010632
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Row Barrow, Dunkeswell		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016563
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Dunkeswell Abbey, Dunkeswell		
DESIGNATION:	Scheduled Monument and Listed Building grade II, 3 LBs	LIST ENTRY NUMBER:	1009303 and 1098253
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Two bowl barrows at Big Wood, 580 metres south Exmouth	west and 470 me	tres south of Moorland Cottage,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017949
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Round barrow cemetery on Broad Down, Farway /	Southleigh	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017642
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A bowl barrow 370 metres WNW of Ring-in-the-Mire, forming part of a round barrow cemetery on Gittisham Hill, Gittisham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014249
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A bowl barrow 460 metres NNW of Ring-in-the-Mire, forming part of a round barrow cemetery on Gittisham Hill, Gittisham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014248
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A bowl barrow 500 metres WNW of Ring-in-the-M Gittisham Hill, Gittisham	lire, forming part o	of a round barrow cemetery on
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014250
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C. Slow decay: no solution agreed.

 D. Slow decay; solution agreed but F not yet implemented.

 Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial lists). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	A bowl barrow 570 metres NNE of Putts Corner, Hill, Gittisham	forming part of a r	ound barrow cemetery on Gittisham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014254
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A cairn 450 metres WNW of Putts Corner, forming Gittisham	ng part of a round l	barrow cemetery on Gittisham Hill,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014255
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A ring cairn and bowl barrow 54 metres NNE of F Gittisham Hill, Gittisham	Putts Corner, formi	ng part of a round barrow cemetery
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014253
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A bowl barrow 420 metres NNW of Ring-in-the-N Gittisham Hill, Gittisham / Honiton	1ire, forming part o	of a round barrow cemetery on
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014247
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Two bowl barrows, 220 metres ESE of Putts Corn Hill, Gittisham / Sidmouth	er, forming part of	a round barrow cemetery on Gittish
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014251
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Membury Castle, Membury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017951
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
ITE NAME:	Cursus, long mortuary enclosure, ring ditch and ot Barton, Nether Exe	ther associated cro	pmarks 700 metres east of Netherex
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014144
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two bowl barrows north of Green Lane, 430 me	etres and 330 metres	west of Rewe Cross, Nether Exe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016565
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Belbury Castle, Ottery St. Mary		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017774
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	A bowl barrow 120 metres south west of Ring-in Gittisham Hill, Sidmouth	n-the-Mire, forming pa	art of a round barrow cemetery on
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014246
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Stockland Great Castle, Stockland		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017952
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 470 metres east of Fortescue, Stok	e Canon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016564
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Roman villa 300 yards (270 metres) SSW of Hole	combe Farm, Uplyme	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002558
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 280 metres NNE of Starved Oak C	Cross, Upton Pyne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010638
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 300 metres SSE of Stevenstone Far	m, Upton Pyne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015973
	Francisco de Company I I anno	TREND:	Declining
CONDITION:	Extensive significant problems	TREND.	Deciming
CONDITION: PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOUTH	H WEST / EAST DEVO	N		
SITE NAME:	Bowl barrow 3!	50 metres NNE of Starved Oak Cro	ss, Upton Pyne	
DESIGNATION:	Scheduled Moni	ument	LIST ENTRY NUMBER:	1010639
CONDITION:	Extensive signific	cant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughin	g	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple	e owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 45	50 metres SSE of Stevenstone Farm,	Upton Pyne	
DESIGNATION:	Scheduled Moni	ument	LIST ENTRY NUMBER:	1015974
CONDITION:	Extensive signific	cant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughin	g	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple	e owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Earthwork encl	osure 330 yards (300 metres) south	west of Three Ho	orse Shoes Inn, Upton Pyne
DESIGNATION:	Scheduled Monu	ument	LIST ENTRY NUMBER:	1002645
CONDITION:	Extensive signific	cant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other		NEW ENTRY?:	No
OWNER TYPE:	Private	Private		Charlotte Russell 01271 831505
SITE NAME:	Two bowl barro	ows, 350 metres south of Stevensto	ne Farm, Upton Py	/ne
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1010631
CONDITION:	Extensive significant problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughin	g	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Castle Hill, Wid	lworthy		
DESIGNATION:	Scheduled Moni	ument	LIST ENTRY NUMBER:	1017477
CONDITION:	Generally satisfactory but with significant localised problems		TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree grov	wth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple	eowners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Woodbury Cas	tle, Woodbury		
DESIGNATION:	Scheduled Moni	ument	LIST ENTRY NUMBER:	1003862
CONDITION:	Extensive signific	cant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion -	- extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial con	mpany	CONTACT:	Charlotte Russell 01271 831505
	SITE NAME:	Bicton, Bicton / Colaton Raleigh / East Budleigh	manor. Large pa	untry house estate developed from earlierly, important gardens and arboretum.
	DESIGNATION:	Registered Park and Garden grade I, 19 LBs, SM	Registered park in three main ownerships. The c site, including the principal house, has been deve the post-war era as a land-based college. Contir	e principal house, has been developed in as a land-based college. Continuous
	CONDITION:	Generally unsatisfactory with major localised problems	tended to erode	elopment as the college has expanded ha the integrity of the designed landscape. a masterplan to guide and inform
	VULNERABILITY:	High	development rer	mains a major cause for concern.
	TREND:	Stable		
© James Carter	NEW ENTRY?:	No		
	OVA (A JED T) (DE	NA: L L: L		

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.

OWNER TYPE:

LIST ENTRY NUMBER:

D Slow decay; solution agreed but not yet implemented.

E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Mixed, multiple owners

1000338

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Jo McAllister 0117 975 0696

ABBREVIATIONS

LIST ENTRY NUMBER:

EXETER



© Historic England

SITE NAME:	Church of St Thomas the Apostle, Cowick Street, Exeter
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Religious organisation

1169954

Church largely rebuilt in 1657. The west tower, south aisle and east end of north aisle are C17. Due to poor original design and lack of maintenance, roofs were in poor condition, rainwater goods failed and water penetrated parapet walls and gutters damaging the structure and decorative detail. A National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship funded a first phase of repairs (2013). Further NHLF Grants for Places of Worship funded additional phases (2015 and 2017). Additional work to the aisle roof and interior of the body of the church is still needed.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Mary Steps, West Street, Exeter
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1224263

C15 fabric. Restored 1868-72 by Edward Ashworth. Chancel re-ordered 1966 by Lawrence King. Nave, chancel, south west tower, south aisle and chapel, north west vestry. The church is very compact, which reflects its constricted site just within the walls of medieval Exeter. Slate roofs. Red Heavitree stone in large blocks with limestone dressings. A National Lottery Heritage Fund Grant for Places of Worship funded the repair of the tower, completed in early 2018. There are cracks in the south east corner and the aisle roof structure and covering are poor. A further phase of work will be needed.

Contact: Sarah Ball 0117 975 0666

SITE NAME:	Exeter city walls		
DESIGNATION:	Scheduled Monument, 2 RPGs, 4 CAs	LIST ENTRY NUMBER:	1003858
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093

EXMOOR (NP)



SITE NAME:	Church of St Brendan, Church Hill, Brendon, North Devon
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1289343

Parish church. Nave, chancel and south porch of 1738, tower rebuilt 1828; the whole restored and north aisle, north transept and vestry added in 1873. Dressed and roughly dressed stone with some brick dressings to vestry, the C19 work snecked with ashlar dressings. There are problems with the foundation beams and dampness in the tower. The gutters and drainage need repair and the external walls need repointing.

Contact: Annie Evans 0117 975 0673



© Historic England

© Historic England

SITE NAME:	Church of St Martin, Martinhoe, North Devon
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1106778

Small parish church dating from C13 with later additions. Stone rubble, tower roughly coursed, with ashlar dressings and slate roofs. Some slipped slates, cracked cement, ground gutter and rainwater goods in bad condition. Cement pointing round tower arch, blistering paint on north aisle and south wall of chancel.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument

SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Badgworthy deserted medieval village, Doone's H	ouses, Brendon, No	rth Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003886
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Two round barrows on Cheriton Ridge, Brendon	, North Devon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002583
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Earthwork defences of Countisbury Castle promo	ontory fort (Wind H	ill), Lynton and Lynmouth, North
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020807
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Remains of leat serving former hydro-electric gen metres east of Oxen Tor, Lynton and Lynmouth,	erating station, on th North Devon	ne south bank of the East Lyn River, 2
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020808
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Standing stones on eastern edge of Furzehill Com	mon, Lynton and Ly	nmouth, North Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003300
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Two round barrows and cairn cemetery, llkerton	Ridge, Lynton and L	ynmouth, North Devon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002566
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Charlotte Russell 01271 831505
	T 11 \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	ton and Lynmouth, I	North Devon
SITE NAME:	Two round barrows near Warcombe Water, Lyn	· · · · · · · · · · · · · · · · · · ·	
SITE NAME: DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003299
	•	•	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003299

- implemented.

 C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

MID DEVON



© Historic England

SITE NAME:	The Manor House Hotel, 2, Fore Street, Cullompton
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Commercial company

1105901

Hotel in partial use, formerly early C17 merchant's house. Concerns regarding the structural stability and public safety led to the Council serving a repairs notice. Most of the external items of work specified in the notice were complied in 2015-16 but subsequent concerns arose regarding the stability of the ornate shell hood porch and the hanging sign on the main facade. A listed building application has now been submitted to address those concerns and stabilise the hood and sign, the site has been scaffolded and work has started. Internal refurbishment on upper floors still to be completed.

Contact: Jenny Chesher 0117 975 0686

i na		
	<u>'</u>	

LIST ENTRY NUMBER:

SITE NAME:	Prescott Baptist Chapel, Culmstock
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

Simple C18 church in an isolated rural location. There are two other Baptist churches within a five mile radius which are closer to centres of population. Its physical problems are putting historic window fabric at risk, and could rapidly escalate into more serious repair problems if not remedied. The chapel has been sold and is no longer in use as a place of worship. Historic England has had discussions with the owner but work is required.

LIST ENTRY NUMBER: 1147714 Contact: Annie Evans 0117 975 0673 © Historic England

Commercial company

SITE NAME:	Roman fort 300 metres north east of Cudmore Fa	rm, Bampton / Clay	hanger
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011251
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	A henge, two barrows, two ring ditches, two enclo of Lower Hampson, Bow	osures and part of a	linear feature 420 metres north west
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015472
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Bowl barrow 80 metres south west of Hampson C	Cottage, Bow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016189
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Bowl barrow 140 metres south east of Burston Cr	ross, Bow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015471
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

HERITAGE AT RISK 2019 / SOL	JTH WEST / MID DEVON		
SITE NAME:	Bowl barrow 220 metres south west of Hampson	Cottage, Bow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015474
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two bowl barrows 180 metres south west of Ham	npson Cottage, Bow	1
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015475
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two bowl barrows 250 metres north of Natson Fa	arm, Bow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015476
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Canonsleigh Abbey, Burlescombe		
DESIGNATION:	Scheduled Monument, LB grade II, CA	LIST ENTRY NUMBER:	1003830
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Millsome Castle, Coldridge		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016227
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Posbury camp, Castle Down, Crediton Hamlets		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003826
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Romano-British villa, Downes, near Crediton, Cred	diton Hamlets	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002668
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Two Roman forts and two Roman camps at St And	drew's Hill, Cullomp	oton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019543
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Three bowl barrows 250 metres south east	t of Gibbet Moor Cross, T	empleton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017134
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Bowl barrow 260 metres north west of Put	tson Cross, Tiverton	
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1017132
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Eggesford Castle, 640 metres north east of	Eggesford House, Wembw	vorthy
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016208
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Bowl barrow 130 metres north east of Burs	ston Cross, Zeal Monacho	rum
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015152
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Bow		
designation:	Conservation Area, 20 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Sue Warren (LPA) 01884 234264
SITE NAME:	Cullompton		
DESIGNATION:	Conservation Area, 46 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Sue Warren (LPA) 01884 234264
SITE NAME:	Tiverton		
	C : A 1041 B 2 CM	NEW ENTRY?:	NI-
designation:	Conservation Area, 194 LBs, 2 SMs	TAETT EITHEIL.	No
designation: Condition:	Conservation Area, 194 LBs, 2 SMs Very bad	TREND:	Deteriorating

NORTH DEVON



SITE NAME: Hall House, Bishop's Tawton DESIGNATION: Listed Building grade II* CONDITION: Poor OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1107730

Built c1846-50 by Philip Hardwick, with a rear range by RD Gould. The house lies within an estate, and there are several other listed structures within the vicinity. The main range is generally in a fair condition. The rear range is still in poor condition, though the roof is weathertight. The owners are very gradually addressing the repair issues.

© Historic England Archive

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Annie Evans 0117 975 0673

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA NP RPG Registered Park and Garden Scheduled Monument UA Unitary Authority
WHS World Heritage Site



© Historic England

SITE NAME:	Bunksland Farmhouse and attached outbuildings, East Anstey
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private

1106670

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

A remarkably unspoilt medieval farmhouse, multiphased, with a surviving early roof structure of some architectural detail and an interesting plan form. The property has been vacant since 2009 and has suffered from deterioration at the external cob wall as well as the collapse of an internal cob partition and roof truss supporting the floor above. Ownership uncertainties are delaying a resolution. In 2019 Historic England has supported North Devon District Council to serve an Urgent Works Notice which has enabled propping and protection work to be carried out.

Contact: Annie Evans 0117 975 0673

	17
E,A	

© Historic England Archive

SITE NAME:	Broomham Farmhouse, King's Nympton
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private

1152877

house, and work is very gradually continuing, but further structural work is still required.

thatched with Historic England grant aid in 2013. Improvements have permitted the family to return to the

Early C16 longhouse with later additions. The roof was re-

Contact: Annie Evans 0117 975 0673



	DESIG
4	CONI
	PRIOF
	OWN
	LIST E

SITE NAME:	Church of St James, Arlington
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1106820

Parish church. Late C15 or early C16 tower with some C19 work. Set in the landscape of Arlington Court, which is owned by the National Trust. Options are being explored by the very small congregation, possibly in conjunction with the neighbouring National Trust. Blocked downpipes are causing significant damage to the interior and roofing repairs are also required. The congregation has been seeking funding but no substantive work has been carried out to date.

Contact: Annie Evans 0117 975 0673



		ti di
1	M	
	SVII TON	Seption 1

SITE NAME:	Church of St John the Baptist, East Down
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1163326

Parish church sited adjacent to the manor house. Surviving C13 fabric to tower, C15 south aisle and some C19 work. The congregation is steadily working through repairs. Roof repairs were completed under the National Lottery Heritage Fund and Historic England Repair Grants for Places of Worship scheme in 2005. Tower is very damp and has structural issues with significant cracking. Condition of windows also remains poor.

Contact: Annie Evans 0117 975 0673

© Historic England

© Historic England

1	

© Historic England

SITE NAME:	Parish Church of Holy Trinity, Church Road, Ilfracombe
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1208207

Large parish church. Early tower with church enlarged in the 1320s and again in the C15. Problems with roof and gutters led to water penetration and subsequent damage of internal fabric. The congregation has been in discussions with Historic England and has repaired the eastern roofs with a Listed Places of Worship Roof Repairs Grant. However the tower (with Norman stonework) and west end of the church, including windows with notable Kempe glass, remain in poor condition.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



The second second	
A	
© Historic	England

SITE NAME:	Church of St Michael, Marwood
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1107157

tower, vestry chimney and north aisle wall. An application to the Listed Places of Worship Roof Repair Grant scheme in 2016 was unsuccessful.

Contact: Annie Evans 0117 975 0673

Parish church. C13 fabric to chancel with two lancets to north side and pointed south doorway. South transept with single lancet in east wall and unmoulded pointed arch into nave. Battered plinth in north aisle indicates former north transept and original cruciform plan. Cracked ridge tiles and missing slates. Rainwater goods need overhauling. Internal damp staining to walls. Bench ends with active insect infestation. Vegetation growth on stonework to

Parish church, sited in a farmyard. Damp has caused deterioration of the fabric and significant works are needed. The east end of the south aisle has cracking and there is some structural movement in the fabric.

SITE NAME:	Church of St John, Satterleigh and Warkleigh
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1258818

R: 1258818 Contact: Annie Evans 0117 975 0673

0	Historia	Fna	land

SITE NAME:	Barnstaple Castle, Barnstaple		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1020922
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Charlotte Russell 01271 831505



© Historic England

SITE NAME:	Church of St Mary Magdalene, The Churchyard, South Molton
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Religious organisation

1317855

Large parish church mainly C15, restored in C19. The stonework has started to decay and the roofs are in bad condition. Water ingress to the interior is causing continuing damage. The church was awarded a maximum Listed Places of Worship Roof Repairs Grant and during 2018 the south aisle, south transept and Lady Chapel roofs were re-slated. Timber flooring has also been repaired. Further funding is still required.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Hillfort on Whitechapel Moors, 640 metres north 6	east of Garliford M	ill, Bishop's Nympton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016214
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505



© Historic England

SITE NAME:	Church of St Bartholomew, Stoke Rivers
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1107658

Parish church. Mainly late C15 to early C16 but may be some earlier fabric. Some C18 work survives. Main restoration in 1880s and in 1905, but possibly some earlier restoration work of 1831. Stone rubble with stone dressings. Slate roofs with coped gabled ends. West tower, nave, chancel, south aisle and south porch. There has been work to the chancel south gutter but an overhaul of other rainwater goods is still needed. Poor drainage. Roofs reported to be in a poor condition. Tower is damp with vegetation growth and tower internal timbers are also reported to be poor.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise.

New Entry is noted).

ABBREVIATIONS CA Conservation Area s LB Listed Building c, LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument

SITE NAME:	Round barrow cemetery 210 metres south west of	f Hillcrest, Centery	Lane, Bittadon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019252
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
ITE NAME:	Round barrow cemetery 500 metres east of Little	Bray Cross, Bratto	n Fleming
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017137
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
ITE NAME:	Wayside cross known as Eastacott Cross or the Stonen Hammer, Chittlehampton		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1013727
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 280 metres north east of Beacon Mo Chulmleigh	or Cross, forming	part of a round barrow cemetery,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015153
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 330 metres east of Beacon Moor Cro	oss, forming part of	a round barrow cemetery, Chulmle
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015154
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Round barrow cemetery on West Burrow Moor, E	ast Worlington	
DESIGNATION:			
	Scheduled Monument	LIST ENTRY NUMBER:	1016215
	Scheduled Monument Extensive significant problems	LIST ENTRY NUMBER: TREND:	1016215 Declining
CONDITION:			
CONDITION: PRINCIPAL VULNERABILITY:	Extensive significant problems	TREND:	Declining
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE:	Extensive significant problems Arable ploughing	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME:	Extensive significant problems Arable ploughing Private, multiple owners	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME: DESIGNATION:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming	TREND: NEW ENTRY?: CONTACT:	Declining No Charlotte Russell 01271 831505
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument	TREND: NEW ENTRY?: CONTACT: Ston LIST ENTRY NUMBER:	Declining No Charlotte Russell 01271 831505
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument Unknown	TREND: NEW ENTRY?: CONTACT: Ston LIST ENTRY NUMBER: TREND:	Declining No Charlotte Russell 01271 831505 1003847 Unknown
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument Unknown Other	TREND: NEW ENTRY?: CONTACT: STON LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Declining No Charlotte Russell 01271 831505 1003847 Unknown No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument Unknown Other Charity (non-heritage)	TREND: NEW ENTRY?: CONTACT: STON LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Declining No Charlotte Russell 01271 831505 1003847 Unknown No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument Unknown Other Charity (non-heritage) Hillfort 400 metres north west of Woodhouse, Quantum problems	TREND: NEW ENTRY?: CONTACT: Eton LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Declining No Charlotte Russell 01271 831505 1003847 Unknown No Charlotte Russell 01271 831505
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument Unknown Other Charity (non-heritage) Hillfort 400 metres north west of Woodhouse, Quantum Scheduled Monument	TREND: NEW ENTRY?: CONTACT: Ston LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: Deen's Nympton LIST ENTRY NUMBER:	Declining No Charlotte Russell 01271 831505 1003847 Unknown No Charlotte Russell 01271 831505
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: OWNER TYPE: OWNER TYPE:	Extensive significant problems Arable ploughing Private, multiple owners Stone Row on Isley Marsh, Lower Yelland, Freming Scheduled Monument Unknown Other Charity (non-heritage) Hillfort 400 metres north west of Woodhouse, Questions Scheduled Monument Extensive significant problems	TREND: NEW ENTRY?: CONTACT: Eton LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: Deen's Nympton LIST ENTRY NUMBER: TREND:	Declining No Charlotte Russell 01271 831505 1003847 Unknown No Charlotte Russell 01271 831505 1015463 Declining

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

IERITAGE AT RISK 2019 / SOU	TH WEST / NORTH DEVON		
SITE NAME:	Two bowl barrows 100 metres east of Catkill Cros	ss, Rose Ash	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015145
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Camp south of Birch Ham Wood, Stoke Rivers		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002533
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 225 metres south east of Elworthy C	ross, Witheridge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016650
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 300 metres north west of Witheridge	e Moor Cross (wes	t), Witheridge
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016652
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 610 metres south east of Elworthy C	ross, Witheridge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016651
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow on Dart Raffe Moor lying 550 metres	south west of Bro	adridge Farm, Witheridge
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015150
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	llfracombe		
DESIGNATION:	Conservation Area, 119 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Collette Hall (LPA) 01271 388352

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

OWNER TYPE:

LIST ENTRY NUMBER:

SOUTH HAMS



© Historic England

SITE NAME:	Deer Park wall at Berry Pomeroy Castle, Berry Pomeroy
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	F (F)

Private

1108572

Medieval deer park wall, extended in the C16. Neglected, heavily overgrown with ivy and partially collapsed in places. The estate has prepared a condition survey in order to understand and monitor mechanisms of decay and to prioritise repairs. A pilot repair scheme was undertaken in 2013/14 with funding from Natural England. This was extended in 2014/15 and a team from the estate continues to make repairs for a period every summer. There have been some further areas of collapse and as of 2019 significant work is still required to stabilise other sections, but steady progress is being made.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Week, Berry Pomeroy
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1108575

Small house reduced in size and now derelict. C16, date 1584 on interior plasterwork now removed to Totnes museum. Also barn at right angles. Stone rubble walls with gabled ends, new slate roof and concrete ring-beam replacing scantle roof. Originally L-shaped on plan but south wing replaced by an adjoining linhay. South east wall partly rebuilt in blockwork. No first floor, stair or glazing, wall footings concreted, ground level raised at north sides. Condition stable but vulnerable. Historic England is in discussion with owner and lessee regarding repair and reuse.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Old Postern, Dartington
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Charity (non-heritage)
LIST ENITRY NILIMBER:	1219732

A late medieval house of considerable importance and complexity. Formerly the parsonage, extended and remodelled in the 1860s by William White and further modified in 1928-9 by Rex Gardner for the Elmhirsts; most recently the building has provided accommodation for the Schumacher College at Dartington. It closed for use in November 2018 after concerns were raised about the slate roof covering, which is in a poor state of repair and not weathertight in several areas. The owners are in discussion with Historic England and the Local Authority regarding a programme of major repairs to the roof.

Contact: Jenny Chesher 0117 975 0686



© South Hams District Council

SITE NAME:	Yarde Farmhouse, Malborough
DESIGNATION:	Listed Building grade I
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1108479

Late C16 evolved manor house. The house, its detached kitchen and also the early C18 chamber block are now wind and weathertight externally. The greatest area of uncertainty remains the interior of the lodging range and the important painted hangings whose conservation and future display are not resolved.

Contact: Annie Evans 0117 975 0673



© Historic England Archive

SITE NAME:	39, The High Street, Totnes
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1236133

Fine C17 plasterwork and interior threatened by poor condition of roof and opening up of floor on the second floor. Ground floor is a shop. Upper floors are unoccupied and in need of repair and new services. Slipped slates and windows in very poor condition. There is increased concern about the condition of the building and Historic England has been in discussion with the Local Authority.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site

LIST ENTRY NUMBER

OWNER TYPE:

CITE NIAME.

LIST ENTRY NUMBER:



© Historic England Archive

SITE NAME:	Fort Bovisand, Wembury
DESIGNATION:	Scheduled Monument, 2 LBs
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (C)
OWNER TYPE:	Charity (heritage)

1002584

Major C19 fort complex forming part of the ring of defences around Plymouth. Most recently used as a base for training divers, it is now disused. A scheme for resdiential conversion with significant levels of public access and interpretation has been agreed and planning permission was granted in 2017. Enabling works and recording have started and are progressing.

Contact: Simon Hickman 0117 975 0717

David .	
Tol	
at Sept.	

© Historic England

SITE NAME:	Garden wall, steps and gate piers south of Langdon Court Hotel, Langdon, Wembury
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1169143

Late C17 to early C18 formal terraced garden, the layout little altered since the early C18. Terraces extend south from the house on rising ground, with central axial path and connecting steps. Enclosed by walls to the east, south and west. The northern (larger) terrace has C17 gate piers and gates in the east and west walls and a central pool. The present owner has instigated a programme of phased repair, which is partially completed but condition has remained static for the last few years.

Contact: Jenny Chesher 0117 975 0686



© Historic England

SITE NAME:	Pair of garden houses south of Langdon Court Hotel, Langdon, Wembury
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)

Private

1108587

Early C18 gazebos standing at the junction of the northern and southern terraces in the late C17 to early C18 formal terraced garden to the south of the house. Extensive repairs have been undertaken to the building exteriors and an application was made in 2014 for their alteration to be used as ancillary accommodation to the hotel in the main house. That was withdrawn pending further discussions with the local planning authority and Historic England. A revised application made in 2018 was approved in July of that year but does not appear to have yet been implemented.

Contact: Jenny Chesher 0117 975 0686



© Historic England

SITE INAME:	Wembury
DESIGNATION:	Scheduled Monument, LB grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Government or agency
LIST ENTRY NUMBER:	1002585

Watch House battom, and ditch

Constructed 1904 but utilising an 1860s ditch system, with First and Second World War additions. The site was leased to a private company until 2009, and since then has been vacant and subject to vandalism. Recording has been put in hand but no options for repair/reuse have been agreed.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Mary, Berry Pomeroy
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1108535

Parish church. Rebuilt in C15 restored in the late C17 and 1878 to 1879. Tower has C13 or C14 west doorway. Stone rubble with freestone dressings and slate roofs, tower rendered. Nave and chancel in one. The church is generally very well maintained and a number of significant repairs have been undertaken. Despite this, the tower remains damp with problems with the render, and the main roofs also need work. The congregation applied in the last round of grants for Places of Worship Scheme from the National Lottery Heritage Fund but was unsuccessful.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair or in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is
shown in brackets (otherwise,
New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument

JA Unitary Authority
VHS World Heritage Site



SITE NAME:	Church of St Lawrence, Bigbury
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1325078

A C14 and C15 church much rebuilt by Sedding in the C19. Nave, chancel, north aisle, south transept, south porch, west tower with spire. Though the congregation has done a lot of work including undertaking works to the rainwater goods there is still a notice in the church that the plaster is dangerous. Damp tower. Ringing chamber has little ventilation.

Contact: Annie Evans 0117 975 0673

© Historic England

© Historic England

© Historic England

© Historic England



SITE NAME:	Church of St Michael, Main Street, Blackawton
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1108023

Parish church. C14 chancel and possibly tower; nave and aisle rebuilt c later C15 or early C16. Restored in 1887, 1893, 1895 and 1898. Local shale rubble with granite and some red sandstone dressings slate roof. The church is generally well-maintained and the roofs are all in good condition. However the tower masonry is damp and friable. Steeplejacks have undertaken emergency tower repairs but it still needs further work.

Contact: Annie Evans 0117 975 0673

1	A Total
	3
TANK!	
	(B)

SITE NAME: Church of St Mary, Charleton

DESIGNATION: Listed Place of Worship grade II

CONDITION: Poor

PRIORITY CATEGORY: C (C)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: 1108510

Parish church. C15 heavily restored in 1849-50. Slatestone rubble walls; windows largely of Caen stone, slate roofs. The fittings are all Victorian and the octagonal font, pulpit and desk are also of Caen stone. High level tower repointed. Rainwater goods rusting and undersized and failing to get the water away from the church resulting in cracking and staining to the interior. Internal decorations poor. The church is generally well maintained and slate roof repairs have been completed. However, significant repairs still need to be undertaken.

Contact: Annie Evans 0117 975 0673

1		
100		
2		
4	11	
		100

SITE NAME:	Church of St Sylvester, Chivelstone
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1108470

Parish church. C15 restored in late C19 or early C20. Slatestone rubble walls. Gabled slate roofs. Good collection of medieval joinery. Small, rural parish church with a number of problems which add up to a significant amount of work: roofs, rainwater goods, damp ingress and structural movement all need addressing. The congregation is making an application to the National Lottery Heritage Fund in 2019 for work to address structural and waterproofing issues, and has commissioned a conservator's report on the Rood and Parclose Screens and Pulpit.

Contact: Annie Evans 0117 975 0673

	- A - 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	7
©	Historic	England

SITE IVALIE.	Street, Kingsbridge
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1165559

Church of St Edmund, Fore

Large parish church of cruciform plan with transepts, north and south aisles to nave, chancel aisles and two-storey south porch. The C13 tower remains, church was rebuilt and dedicated 1414. Restored and extended 1849 and 1896. Internal decorations are in poor condition and have staining in numerous places. Staining below valley gutters that may be failing. Windows and stonework problems urgent. A blocked valley gutter has now led to dry rot outbreak in south aisle, the congregation is consulting the church architect on remedial work.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

SITE NAME

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument

Unitary Authority World Heritage Site



England

© Historic England

© Historic England

© Historic England

SITE NAME:	Church of the Blessed Virgin Mary, Rattery
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

LIST ENTRY NUMBER: 1147626

Parish church. C13, enlarged in C15 by addition of aisles and enlargement of transepts. Restored probably c1860s. Roughcast stone with slate roofs. Internally the walls are entirely plastered with unique incised and painted decoration. This has been affected by previous high level roof leaks and more so from rising damp retained by hard cementitious external pointing which is causing significant salt damage internally. The congregation has begun to plan a campaign of repair and to consider sources of funding.

Contact: Annie Evans 0117 975 0673

To a part of	
	in the first of the second
	114.

SITE NAME:	Church of St Paul, Staverton
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1108524

Early C14 church, largely rebuilt in the C15, with north and south aisles, western tower and two-storey porch. Rainwater goods have been overhauled. Vestry roof poor. Very damp at low level with damage to tile floors and evidence of beetle in pew platforms and white salts. Cracks in cement render. In need of stonework repair and repointing.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of St Michael, Strete
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1165589

Parish church in Perpendicular Gothic style built in 1836 with older tower. Cementitious render over local slate rubble. Single span Welsh slate roof over nave and aisles with gabled ends and eaves brackets to moulded cast-iron gutters. Very damp tower. High level water penetration with salts and damage to interior plaster and decorations. Other works to the church have been done but these issues have not been addressed.

Contact: Annie Evans 0117 975 0673

To All	110	W

SITE NAME:	Church of St Mary, High Street, Totnes
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1236065

Former priory church rebuilt 1430-60. Random Devonian rubble with red sandstone dressings, some pale limestone dressings and parapets, and sandstone tower. Tower stonework poor needing repointing and vegetation removal. North aisle parapet and stonework decaying. Ground gutters poor. Rainwater goods need painting and vegetation removed. Internal damage to windows from rusty ferramenta (iron work) and damaged paint to north aisle east end on chancel south wall. Discussions with the church regarding proposals for reordering continue but as of 2019 substantial repairs are still needed.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Hilltop enclosure known as Maristow Camp, 240	metres east of Midd	lle Park House Bickleigh
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019784
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



SITE NAME:	Church of St Peter, The Square, Ugborough
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1168309

Large parish church, dubbed 'The Cathedral of the South Hams'. The north aisle roof has become porous allowing significant water ingress, threatening the integrity of medieval carved roof bosses. The congregation has completed a phase of repair with a National Lottery Heritage Fund Grant for Places of Worship but the church remains very damp and further works are still being

Contact: Annie Evans 0117 975 0673

0	Le	Page	Arc	hitects
---	----	------	-----	---------

SITE NAME:	Medieval holy well known as St Ann's Well, 120 me	etres south of Holv	vell Farm, Bigbury
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1019315
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Iron Age hillfort known as Wasteberry Camp, med north west of Lyneham House, Brixton / Yealmpto	lieval deer park and on	post-medieval warren, 800 metres
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020160
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two round barrows on Ridding Down, Cornwood		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002586
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Levelling	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Hilltop enclosure and woodbanks in Chacegrove V Dartington	Vood, 540 metres r	north west of Dartington Hall,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020553
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Hilltop enclosures in North Wood, 780 metres NI	NW of Old Parsona	age Farm, Dartington
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020381
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Four bowl barrows at Bickleigh Brake 540 metres barrow cemetery, Halwell and Moreleigh	south west of Bickl	eigh, forming part of a linear round
		LIST ENTRY NUMBER:	1019238
DESIGNATION:	Scheduled Monument	EIST EITHE TOT IDEE	1017230
DESIGNATION: CONDITION:	Scheduled Monument Generally satisfactory but with significant localised problems	TREND:	Declining
	Generally satisfactory but with significant localised		

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 - Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA NP RPG Registered Park and Garden Scheduled Monument UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Hillfort and two bowl barrows at Halwell Camp, Halwell and Moreleigh		
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1019237
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	D-Day landing craft maintenance site on the River Kingswear	Dart immediately t	o the south of Lower Noss Point,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021076
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Gomerock Tower, Kingswear		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003852
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Annie Evans 0117 975 0673
SITE NAME:	Two ring cairns 330 metres south east of Coldharbour Cross, Loddiswell		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014244
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093
SITE NAME:	Hilltop enclosure 380 metres east of Middle Soar,	Malborough	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1019533
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two hut circles and associated field systems and er	nclosure at Mouseh	ill Brake, Malborough
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020573
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Two bowl barrows at Beacon Hill, 120 metres sou	th of The Beacon, I	Marldon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020164
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Digging	NEW ENTRY?:	No
OWNED TYPE	Mixed multiple owners	CONTACT:	Daniel Bashford 07824 103102
OWNER TYPE:	Mixed, multiple owners		Daniel Basillord 07624 103102

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

SITE NAME:	Fort Charles, Salcombe		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1020165
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Annie Evans 0117 975 0673
SITE NAME:	Hut circle 1000 yards (915 metres) east of Colelan	d Bridge, Sparkwel	I
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002596
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Post-medieval deer park, medieval fishpond, and a Park, Sparkwell	C19 lead mine, ore	works and smelt mill at Boringdon
DESIGNATION:	Scheduled Monument and Listed Building grade II*	LIST ENTRY NUMBER:	1020565 and 1386330
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Immersion bath associated with Leechwell holy we	II, 40 metres north	east of Leechwell Cottage, Totnes
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021390
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth - Notifiable plants	NEW ENTRY?:	Yes
OWNER TYPE:	Local authority	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Woodbury Camp, Stoke Fleming		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019783
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Hillfort known as Slapton Castle, Stokenham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019236
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Roman settlement site at Bantham Ham, Thurlesto	ne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019322
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C. Slow decay: no solution agreed.

 D. Slow decay; solution agreed but F not yet implemented.

 Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial lists). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Hilltop enclosure at Yellowberries Copse, 430 metres west of Higher Turtley, Ugborough		
DESIGNATION:	Scheduled Monument LIST ENTRY NUMBER: 1019325		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102

TEIGNBRIDGE



© Teignbridge District Council

SITE NAME:	Former stables to Stover House, Stover, Teigngrace
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company

LIST ENTRY NUMBER: 1308968

LIST ENTRY NUMBER:

Built as stables, 1779. The stables were stripped out when they were superseded by a larger stable block in 1843, and were converted to a magnificent backdrop to the newly laid out gardens for the 11th Duke of Somerset. They are a key feature of Stover's grade II designed landscape. Now in very bad condition due to the spread and distortion of single ashlar front, rusting cramps, and water and vegetation damage. Currently fenced off. Repairs are being discussed as part of a wider improvement scheme to the adjoining park.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	The Granite Lodge adjacent A38 approx 1550 metres NNW of Stover House, Teigngrace
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority

Disused pedimented lodges, with linking screen, gates, and flank walls to former drive to Stover House. Likely c1830, possibly by Philip Hardwick. Banded rusticated granite ashlar with slate roofs. South west lodge in extremely poor condition and open to the weather, with a collapsed roof and collapsed suspended timber floor. North east lodge in better condition, but vacant with graffiti on the internal plaster wall. Connecting portico appears to be in reasonable condition but has not been closely inspected. Repairs are being discussed as part of a wider scheme of improvements to the park.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of St Mary the Virgin, Bickington
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1097150

1308943

Parish church. C15 Nave, chancel, with early C16 north aisle, west tower restored in 1883-4 when the south wall, south porch, and east and west gables of north aisle were rebuilt. Devonian limestone, with granite detail in the medieval work and Ham stone used in the C19. Slated roofs with lots of tingles. Tall tower with cementitious pointing and vegetation growth. Black and green staining to east end at high level.

Contact: Annie Evans 0117 975 0673



© Historic England

© Historic England

SITE NAME:	Church of St Thomas, Mamhead
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1170048

Parish church. Probably C13 or earlier in origin with surviving early windows in the chancel, C15 three-bay north aisle, south transept (now the baptistery) probably CI3 or CI4 but much altered, CI5 tower. CI9 restorations including one attributable to Anthony Salvin. Red sandstone and grey limestone rubble and red sandstone dressings and slate roofs. Works to repair stonework and remove ivy were undertaken in 2017-2018.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG UA Unitary Authority WHS World Heritage Site



© Historic England

SITE NAME:	Church of St Michael, Ilsington, Teignbridge
DESIGNATION:	Listed Place of Worship grade I,

CA

CONDITION: Poor

PRIORITY CATEGORY: C (New entry)

OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: 1240794

LIST ENTRY NUMBER:

C13 or early C14, south transept may be earlier. Nave and aisles enlarged and partly rebuilt in C15 or early C16. Rendered stone walls where exposed, of granite and slatestone rubble. Tower of coursed granite rubble. Slated roofs. Nave, transepts and chancel wagon roofs intersect over crossing as a fine ribbed vault. Very damp; cementicious pointing and render trapping moisture in walls and roofs nearing the end of their lives. Condition of interior has declined since last inspection in 2014 so added to the Register in 2019.

Sizeable Anglican parish church. Chancel and transepts late

Contact: Annie Evans 0117 975 0673



SITE NAME:

St Michael the Archangel, Den Promenade, Teignmouth

Listed Place of Worship grade II, CA

CONDITION:

Poor

PRIORITY CATEGORY:

F (D)

OWNER TYPE:

Religious organisation

1269103

The church dates from 1821 in neo-Norman style by Andrew Patley. In 1875 the Chancel by Fredric Deshom was added, followed by the Vestry in 1885. The Early English style west tower by Fulford was added 1887-1889; it has five stages with a distinctive castellated parapet with pierced panels and octagonal corner towers with spirelets. The roofs were repaired in 2011-12. Many of the windows are in poor condition, some requiring urgent conservation work. A National Lottery Heritage Fund Grant for Places of Worship was granted in June 2018 for window repairs, due for completion in July 2019.

Contact: Sarah Ball 0117 975 0666

© Historic	England
------------	---------

SITE NAME:	Earthwork (possibly civil war) on Bovey Heath, Bo	vey Tracey	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002657
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Bishop's Palace, Chudleigh		
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1008679
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Denbury camp, Denbury and Torbryan		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003857
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Earthwork enclosure south of Blackall's Copse, Ex	minster	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004579
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Linear round barrow cemetery at Castle Park, Alp	hington, Exminster	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012347
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair or in fair to good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

	SITE NAME: Oxton House Kenton	In the mid-C19 t	he picturesque grounds comprised lawns.
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Daniel Bashford 07824 103102
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
CONDITION:	Extensive significant problems	TREND:	Declining
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021377
SITE NAME:	Prehistoric field system and settlements on Ke	erswell Down and Whill	oorough Common, Kingskerswell
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
CONDITION:	Extensive significant problems	TREND:	Declining
DESIGNATION:	Scheduled Monument, LB grade II, CA	LIST ENTRY NUMBER:	1020875
SITE NAME:	Kingskerswell Manor House, Kingskerswell		

SITE NAME:	Oxton House, Kenton
DESIGNATION:	Registered Park and Garden grade II, 7 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	Medium
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners
LIST ENTRY NUMBER:	1001269

In the mid-C19 the picturesque grounds comprised lawns, parterres, shrubberies, parkland and a lake. In the C20 the property was occupied by a school before being divided into apartments. The pleasure grounds are neglected and much of the park is ploughed, with considerable loss of parkland planting.



© Historic England

SITE NAME:	Stover Park, Teigngrace
DESIGNATION:	Registered Park and Garden grade II, 7 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Stable
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1001268

Late C18 gardens, pleasure grounds and park in divided ownership. A large area of the park is run by the County Council as a country park and other parts developed as mineral workings. The main house and environs are in use as a school. The setting is under threat from development, including road widening and housing allocation. A parkland plan was produced through a Natural England Stewardship Scheme in 2014. An application to the National Lottery Heritage Fund (to implement the plan's recommendations) is being revised.

Contact: Jo McAllister 0117 975 0696

Contact: Jo McAllister 0117 975 0696

SITE NAME:	Bovey Tracey, Pottery Road, Bovey Tracey		
DESIGNATION:	Conservation Area, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Maureen Pearce (LPA) 01626 215705

TORRIDGE



© Historic England

SITE NAME:	Winsford Hospital, Halwill Junction, Halwill
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Charity (heritage)

1105657

Winsford Centre was built as a cottage hospital in 1899, designed by Charles Voysey and founded by a local landowner. The NHS closed the hospital in 1998 and it was bought by the Winsford Trust. Since then it has been run as a day centre and community resource. Historic England grant aid led to the production of a Conservation Management Plan, options appraisal and costed condition survey in 2012. A National Lottery Heritage Fund grant has been given to develop a project to restore the building in conjunction with the Landmark Trust who have taken on the ownership of the building.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



© Historic England

SITE NAME:	Richmond Dock, Northam
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company

1140140

Dry dock, 1856. It is said to have been the largest dry dock in the Bristol Channel at the time it was built. The dock is now vacant. In 2015 the gates were in poor condition, and no repair proposals have been made to Historic England. Ongoing discussions for alternative uses and greater regeneration proposals are being held with the Local Planning Authority, as of May 2019.

Contact: Catherine Marlow 0117 975 0732

© Historic England Archive

SITE NAME:	World War II air traffic control building 400 metres north west of Seckington Cross, on the former airfield of RAF Winkleigh, Winkleigh
DESIGNATION:	Scheduled Monument
CONDITION:	Poor

OCCUPANCY:

LIST ENTRY NUMBER

Vacant/not in use

PRIORITY CATEGORY: A(A)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1020765

The monument is a World War II brick and concrete control tower. Although structurally sound, the tower has suffered from vandalism and lack of maintenance and has failing concrete as a result of oxidising steel reinforcement.

Contact: Charlotte Russell 01271 831505



SITE NAME:	Church of All Saints, Bradford
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1105088

Parish church with Norman origins, C14 chancel, C15 north aisle and porch, restored from a ruinous state in 1869 and between 1875 to 1889. The tower suffers from water ingress and damp and the bell ropes drip with water. The rest of the church is damp. The gutters and downpipes need overhauling.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Bridget, Bridgerule
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1104976

Externally the tower has black staining, indicating that is damp. There are no rainwater goods and areas of cement ribbon pointing. The church is in need of patch repointing. This has contributed to some paint blistering internally, such as in the east end of the south aisle.

Contact: Annie Evans 0117 975 0673



© Historic England



© Historic England

SITE NAME:	Church of St Mary and St Gregory, Frithelstock
DESIGNATION:	Listed Place of Worship grade I, SM
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1105177

Parish church. C13 north wall; chancel rebuilt and south aisle built in early C14; c1500 south-east chapel and roofs, and west tower rebuilt in C15. Coursed slatestone rubble; squared and coursed stone to tower; ashlar dressings. Stone-gabled and gabled slate roofs. This church is in need of external patch repointing and the overhaul and renewal of all of the rainwater goods is required.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



SITE NAME:	Church of St Swithun, Littleham
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1105152

Parish church. Mid C13 nave and chancel; late C13 north transept; early C15 south aisle and west tower which was restored in 1892. Rainwater goods do not appear to be installed. The tower shows signs of damp.

Contact: Annie Evans 0117 975 0673

© Historic England

© Historic England



SITE NAME:	Church of Holy Trinity, Milton Damerel
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Very bad
PRIORITY CATEGORY:	A (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1162778

Parish church. Late C13 origins with C14 fabric, remodelled in C16 restored c1900 to1910. Stone rubble walls. Gable-ended slate roof. Tower destroyed by lightning in 1879 and in ruins for 20 years but re-opened in 1904. Tower partly re-erected in 1892 and rebuilt 1910-1911. The church is generally well maintained, but needs a significant project to secure loose stones on top of the tower, tackle damp problems, and repair roofs. The congregation has made three applications for National Lottery Heritage Fund Grant for Places of Worship but has not been successful.

Contact: Annie Evans 0117 975 0673

© Historic England

SITE NAME:	Church of St Margaret, Northam
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1169270

Large parish church. Mainly C15 although lower part of tower is older. Thoroughly restored between 1849 and 1865. The roof slating is nearing the end of its life, and the ceilings are plastered to the underside of roofing battens. The church was awarded a National Lottery Heritage Fund Grant for Places of Worship in late 2016 for the repair of the nave and vestry roofs. Work was planned to start on site by the end of 2018 but has been delayed awaiting slate supply from the quarry. At least one further phase of work to the roofs will then be needed.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Petrock, Petrockstow
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1333084

Parish church. C14 aisle and C15 tower, the rest rebuilt from 1878 to 1880. There are some problems with the roof covering, especially verges and eaves, parapets and flashings. The rainwater goods and drainage need repair and overhauling. This has led to water ingress and salt damage to the interior. The congregation made an application for funding under the National Lottery Heritage Fund Grant for Places of Worship scheme in 2017 but was not successful. The congregation is continuing with fundraising.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Michael, Shebbear
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1309558

Rural Devon church. Most significant feature is mid-C12 south doorway. Plain nave and south aisle; simple rendered tower. Damp interior with carpet hiding salt damage to floor. Prone to vegetation growth in the external ground gutter and there is a poor vestry valley gutter arrangement, worsening the internal problems. The roof is poor and is likely to require recovering in the forseeable future.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Gar

RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



ര	Historic	England	

SITE NAME:	Church of the Holy Cross, Tetcott
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1252173

Parish church. Fabric of nave and chancel C13, south transept C13 or C14, tower C15, vestry probably C19. Stone rubble with granite dressings, the tower ashlar masonry with granite quoins and lacing, slate roofs. Fittings including several good C18 wall monuments. The church forms part of an important group including Tetcott Manor and associated buildings. The north wall is still moving, even after works to stop the roof spreading. Tower masonry needs repointing and the roof re-covering to prevent water ingress to the belfry and ringing chamber.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Bowl barrow 250 metres north east of Oak Cottag	ge, forming part of	a round barrow cemetery, Ashwater
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020079
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 540 metres south east of Sandymoor Cross, forming part of a round barrow cemetery, Ashwater		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020080
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
Bowl barrow 770 metres south east of Sandymoor Cross, forming part of a round barrow cemetery, Ashwater			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020081
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Hillfort known as Castle Hill Settlement, 350 metres south of Woolleigh Bridge, Beaford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021417
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Holy well 480 metres north west of Beaford Mill, E	Beaford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015142
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Hallsannery limekiln, Bideford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004578
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Bowl barrow 420 metres north west of Dural C	Cross, Bradworthy		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016643	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505	
ITE NAME:	Bowl barrow 280 metres south west of Upcott	Cross, Broadwoodwig	dger	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019546	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505	
ITE NAME:	Two bowl barrows 690 metres and 760 metres	Two bowl barrows 690 metres and 760 metres south west of Leworthy, Clawton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017974	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
RINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505	
ITE NAME:	Clovelly Dykes hillfort, Clovelly			
esignation:	Scheduled Monument	LIST ENTRY NUMBER:	1018522	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505	
ITE NAME:	Four bowl barrows 110 metres and 360 metres cemetery, East Putford	west of Wrangworth	y Cross forming part of a round barro	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018526	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
RINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505	
ITE NAME:	Three fishponds at Winslade, East Putford			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017979	
CONDITION:	Extensive significant problems	TREND:	Declining	
RINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505	
ITE NAME:	Two bowl barrows 600 metres and 750 metres cemetery, East Putford	west of Wrangworth	y Cross forming part of a round barro	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018515	
CONDITION:	Extensive significant problems	TREND:	Declining	
RINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505	

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two bowl barrows one immediately north and one part of a round barrow cemetery, East Putford	e 100 metres south	of Commonmoor Cottage forming
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018516
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Hender Barrow, Halwill		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019727
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow 520 metres west of Higher Welsford	, Hartland	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1017138
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Ring cairn and bowl barrow 540 metres south wes	t of Higher Welsfo	rd, Hartland
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017139
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow on Ugworthy Moor 510 metres sout	h of West Ugworth	ny House, Holsworthy Hamlets
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017977
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
	Arable clipping Private	NEW ENTRY?: CONTACT:	No Charlotte Russell 01271 831505
OWNER TYPE:	,, -	CONTACT:	
OWNER TYPE: SITE NAME:	Private	CONTACT:	
OWNER TYPE: SITE NAME: DESIGNATION:	Private Bowl barrow 60 metres west of St James's Church	CONTACT:	Charlotte Russell 01271 831505
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Private Bowl barrow 60 metres west of St James's Church. Scheduled Monument	CONTACT: , Luffincott LIST ENTRY NUMBER:	Charlotte Russell 01271 831505
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Private Bowl barrow 60 metres west of St James's Church Scheduled Monument Extensive significant problems	CONTACT: Luffincott LIST ENTRY NUMBER: TREND:	Charlotte Russell 01271 831505 1020476 Declining
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing	CONTACT: , Luffincott LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Charlotte Russell 01271 831505 1020476 Declining No
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private	CONTACT: , Luffincott LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Charlotte Russell 01271 831505 1020476 Declining No
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Private Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout.	CONTACT: , Luffincott LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: , Lundy	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout. Scheduled Monument Generally satisfactory but with significant localised	CONTACT: LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LUNDY LIST ENTRY NUMBER:	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505 1016019
OWNER TYPE: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout. Scheduled Monument Generally satisfactory but with significant localised problems	CONTACT: LUST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LUNDY LIST ENTRY NUMBER: TREND:	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505 1016019 Improving
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout. Scheduled Monument Generally satisfactory but with significant localised problems Bracken	CONTACT: LUST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LUNDY LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505 1016019 Improving No
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout. Scheduled Monument Generally satisfactory but with significant localised problems Bracken Charity (heritage)	CONTACT: LUST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LUNDY LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505 1016019 Improving No
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Bowl barrow 60 metres west of St James's Church. Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout. Scheduled Monument Generally satisfactory but with significant localised problems Bracken Charity (heritage) Cairn 530 metres west of Quarterwall Cottages, L	CONTACT: LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LUNDY LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505 1016019 Improving No Charlotte Russell 01271 831505
PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: CONDITION: PRINCIPAL VULNERABILITY: PRINCIPAL VULNERABILITY:	Bowl barrow 60 metres west of St James's Church Scheduled Monument Extensive significant problems Arable ploughing Private Cairn 325 metres north west of Tibbett's Lookout Scheduled Monument Generally satisfactory but with significant localised problems Bracken Charity (heritage) Cairn 530 metres west of Quarterwall Cottages, L Scheduled Monument	CONTACT: LUST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: LUNDY LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Charlotte Russell 01271 831505 1020476 Declining No Charlotte Russell 01271 831505 1016019 Improving No Charlotte Russell 01271 831505

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Chambered tomb 165 metres north east of the Rocket Pole Pond, Lundy		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015931
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Chapel remains, cemetery and prehistoric settlement on Beacon Hill, Lundy		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016040
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Coastal defence platforms at the Mousehole and T	rap, Lundy	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016031
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Granite quarry on East Sidelands, Lundy		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016041
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Hut circle and small enclosure 270 metres north w	est of The Old Lig	hthouse, Lundy
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016014
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Long house and enclosure 160 metres north of Widow's Tenement, Lundy		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018547
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Medieval settlement immediately south of Halfway	Wall, Lundy	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017647
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

101271 831505		
The Widow's Tenement medieval settlement and prehistoric settlement sites, Lundy		
101271 831505		
Moated site at Grange Farm, Merton		
101271 831505		
tham		
101271 831505		
101271 831505		
World War II air traffic control building 400 metres north west of Seckington Cross, on the former airfield of RAF Winkleigh, Winkleigh		
10		

WEST DEVON



SITE NAME:

Gawton Mine complex,
Gulworthy / Bere Ferrers

DESIGNATION:

Scheduled Monument, WHS

CONDITION:

Very bad

OCCUPANCY:

N/A

PRIORITY CATEGORY:

A (A)

OWNER TYPE:

Private

Former copper and arsenic mine and processing complex, comprising a full range of buildings from cooperage to engine houses. The site has suffered damage from vehicles. Despite recent extensive clearance and emergency support works, the structures remain at risk and the vegetation is again encroaching on the monument.

LIST ENTRY NUMBER: 1002667 Contact: Nick Russell 0117 975 0671

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



DESIGNATION: Listed Building grade I CONDITION: Poor OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER 1318194

SITE NAME:

C18 house with serious maintenance issues. Roof is in need of renewal, rear medieval wing is partly propped. Main house is weathertight and maintenance is gradually being addressed.

Contact: Annie Evans 0117 975 0673

© Historic England



SITE NAME:	Stable block north of Kelly House, Kelly
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private

Kelly House, Kelly

Stables, 1740. Partly used, part collapsed.

LIST ENTRY NUMBER: 1104813 Contact: Annie Evans 0117 975 0673 © Historic England



SITE NAME: Greenslade Farmhouse, North Tawton DESIGNATION: Listed Building grade II* CONDITION: Very bad OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: A (New entry) OWNER TYPE: Private LIST ENTRY NUMBER: 1105370

Farmstead including farmhouse with medieval origins, attached jointed cruck barn, further barn probably C19 and southern range with large malthouse as well as further open fronted barns and stabling. Mainly cob-built. Roofing and roof structures in very poor condition. Historic England is in discussion with the current owners regarding repairs and maintenance.

© Historic England

SITE NAME: Lower Sessland Farm including

> cob walls adjoining to north west and south west, Sessland Lane, South Tawton

DESIGNATION: Listed Building grade II*

CONDITION:

Late medieval thatched farmhouse with later additions, including C17 hall bay and parlour wing. Further C17 addition to north west has been used as a separate cottage. Temporary protection was erected in 2006 following an Urgent Works Notice, and from 2012 was vacant and in very poor condition, with severe water penetration and decay of thatch and roof timbers. The building has now been returned to single ownership and a scheme of repairs for use as a farm cottage is nearing completion.

© South Hams District Council

OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: F(D) OWNER TYPE: Private LIST ENTRY NUMBER: 1170877

Contact: Annie Evans 0117 975 0673

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Tavistock Abbey, Tavistock
DESIGNATION:	Scheduled Monument, 16 LBs, CA, WHS
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1020401

Tavistock Abbey is central to the history and character of the medieval town which developed around it. The Saxon foundation of the abbey places it amongst the earliest of the medieval religious houses founded in Britain. Its occupation from 974 to 1539 included continuous use by the same Benedictine order for over five and a half centuries. The ruins are suffering from water ingress and damaging vegetation growth. Historic England has offered a grant to carry out a full condition survey and conservation management plan for the West Gate House (Betsy Grimbals Tower) and the Still Tower.

Contact: Andy Crabb 01626 832093

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



© West Devon Borough Council

SITE NAME:	Guildhall and police station, Abbey Place, Guildhall Square, Tavistock
DESIGNATION:	Listed Building grade II*, SM, CA, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use

PRIORITY CATEGORY: D(D)

OWNER TYPE: Local authority

LIST ENTRY NUMBER: 1309358

Completed 1848, incorporating medieval fabric in part. Use as court ended 1997 and police station has relocated. The first known example of a combined police station and magistrates' court. Roof is in very poor condition and fabric in general urgently needs attention. Devon Historic Buildings Trust sold the building to the Town Council, who made a successful National Lottery Heritage Fund bid in 2015 and are working on their second.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Mary, Bratton Clovelly
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1326312

Parish church. Mainly mid to late C14 although the chancel may be earlier, porch probably early C15; various repairs made in C19 and restored from 1891 to 1892. Granite and slate rubble walls with granite dressings, tower is constructed of coursed dressed granite blocks of irregular sizes. Medieval structure enhanced by the remarkable survival of a large number of wall paintings. The church suffers from water ingress and there is some structural movement at the east end.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of Holy Cross, Highampton
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1165844

Parish church. C12 origins with a late C15 tower and the rest of the church rebuilt in 1837. Restored in 1876. The church suffers from water ingress and damp possibly associated with its very exposed position. The tower walls are damp; the congregation and appointed architect are investigating the causes. Active insect infestation to ceiling timber ribs. Some roof slates cracked and missing. North west window buckled and missing glass.

Contact: Annie Evans 0117 975 0673



© Historic England

© Historic England

SITE NAME:	Church of St Mary, Walkhampton, West Devon
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1105371

Church in an elevated position on the edge of Dartmoor about a mile outside the village. Largely C14 but may be pre-conquest in foundation. Aisle and tower added in the C15. Local rubble with granite dressings. Cornish slate roofs. Tower is wet with large amounts of vegetation growth. Valley gutter and rainwater goods in need of work.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Iron Age defended settlement in Dunterue Wood,	570 metres south	of Castle Head, Dunterton
DESIGNATION:	Scheduled Monument, RPG grade I	LIST ENTRY NUMBER:	1020273
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Andy Crabb 01626 832093

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

LIST ENTRY NUMBER:

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

SITE NAME:	Bowl barrow 375 metres north east of Higher Eworthy, Germansweek			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020084	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093	
ITE NAME:	Bowl barrow 620 metres north of Higher Eworthy, Germansweek			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017971	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093	
ITE NAME:	Morwellham Quay: transport infrastructure, part o Gulworthy	Morwellham Quay: transport infrastructure, part of the water control system and a manganese mill, Gulworthy		
DESIGNATION:	Scheduled Monument, 3 LBs, WHS	LIST ENTRY NUMBER:	1021461	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Andy Crabb 01626 832093	
ITE NAME:	Gawton arsenic mine and flue, Gulworthy / Bere Fo	errers		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1002667	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Russell 0117 975 0671	
SITE NAME:	Round barrow cemetery and beacon at Heathfield, / Brentor	650 metres west o	of Moorlands, Lamerton / Milton Abbo	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020075	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093	
ITE NAME:	Roman forts, marching camps and associated monu	ıments, North Taw	ton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021151	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Andy Crabb 01626 832093	
ITE NAME:	Two bowl barrows 200 metres north east of New	and Cross, North	Tawton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017131	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
		CONTACT		
OWNER TYPE:	Private	CONTACT:	Andy Crabb 01626 832093	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Guide post at Place Cross, Okehampton Hamlets		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020069
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Andy Crabb 01626 832093

DORSET (UA)



© Historic England

SITE NAME:	Maiden Street Methodist Church, Maiden Street, Weymouth
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (C)
OWNER TYPE:	Private

1142294

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

Former Methodist church. Fire in January 2002 left the church a gutted, roofless ruin. Subsequent health and safety works completely cleared the interior. Consent was granted in 2007 but not implemented for conversion/ reconstruction to mixed residential and commercial use. The site changed hands in 2016. Historic England has been in discussions with the new owner regarding the options available to them and in May 2019, planning permission and listed building consent applications for residential conversion/reconstruction were submitted.

Contact: Eve Van Der Steen 01179750685



© Historic England

SITE NAME:	gatehouse and walling, gateway, granary and tithe barn, St Peter's Abbey, Abbotsbury
DESIGNATION:	Scheduled Monument and Listed Buildings - 5 grade I; 5 grade II*; 4 grade II, LB grade II, part in CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Mixed, multiple owners

Mixed, multiple owners 1015693 and 1305224; 1118743; 1305209; 1118706;

The dovecote malthouse outer

1118742; 1118744; 1118745; 1118748

This large scheduled site contains 12 individually listed buildings, six of which are in poor or very bad condition. Several of the buildings were included in a 2013/14 condition survey to inform a future repair strategy. The published photo shows the dovecote, which is disused and unstable. It has potential for low-key use in conjunction with a visitor attraction centred on the nearby Tithe Barn complex. In 2018/19, Historic England Repair Grants helped to fund project development work on the Tithe Barn, in preparation for repairs to start in 2019, and also works to the Granary.

Contact: Katy Hoskyn 0117 975 1311



© Historic England

SITE NAME:	Parnham House, Beaminster
DESIGNATION:	Listed Building grade I, RPG grade II*
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1221178

C16 country house, much refashioned and extended in 1810 by Nash. Suffered catastrophic fire in April 2017. Majority of roof and internal structure have been destroyed, but the external shell largely survives. Complex circumstances have left the building still unprotected after two years, and Historic England's Conservation Engineer has assessed its condition as increasingly vulnerable. In September 2018 the property was marketed by Receivers following their appointment by mortgagees, and in May 2019 it was under offer but the identity of the purchaser was undisclosed.

Contact: Jenny Chesher 0117 975 0686

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

OWNER TYPE:

CITE NIAME

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:



© Historic England

SITE NAME:	Literary and Scientific Institute East Street, Bridport
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)

1118999

Charity (non-heritage)

Founded 1835 as Mechanics Institute and reconstituted 1855 as Literary and Scientific Institute. Bridport Development Trust delivered project to repair and extend the building with National Lottery Heritage Fund support and grant-aid from Historic England. Works largely completed in 2018 although some outstanding issues remain.

C18, possibly older. Former bonded stores. The yard is being used as an antiques/pop-up market. Discussions are ongoing with the Local Planning Authority, the head lessee and Historic England regarding the repair of the listed building and use of the site. In May 2019, the freehold of

Contact: Sarah Ball 0117 975 0666

the site was for sale.



© Historic England

SITE NAME:	Messrs Norman goods warehouse, Station Road, West Bay, Bridport
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	E (E)

PRIORITY CATEGORY: E (E)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1228722

Contact: Eve Van Der Steen 01179750685



© Historic England

SITE NAME:	North Lodges, Lulworth Castle, Coombe Keynes
DESIGNATION:	Scheduled Monument and Listed Building grade II*, part in RPG grade II
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

Ornamental gate lodges and gateway to Lulworth Castle, 1785. The lodges and gates are stable but the flank walls and mock-fortifications are in poor condition. The estate is exploring possible funding for the repair of the lodges. It is hoped that with the Estate's newly appointed architect working on nearby Bindon, that the Estate's direct labour will be able to carry out repairs to the walls. They are currently successfully repairing outer walls.

The site comprises a rectangular earthwork enclosure with

a moat (partly filled). There are substantial remains of the internal ramparts and the motte. These masonry structures require consolidation and careful on-going management. The masonry is precarious and currently being eroded by

LIST ENTRY NUMBER: 1016685 and 1323333

Marchinand Castla Marchinand

Contact: Jenny Chesher 0117 975 0686



© Historic England

SHE NAME:	Marshwood Castle, Marshwood
DESIGNATION:	Scheduled Monument and Listed Building grade II*, LB grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1002836 and 1324105

Contact: Katy Hoskyn 0117 975 1311

both stock and vegetation.



© Historic England

SITE NAME:	Abbey Church of St Mary, St Sansom and St Branwalader, Milton Abbas
DESIGNATION:	Listed Building grade I, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	Occupied/in use
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Religious organisation

1304822

to roofs, windows, floors and drainage has been completed with Viridor funding. Transept roofs and tower louvres remain vulnerable.

Formerly church of a Benedictine abbey now used as a school chapel. Mainly C14, upper part of tower and north transept C15. Restored c1790 by J Wyatt and 1865 by Sir Gilbert Scott. Walls of stone and flint with ashlar dressings. Nave and aisles were not rebuilt after fire in C14. Repairs

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Fundamental and first a good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area

Is LB Listed Building

Se, LPA Local Planning Authority

NP National Park

RPG Registered Park and Garden

SM Scheduled Monument

UA Unitary Authority

WHS World Heritage Site

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER



© Historic England

SITE NAME:	Icehouse at Ringstead, 660 metres south west of Pit House, Osmington
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1020358

A small C19 icehouse, built to serve the needs of the local fishing community. It is now in unmanaged woodland, with trees and ivy growing over it. The roots will have weakened the roof and there is a high risk of damage from falling trees.

Former stables and cart shed, dated 1702. Application for repair and conversion to holiday let use has been

approved. The roof has been re-thatched, but other works

Contact: Katy Hoskyn 0117 975 1311

	The state of the s
2 1	
TO to	
	NO. SCHOOL STATE OF

© Historic England

SITE NAME:	Cart shed and stables 10 metres south of Waddon House, Portesham
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private

1152606

Contact: Sarah Ball 0117 975 0666

Contact: Sarah Ball 0117 975 0666

still needed.



© Historic England Archive

SITE NAME:	Rufus Castle, Church Ope Road, Easton, Portland
DESIGNATION:	Scheduled Monument and Listed Buildings - I grade I; I grade II*, LB grade II, CA, WHS
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)

1002698 and 1280727; 1205384

Private

Present structure probably late C15, on site of earlier building captured in 1142 by Earl Robert of Gloucester. Ruinous and in need of conservative repair and consolidation. Scheme of repair and urgent works carried out in 2010 with Historic England grant although more work is still needed. Site has a new owner and discussions are at an early stage. The monument also includes the ruins of a C12 grade II* church, St Andrews, believed to stand on the site of an earlier Saxon church.

SITE NAME:	Church of St Peter, Grove Road, Grove, Portland
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1205607

Former Church of England church in robust Romanesque style, erected in 1872. Designed by Major General Edmund du Cane, built by convict labour from Portland's prison and later transferred to the parish. No longer used for worship and in poor condition. Relatively complete interior of interest as an undivided space and with robust contemporary fittings. Local Authority considering taking action against owner.

© Historic England Archive

SITE NAME:	Sherborne House, Newland, Sherborne
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)
OVA (NIED TV/DE	t t d s

Contact: Eve Van Der Steen 01179750685



© Historic England Archive

OWNER TYPE: Local authority LIST ENTRY NUMBER: 1110694

Grand town house of c1720 with earlier elements. formerly a school. Fine internal features include the formal stairhall decorated with Thornhill wall paintings. Planning Permission for gallery/office use has been approved and works have included the installation of a lift/stair core at the rear of the house and external repairs. The interior was damaged by dry rot and still requires refurbishment. The properrty was sold in 2018 and a new charitable trust has been set up for it. Initial pre-application advice has been provided by Historic England and the LPA regarding a new

Contact: Jenny Chesher 0117 975 0686

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

	*
© Historic Engla	and

SITE NAME:	Sturminster Newton Castle, Sturminster Newton
DESIGNATION:	Scheduled Monument and Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private

1002719 and 1324461

Ruins of C14 stone built manor house within Sturminster Newton Castle, a probable Iron Age promontory fort overlooking the River Stour. Upstanding remains are in a very precarious position and a considerable amount of consolidation work is urgently required to avoid significant areas of collapse. Historic England architectural survey team has recorded the structure. The site is up for sale and we hope to engage in discussions with the new owner as soon as possible to discuss the most urgent works.

Contact: Katy Hoskyn 0117 975 1311

	4 . 11		3
10 Mg (# 5			V
A Acet			
		20	

© Historic England

SITE NAME:	Tithe Barn, Church Lane, Sydling St. Nicholas
DESIGNATION:	Scheduled Monument and Listed Building grade II*, part in CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private

Impressive C16 barn. It has an interesting constructional history and is part of an important complex of historic buildings. Its gradual deterioration has recently shown signs of accelerating with the loss of an area of roof covering. Progress on finding a suitable use has stalled and part of the protective roof covering has become dislodged.

1003209 and 1119426 Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Barn and outbuilding range, Tarrant Abbey Farm, Tarrant Crawford
DESIGNATION:	Scheduled Monument and Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)

Private, multiple owners 1002715 and 1110841 Contact: Nick Croxson 07795 665645

C15 barn with C18 outbuildings and alterations. No longer in agricultural use. Works have been undertaken to support the structure but deterioration is on-going and part of the roof has collapsed.



© Historic England

SITE NAME:	Holditch Court Tower, Thorncombe
DESIGNATION:	Scheduled Monument, LB grade I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1002835

This monument includes part of a fortified house situated within a farmyard. The part of the fortified house survives as a three-storeyed roofless rectangular plan tower with a projecting circular stair-turret in the south west angle and stands to a height of approximately eight metres. Historic England funded a project development grant in 2018 for the removal of the ivy, a condition survey and measured survey which are underway. It is anticipated this will inform a future repair project.

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Stable Block immediately south east of Little Toller Farm, Toller Fratrum
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1228876

Mid C16 stable building, forming part of a working farm but currently disused. The thatch is in a very degraded state leading to partial collapse of the roof and rear wall structure at the end of 2011. The stable building has been scaffolded with a temporary roof structure which is protecting the collapsed historic fabric. The long term repair of the structure needs to be explored along with possible funding sources.

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

ABBREVIATIONS



© Historic England

SITE NAME:	Former Methodist Chapel, Dorchester Road, Tolpuddle
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Charity (heritage)

1119849

LIST ENTRY NUMBER:

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

OWNER TYPE:

LIST ENTRY NUMBER:

Contact: Sarah Ball 0117 975 0666

Former Methodist church, c1818, and the meeting place of the Tolpuddle Martyrs. Building bought by Tolpuddle Old Chapel Trust at the beginning of 2015. Historic England grant awarded in 2014 to carry out emergency works and undertake project development work; completed in spring 2015. National Lottery Heritage Fund development grant completed in 2017 and the Trust has secured further Lottery funding for Stage 2 repairs starting in 2019. Historic England offered match-funding for repairs to fabric of former chapel anticipated to start on site in summer 2020.

The cordite factory was built in 1916, and continued to produce explosives until 1945. It covers a large area of land, with lots of small workshops surrounded by earth banks, to contain any accidental blasts. A large number of individual buildings and structures still remain, now in varying degrees of collapse, and a programme of works to identify and repair the most significant of these is urgently needed. Much of the site is within a nature reserve and only open to the public by prior arrangement. The area included in the scheduling was extended in 2016.

amount.	
25	
	THE TREE LEWIS CO.
	《
at the	
274	

© Historic England

SITE NAME:	Royal Naval Cordite Factory at Holton Heath, Wareham St. Martin
DESIGNATION:	Scheduled Monument, LB grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)

Mixed, multiple owners

Contact: Sarah Ball 0117 975 0666

Contact: Sarah Ball 0117 975 0666

Contact: Katy Hoskyn 0117 975 1311



© Historic England

SITE NAME:	Grotto 250 metres south east of St Giles House, Wimborne St. Giles
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Private

1120131

1019151

Grotto c1751-53, located 250 metres to the south east of the house, at the east end of a winding channel of water running towards the lake. One of several garden buildings situated in the C17 and C18 landscape. The Grotto was subject to a major programme of repair during 2014, under a Natural England Stewardship scheme. External consolidation and much of the internal shell decoration reinstated. A further and final phase of repair to the structural vaults which are largely below water level, is needed.



SITE NAME:	Manor Farm barn, Winterborne Clenston
DESIGNATION:	Listed Building grade I
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Mixed, multiple owners

Huge late C16 tithe barn part used for storage. The hammerbeam roof may have been reused from a monastic building at Milton Abbey. Partial roof collapse resulted in Historic England funding the erection of scaffolding as a temporary roof support. These repair works were completed in 2008, but there has been no further progress and the building is slowly deteriorating.



LIST ENTRY NUMBER:	1110166
SITE NAME:	Bindon Abbey (site), Wool
311214112	Billdoll 7 (BBC) (Site), 11001
DESIGNATION:	Scheduled Monument, LB grade I
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	E (A)

Private

1002703

Bindon Abbey was founded as a Cistercian monastic house in 1172 and converted to a fine house in 1539 following the Dissolution. Much of the building was burnt down during the English Civil War but some of the structure survives as a standing ruin of up to 7 metres high. The masonry was very precarious, with several recent falls of stone, and supported by scaffolding. In 2018, the estate received a repair grant from Historic England and, as of Summer 2019, most of the main repairs are complete, Still some ivy removal and consolidation needed elsewhere on the site,

but progressing well.

Contact: Katy Hoskyn 0117 975 1311

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:



© Marcus Chantrey, Benjamin Beauchamp Architects

SITE NAME:	Church of St Peter and St Paul, Market Place, Blandford Forum
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	B (A)
OWNER TYPE:	Religious organisation

1251913

This church is a prime example of Georgian church architecture outside London. It was rebuilt after a fire between 1732 and 1739 to designs by John and William Bastard. The external stonework is in poor condition and there is water ingress to the interior causing damage to the plaster work. A Development grant was awarded by the National Lottery Heritage Fund in January 2019 for repairs works to nave roof, parapet gutters, high level masonry and internal plasterwork.

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Church of St John, The Harbour, West Bay, Bridport
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Fair
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1279419

This 1930s Arts and Crafts church is a simple, low building on the quayside, built to serve the local fishing community. Since it was added to the Heritage at Risk register in 2014, the congregation have made very good progress. Although there are still some areas of damp, and the leaded windows are leaking, the roofs have been repaired and the building is beginning to dry out. Some further work is needed but it is improving.

Contact: Katy Hoskyn 0117 975 1311



© Marcus Chantrey, Benjamin Beauchamp Architects

SITE NAME: Church of St Andrew, The Street, Charmouth DESIGNATION: Listed Place of Worship grade II, CA CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation		
CA CONDITION: Poor PRIORITY CATEGORY: C (C)	SITE NAME:	•
PRIORITY CATEGORY: C (C)	DESIGNATION:	
()	CONDITION:	Poor
OWNER TYPE: Religious organisation	PRIORITY CATEGORY:	C (C)
0 0	OWNER TYPE:	Religious organisation

1215162

Parish church. Entirely rebuilt 1836-8, by Charles Fowler in Gothic Revival style. Forest marble plinth, chert rubble walls with "long-and-short style" stone dressings. Window dressings of Beer stone. Boscastle slate roofs; nave has tiled ridge. Tower and church walls are cement pointed which is failing causing water ingress. Unsuccessful in attempts to secure funding from National Lottery Heritage Fund. Reroofing of north porch underway in Spring 2019. Further works are planned and funding being sought to address the water ingress and damage caused.

Contact: Sarah Ball 0117 975 0666



© James Menzies

SITE NAME:	Church of All Saints, Straits, Portland
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1281831

Church built in 1914-17 to design of Crickmay and Sons. Built of Portland ashlar with predominantly tiled roofs. Traditionally orientated with large nave, north and south aisles, north and south transepts, chancel, side chapel and vestry. Windows in south chapel by Clayton and Bell. Strong design of single phase with meticulous detailing and retaining most of its original fittings. Window stonework in poor condition.

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Parish Church of St Andrew, Trent
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	F (B)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1323927

Medieval church with a richly decorated interior. There is internal damp, and structural work to the tower and spire is needed. The church also has important and high quality medieval and Victorian window glass, some of which is showing signs of structural instability and paint detachment. Conservation works have been undertaken to the east and west windows and external protective glazing installed on the east window. The chancel roof has been recovered. Repair works to the spire are due to commence in June 2019.

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument

1EKITAGE AT KISK 2019 / 300	ITH WEST / DORSET (UA)		
SITE NAME:	Group of round barrows on Ridgeway		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002760
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Abbotsbury Castle (camp), Abbotsbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002710
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Four bowl barrows 725 metres ESE of Wears Farm	n, Abbotsbury	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002825
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Group of five round barrows on White Hill, Abbor	tsbury	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003213
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Round barrow 230 yards (210 metres) east of Wh	ite Hill Plantation, A	Abbotsbury
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1002824
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Two fishponds in Oddens Wood, Abbotsbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015696
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Two round barrows on Wears Hill, Abbotsbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002731
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Keith Miller 0117 975 0670

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	The Double Barrow, a bowl barrow in Kite Hill F Affpuddle	Plantation 250 metres	s south east of Roger's Hill Cottages,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015900
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Length of deer park bank and ditch at Alderholt,	Alderholt	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002394
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Barrow east of Burnt House Bottom, Alton Panc	ras	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002862
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow on Worgret Heath, 320 metres no	rth west of High Tor	, Arne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018190
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Linear boundary 870 metres south west of Spring	g Farm, Ashmore	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020729
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Linear boundary and section of Roman road, 550 Royal	metres south east o	f Ashmore Farm, Ashmore / Tollard
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020728
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Earthwork 80 yards (70 metres) long, north west	of Coombe Bottom	, Askerswell
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002734
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Round barrow north west of Coombe Bottom,	Askerswell		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003061	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow on Beaminster Down 530 metres	Bowl barrow on Beaminster Down 530 metres south east of East Axnoller Farm, Beaminster		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015049	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow on Beaminster Down 770 metres	north east of Higher I	Meerhay Farm, Beaminster	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015050	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 515 metres south of the southern	extent of Horse Clos	e Plantation, Bere Regis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015386	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 590 metres north east of Bere Do	wn Farm, Bere Regis		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015378	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 610 metres east of Bere Heath Fal	rm, Bere Regis		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015365	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Government or agency	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 790 metres north east of Hayward	ds Farm, Bere Regis		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015330	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay: no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.

 Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial uses). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow on Warren Heath, 350 metres sou	ith west of Warren H	ouse, Bere Regis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019367	
CONDITION:	Extensive significant problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311	
ITE NAME:	Four bowl barrows 240 metres east of Oak Cot	tage, Bere Regis		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015369	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Long barrow on Bere Down, 1100 metres north	n east of Roke Barn, B	ere Regis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015329	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	The End Barrow, a bowl barrow 320 metres south west of White House, Bere Regis			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017462	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311	
ITE NAME:	Three bowl barrows 230 metres south west of	Haywards Farm, Bere	Regis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015333	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Two bell barrows and a bowl barrow, 200 metr	es north east of Hayw	ards Farm, Bere Regis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015332	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
ITE NAME:	Two bowl barrows on South Heath, 900 metres	SSE of The Bungalow	, Bere Regis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017694	
	Generally unsatisfactory with major localised	TREND:	Declining	
CONDITION:	problems			
	problems Scrub/tree growth	NEW ENTRY?:	No	
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	•	NEW ENTRY?: CONTACT:	No Katy Hoskyn 0117 975 131	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bell barrow on Blackhill Clump 470 metres north of	of Mintern's Ferry,	Bere Regis / Turners Puddle
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015899
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two bowl barrows both 350 metres north east of	Spring Garden Bar	n, Bere Regis / Turners Puddle
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015898
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	St Leonard's Chapel, Blandford Forum		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1002726
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Roman villa south east of East Farm, Bradford Abb	as	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002414
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Educational (independent)	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bell barrow in Highfield Plantation and two bowl b Bradford Peverell	arrows immediately	north west of Forty Acre Plantation
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019415
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 380 metres west of Whitfield Farm, I	Bradford Peverell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019639
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Group of barrows in Seven Barrow Plantation, Bra	dford Peverell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002812
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 Slow decay; solution agreed but for tyet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial like) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Long barrow and four bowl barrows 500 metres n	orth west of Whitfi	ield Farm, Bradford Peverell
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019416
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Discontinuous surviving sections of Roman aquedu	ct, Bradford Pevere	ell / Dorchester
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1002730
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Culliford Tree long barrow and group of round bar	rrows, Broadmayne	e / Whitcombe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003304
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Field system in Old Park, Bryanston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002427
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Two bowl barrows on Lord's Down 580 metres so	outh east of Crawth	norne Farm, Burleston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017277
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	The Castle hillfort, Cattistock		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004545
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow on Dickley Hill, Cerne Abbas		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002849
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Settlement on Dickley Hill, Cerne Abbas			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002852	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	Yes	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 470 metres south east of Down Ba	ırn: an outlier of the (Chaldon Down barrow group, Chaldo	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008146	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 650 metres south of Chaldon Dow cemetery, Chaldon Herring	n Buildings: part of th	ne Chaldon Down round barrow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008523	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	The Round Pound, an enclosure on Chaldon Down, Chaldon Herring			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018436	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Two bowl barrows 200 metres south east of Hil	l Barn: two of a group	o of three barrows, Chaldon Herring	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008162	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Wardstone Barrow: a bowl barrow on the Dors Chaldon Herring	et coastal ridge 300 n	netres south of Chideock Farm,	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008676	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 350 metres south of Gorcombe Fa	rm, Charlton Marsha	II	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014848	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 500 metres south west of Gorcom	be Farm, Charlton M	arshall
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014847
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 650 metres south west of Gorcom	be Farm, Charlton M	arshall
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014849
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 1020 metres south east of Charisv	orth Cottages, Charl	ton Marshall
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014846
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow on Wood Hill 310 metres north ea	ast of Cowden, Charr	minster
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019395
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow east of Forston Farm, Charminsto	er	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002851
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow on Cheselbourne West Down, C	heselbourne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002878
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Long barrow 360 metres SSW of Chettle House	, Chettle	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013792
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow on Creech Barrow Hill, Church Kr	nowle / Steeple	
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1014830
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Section of Roman road 150 metres south of Pa	rk Farm Cottages, Col	ehill	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018028	
CONDITION:	Extensive significant problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 360 metres south of Compton Ba	ırn, Compton Valence		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019741	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Settlement south east of Soaper's Hill Plantation	n, Compton Valence		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003234	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	The Rings: a ringwork and bailey and a Civil War battery 400 metres south west of Corfe Castle, CorCastle			
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1011479	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Charity (heritage)	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 450 metres east of Dennet's Bott	om Barn, Dewlish		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015427	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 550 metres WNW of West End I	Barn, Dewlish		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015032	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Three bowl barrows 380 metres west of West	End Barn, Dewlish / M	ilborne St. Andrew	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015031	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Earthwork east of Stake Farm, East Chelboroug	gh		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002845	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
	F			
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
PRINCIPAL VULNERABILITY:		NEW ENTRY?: CONTACT:	No Katy Hoskyn 0117 975 1311	

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Three bowl barrows in Holme Lane Plantation, 2	200 metres south wes	st of Squirrel's Cottages, East Holme
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016728
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two barrows known as 'Water Barrows' 650 m cemetery to the south east of East Lulworth, Ea	etres WNW of White st Lulworth	eway Farm: part of a round barrow
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008144
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Flower's Barrow: a small multivallate hillfort and	associated outwork of	on Rings Hill, East Lulworth / Tyneha
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008141
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Bowl barrow 60 metres north east of Hethfelto	n Farm, East Stoke	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018192
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow on Farm Heath, 470 metres south	east of Hill Cottages,	East Stoke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016272
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Bowl barrow on Farm Heath, 480 metres south	east of Hill Cottages,	East Stoke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016271
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Section of Battery Bank on Binnegar Plain, 830 n	netres north east of S	tokeford Farm, East Stoke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018189
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Section of Battery Bank on South Heath, East St	oke	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016273
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Two bowl barrows on South Heath, 290 metres	and 370 metres east	of Binnegar Hall, East Stoke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016276
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Bell barrow 500 metres north east of Beacon Fa	rm, Ferndown Town	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015995
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Bell barrow known as Belle Vue Barrow and a b Town	owl barrow 250 metr	res north east of Hillamsland, Ferndow
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015994
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Bowl barrow 250 metres west of Ferndown Upp	per School, Ferndowr	n Town
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015791
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Part of Ackling Dyke (Roman road), including Ro Michael / Pentridge / Wimborne St. Giles	oman road on Oakley	Down, Gussage All Saints / Gussage St
DESIGNATION:	Scheduled Monument, part in RPG grade II*	LIST ENTRY NUMBER:	1003309
CONDITION:	Extensive significant problems	TREND:	Declining
RINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Barrow on Parsonage Hill, Gussage St. Michael		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002783
CONDITION:	Extensive significant problems	TREND:	Declining
RINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Scheduled Monument CONDITIONS Generally satisfactory but with significant localised problems PRISORAN Arable ploughing CONDITIONS COMMENTATION COMME	SITE NAME:	Long mound 1500 yards (1370 metres) east of Hig	her Farm, Gussage	St. Michael
Seminary Problems Seminary Problems Anable ploughing SONDARTHY Commercial company CONTACT: CONTACT: CONTACT: CATY Hostyn 0117 975 1311 SEMINARE Two barrows near Ackling Dyke, Gussage St. Michael Scheduled Monument Extensive significant problems TRONG: CONTACT: TWO DOZ786 Scheduled Monument Extensive significant problems TRONG: CONTACT: Two Long Barrows on Gussage Hill, Gussage St. Michael Scheduled Monument Two Two In St. Scheduled Monument Generally satisfactory but with significant localised problems REMINISTRATION Scheduled Monument Generally satisfactory but with significant localised problems REMINISTRATION Commercial company	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002784
CONTROL Commercial company CONTROL Katy Hoskyn 0117 975 1311 Two barrows near Ackling Dyke, Gussage St. Michael CONTROL Scheduled Monument CONTROL Declining RESCHAUSERSHULTY Arable ploughing NANY MIRTER No CONTROL Scheduled Monument CONTROL Katy Hoskyn 0117 975 1311 Two long barrows on Gussage Hill, Gussage St. Michael Scheduled Monument Commercial company Commercial Co	CONDITION:		TREND:	Declining
Two barrows near Ackling Dyke, Gussage St. Michael Scheduled Monument Scheduled Monument Scheduled Monument Scheduled Monument Scheduled Monument Scheduled Monument Two long barrows on Gussage Hill, Gussage St. Michael Scheduled Monument Two round barrows on Gussage Down, Gussage St. Michael Scheduled Monument Scheduled Monument Two round barrows on Gussage Down, Gussage St. Michael Scheduled Monument Schedul	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
RESIDENTIFICAL Scheduled Monument UST ENTRY NUMBER 1002786 EXTENSIONE EXTENSIVE Significant problems NEW ATTER NUMBER 1002707 TWO long barrows on Gussage Hill, Gussage St. Michael Scheduled Monument UST ENTRY NUMBER 1002707 CONDITION: Commercial company CONTACT: Katy Hoskyn 0117 975 1311 CONDITION: Scheduled Monument IST ENTRY NUMBER 1002741 CONDITION: Extensive significant problems PRINCE Declining NEW ENTRY: NUMBER 1002741 CONDITION: Extensive significant problems PRINCE CONTACT: Katy Hoskyn 0117 975 1311 C	OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
Extensive significant problems TREAD: Declining MARKER NO CONTACT: Katy Hoskyn 0117 975 1311 111 111 111 111 111 111 111 111 1	ITE NAME:	Two barrows near Ackling Dyke, Gussage St. Mich	ael	
RENIGIPAL VOLUMENMILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 TOWNET TITLE Private CONTACT: Katy Hoskyn 0117 975 1311 TOWNET TITLE PRIVATE: Two long barrows on Gussage Hill, Gussage St. Michael Scheduled Monument (ISTENTRY NUMBER: 1002707 Generally satisfactory but with significant localised problems Problems (ISTENTRY NUMBER: 1002707 Arable clipping New ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 TOWNET TITLE TWO round barrows on Gussage Down, Gussage St. Michael The Private (ISTENTRY NUMBER: 1002741 Declining New ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 Extensive significant problems TREND: Declining New ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley- DESCRIPTION Scheduled Monument (ISTENTRY NUMBER: 1002740 DECLINING NUMBER: No CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Earthworks on Gussage Down, Gussage St. Michael / TIEND: Declining NUMBER: No CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton EXTENSIVE: No CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE: Private (CO	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002786
ENTERNAME Two long barrows on Gussage Hill, Gussage St. Michael Scheduled Monument Two round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows on Gussage Down, Gussage St. Michael SCHEDULE TWO round barrows significant problems SCHEDULE TWO round barrows significant problems SCHEDULE TWO round barrows near Thickthorn Farm, Gussage St. Michael SCHEDULE TWO round barrows near Thickthorn Farm, Gussage St. Michael SCHEDULE TWO round barrows near Thickthorn Farm, Gussage St. Michael SCHEDULE TWO round barrows near Thickthorn Farm, Gussage St. Michael SCHEDULE TWO rounds SCHEDULE TWO rounds	CONDITION:	Extensive significant problems	TREND:	Declining
Two long barrows on Gussage Hill, Gussage St. Michael Scheduled Monument Generally satisfactory but with significant localised problems REACHAL MULLINEABILITY: CONDITION: CONTRACT: CO	'RINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Sesignation Scheduled Monument UST ENTRYMENSEN 1002707 CONDITION Generally statisfactory but with significant localised problems RINCIPAL VULNETABILITY: Arable clipping NEW ENTRY: No CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME TWO round barrows on Gussage Down, Gussage St. Michael SESIGNATION Scheduled Monument UST ENTRYMUNISER: 1002741 CONDITION Extensive significant problems TREND Declining RINCIPAL VULNETABILITY: Arable ploughing NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley SESIGNATION Scheduled Monument UST ENTRYMUNISER: 1002740 CONDITION Extensive significant problems TREND Declining RINCIPAL VULNETABILITY: Arable ploughing NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS SCHEDULED NO EXTENSIVE Significant problems TREND Declining RINCIPAL VULNETABILITY: Arable ploughing NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS SCHEDING NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW TRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS SCHEDING NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTRY: NO CONTRACT: Katy Hoskyn 0117 975 1311 THE NAME ROUND BARROWS NEW ENTR	OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
Generally satisfactory but with significant localised problems RINCIPAL YULNERABILITY: Arable clipping New BOTKY: No COMMACT: Katy Hoskyn 0117 975 1311 THE NAME: Two round barrows on Gussage Down, Gussage St. Michael ESSONATION: Scheduled Monument ESTONATION: Scheduled Monument ESTONATION: Scheduled Monument EXTERNITY: Arable ploughing NEW BOTKY: NO CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Type: Private CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Barthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley ESSONATION: Scheduled Monument ESTENBER: Declining RINCIPAL YULNERABILITY: Arable ploughing NEW BOTKY: NO CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Barthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley ESSONATION: Scheduled Monument ESTENBER: Declining RINCIPAL YULNERABILITY: Arable ploughing NEW BOTKY: NO CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton ESSONATION: Scheduled Monument ESTONATION: Maty Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell ESTONATION: Scheduled Monument ESTONATION: Scheduled M	ITE NAME:	Two long barrows on Gussage Hill, Gussage St. Mi	chael	
problems pro	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002707
Commercial company Contact: Katy Hoskyn 0117 975 1311 Two round barrows on Gussage Down, Gussage St. Michael SesGNATION: Scheduled Monument UST ENTRY NUMBER: 1002741 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 SESGNATION: Scheduled Monument UST ENTRY NUMBER: 1002740 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton SESGNATION: Scheduled Monument UST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell SESGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell SESGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton CESGNATION: Scheduled Monument UST ENTRY NUMBER: 1018411 CONDITION: Cenerally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: No	CONDITION:		TREND:	Declining
Two round barrows on Gussage Down, Gussage St. Michael DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002741 DONNITION: Extensive significant problems REVENTRY: No DEVINITION: Private CONTACT: Katy Hoskyn 0117 975 1311 DISTENAME: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002740 DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002740 DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002816 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002816 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002816 DOWNER TYPE: Mixed, multiple owners TREND: Declining PRENCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002816 DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 DEVENTE TYPE: Mixed, multiple owners TREND: Declining DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 DEVENTE TYPE: No DOWNER TYPE: No DOWNER TYPE: No DOWNER TYPE: No DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1018411 DESIGNATION: Scheduled Monument UST ENTRY NUMBER:	'RINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
Scheduled Monument LIST ENTRY NUMBER: 1002741 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing Private CONTACT: Katy Hoskyn 0117 975 1311 STIT NAME: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley- DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002740 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 STE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton SESSIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 STE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton SESSIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 STE NAME: Round barrow north west of High Lea Farm, Hinton Martell SESSIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONTACT: Katy Hoskyn 0117 975 1311 STE NAME: Round barrow north west of High Lea Farm, Hinton Martell SESSIGNATION: Scheduled Monument LIST ENTRY NUMBER: No CONTACT: Katy Hoskyn 0117 975 1311 STE NAME: Round barrow cemetery and a cross dyke on Horton Common 800 meters south of Bridge Farm, Horton DESIGNATION: Scheduled Monument STE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 meters south of Bridge Farm, Horton DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems SCHEDITON: NEW ENTRY: No	OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DAVINER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311 ITENAME: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002740 Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DAVINER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 ITENAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1002816 EXTENSIVE Significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DAVINER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 ITENAME: Round barrow north west of High Lea Farm, Hinton DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 EXENSIONAL Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DEVINER TYPE: Round barrow north west of High Lea Farm, Hinton DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1004552 EXTENSIONAL Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DEVINER TYPE: Round Bowl barrow cemetery and a cross dyke on Horton DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1018411 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1018411 EXTENSIONAL UNDERABILITY: Scrub/tree growth NEW ENTRYP: No	SITE NAME:	Two round barrows on Gussage Down, Gussage S	t. Michael	
Arable ploughing NEW ENTRY!: No DATACT: Katy Hoskyn 0117 975 1311 THE NAME: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002740 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: NO DATACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: NO DAVER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: NO EXERCIPATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: NO DAVER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002741
Private Private CONTACT: Katy Hoskyn 0117 975 1311 TE NAME: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley Designation: Scheduled Monument UIST ENTRY NUMBER: 1002740 Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 TE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: NO DOWNER TYPE: No DOWNER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: ROUND BARROWS NEW ENTRY: NO DOWNER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument UIST ENTRY NUMBER: 1018411 THE NAME: BOWL BARROWS AND	CONDITION:	Extensive significant problems	TREND:	Declining
THE NAME: Earthworks on Gussage Down, Gussage St. Michael / Sixpenny Handley DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002740 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell SESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 THE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Designation: Scheduled Monument LIST ENTRY NUMBER: 1002740 CONDITION: Extensive significant problems TREND: Declining RINGIPAL VULNERABILITY: Arable ploughing NEW ENTRY!: No CONTACT: Katy Hoskyn 0117 975 1311 STENAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining RINGIPAL VULNERABILITY: Arable ploughing NEW ENTRY!: No DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 STENAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINGIPAL VULNERABILITY: Arable ploughing NEW ENTRY!: No DEVINER TYPE: No DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 STENAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: Unknown	OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
Extensive significant problems TREND: Declining NEW ENTRY?: No Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 ATABLE Ploughing Mixed, multiple owners Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing RINCIPAL VULNERABILITY: No DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: No DEVINITY: No DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 DONDITION: Generally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: No RINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY: No	SITE NAME:	Earthworks on Gussage Down, Gussage St. Michae	el / Sixpenny Handle	ey
Arable ploughing NEW ENTRYP: No DWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 BITE NAME: Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 BITE NAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No DWNER TYPE: Private BOW barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems FIREND: Unknown CONTACT: VILNERABILITY: No CONTACT: Katy Hoskyn 0117 975 1311 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Scheduled Monument LIST ENTRY NUMBER: VILNERABILITY: No CONDITION: Scheduled Monument LIST ENTRY NUMBER: VILNERABILITY: No CONDITION: Scheduled Monument LIST ENTRY NUMBER: VILNERABILITY: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002740
Mixed, multiple owners Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument Extensive significant problems RINCIPAL VULNERABILITY: Arable ploughing RINCIPAL VULNERABILITY: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Scrub/tree growth NEW ENTRYP: No	CONDITION:	Extensive significant problems	TREND:	Declining
Round barrows near Thickthorn Farm, Gussage St. Michael / Tarrant Hinton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1002816 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No DWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 SITE NAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No DOWNER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311 SITE NAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Scheduled Monument Extensive significant problems TREND: Declining NEW ENTRY?: No Declining Mixed, multiple owners Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Extensive significant problems TREND: DESIGNATION: Scheduled Monument UST ENTRY NUMBER: DESIGNATION: Extensive significant problems TREND: Declining NEW ENTRY?: No CONTACT: Katy Hoskyn 0117 975 1311 Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Katy Hoskyn 0117 975 1311 Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Katy Hoskyn 0117 975 1311 DESIGNATION: Scheduled Monument UST ENTRY NUMBER: LIST	OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
Extensive significant problems TREND: Declining NEW ENTRY: No WA rable ploughing Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 TENAME: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing Private Bowl barrow cemetery and a cross dyke on Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONTACT: Katy Hoskyn 0117 975 1311 TREND: No CONTACT: Katy Hoskyn 0117 975 1311 THE NAME: Bowl barrow cemetery and a cross dyke on Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	ITE NAME:	Round barrows near Thickthorn Farm, Gussage St	. Michael / Tarrant	Hinton
Arable ploughing NEW ENTRY?: No DOWNER TYPE: Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 Arable ploughing New Entry?: No Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 DONDITION: Extensive significant problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No DOWNER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311 ATABLE Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002816
Mixed, multiple owners CONTACT: Katy Hoskyn 0117 975 1311 Reference: Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing Private CONTACT: Katy Hoskyn 0117 975 1311 No CONTACT: Katy Hoskyn 0117 975 1311 Reference: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton Designation: Designation: Scheduled Monument EXTENSIVE DESIGNATION: Scheduled Monument CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth New ENTRY?: No	CONDITION:	Extensive significant problems	TREND:	Declining
Round barrow north west of High Lea Farm, Hinton Martell DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Katy Hoskyn 0117 975 1311 EXTENAME: Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Scheduled Monument Extensive significant problems PRINCIPAL VULNERABILITY: Arable ploughing Private Bowl barrow cemetery and a cross dyke on Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1004552 Declining No CONTACT: Katy Hoskyn 0117 975 1311 EXTENSIVE South of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY: No	OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
Extensive significant problems TREND: Declining Arable ploughing Private Bowl barrow cemetery and a cross dyke on Horton DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth TREND: Declining No New ENTRY?: No CONTACT: Katy Hoskyn 0117 975 1311 Katy Hoskyn 0117 975 1311 TREND: LIST ENTRY NUMBER: 1018411 TREND: Unknown NEW ENTRY?: No	ITE NAME:	Round barrow north west of High Lea Farm, Hinto	on Martell	
Arable ploughing Private CONTACT: Katy Hoskyn 0117 975 1311 Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004552
Private Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth CONTACT: Katy Hoskyn 0117 975 1311 LIST ENTRY NUMBER: 1018411 TREND: Unknown NEW ENTRY: No	CONDITION:	Extensive significant problems	TREND:	Declining
Bowl barrow cemetery and a cross dyke on Horton Common 800 metres south of Bridge Farm, Horton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018411 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Scrub/tree growth LIST ENTRY NUMBER: 1018411 TREND: Unknown NEW ENTRY?: No	OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
Generally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: Generally unsatisfactory with major localised TREND: Unknown NEW ENTRY?: No	ITE NAME:	Bowl barrow cemetery and a cross dyke on Horto	n Common 800 me	etres south of Bridge Farm, Horton
problems PRINCIPAL VULNERABILITY: Scrub/tree growth NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018411
-	CONDITION:		TREND:	Unknown
DWNER TYPE: Private CONTACT: Katy Hoskyn 0117 975 1311	PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
	OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Causewayed camp on Hambledon Hill, Iwerne C	Courtney or Shroton /	Child Okeford / Hanford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002767
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow known as Folly Barrow, Iwerne M	nster	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020030
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Two bowl barrows 350 metres south west of K	eeper's Lodge, south (east of Bareden Down, Iwerne Minste
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013745
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Alum works, other multi-period industrial rema Kimmeridge Bay, Kimmeridge	ins and an associated g	group of jetties and breakwaters,
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1017307
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bell barrow and five bowl barrows 1000 metres round barrow cemetery, Kingston Russell / Littl		n Russell Farm, part of the Black Dow
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011693
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 600 metres west of Well Bottom cemetery, Littlebredy	Wood, forming part o	f the Pitcombe Down round barrow
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013249
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Three bowl barrows 300 metres south west of round barrow cemetery, Littlebredy	Well Bottom Wood, f	forming part of the Pitcombe Down
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013251
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 550 metres north east of Pitcombe F Littlebredy / Kingston Russell	arm, part of the Bla	ack Down round barrow cemetery,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011694
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 250 metres north west of Veiny Che	ese Pond, Long Cri	ichel
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015191
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two bowl barrows 165 metres west of Veiny Che	ese Pond, Long Cri	chel
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015785
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Disc barrow and a bowl barrow 640 metres south Launceston	west of Veiny Che	ese Pond, Long Crichel / Tarrant
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020444
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Lambert's Castle: an Iron Age hillfort 425 metres v post-medieval fair and a telegraph station, Marshwo	vest of Nash Farm, ood	with a bowl barrow, and the sites of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017035
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Earthwork and ancient fields south east of Lyscoml	oe Bottom, Melcon	nbe Horsey / Cheselbourne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002456
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 70 metres south east of West End Ba	arn, Milborne St. Ai	ndrew
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014854
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 480 metres south east of West En	d Barn, Milborne St. A	Andrew	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014855	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Three bowl barrows on Milborne Down 520 me Castle hillfort, Milborne St. Andrew	tres and 585 metres	north east of obelisk on Weatherby	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019364	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Two bowl barrows and two ring ditches 450 me	tres north west of Ha	aywards Farm, Milborne St. Andrew	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019365	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Weatherby Castle, an Iron Age hillfort 1020 metres north west of Ashley Barn Farm, Milborne St. Andre			
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1019360	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Stable Barrow 230 metres NNE of Frogmore Fa	rm, Milborne St. Andr	rew / Milton Abbas	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1014761	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow in Morden Park 350 metres south	west of Hunting Bridg	ge, Morden	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016281	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Two bowl barrows 760 metres north east of Mil	ler's Farm, Morden		
DESIGNATION:	Scheduled Monument, RPG grade II*	LIST ENTRY NUMBER:	1016283	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JIH VVESI / DUKSET (UA)		
SITE NAME:	Obelisk on Fir Hill, Moreton		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1002425
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	King's Court Palace moated site, Motcombe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017276
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Hugh Beamish 0117 975 0726
SITE NAME:	Ancient settlement south west of Incombe Woo	d, Nether Cerne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002438
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Bowl barrow 230 metres north east of Great Sti	rode House, Netherb	oury
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016372
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Upton Fort, a coastal artillery battery and two se	earchlight emplaceme	nts, Osmington
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1021435
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Four barrows on Moigns Down, Owermoigne		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002774
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bradford Barrow, Pamphill		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002713
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Colsia fields on Bonswides Davis Banswides		
DESIGNATION:	Celtic fields on Pentridge Down, Pentridge	LICT ENITDY NILIMBED	1002707
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002796
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Long barrows and group of round barrows on Bok	erley Down, Pentri	dge
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002722
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Part of Dorset Cursus, Pentridge / Wimborne St. 0	Giles	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003222
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow south west of Bourne Farm, Piddleh	ninton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004550
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two barrows on Little Puddle Hill, Piddlehinton		
			1000004
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003224
DESIGNATION: CONDITION:	Scheduled Monument Generally satisfactory but with significant localised problems	LIST ENTRY NUMBER: TREND:	Declining
	Generally satisfactory but with significant localised		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
CONDITION: PRINCIPAL VULNERABILITY:	Generally satisfactory but with significant localised problems Arable clipping	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Generally satisfactory but with significant localised problems Arable clipping Private	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehing	TREND: NEW ENTRY?: CONTACT:	Declining No Katy Hoskyn 0117 975 1311
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument	TREND: NEW ENTRY?: CONTACT: nton LIST ENTRY NUMBER:	Declining No Katy Hoskyn 0117 975 1311 1002805
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems	TREND: NEW ENTRY?: CONTACT: Iton LIST ENTRY NUMBER: TREND:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Lower	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: Per Farm, Plush, Pido	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Lowe Scheduled Monument Generally satisfactory but with significant localised	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: Per Farm, Plush, Pide LIST ENTRY NUMBER:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311 Illetrenthide 1015037
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Low Scheduled Monument Generally satisfactory but with significant localised problems	TREND: NEW ENTRY?: CONTACT: ILST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: Per Farm, Plush, Pide LIST ENTRY NUMBER: TREND:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311 dletrenthide 1015037 Declining
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: PRINCIPAL VULNERABILITY:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Lowe Scheduled Monument Generally satisfactory but with significant localised problems Arable clipping	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: EF Farm, Plush, Pide LIST ENTRY NUMBER: TREND: NEW ENTRY? CONTACT:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311 dletrenthide 1015037 Declining No Katy Hoskyn 0117 975 1311
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Lowe Scheduled Monument Generally satisfactory but with significant localised problems Arable clipping Private	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: EF Farm, Plush, Pide LIST ENTRY NUMBER: TREND: NEW ENTRY? CONTACT:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311 dletrenthide 1015037 Declining No Katy Hoskyn 0117 975 1311
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: OWNER TYPE:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Low Scheduled Monument Generally satisfactory but with significant localised problems Arable clipping Private Bowl barrow on Pond Eweleaze 500 metres north	TREND: NEW ENTRY?: CONTACT: IST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: EF FARM, Plush, Pide LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: east of Dole's Ash	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311 Elletrenthide 1015037 Declining No Katy Hoskyn 0117 975 1311 Farm, Piddletrenthide
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Generally satisfactory but with significant localised problems Arable clipping Private Two barrows west of Little Piddle Down, Piddlehin Scheduled Monument Extensive significant problems Arable ploughing Private Bowl barrow on Plush Hill 600 metres ESE of Lowe Scheduled Monument Generally satisfactory but with significant localised problems Arable clipping Private Bowl barrow on Pond Eweleaze 500 metres north Scheduled Monument	TREND: NEW ENTRY?: CONTACT: INTON LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: EF Farm, Plush, Pide LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: east of Dole's Ash LIST ENTRY NUMBER:	Declining No Katy Hoskyn 0117 975 1311 1002805 Declining No Katy Hoskyn 0117 975 1311 Illetrenthide 1015037 Declining No Katy Hoskyn 0117 975 1311 Farm, Piddletrenthide 1015035

Immediate risk of further rapid deterioration or loss of fabric; no

B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

C Slow decay; no solution agreed.

D Slow decay; solution agreed but F not yet implemented.

E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Round barrow on Hog Leaze, Piddletrenthide		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003238
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Pilsdon Pen hillfort and associated remains, Pilsdon	ı	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019394
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Keith Miller 0117 975 0670
SITE NAME:	Enclosure south of Pimperne Down, Pimperne		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002860
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Round barrow north east of Friar Waddon, Portes	ham	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002488
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two round barrows on Ridgeway, Portesham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002758
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Battery 200 yards (180 metres) east of the Naval o	emetery, Portland	
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1002412
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Mesolithic sites near Culver Well, Portland		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1002406
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

.2 (32 / 11 11(31) 2017 / 300	THE WEST / BOIGET (OA)			
SITE NAME:	Barrow near east boundary of parish, Powerston	ck		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002809	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Group of barrows east of Northdown Barn, Pox	well		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1002770	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311	
ITE NAME:	Bowl barrow on Little Puddle Hill, 920 metres n	orth west of Fidler's (Green Farm, Puddletown	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017261	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Round barrow west of Druce Higher Barn, Puddletown			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002874	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Three round barrows on Puddletown Down, Pu	ddletown		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002450	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Two bowl barrows 320 metres south west of La	ycock Dairy Farm, Pu	ıddletown	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017266	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Two round barrows south west of Well House	Cottage, Puddletown		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002875	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	
SITE NAME:	Bowl barrow 400 metres north east of Look Far	rm, Puncknowle		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016370	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JIH WEST / DORSET (UA)		
SITE NAME:	Castle Hill, Shaftesbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002724
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Camp in Mistlebury Wood, Sixpenny Handley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002455
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Enclosure south of Humby's Stock Coppice, Sixper	nny Handley	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005575
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Crawford Castle (or Spetisbury Rings), Spetisbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004563
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Three bowl barrows in Avon Heath Country Park, Matcham's House, St. Leonards and St. Ives	two 620 metres a	nd one 700 metres north west of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016095
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bell barrow 70 metres west of Fidler's Green, Stin:	sford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017262
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Hod Hill camp and Lydsbury Rings, Stourpaine / Ha	anford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002678
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Keith Miller 0117 975 0670

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JTH WEST / DORSET (UA)		
SITE NAME:	Round barrow north east of Hog Hill Barn, Stratto	on	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1003237
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow north west of Jackman's Cross, Stra	atton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002470
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow on Stratton Down, Stratton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002871
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Group of three bell barrows and a bowl barrow on Godlingston Heath, Studland		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014291
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Earthworks on Loscombe Hill, Sydling St. Nicholas		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002820
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow on Eype Down 275 metres east of Fr	ogmore Farm, Sym	nondsbury
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016100
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Slight univallate hillfort 850 metres north east of B	usseys Stool Farm,	Tarrant Gunville
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020611
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 200 metres south east of Pimperne	J		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013794	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Prehistoric habitation site between north and south Hinton Downs, Tarrant Hinton			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003235	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Roman villa on Little Barton Hill, Tarrant Hinton	/ Tarrant Gunville		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002424	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow 350 metres south west of Buzbury	Rings, Tarrant Keyne	eston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013789	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow 850 metres ESE of Hill Farm, Tarra	nt Keyneston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015182	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Buzbury Rings, Tarrant Keyneston / Tarrant Raw	ston / Langton Long	Blandford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002718	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow 600 metres south of Plantation Far	m, Tarrant Launcesto	on	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015190	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow on The Cliff 680 metres east of Lu	ton Farm, Tarrant Ra	wston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015187	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow on The Cliff 680 metres NNW of	Smith's Cottages, Tar	rant Rawston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015186
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow and two bowl barrows 140 metres	north west of Dorm	y House, Tarrant Rawston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014572
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Roman enclosure on Keyneston Down, Tarrant	Rawston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002373
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Holditch Court Tower, Thorncombe		
DESIGNATION:	Scheduled Monument, LB grade I	LIST ENTRY NUMBER:	1002835
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sarah Ball 0117 975 0666
SITE NAME:	Four bowl barrows 710 metres north, 750 metr Tolpuddle	es north west and 95	0 metres north west of Clyffe House,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016378
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow in Piddle Wood, 530 metres north east of Gate Barn, Turners Puddle		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015901
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Group of six bowl barrows, forming a round bar	row cemetery on Bla	ck Hill, Turners Puddle / Bere Regis
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015897
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	High Cank, a hengi-form monument 520 metres no	orth of Up Cerne M	lanor House, Up Cerne
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1018413
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Stephen's Castle, a bowl barrow 720 metres east of Eastworth Farm, Verwood		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021148
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Decoy pond and associated overnight shelter on D	ecoy Heath, Warel	ham St. Martin
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016916
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Light Anti-aircraft battery on Holton Heath, 210 m	etres west of Sandi	ford House, Wareham St. Martin
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019153
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Light Anti-aircraft battery on Holton Heath, 650 m	etres south east of	Sandford House, Wareham St. Mart
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019152
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Royal Naval Cordite Factory at Holton Heath, Wa	reham St. Martin	
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1019151
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Four bowl barrows 150 metres north east of Seven	n Barrows Farm, W	/areham Town
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015373
	Generally satisfactory but with significant localised	TREND:	Declining
CONDITION:	problems		
	Stock erosion - extensive	NEW ENTRY?:	No
CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	·	NEW ENTRY?: CONTACT:	No Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- deterioration or loss of labric; is solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Dyke south east of Eggardon Hill camp, West Com	npton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002404
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Barrow near Eggardon, West Compton / Powersto	ock	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004567
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bindon Hill camp, West Lulworth / East Lulworth		
DESIGNATION:	Scheduled Monument, part in CA, WHS	LIST ENTRY NUMBER:	1002705
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Parley Barrow, a bowl barrow on the corner of Ell	esfield Drive and D	ruid's Close, West Parley
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015792
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two bowl barrows on Frome Hill 520 metres wes	t of Frome Farm, V	Vest Stafford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019875
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Enclosure on Mount Pleasant Hill, West Stafford /	Dorchester	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002463
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Coney's Castle camp, Whitchurch Canonicorum		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003208
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Keith Miller 0117 975 0670

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Three bowl barrows 530 metres and 350 metres n	orth east of White	ombe Barn. Whitcombe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019413
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Oval barrow and three bowl barrows 250 metres a	and 330 metres sou	uth of Whitcombe Barn, Whitcombe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019414
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two round barrows south of Cranborne Farm, W	imborne St. Giles	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002459
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Barrows in and near St Giles Park, Wimborne St. C	Giles / Edmondshan	1
DESIGNATION:	Scheduled Monument, part in RPG grade II*	LIST ENTRY NUMBER:	1002782
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Barrows in and near The Drive Plantation, Wimbo	rne St. Giles / Guss	sage All Saints
DESIGNATION:	Scheduled Monument, part in RPG grade II*	LIST ENTRY NUMBER:	1002788
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Barrows in Salisbury Plantation, Wimborne St. Gile	es / Pentridge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002817
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Drove Hill round barrows, Winfrith Newburgh		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002765
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two round barrows north of Came Farm, Winterl	oorne Came	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002828
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 150 metres north east of Dunbury, V	Vinterborne Hough	nton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014758
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 500 metres south of West Down Bar	rn, Winterborne Ki	ingston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020986
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow immediately north west of Maiden Ca	astle, Winterborne	Monkton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015779
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Long barrow, three bell barrows, fancy barrow and Winterborne Monkton	d a linear earthwork	< 800 metres north of Maiden Castle
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015783
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow cemetery immediately south east of	f Maiden Castle, W	interborne Monkton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015778
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Settlement remains north of Maiden Castle, Winte	rborne Monkton /	Dorchester
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1002409
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

HERITAGE AT RISK 2019 / SOC	DIFF VVEST / DORSET (UA)		
SITE NAME:	Group of barrows south of Goldsmith's Plantation	on, Winterborne St. N	Martin ————————————————————————————————————
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002810
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Group of round barrows near Eweleaze Barn, V	Vinterborne St. Martir	n
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1002756
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners CONTACT: Katy Hoskyn		Katy Hoskyn 0117 975 1311
SITE NAME:	Group of round barrows on and to east of Grea	t Hill, Winterborne S	t. Martin
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004564
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow north of Ridgeway, Winterborne	St. Martin	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002759
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrows on Four Barrow Hill, Winterboo	rne St. Martin	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002755
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrows on Grove Hill, Winterborne St.	Martin	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002757
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Three barrows south of Hart Hill Plantation, Wi	interborne St. Martin	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002814
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two barrows at Rew, Winterborne St. Martin		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002811
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Group of round barrows on Shorn Hill and Bronk	ham Hill, Winterbo	rne St. Martin / Portesham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002699
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 900 metres north west of Pond Dov	vn Buildings, Winter	rborne Stickland
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013749
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 25 metres south of Whitechurch Hil	l Barn, Winterborn	e Whitechurch
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013788
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Milling House, West Farm, Winterborne Whitech	urch	
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1002396
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management NEW ENTRY?: N		No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 120 metres south of the southern extent of Horse Close Plantation, Winterborne Whitechur / Bere Regis		
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015387
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bell barrow 100 metres south of Winterbourne Po	oor Lot, part of the	Winterbourne Poor Lot round barrow
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012027
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 400 metres north east of Manor Fare Winterbourne Abbas	m, part of the Poun	d Hill round barrow cemetery,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011692
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Katy Hoskyn 0117 975 1311

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed but F not yet implemented.

 Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial lists) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 450 metres north east of Manor Farr Winterbourne Abbas	n, part of the Pound	d Hill round barrow cemetery,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011691
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Triple barrow and bowl barrow forming part of a be metres north east of Winterbourne Poor Lot, Wir		nd part of an associated field system 2
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012030
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two bell barrows 15 metres north of Well Botton Winterbourne Abbas	n Wood, part of the	e Poor Lot round barrow cemetery,
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1012029
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Unknown	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow in Well Bottom Wood, Winterbourne Abbas / Littlebredy		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013255
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Four round barrows north west of Blagdon Barn, \	Winterbourne Steep	pleton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002750
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Round barrow on Pound Hill, Winterbourne Steep	leton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002870
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
ITE NAME:	Round barrow south west of village, Winterbourne	e Steepleton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002751
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

SITE NAME:	Round barrows on Sheep Down, Winterbourne	Steepleton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003306
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two conjoined bowl barrows 550 metres north	east of Manor Farm,	Pound Hill, Winterbourne Steepleton
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1002687
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Two round barrows on North Hill, Winterbour	ne Steepleton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002865
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Group of barrows near Big Wood, Winterbourne Steepleton / Winterbourne Abbas		
DESIGNATION:	Scheduled Monument, part in RPG grade II	LIST ENTRY NUMBER:	1002696
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Group of henge monuments, an associated grou at Knowlton, Woodlands	o of round barrows, a	Saxon cemetery and a Norman churc
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1020580
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Round barrow cemetery south of New Barn Far	m, associated with th	e Knowlton Circles, Woodlands
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020582
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow 300 metres south east of Hyford C	Cottage, Wool	
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015894
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OVA/NIED TVDE	D. t.	001171.07	
OWNER TYPE:	Private	CONTACT:	Katy Hoskyn 0117 975 1311

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 38	0 metres north west of Hyford Co	ttage, Wool	
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1015895
CONDITION:	Generally unsatis problems	factory with major localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree grow	th	NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bul Barrow, 750	metres east of Rawlsbury Camp, V	Voolland	
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1013787
CONDITION:	Generally unsatis problems	Generally unsatisfactory with major localised problems		Declining
PRINCIPAL VULNERABILITY:	Scrub/tree grow	th	NEW ENTRY?:	No
OWNER TYPE:	Commercial com	npany	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow on	Emmett's Hill, Worth Matravers		
DESIGNATION:	Scheduled Monu	ment, WHS	LIST ENTRY NUMBER:	1017268
CONDITION:	Extensive significa	ant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow on	North Hill, 400 metres north east	of Renscombe Far	m, Worth Matravers
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1017269
CONDITION:	Extensive significa	Extensive significant problems		Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	Arable ploughing		Yes
OWNER TYPE:	Private		CONTACT:	Katy Hoskyn 0117 975 1311
SITE NAME:	Bowl barrow on	e kilometre south west of Manor F	arm, Wraxall	
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1015051
CONDITION:	Generally satisfact problems	ctory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Katy Hoskyn 0117 975 1311
	SITE NAME:	Kingston Maurward, Stinsford		ape around early C18 house with notable
	designation:	Registered Park and Garden grade II*, 8 LBs, part in SM, part in CA	Edwardian gardens open to the public. House nucleus of expanding land-based college. Mar buildings which impact on view lines and appropriate the standard landscape. In 2011, Natural England	ding land-based college. Many post-war
A STATE OF THE PARTY OF THE PAR	CONDITION:	Generally satisfactory but with minor localised problems	restoration plan proposals appear	for part of the park. Further developmen r to have been shelved, for the present.
	VULNERABILITY:	High		is being consulted on a new draft ide future development.
建	TREND:	Stable		
) Historic England	NEW ENTRY?:	No		
	OWNER TYPE:	Educational (state sector)		
	LIST ENTRY NUMBER:	1000719	Contact: Jo McA	llister 0117 975 0696
SITE NAME:	Blandford Forum	,		
DESIGNATION:			NEW ENTRY?:	No
223.314 (11014.	Conservation Ar	ea, LD grade i	. ACTT ELVINII.	INU

PRIORITY	CATEGORIES

CONDITION:

 ${\tt VULNERABILITY:}$

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.

Very bad

Low

D Slow decay; solution agreed but not yet implemented.

E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

TREND:

CONTACT:

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Deteriorating

ABBREVIATIONS

Paul Wyeth (LPA) 01305 251010

SITE NAME:	Gillingham		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Paul Wyeth (LPA) 01305 251010
SITE NAME:	Lytchett Minster, Lytchett Minster and Upton		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Paul Wyeth (LPA) 01305 251010
SITE NAME:	Swanage		
DESIGNATION:	00.15.014.14.115		
	Conservation Area, 88 LBs, SM, WHS	NEW ENTRY?:	No
CONDITION:	Conservation Area, 88 LBs, SM, WHS Very bad	NEW ENTRY?: TREND:	No Deteriorating
CONDITION: VULNERABILITY:			
	Very bad Low	TREND:	Deteriorating
VULNERABILITY:	Very bad	TREND:	Deteriorating
VULNERABILITY: SITE NAME:	Very bad Low Weymouth Town Centre	TREND: CONTACT:	Deteriorating Paul Wyeth (LPA) 01305 251010
VULNERABILITY: SITE NAME: DESIGNATION:	Very bad Low Weymouth Town Centre Conservation Area, 361 LBs, SM	TREND: CONTACT: NEW ENTRY?:	Deteriorating Paul Wyeth (LPA) 01305 251010 No

GLOUCESTERSHIRE

CHELTENHAM



SITE NAME: Church of St Mark, Church Road, Cheltenham DESIGNATION: Listed Place of Worship grade II CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1386790

Parish church built in 1860-6 by John Middleton, with transepts of 1888. Drilled Cotswold stone with Bath stone quoins and dressings, Forest of Dean stone forming alternating polychromy in voussoirs (wedge shaped stones), red tile roof. Gothic Revival, Decorated style. Nave roof is in poor condition. Plain clay tile loss on the north vestry and chancel roofs were repaired in 2015. Water ingress in some areas is exacerbating the poor condition of the interior.

Contact: Chris Miners 0117 975 1355

© Historic England



© Historic England

SITE NAME: Church of St Luke, College Road, Cheltenham Listed Place of Worship grade II, DESIGNATION: CONDITION: Poor PRIORITY CATEGORY: D (D) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1387880

Church built in 1853-4 by Frederick W Ordish, partly intended for schoolboys from nearby Cheltenham College. Drilled Cotswold stone with ashlar quoins and dressings and with plain tile roof. Middle Pointed style. Cruciform plan with west tower; four-bay aisled nave with clerestory and south porch, crossing with north and south transepts, four-bay chancel with south Lady Chapel, north vestry. West tower has heavily broached spire. The roof covering is in poor condition and the interior is damaged by water ingress. The rainwater goods were repaired in 2016.

Contact: Chris Miners 0117 975 1355

COTSWOLD



Elizabeth Pengree Memorial, SITE NAME: The Square, Blockley DESIGNATION: Listed Building grade II*, CA CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Unknown LIST ENTRY NUMBER: 1341728

Commemorative monument (1770s) decaying on one side and the railings are displaced and in poor condition. Basic maintenance has been undertaken, but no significant repairs.

© Historic England Archive

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Alfreds Hall, Cirencester Park, Cirencester
DESIGNATION:	Listed Building grade II*, RPG grade I
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private

Folly, begun 1721, designed by Lord Bathurst with Alexander Pope's advice, completed 1732. Probably the earliest C18 mock-Gothic castle; part former house, part banqueting house and part mock ruin. Located in Oakley Wood, with rides radiating from it through the wood. The building is in very bad condition and continues to deteriorate.

Contact: Alessandra Perrone 0117 975 1345

TOTAL	
A A	
型2000年	
\$230 A TOWER	
(1) [1] [1] [1] [1] [1] [1] [1] [1] [1] [1]	
The second secon	
THE RESERVE OF THE PARTY OF THE	

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

SITE NAME:	Dovecote at the Manor House, Lower Slaughter
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (A)
OWNER TYPE:	Commercial company

1298719

A late C16 structure of coursed rubble and Cotswold stone roof. This large dovecote hosts two separate columbaria inside, built of nesting boxes from ground to the roof. It is currently without a use and in poor condition. Some emergency repairs to the roof coverings have been carried out in 2018.

1341062 Contact: Alessandra Perrone 0117 975 1345



© Historic England

© Historic England

SITE NAME:	Church of St Peter, Daylesford, Adlestrop
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Very bad
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENITRY NILIMBER.	1341122

Parish church in the high Gothic style by JL Pearson 1863. Cruciform plan with a pyramidal spire. Limestone with red sandstone features, stone slate roofs. The stone slates are slipping or fractured and need renewal. The sandstone colonettes are heavily eroded on the outside and are structurally unsafe. The church is now owned by the St Peter's Daylesford Charitable Trust and shares services between the Church of England and the Roman Catholic church.

Contact: Chris Miners 0117 975 1355



@ Historic	Fngland

SITE NAME:	Church of St James, Colesbourne
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1341787

Small parish church adjacent to Colesbourne Park. C12 with C15 tower and chancel; largely rebuilt 1851-53 by David Brandon. Random rubble limestone with ashlar tower; stone slate roof. Nave with north and south transept; west tower; south porch; and chancel. The roof slates have slipped or fallen and need repair on the north nave roof.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Church of St Edward, Evenlode
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1089794

Parish church. C12, C14, C19 vestry and porch, restoration by JEK Cutts 1879. Coursed squared and dressed limestone and sandstone. Stone slate roof. Plan: nave with north vestry, south aisle, projecting porch from west end of south aisle, west tower, chancel. The stone slate roofs, especially on the south side, have reached the end of their life and need renewal.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Arnold Bartosch Ltd

ITE NAME:	Church of St Bartholomew, Whittington

Listed Place of Worship grade DESIGNATION: II*, CA

CONDITION: Very bad

PRIORITY CATEGORY:

F(D) OWNER TYPE: Religious organisation

LIST ENTRY NUMBER: 1341364

Norman in origin; restoration by Waller around 1872 included roofs, porch and vestry, and removal of rood screen formerly dividing nave from chancel. South chapel possibly late C16-17. South aisle probably C18 rebuilt on smaller scale incorporating C12 elements. Stone slate roofs are in extremely poor condition and are likely to date from the 1872 restoration. National Lottery Heritage Fund Grant for Places of Worship awarded in 2017 for repairs to roofs. Repair phase underway and due for completion in September 2020.

Contact: Sarah Ball 0117 975 0666

SITE NAME:	Two bowl barrows 690 metres and 790 metres no	orth of The Manor F	arm, Avening
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017337
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Perrott's Brook dykes, Bagendon / North Cerney		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003436
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Long barrow 800 metres north east of Oldwalls Fa	ırm, Bibury	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018163
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	West Barrow: a long barrow 200 metres west of L	eighterton School,	Boxwell with Leighterton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013590
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Animal burrowing - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Chedworth Roman villa, Chedworth		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003324
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Rain entry	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Melanie Barge 0117 975 1300
SITE NAME:	Settlement south east of Chesterton Farm, Cirence	ester / Siddington	
	Scheduled Monument	LIST ENTRY NUMBER:	1003444
DESIGNATION:	ocheduled i fortument		
	Extensive significant problems	TREND:	Improving
CONDITION:		TREND: NEW ENTRY?:	Improving No
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Extensive significant problems		

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA NP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

HERITAGE AT RISK 2019 / SOU	TI H WEST / COTSWOLD		
SITE NAME:	Hullasey Grove medieval village site, Coates		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003359
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Three bowl barrows, known as Emma's Grove rou	ınd barrows, Cober	ley
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017079
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Two bowl barrows, known as Crippet's Wood rou Dryhill Farm, Coberley	und barrows, 560 m	netres and 590 metres north east of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017041
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Norbury Camp hillfort, Colesbourne		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018167
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Tump Barn bowl barrow, Didmarton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016077
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Camp at Upper Dowdeswell, Dowdeswell		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1003321
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Hoar Stone long barrow, Duntisbourne Abbots		
		LIST ENTRY NUMBER:	1018161
DESIGNATION:	Scheduled Monument		
	Scheduled Monument Generally unsatisfactory with major localised problems	TREND:	Declining
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Generally unsatisfactory with major localised		

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow in Three Ash Belt, 460 metres nor	th east of Westwood	Farm, Edgeworth
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016840
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Icomb camp, Icomb		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003342
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 134
ITE NAME:	The Chessalls Roman town, Kingscote / Wotton	-under-Edge	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018607
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Summerhill prehistoric site, Naunton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003339
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 134.
SITE NAME:	Bowl barrow in Inlands Plantation, 650 metres so	outh of Hazleton Man	nor Farm, Rodmarton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008788
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 134
ITE NAME:	Bowl barrow 120 metres north of Home Farm,	Sherborne	
DESIGNATION:	Scheduled Monument, RPG grade II, CA	LIST ENTRY NUMBER:	1017082
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Alessandra Perrone 0117 975 134
ITE NAME:	South Cerney castle, South Cerney		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003422
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bowl barrow 335 metres south east of Broadfiel	d Farm, Tetbury Upto	on
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016838
CONDITION:	Generally unsatisfactory with major localised	TREND:	Declining
CONDITION.	problems		
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

LIST ENTRY NUMBER:

SITE NAME:	Four bowl barrows forming part of a round barrow Hill Farm, Upper Slaughter	w cemetery, and a l	ong barrow 550 metres NNE of Eyford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020987
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345

FOREST OF DEAN



© Historic England Archive

SITE NAME:	Blakeney United Reformed Church, Cinderford Road, Blakeney, Awre
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

Contact: Alessandra Perrone 0117 975 1345

Stonework repairs required.



© Historic England Archive

SITE NAME:	Gunns Mill Furnace, Littledean
DESIGNATION:	Scheduled Monument and Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1002080 and 1186479

1186386

paper mill. Now unused and in perilous condition, despite some emergency holding repairs. The Forest of Dean Building Preservation Trust is working with Historic England to secure the future of the building. Funding to date has completed various surveys and improved the landscape and setting. A 2017 National Lottery Heritage Fund application was rejected. A revised application will be made for funding to develop a proposal to reuse the site and restore the furnace.

Formerly a C17 charcoal blast furnace and later an C18

Former non-conformist chapel, dated 1849. Remarkably complete and architecturally distinctive example of its type.

Contact: Melanie Barge 0117 975 1300



© Historic England

SITE NAME:	Lydney Docks and Harbour, Naas Lane, Lydney
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Government or agency

LIST ENTRY NUMBER: 1002079 and 1338556

The docks and harbour date from c1810 to 1821 and were once the main commercial port serving industry in the district. The Inner Basin is still in poor condition and needs extensive repairs. The Environment Agency has advertised the site and selected a preferred bidder to take over the ownership of the site. The final details of this sale are still being resolved. A local partnership group through the Local Authority are looking for funding to repair some structures and enhance the visitor experience of the site. Work has also been on-going to clear and control vegetation on the



© Historic England Archive

SITE NAME:	Tithe Barn, Highleadon Court, Rudford and Highleadon
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1152574

C15 or early C16 tithe barn built for the Abbey of St Peter, Gloucester. The roof is sound, but the framing and infill panels are deteriorating. Used for agricultural storage. Some maintenance has been undertaken.

Contact: Chris Miners 0117 975 1355

Contact: Melanie Barge 0117 975 1300

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

LIST ENTRY NUMBER:

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



SITE NAME:	Church of St Mary the Virgin, Flaxley, Blaisdon
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1186458

Parish church, 1856, by Sir George Gilbert Scott. Red sandstone ashlar, with grey sandstone ashlar dressings, timber porch, tiled roof with crested ridge, shingles to spire. Nave, north aisle, with tower at its west end, chancel, organ chamber and south porch. The nave roofs have had repairs, however the chancel and organ chamber roofs need urgent re-tiling. The spire shingling needs renewing following woodpecker damage.

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Michael and All Angels, Blaisdon
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1299195

Parish church, C15 tower, the rest rebuilt 1867-9 by FR Kempson of Hereford in the Early English style. Tower thin coursed rubble, church squared red Forest stone with Bath stone ashlar dressings; slate roof. West tower, four-bay nave, with north aisle, chancel with vestry, south entrance porch. The damp penetration into the church stonework at both high and low level put the building at risk. A Listed Places of Worship Roof Repairs Grant was accepted in 2015 for repairs which have addressed some of the issues.

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Mary, Dymock
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1303073

Large parish church. C11, C12, C14, C15, probably C18, Cl9 restoration. Tower, well-squared coursed stone; west end nave and east end chancel random rubble with ashlar dressings; transepts and vestry roughly squared, coursed stone with ashlar dressings; squared, coursed stone to east end nave, and bottom part west end, also west part of chancel. Tiled roofs, shingled spire. The stonework of the tower and buttresses is heavily eroded and a repair scheme is planned. The tiled roof pitches have been repaired.

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Michael, High Street, Mitcheldean
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1100386

Large parish church with a tall tower and needle spire. Slate roofs, south aisle flat roof. A National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship remedied some structural problems of the spire and the high level west aisle gables in 2012. A Listed Places of Worship Roof Repairs Grant repaired further roof problems, however more problems remain with instability at the apex of the spire.

Contact: Chris Miners 0117 975 1355

© Historia	: England

SITE NAME:	Church of St Saviour, Redbrook, Newland
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Very bad
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1212814

Small parish church, now sharing community hall uses, by JP Seddon in 1873. Nave with south porch and chancel with south chapel and bellcote; in red sandstone with buff limestone dressings. The limestone and sandstone mix has been auto-destructive with severe erosion of the sandstone on the north wall and to the limestone on the dressings on the south side. The tiled roof on the south nave pitch has slipped or missing tiles.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

I PA ΝP RPG

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Church of St Bartholomew, The Causeway, Redmarley D'abitot
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation

Keligious organisation

LIST ENTRY NUMBER: 1341976

Large parish church of sandstone ashlar with tiled roofs. C13, and part of the tower probably dates from that time; but the majority of the building goes back only to 1855 when most of the church was in serious disrepair, demolished and rebuilt. The stonework of the tower is seriously eroded with open jointing and structural cracking and rainwater disposal problems. Some falls of stone have been reported.

Contact: Chris Miners 0117 975 1355



SITE NAME:	Church of St Mary, Upleadon
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1153374

Small parish church; C12, C15, C18, restored 1850, 1879 by Ewan Christian; vestry added 1884. West tower is close-studded timber-framed tower, brick nogged, on squared, coursed stone plinth: with pyramidal slate roof. Nave sandstone ashlar with south entrance porch, lower east chancel with projecting north vestry. All with graduated stone slate roofs. The timber frame has patches of decay and some stone slates are slipping.

Contact: Chris Miners 0117 975 1355

SITE NAME:	Whitecliff Iron Works, Coleford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021420
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Melanie Barge 0117 975 1300
SITE NAME:	Offa's Dyke: section in Caswell Wood, 280 metres	west of Beeches F	arm, Tidenham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020601
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Offa's Dyke: section in Chapelhouse Wood, 240 m	etres west of the R	Lecreation Ground, Tidenham
SITE NAME: DESIGNATION:	Offa's Dyke: section in Chapelhouse Wood, 240 m Scheduled Monument	netres west of the R	ecreation Ground, Tidenham
DESIGNATION:	Scheduled Monument Generally unsatisfactory with major localised	LIST ENTRY NUMBER:	1020639
DESIGNATION: CONDITION:	Scheduled Monument Generally unsatisfactory with major localised problems	LIST ENTRY NUMBER: TREND:	1020639 Declining
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Scheduled Monument Generally unsatisfactory with major localised problems Scrub/tree growth	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	1020639 Declining No Alessandra Perrone 0117 975 1345
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Scheduled Monument Generally unsatisfactory with major localised problems Scrub/tree growth Private, multiple owners	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	1020639 Declining No Alessandra Perrone 0117 975 1345
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Scheduled Monument Generally unsatisfactory with major localised problems Scrub/tree growth Private, multiple owners Offa's Dyke: section in Lippets Grove, 680 metres	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: WSW of Beeches I	1020639 Declining No Alessandra Perrone 0117 975 1345 Farm, Tidenham
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Scheduled Monument Generally unsatisfactory with major localised problems Scrub/tree growth Private, multiple owners Offa's Dyke: section in Lippets Grove, 680 metres Scheduled Monument Generally unsatisfactory with major localised	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: WSW of Beeches I	1020639 Declining No Alessandra Perrone 0117 975 1345 Farm, Tidenham 1020602

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

SITE NAME:	Offa's Dyke: section in Passage Grove, 660 metres	west of Sheepcot,	Tidenham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020603
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Offa's Dyke: section in Worgan's Wood, 800 metr	es west of Chase F	arm, Tidenham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020605
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Roman villa 600 yards (550 metres) south west of	Woolaston Station	, Woolaston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004860
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345

GLOUCESTER



SITE NAME:

Llanthony Priory, remains of precinct wall north of Inner Gatehouse, Llanthony Road, Gloucester

Scheduled Monument and Listed Buildings - 6 grade I, LB grade II, part in CA

CONDITION:

Poor

Stone and brick wall on the west and north sides of the Outer Court of the former Augustinian Priory. Built in the C15, it was rebuilt or extended in the C17 and C18. The Llanthony Priory Trust successfully bid for National Lottery Heritage Fund grant and repair works to most of the Priory site are now complete. This length of wall will remain unrepaired for the short term due to budget constraints.

© Gloucester City Council

DESIGNATION:

Buildings - 6 grade I, LB grade II, part in CA

CONDITION:

Poor

OCCUPANCY:

N/A

PRIORITY CATEGORY:

C (C)

OWNER TYPE:

Charity (heritage)

1002091 and 1271693;
1271697; 1271694; 1271696;

1271695; 1271698

Contact: Chris Miners 0117 975 1355

© Historic England

SITE NAME:

The Fleece Hotel, 19, Westgate Street, Gloucester

DESIGNATION:

Listed Building grade I, CA

CONDITION:

Poor

OCCUPANCY:

Vacant/not in use

PRIORITY CATEGORY:

D (D)

OWNER TYPE:

Local authority

LIST ENTRY NUMBER:

1245447

C15 timber-framed range most recently occupied as the Fleece Hotel. The building has been vacant for some time. It is in poor repair, with some internal decay. A series of opening up works were carried out early summer 2010 to provide more information on the condition. Ownership passed to Gloucester City Council in 2011 who have done some emergency repairs, and a Timber Frame Report and Options Appraisal have now been produced. They are now actively seeking a development partner to move the project forward. The rear Edwardian wing is now stablised and re-roofed following the 2017 fire.

Contact: Stephen Guy 0117 975 0725

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Historic England

SITE NAME:	Old Judges House, 26, Westgate Street, Gloucester
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1245450 Late C15 timber-framed merchant house, greatly enlarged and remodelled in late C16/early C17. Refronted and altered internally c1815. Operated as seed merchant for c100 years until 1989, then partly occupied as bookshop, before becoming vacant. Whilst some repairs have been undertaken, there remain many areas which require attention, particularly the roof and significant joinery. The upper floors are now accessible via a new lift, although not yet in use. This will generate income to help fund roof and joinery repairs.

Contact: Stephen Guy 0117 975 0725

SITE NAME:	Barton Street, Gloucester		
DESIGNATION:	Conservation Area, 5 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Charlotte Bowles-Lewis (LPA) 01452 396855
SITE NAME:	Southgate Street, Gloucester		
SITE NAME: DESIGNATION:	Southgate Street, Gloucester Conservation Area, 31 LBs	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Improving significantly
DESIGNATION:	Conservation Area, 31 LBs		

STROUD



© Historic England

SITE NAME:	Guise Mausoleum to north west of Church of St John the Baptist, Stroud Road, Brookthorpe, Elmore
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)

OWNER TYPE: Charity (heritage) LIST ENTRY NUMBER: 1247875

Built in 1733 for Sir John Guise of Elmore Court and his family in neoclassical style, as an exact copy of what the commissioner thought to be Virgil's tomb in Italy. The monument, which includes a burial vault, has been left ruinous after the collapse of its pyramidal roof in the early C20. The ashlar and decorative elements which remain have been affected by weathering and erosion. Vegetation has also taken hold of the plot and is obscuring some of the masonry.

Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME:	Main building at Stanley Mills, Ryeford, King's Stanley
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1171285

condition and part occupied. Roof repaired with Historic England grant. A proposal for repair and conservation was granted consent in 2011. The planning permission has been implemented by a commencement on the factory building and the enabling development has now also started on site. Main works to the mill are yet to begin and condition is deteriorating. Temporary repairs have been carried out to areas of the roof following a series of lead thefts in 2017.

Woollen mill, 1813. Ancillary building (grade II) is in poor

Contact: Stephen Guy 0117 975 0725



© Historic England Archive

SITE NAME:	St Mary's House, London Road, Minchinhampton
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1091156

Former mill owner's house and weavers' cottages, late C16 and late C17. Roof in exceptionally poor condition and has been covered with tarpaulin for over 30 years. There are signs of detachment of the shell hood over the front door and external joinery continues to deteriorate. The local planning authority continues to engage with the owner to seek remedial and longer term repairs.

Contact: Stephen Guy 0117 975 0725

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



© Historic England

ITE NAME:	Old Mill Building at Longfords
	Mills, Avening Valley,
	Minchinhampton

DESIGNATION: Listed Building grade II*, CA

CONDITION:

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: D (D)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1305339

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

Centrepiece of an extensive industrial complex, from 1766. This is one of two buildings on site to remain vacant after a residential redevelopment that has refurbished and re-used the rest of the complex. Repairs and conservation proposals are being explored by a local Trust.

Contact: Alessandra Perrone 0117 975 1345

Mansion c1854-68 incorporating a magnificent private chapel. The Woodchester Mansion Trust was formed in 1989 to do a continuous programme of conservation and display of the uncompleted Gothic-style masterpiece. In 1991 a protective scaffold was built to cover the leaking roof of the chapel. The scaffold is now decaying and unsafe. Repairs are immediately needed to the scaffold or, ideally, the roof underneath. Other adjacent roofs are now developing serious faults. Development work is being organised in order to apply for the large grant funding now



© Historic England

SITE NAME:	Woodchester Mansion, Woodchester
DESIGNATION:	Listed Building grade I, RPG grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (A)
OWNER TYPE:	Charity (heritage)

1340703 Contact: Chris Miners 0117 975 1355

needed.



© Historic England

SITE NAME:	Church of St Mary the Virgin, Church Lane, Berkeley
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Very bad
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1304581

Parish church. C12 foundation on probable site of important early medieval minster church, altered in C13 and C15, and in C19. Random coursed rubblestone, roofs with coped verges and cross finials. Nave and aisles of seven bays with clerestory windows to south only, north porch, lower chancel with flanking chapels. The roof has been extensively repaired. The extensive interior wall paintings continue to decay.

Contact: Chris Miners 0117 975 1355



SITE NAME:	Church of St Mary, Fretherne with Saul
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation
	= . = . =

Largel mid-Victorian parish church in an isolated site. Ornate in the decorated style of sandstone with limestone dressings. There has been a loss of stonework with many falls of carved features.

LIST ENTRY NUMBER: 1154542 Contact: Chris Miners 0117 975 1355



© Historic England

© Historic England

SITE NAME:	Church of St James, Fretherne with Saul
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Very bad
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1090510

Church said to date originally from 1140, with elements from C15 and C16. Enlarged and restored at different times in C19. Roof coverings, which vary from stone slate on some areas to concrete tiles on others, are in very bad condition. The rainwater goods need repairing and replacing where previous patch repairs have failed. The stonework of the tower is delaminated in places.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



SITE NAME:	Church of St Giles, High Street, Hillesley, Hillesley and Tresham
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1129364

Church, 1851 by Reverend B Perkins, Vicar of Wotton Under Edge, in Early English style. Coursed rubble with freestone dressing; Cotswold stone slate roofs. Nave with clerestory, north and south aisles, chancel and south porch. The roofs at east end of the church have stone slates in bad condition.

© Historic England

State State		
		Y
	fair.	
	AND RESIDENCE AND ADDRESS OF THE PARTY OF TH	The Paris

SITE NAME:	Church of St John the Baptist, B4072, Edge, Painswick
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1172665

Small Victorian rural church. Cotswold stone walls, roof tiles and tower with a squat spire. The congregation has completed a repair scheme to the tower and spire, however the stone slate roofs are in need of renewal soon.

Contact: Chris Miners 0117 975 1355

Contact: Chris Miners 0117 975 1355

© Historic England



SITE NAME:	Church of St Mary Magdalene, Church Place, Rodborough
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1340958

St Mary Magdalene is a parish church with an early C16 west tower. The body of the church dates largely from 1842, to a design by Thomas Foster and Son of Bristol, with 1895 additions by FS and FW Waller all in the Decorated style. The roof pitches have some missing or fractured stone slates and the rainwater goods need an urgent overhaul.

Contact: Chris Miners 0117 975 1355

1	

© Historic England

SITE NAME:	Church of St Andrew, Whitminster
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1303052

Small church. Cll foundation, earliest work probably of C14, altered and tower added late C15/early C16, north aisle added 1842, restored c1884-5 by Sir Arthur Blomfield. Random coursed and dressed stone, ashlar tower and part ashlar walls, stone slate roof with coped east verges with saddle stones and cross finials. West tower, nave with south porch and north aisle, chancel, with north vestry of 1880s. The stone slates have slipped or fallen on the nave and north aisle pitches and the porch.

Contact: Chris Miners 0117 975 1355

SITE NAME:	Bowl barrow 450 metres south east of Upper Hyde Farm, Minchinhampton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008626
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Gatcombe long barrow, 400 metres east of Gatcon	nbe Farm, Minchinl	nampton
SITE NAME: DESIGNATION:	Gatcombe long barrow, 400 metres east of Gatcom Scheduled Monument	nbe Farm, Minchinl	nampton 1008623
	<u> </u>		·
DESIGNATION:	Scheduled Monument Generally unsatisfactory with major localised	LIST ENTRY NUMBER:	1008623

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair on in fair to good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

HERITAGE AT RISK 2019 / SOC	TH WEST / STROUD / TEVVRESBURT		
SITE NAME:	Miserden Castle mound, Miserden		
DESIGNATION:	Scheduled Monument, RPG grade II*	LIST ENTRY NUMBER:	1004870
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bowl barrow 720 metres south east of Longwood	Farm, Woodcheste	er
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017084
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bowl barrow 330 metres north of Symonds' Hall F	arm, Wotton-unde	r-Edge
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017083
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Stanley Mills, Kings Stanley, King's Stanley / Stoneh	ouse	
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Kate Russell (LPA) 01453 766321
SITE NAME:	Stroud Industrial Heritage (IHCA), Multiple parishe Bisley-with-Lypiatt / Brimscombe and Thrupp / Cai Fretherne with Saul / King's Stanley / Leonard		
DESIGNATION:	Conservation Area, 188 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Kate Russell (LPA) 01453 766321

TEWKESBURY



© Mr John Brookes. Source Historic

SITE NAME:	metres south east of Manor Farm, Ashchurch, Ashchurch Rural
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1091923

Dovecote, 1637. Pointing eroded particularly on the north face. Occasional missing roof tiles, although some roofing works have taken place.

Contact: Alessandra Perrone 0117 975 1345

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

LIST ENTRY NUMBER:

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument LPA NP RPG SM UA Unitary Authority
WHS World Heritage Site



© Historic England

DESIGNATION: Listed Building grade II*

CONDITION: Poor OCCUPANCY: N/A

PRIORITY CATEGORY: C (C)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1304753

Dovecote, C17. Movement of structural timbers on south east and north east walls has caused joints to pull apart, leading to brick panels falling out. Wattle and daub panels are fragmenting. Some timber decay on the west side and cement repairs to the roof are also of concern.

Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME: Southam tithe barn and shelter shed, Southam Lane, Southam DESIGNATION: Listed Building grade II* CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: A(A)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1091668

Large late medieval tithe barn converted to assembly uses but now vacant. Weather boarded timber-framed walls on a high stone plinth. Artificial stone (concrete) moulded tile roof has holes. The roof truss frames have structural faults. One bay of the roof (east end) exhibits severe bowing due to failed purlins. Short term holding repairs have prevented an immediate collapse of the roof.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME: Mythe Bridge, A438, Téwkesbury Listed Building grade II*, part in DESIGNATION: CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE:

Local authority, multiple owners LIST ENTRY NUMBER: 1282810

Road bridge over the River Severn. Built 1823-26 by Thomas Telford, cast iron bridge of six segmental arched latticed beams, latticed roadway beam with latticed ironwork filling the spandrels. Éach abutment has outer and inner sandstone piers separated by six brick arched tunnel vaults with cast iron colonettes. Cast iron roadway balustrade between piers. Ironwork of the balustrades is rusting at connections. Sandstone piers, especially above roadway level, are severely fractured and eroded, some covered in excessive and harmful ivy growth. Also in West Midlands Heritage at Risk Register.

Workshop, former malthouse. C17. Building has been unoccupied for some time. Listed Building Consent was approved in 2016 for conversion from a workshop to a dwelling. However, the permission has not been

Late C15 town house, altered C16 and C19, with shop under. Building only partly occupied and in poor condition

Contact: John Ette 0117 975 0687



© Tewkesbury Borough Council

SITE NAME:	Malthouse to the rear of 23, Barton Street, Tewkesbury
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1281018

Contact: Stephen Guy 0117 975 0725

with broken windows on second floor.

implemented and work is yet to start.



© Tewkesbury Borough Council

SITE NAME:	88, Church Street, Tewkesbury
designation:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private, multiple owners

1205905

Contact: Alessandra Perrone 0117 975 1345

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS I PA

Conservation Area Listed Building Local Planning Authority National Park ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

LIST ENTRY NUMBER:



© Historic England Archive

SITE NAME:	Toddington Manor, Toddington
DESIGNATION:	Listed Building grade I, RPG grade II
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private

1340101

Manor house, 1820-35, set in C19 formal gardens, on the east side of a late C18 landscape park. The house was mothballed for more than 15 years, but has been purchased by a new owner who engaged in an extensive programme of urgent works and repairs in consultation with the Local Planning Authority and Historic England. Following extensive stabilisation work, a temporary protective roof was installed and is in good order. There is no apparent further deterioration to the fabric. Discussions are ongoing with the owner's agent regarding building

Contact: Stephen Guy 0117 975 0725



© Historic England

SITE NAME:	Church of St Nicholas, Ashchurch Rural	
DESIGNATION:	Listed Place of Worship grade II*	
CONDITION:	Poor	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1153103	

Parish church. C12, C13, late C14, and C15, restored 1889 and 1931, small mid-late C20 extension. Nave; random limestone. Clerestory; coursed squared and finely dressed limestone and sandstone. South porch and tower; large blocks coursed finely dressed limestone. Artificial stone slate roof to chancel. Red tile roof to C12 nave with C15 clerestory. Nave south wall; two raking buttresses (possibly added C14). The roof is in bad condition masked behind the nave parapet. The chancel north pitch has slipped slates.

Contact: Chris Miners 0117 975 1355



SITE NAME:	Church of St Mary Magdalene, Boddington
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1172312

Small parish church. C12, C13, C14, possibly early C17, C18, restored late C19, mid C20 vestry. Random rubble stone, larger quoins, ashlar buttresses; north and east walls rendered; stone slate roof, band of concrete tiles to north slope nave; concrete tiles to vestry. There are structural problems with the nave that put this church at risk.

Contact: Chris Miners 0117 975 1355

	leeku	
) 1 = W	W. Sa	

SITE NAME:	Church of St John the Baptist, Oxenton	
DESIGNATION:	Listed Place of Worship grade I	
CONDITION:	Poor	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1303393	

Parish church. C13, C14 and C15, restored 1905. Nave and chancel coursed limestone rubble except the south wall of chancel which is coursed squared and dressed limestone. Porch and north aisle also coursed squared and dressed limestone. Tower and mortuary chapel: ashlar; stone slate roof. Nave with north aisle with mortuary chapel at right angles, chancel and west tower. The key issue is the decay of the interior plaster and the threat that this poses to the wall paintings.

Contact: Chris Miners 0117 975 1355

	n	0	
Aug.			1

© Historic England

© Historic England

SITE NAME:	Church of St Martin, Charlton Abbotts, Sudeley
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1340100

Tiny parish church in a small hillside churchyard. Nave with south porch and north vestry and lower chancel all in limestone ashlar. All from an 1887 rebuild of a ruin, incorporating medieval features, except for the vestry added in 1933. Graduated limestone slate roofs which are in need of repair especially on the north side.

Contact: Chris Miners 0117 975 1355

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

SITE NAME:	Great Witcombe Romano-British villa, Great Wi	tcombe / Brockwort	 h
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014826
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Over earthwork, Highnam		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002092
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Hailes Wood camp, Hailes, Stanway		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004843
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Milhampost Roman site, Stanway		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004844
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 134
SITE NAME:	Spoonley Wood Roman villa, Sudeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004847
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Melanie Barge 0117 975 1300
ITE NAME:	Wadfield Roman villa, Sudeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004846
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 134
ITE NAME:	Romano-British villa 170 metres south west of V	/inchcombe School, (Greet Road, Winchcombe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021449
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Alessandra Perrone 0117 975 1345

- A Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Winchcombe		
DESIGNATION:	Conservation Area, 178 LBs, part in RPG grade II*, part in SM	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Christopher Partrick (LPA) 01684 272060

ISLES OF SCILLY (UA)



© Historic England Archive

SITE NAME:	Late C19-early C20 Woolpack Battery on The Garrison, St. Mary's
DESIGNATION:	Scheduled Monument, LB grade II, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)

OWNER TYPE: Crown
LIST ENTRY NUMBER: 1014783

Late C19/early C20 battery. Generally good condition and secure but unoccupied since 2015. Converted to volunteer hostel accommodation in late C20/early C21 but now suffering from problems with water ingress into the former magazines, now dormitories. Discussions regarding repair and potential new uses are underway with the site owner, and the Local Authority.

Contact: Helen Woodhouse 0117 975 0676



© Historic England Archive

SITE NAME:	Post-medieval cottages, Samson, Tresco
DESIGNATION:	Scheduled Monument, part in CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Crown
LIST ENTRY NUMBER:	1016509

Fossilised C18/C19 landscape. The remains of the buildings are at risk from natural weathering, vegetation and erosion caused by visitors. A management plan has been devised and initial phase of consolidation grant-aided by Historic England is now complete. The results of the consolidation trials are being studied to ultimately inform a wider programme of repair.

Contact: Ann Preston-Jones 07917 642388

SITE NAME:	Civil War battery on The Green, Bryher		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1010176
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Gig shed on the north coast of Great Porth, Bryher	•	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1016173
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
OWNER TYPE: SITE NAME:	Crown Prehistoric enclosure south east of The Brow, Bryh		Ann Preston-Jones 07917 642388
			Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric enclosure south east of The Brow, Bryh	er	·
SITE NAME: DESIGNATION:	Prehistoric enclosure south east of The Brow, Bryh Scheduled Monument, CA Generally satisfactory but with significant localised	er LIST ENTRY NUMBER:	1015649

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise,

New Entry is noted).

gory is LB rwise, LPA NP

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

ABBREVIATIONS

SITE NAME:	Prehistoric field system and post-medieval quay in	Great Porth. Brvhe	er
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric field system and Romano-British cist in Green Bay, Bryher		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1014989
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric hut circle south of The Brow, Bryher		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1014990
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric linear boundary and cairns south west of The Bar, Bryher		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1016170
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric linear boundary SSE of The Island, Bryh	er	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1014991
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric cairns, entrance graves, field system and settlements and post-medieval kelp pits on Kittern Hill, Gugh, St. Agnes		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1014792
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Russell 0117 975 0671
SITE NAME:	Prehistoric entrance grave and two round cairns o	n the Clapper of W	/orks, Gugh, St. Agnes
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1008337
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric field system and post-medieval breastw	ork and maze on C	astella Down, St. Agnes
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1015697
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Kerbed round cairn with central cist on Gun Hill, St. Martin's		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1013809
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth - General	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Platform cairn on Turfy Hill, St. Martin's		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1018114
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric cairn cemetery and field system on Tinkler's Hill, St. Martin's		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1018109
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric entrance grave, the middle one of three	e on Cruther's Hill,	St. Martin's
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1013804
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric entrance grave, the northern one of the	ree on Cruther's H	ill, St. Martin's
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1013803
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Prehistoric entrance grave, the southern one of the Martin's	ree, and kerbed rou	and cairn with cist on Cruther's Hill,
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1013805
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Prehistoric field system and kerbed cairn, with pos Island, St. Martin's	t-medieval kelp pit	and linear boundary on southern Wh
designation:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1014789
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Russell 0117 975 0671
ITE NAME:	Ennor Castle, Old Town, St. Mary's		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1014994
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ann Preston-Jones 07917 642388
ITE NAME:	Hut circle settlement in Pendrathen, St. Mary's		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1015663
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	Post-medieval breastwork, curtain wall and associa St. Mary's	ted defensive struc	tures on the periphery of The Garris
DESIGNATION:	Scheduled Monument, LB grade I, CA	LIST ENTRY NUMBER:	1018370
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	The Old Quay, Old Town Bay, St. Mary's		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1015656
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
ITE NAME:	World War II pillbox between Thomas' Porth and	Porthaloo, St. Mar	y's
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1016517
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388
SITE NAME:	World War II pillbox west of Porth Hellick, 90 me	tres north of Drun	n Rock, St. Mary's
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1016516
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Ann Preston-Jones 07917 642388

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.


 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

SITE NAME: Prehistoric cairn group on Abbey Hill, Tresco DESIGNATION: Scheduled Monument, LB grade I, RPG grade I, CA LIST ENTRY NUMBER: 1016183 CONDITION: Generally satisfactory but with significant localised problems PRINCIPAL VULNERABILITY: Visitor erosion - limited/localised NEW ENTRY: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and hut circle north of Crab's Ledge, Tresco DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016422 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion NEW ENTRY: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco ESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016423			
Generally satisfactory but with significant localised problems PRINCIPAL VULNERABILITY: Visitor erosion - limited/localised NEW ENTRY?: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and hut circle north of Crab's Ledge, Tresco DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016422 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion NEW ENTRY?: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco			
PRINCIPAL VULNERABILITY: Visitor erosion - limited/localised NEW ENTRY?: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and hut circle north of Crab's Ledge, Tresco DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016422 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion NEW ENTRY?: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco			
Crown Contact: Ann Preston-Jone Prehistoric field system and hut circle north of Crab's Ledge, Tresco Designation: Scheduled Monument, CA LIST ENTRY NUMBER: 1016422 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion New Entry: No Contact: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco			
Prehistoric field system and hut circle north of Crab's Ledge, Tresco DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016422 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion NEW ENTRY?: No OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco			
DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016422 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco	es 07917 642388		
Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Coastal erosion New Entry?: No Contact: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco	es 07917 642388		
problems PRINCIPAL VULNERABILITY: Coastal erosion OWNER TYPE: Crown Contact: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco	es 07917 642388		
OWNER TYPE: Crown CONTACT: Ann Preston-Jone SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco	es 07917 642388		
SITE NAME: Prehistoric field system and settlement in Bathinghouse Porth, Tresco	es 07917 642388		
· · · · · · · · · · · · · · · · · · ·			
DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016423			
CONDITION: Generally satisfactory but with significant localised TREND: Declining problems			
PRINCIPAL VULNERABILITY: Coastal erosion NEW ENTRY?: No			
OWNER TYPE: Crown CONTACT: Ann Preston-Jone	es 07917 642388		
Prehistoric field system and settlement north of Appletree Point, Tresco	Prehistoric field system and settlement north of Appletree Point, Tresco		
DESIGNATION: Scheduled Monument, CA LIST ENTRY NUMBER: 1016182			
CONDITION: Unknown TREND: Declining			
PRINCIPAL VULNERABILITY: Coastal erosion NEW ENTRY?: No			
OWNER TYPE: Crown CONTACT: Ann Preston-Jone	es 07917 642388		
Prehistoric to post-medieval funerary, field system and settlement remains, with post-medieval funeracy, field system and settlement remains for the field	edieval kelp pit and		
DESIGNATION: Scheduled Monument, part in CA LIST ENTRY NUMBER: 1016509			
CONDITION: Extensive significant problems TREND: Declining			
PRINCIPAL VULNERABILITY: Plant growth NEW ENTRY?: No			
OWNER TYPE: Crown CONTACT: Ann Preston-Jone	es 07917 642388		
SITE NAME: St Nicholas' Priory, Tresco			
DESIGNATION: Scheduled Monument, LB grade I, RPG grade I, CA LIST ENTRY NUMBER: 1016184 CONDITION: Generally satisfactory but with significant localised TREND: Stable			

NORTH SOMERSET (UA)

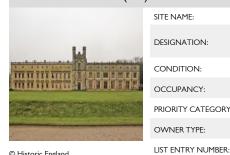

SITE NAME: Ashton Court, Long Ashton Listed Building grade I, RPG DESIGNATION: grade II* CONDITION: Very bad OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority

1129841

Large country house with various elements dating from C15, C17, C18 and C19. House partly used but large part remains derelict and subject to slow but ongoing decay. The house has been the subject of negotiations between owners, Local Planning Authority, Historic England and other interested parties for many years. Historic England grant offered in 2011 for project development work, the majority of which was completed by 2013. Options Appraisal completed for Bristol City Council in May 2019. Historic England in ongoing discussions with Bristol City

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. D
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA NP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Elms Colliery, Nailsea
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Local authority

LIST ENTRY NUMBER: 1004533 and 1320976

Known locally as Middle Engine Pit, this is one of the most complete examples of an early C19 colliery in England. However the surviving structures are in a poor and vulnerable condition. Since 2015 Historic England has been working with the owners and other stakeholders to help improve its condition, and have grant-aided repairs to the boundary wall and the consolidation of some of the remaining standing structures.

Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME:	Birnbeck Pier, Weston-Super- Mare
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1129718

Main pier connecting Birnbeck Island to the mainland below the Prince Consort Gardens. Discussions are ongoing between the Local Planning Authority, Historic England and other interested parties about the future of the pier with enforcement action actively under consideration. Storms and the weather continue to cause damage to the main pier which is now too dangerous to walk over or under. The North Jetty has suffered a partial collapse and consent has been granted to demolish much of the structure. The further threat of Heritage crime to the structure has resulted in recent prosecution.

Contact: John Ette 0117 975 0687



© Historic England

SITE NAME:	St Mary's Church, Church Lane, Portbury
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1311826

C12 parish church, altered and extended early C13 and C14/C15, restored 1870-5. The stone slate roofs of the chancel, vestry and associated lean-to roofs have come to the end of their life. Water has been getting in causing ceiling plaster falls. A National Lottery Heritage Fund Grant for Places of Worship enabled roof repairs to be completed in 2014. However, further problems with the poor state of the sandstone wall, especially on the south transept, keeps the church at risk. A further National Lottery Heritage Fund grant has been awarded and the project development is nearing completion.

Contact: Chris Miners 0117 975 1355

SITE NAME:	Worlebury Camp: a large multivallate hillfort on Wo	orlebury Hill, Wes	ton-Super-Mare
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1011260
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Long barrow 350 metres south west of Cornerpoo	I Farm, Wrington	
SITE NAME: DESIGNATION:	Long barrow 350 metres south west of Cornerpool Scheduled Monument	I Farm, Wrington LIST ENTRY NUMBER:	1008291
	, i		1008291 Declining
DESIGNATION:	Scheduled Monument Generally unsatisfactory with major localised	LIST ENTRY NUMBER:	

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

LIST ENTRY NUMBER:

CITE NIANAE

PLYMOUTH, CITY OF (UA)



© Historic England Archive

SITE NAME:	Knowle Battery
DESIGNATION:	Scheduled Monument
CONDITION:	Good
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (New entry - re-assessed)
OWNER TYPE:	Local authority

1002614

Palmerston Fort; part of the site is now the grounds of a primary school. Historic England funded a Condition Survey of the structure with proposals for refurbishment in preparation for re-use of the guardhouse, and a five year Management Agreement to control vegetation. Further funding from Historic England and Plymouth City Council has addressed the most urgent repair issues and the shell is now in good repair. A new user had been identified but sadly negotiations have faltered. Until a new use is in place the site remains very vulnerable to vandalism.

Contact: Annie Evans 0117 975 0673



© Historic England Archive

SITE NAME:	Western Hotel (Palace Theatre), Union Street, Stonehouse, Plymouth
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1386483

A -- - - - - Th -- - - - - - - C -- - -

Former variety theatre and hotel, built 1898. A significant building in an area where major regeneration has been underway. Historic England has offered grant aid in the past, which was not taken up. Temporary repairs were undertaken in 2013 and 2015 to make the theatre weathertight. Further temporary weatherproofing has been put in place in the last two years but as of 2019 a full condition report and detailed scheme of repairs, and a business plan, are still required.

Contact: Annie Evans 0117 975 0673



© Historic England Archive

SITE NAME:	Agaton Fort, Plymouth
DESIGNATION:	Scheduled Monument
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Government or agency
LIST ENTRY NUMBER:	1002613

One of the ring of C19 land forts built to defend Plymouth. Overlooks River Tamar. Irregular pentagonal plan, with deep ditch on four sides protected by caponiers and a counterscarp gallery. Internally the officer's quarters, cookhouse and barracks, seven of twenty open gun positions, one Haxo casement, five expense magazines and two of previous six mortar batteries survive. Ceased military use in 1958 but was used as Heavy Goods Vehicle testing centre (partly in a modern building) until 2015. Vacancy is concerning and there are significant problems with dry rot and vegetation management.

Contact: Annie Evans 0117 975 0673

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Amphitheatre in grounds of Saltram House, Merafield Road, Plympton
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)

Charity (heritage)

1386231

Late C18 screen wall fronting rock-cut grottos overlooking the River Plym. Surrounding rock faces have become unstable and are subject to collapse. A condition survey of the structure has recently been undertaken, and the owners are in the process of updating their conservation management plan for the Saltram Estate. However, no physical repair works have yet been undertaken.

Designed by Robert Adam and built in 1783, built as a triumphal arch and eye-catcher to be viewed from Saltram House. Now within a golf course. It was advertised for sale in 2014 but was not sold, and remains in a state of slow decay. There is scope for limited reuse of the former lodges (now roofless ruins) behind the arch flank walls to be reused for beneficial purposes, but access remains a

© Historic England

SITE NAME:	Boringdon Arch, Plymbridge Road, Plymouth
DESIGNATION:	Listed Building grade II* and Scheduled Monument
CONDITION:	Poor
OCCLIPANICY:	NI/A

N/A PRIORITY CATEGORY: C(C)OWNER TYPE: Private, multiple owners LIST ENTRY NUMBER: 1386330 and 1020565

Contact: Simon Hickman 0117 975 0717

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

OWNER TYPE:

LIST ENTRY NUMBER:

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise.

New Entry is noted).

constraint.

ABBREVIATIONS		
CA LB LPA NP RPG SM UA WHS	Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garde Scheduled Monument Unitary Authority World Heritage Site	

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:



© Plymouth City Council

SITE NAME:	Efford Fort and Emplacement, Military Road, Efford
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Mixed, multiple owners

1021135

to water penetration and structural problems. No solution agreed as of 2019.

Contact: Annie Evans 0117 975 0673

	11	M	8
1		9	
	2		319

© Peter Grills

SITE NAME:	Elizabethan House Museum, 32, New Street
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Local authority

1386279

Early C17 three-storey timber frame and jettied merchant's house with rubble side wall and evidence of former adjoining house, restored in 1926 by AS Parker. Interior has many original features and it is probably the most complete and unaltered example of a jettied merchant's house in Plymouth. Historic England has funded investigation into causes of structural weakness and water ingress, and repair work will be underway from the summer of 2019 onwards.

Palmerston Fort built between 1863 and 1869. Partially occupied, as the parade ground is used for seasonal accommodation whilst buildings are vacant or used for storage. Buildings are suffering from benign neglect with heavy vegetation growth on the ramparts which may lead

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Melville Building, Royal William Yard, Plymouth
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F(D)
OWNER TYPE:	Local authority

1378531

The Melville building was constructed c1826-1832 as stores and offices for the Victualling Board to the design of Sir John Rennie Jnr, and forms part of the impressive Royal William Yard. Planning permission in place for the repair of Melville and conversion of most of the building for mixed use development. First phase of repair and conversion works to approximately a third of the building began in Spring 2019. Historic England is grant-aiding the repair of the roofs and external walls in this first phase of work.

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Oddfellows Hall, Ker Street, Devonport
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	Occupied/in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1322006

Hall built 1823 by John Foulston, in the Egyptian style. Part of a group with the Guildhall and Devonport Column. Egyptian columns flank a central, recessed porch. Currently used as a social club and in poor repair. Historic England grant-aided a feasibility study and emergency repairs to the roof, completed in 2007. The building has been acquired by new owners. Historic England has met with the new owners and is in discussions over the future repair of the building.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Old Cooperage, Royal William Yard, Plymouth
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (A)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1378536

The Cooperage was built c1826 -1832 for the Victualling Board, and forms part of the Royal William Yard. Part of the Cooperage has been successfully converted into artists' studios; Historic England grant-aided the stone conservation works. A sustainable future for the rest of the Cooperage is being explored by the leaseholder and Historic England have grant-aided urgent repairs to the rest of undeveloped sections of the building. Historic England is in a continuing dialogue with the leaseholder.

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Full ladar repair or in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

OWNER TYPE:

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:



© Historic England

	,
SITE NAME:	South Saw Mills, South Yard, HM Naval Base, Plymouth
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)

1388413

Government or agency

Sawmill built between 1856 and 1859. The saw mills ceased to be used as such in 1987, but the ground floor remained in light industrial and storage use until 1997. An options report was issued in 2010, but the building remains vacant with no identifiable use. The roof was provided with a large net in 2017 to prevent dislodged roofing materials becoming flying projectiles.

Contact: Simon Hickman 0117 975 0717

1	

Historic England

SITE NAME:	South Smithery, South Yard, HM Naval Base, Plymouth
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Government or agency

1392692

Dockyard smithery built 1771, modified C19 and reconstructed c1897. It remained in use until 1987 when structural faults were discovered. There is continued deterioration of the roof, masonry and interiors. An options report was issued in 2010, but a repair strategy has not yet been put in place. In 2017 a large net was installed on the roof to prevent dislodged roofing materials falling in high winds.

Contact: Simon Hickman 0117 975 0717



© Historic England

SITE NAME:	The coastal fortifications of Drake's Island, Plymouth
DESIGNATION:	Scheduled Monument, LB grade
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Mixed, multiple owners

The island incorporates numerous defences/military monuments from 1549 to C20. It was held for Parliament during the Civil War and used for defence purposes until 1958. All buildings and structures are in a derelict condition. A planning application for conversion to hotel use was granted in 2017, works are yet to commence.

© Historic England

SITE NAME:	Woodland Fort, Crownhill Road, Crownhill
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1002615

1010910

Palmerston Fort, built between 1863 and 1869. Part of barrack block in use as a social club, but the rest is empty. Remedial repairs have been undertaken and some of the heavy vegetation has recently been cleared. Site is prone to vandalism and rubbish dumping. Historic England grant-aided repair works in 2016-17 which has cleared part of the ditch and helped to drain the caponier, but considerable further work is still required.

Contact: Helen Woodhouse 0117 975 0676

V DAN	

© Historic England

SITE NAME:	Church of St Mary and All Saints, Church Road, Plymouth
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1330541

1330541

Contact: Annie Evans 0117 975 0673

Contact: Annie Evans 0117 975 0673

Roof coverings are desperately in need of renewal, particularly the nave and inner slopes of north and south aisle. Slates to these areas have previously been covered with bitumen-coated hessian and will not be reusable for repairs. Valley gutter also needs renewing. Interior suffers from condensation and poor ventilation. Gullies need clearing out. Downpipe to tower leaking or blocked. Some ivy growth to masonry. Buttresses need repointing. Excessive tree growth near north wall. A bid to the last round of Listed Places of Worship Roof Repair Grants was unsuccessful.

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

HERITAGE AT RISK 2019 / SOU	JTH WEST / PLYMOUTH, CITY OF (UA)		
SITE NAME:	Austin Fort and section of military road		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021380
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Annie Evans 0117 975 0673
SITE NAME:	Efford Fort and Efford Emplacement, Military Road	, Efford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021135
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Charity (non-heritage)	CONTACT:	Annie Evans 0117 975 0673
SITE NAME:	Egg Buckland Keep		
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1020543
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Fort Stamford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002544
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Plympton Castle		
DESIGNATION:	Scheduled Monument, LB grade II*, CA	LIST ENTRY NUMBER:	1003865
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Local authority	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Laira Battery		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021134
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102
SITE NAME:	Laira Emplacement, immediately south west of Lair	ra Battery	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020686
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Daniel Bashford 07824 103102

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

324 103102
324 103102
324 103102
0117 975 0676
75 0673
3

SOMERSET

EXMOOR (NP)



 $\ \, \mbox{\Large @} \mbox{\Large T.}$ Thurlow HBO with kind permission of Exmoor National Park Authority

SITE NAME:	Dovecote at Little Blackford, Selworthy, Somerset West and Taunton
DESIGNATION:	Scheduled Monument, LB grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Charity (heritage)

1020774

This dovecote which survives well requires some repointing, limewashing and repairs to the roof covering in order to secure it in good condition.

Contact: John Ette 0117 975 0687

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

LIST ENTRY NUMBER:

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument LPA NP RPG SM UA Unitary Authority
WHS World Heritage Site

OWNER TYPE:

LIST ENTRY NUMBER:



© T. Thurlow HBO with kind permission of Exmoor National Park Authority

SITE NAME:

Packhorse Bridge about 50 metres west of Lyncombe, Winsford, Somerset West and Taunton

DESIGNATION:

Listed Building grade II*

CONDITION:

Poor

OCCUPANCY:

N/A

PRIORITY CATEGORY:

A (A)

Private

1174159

Packhorse Bridge. C17-C18, possibly earlier. Lias. Dry stone flat bedded rubble; single span, pointed arch; rubble voussoirs; curved abutments; parapet of undressed stone set on end, ramped up to centre. Hump-backed bridge with remains of pebble pathway. A recent condition survey has identified loss or covering of cobble pathway, partial loss of parapet, cracking above the arch and extensive plant growth including ivy and large saplings rooting into fabric. Historic England has met the owners to discuss repairs.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Barlinch Priory, Brompton Regis, Somerset West a	and Taunton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006213
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bury Castle, Brompton Regis, Somerset West and	Taunton	
Designation:	Scheduled Monument	LIST ENTRY NUMBER:	1006170
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bat's Castle: a small multivallate hillfort and associa	ated outwork, Carh	ampton, Somerset West and Taunton
Designation:	Scheduled Monument, RPG grade II*	LIST ENTRY NUMBER:	1007667
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Later prehistoric defended enclosure, Long Wood	, Carhampton, Som	erset West and Taunton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008255
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Mounsey Castle, Dulverton, Somerset West and T	aunton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021357
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Black Ball Camp: a later prehistoric defended settle Taunton	ement on Gallox H	ill, Dunster, Somerset West and
DESIGNATION:	Scheduled Monument, RPG grade II*	LIST ENTRY NUMBER:	1007668
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Charlotte Russell 01271 831505

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- O Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

HERITAGE AT RISK 2019 / SOU	JIH WESI / EXMOOR (NP)		
SITE NAME:	St Leonard's Well, Dunster, Somerset West and T	aunton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021154
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Almsworthy Common: a stone alignment 560 met West and Taunton	res south west of C	Chetsford Bridge, Exford, Somerset
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015017
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Chains Valley stone alignment 400 metres north w	est of Exe Head, Ex	kmoor, Somerset West and Taunton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014278
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth - General	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Cow Castle, Exmoor, Somerset West and Taunton	n	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002955
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Kittuck stone setting and cairn, 200 metres south Taunton	west of Three Com	bes Foot, Exmoor, Somerset West and
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014284
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Sweetworthy deserted medieval settlement, Lucco	mbe, Somerset We	est and Taunton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008469
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Berry Castle, Iron Age enclosure in Berry Castle V	Vood, Porlock / Lu	ccombe, Somerset West and Taunton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006204
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Charlotte Russell 01271 831505

- C Slow decay; no solution agreed.
- Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 D Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial list). use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

TIENTAGE AT NISK 2017 / 300	TH WEST / EXPLOOR (INF) / PIENDIP		
SITE NAME:	Allerford packhorse bridge, immediately north of G	Cross Lane Farm, Se	elworthy, Somerset West and Taunton
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1020776
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Earthwork enclosure on Rodhuish Common, 300 and Taunton	metres west of Moo	or Barn, Withycombe, Somerset West
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021122
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Brewer's Castle, Withypool and Hawkridge, Some	rset West and Tauı	nton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021358
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Brightworthy Barrows on Withypool Common, W	ithypool and Hawk	cridge, Somerset West and Taunton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021264
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Stone circle on Withypool Hill 670 metres ESE of West and Taunton	Portford Bridge, W	ithypool and Hawkridge, Somerset
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021261
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505

MENDIP

© Historic England



SITE NAME:	Kilmersdon Lodges, Kilmersdon
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Private

1307411

Pair of lodges, gate piers and gates, associated with Ammerdown House, built from 1788 to 1794, situated on the edge of late C18 to early C19 park. The lodges were ruinous when listed in the 1960s and their potential for reuse is limited by their size. A feasibility study has been undertaken but the scale of the project indicated was prohibitive. A schedule of work to stabilise the structures has been undertaken and a programme of monitoring is being carried out by the owners.

Contact: Eve Van Der Steen 01179750685

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. D

LIST ENTRY NUMBER:

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA NP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

DESIGNATION: Listed Building grade II*, CA

CONDITION: Poor

OCCUPANCY: Part occupied/part in use

PRIORITY CATEGORY: A(A)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1296561

Brewery, now warehouses, built in 1864. Whilst partly occupied at ground floor level, most of the building has been vacant for many years. A feasibility study has been undertaken which has identified a substantial conservation deficit. A partial collapse has now been repaired. No further work has been undertaken as of 2019.

Contact: Rhiannon Rhys 0117 975 0685



© Mendip District Council

SITE NAME: Outbuilding about 30 metres west of Higher Southtown Farm, Southtown Lane, West Pennard DESIGNATION: Listed Building grade II* CONDITION:

OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C)

LIST ENTRY NUMBER: 1175928

OWNER TYPE:

SITE NAME:

due to lack of maintenance and beneficial use for many years. Emergency clearance and stabilisation works to the building have been undertaken by Mendip District Council. Discussions underway with Historic England regarding the building's full repair.

Early C17 timber-framed brewhouse later utilised as a

cottage, now part calf shed/hay store. In poor condition

Contact: Sarah Ball 0117 975 0666



© Historic England

Gatehouse to west of Manor SITE NAME: Farmhouse, Whatley DESIGNATION: Listed Building grade I CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (C) OWNER TYPE: Private

Private

LIST ENTRY NUMBER: 1175158

Gatehouse, C15 built from random local limestone rubble with a plain tile roof. Two storeys, all window openings blocked apart from left side of ground floor. The arched entry is slightly left of centre and there is a Tudor arch doorway within the passage. Rear has stone steps to first floor doorway on the left side. The building is showing signs of structural movement to the south gable and significant deflection to the roof. Some areas of stone work are very weak, particularly around the small door under the arch. The vegetation to the east side needs to be removed.

Contact: Sarah Ball 0117 975 0666



© Historic England

Fenny Castle Cross: a medieval wayside cross 20 metres north west of Castle Farm, Castle, Wookey DESIGNATION: Scheduled Monument CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: A(A)

OWNER TYPE: Private, multiple owners LIST ENTRY NUMBER: 1015797

A medieval stone cross thought to date back to the early C14. Despite the loss of its shaft, the rest of the structure survives in situ though in very bad condition. Several stones show signs of fracture, the joints are open and missing mortar and vegetation is slowly encroaching.

Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME:	Baptist Chapel, Frome Road, Beckington
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1296104

Chapel dated 1786 now converted to community use as a pre-school as well as a place of worship. Random rubble, with plain corner pilasters, pilasters between each bay and a central pediment with balustraded parapet to each side. Roof aging and some slate slippage. Stone balustraded parapet needs repair work. Some broken panes of glass.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



400		
© Historia	: England	

SITE NAME:	Church of the Holy Trinity, Binegar
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1058641

Parish church rebuilt in the C15 with the tower dating from 1858. The building is generally very well maintained but the slated roofs require complete recovering and new ceilings. The roofs are covered in asbestos cement slates with fibreboard ceilings below. The slates require annual attention to deal with leaks, which have significantly disfigured the ceilings. The floors also need work due to rotten joists.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Church of St John the Baptist, Church Lane, Chilcompton
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1345096

Parish church dating from the C15 much rebuilt in the C19. The nave north parapet has been secured, and there was a significant problem in the eastward parts of the building which had severe frost damage to limestone copings and string courses and further problems with poor walling stone and pointing. A Listed Places of Worship Roof Repairs Grant awarded in 2015 enabled most work to be completed. Some very significant boundary wall repairs are still reauired.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of St Mary the Virgin, Church Street, Croscombe
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1174682

Very fine parish church dating mainly from C15 and C16, with C19 restoration. South aisle and nave roofs are leaking. Parapet gutters require redesign. National Lottery Heritage Fund Grant for Places of Worship offered and accepted in 2016 for roofing works. Works due to be completed in June 2019.

© Historic England

© Historic England

SITE NAME:	Church of All Saints, Pound Lane, Downhead
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1174065

Parish church with a perpendicular tower from the C14. Nave, chancel and south porch from the mid C18, the building also has some C19 restorations. The building is generally well maintained. However it is exposed and water penetration to the tower is now spreading and affecting the nave roof structure as well as the tower arch.

Contact: Annie Evans 0117 975 0673

Contact: Sarah Ball 0117 975 0666

© Historic England



© Historic England

SITE NAME:	Christ Church, Christchurch Street West, Frome
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1057853

Built 1817-1818 as an aisled nave, with crenellated east tower. Eastern extension built 1904-1905, the south transept in 1899, and the north transept 1929. Perpendicular style, with traceried openwork parapets, pinnacles and gargoyles over buttresses. The rainwater goods are in poor condition. There is detrimental external secondary glazing and large number of tingles (temporary repairs) on chancel roof.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



SITE NAME:	Church of St Giles, Church Walk, Leigh-on-Mendip
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1058345

Medieval parish church dating from c1350, rebuilt c1500. Well maintained. Iron cramps are pushing apart the joints in the parapet but as yet not splitting the stones. A programme of repairs addressing the external walling and parapets as well as repairs to the C18 roof coverings is needed. The chancel roof was repaired with Listed Places of Worship Roof Repairs Grant and in 2017, the congregation received National Lottery Heritage Fund Grant for Places of Worship to address the Nave roof. Work is in development. The congregation is also developing proposals for repairs and reordering.

Contact: Annie Evans 0117 975 0673






SITE NAME:	Church of St Andrew, Mells
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1295876

Parish church. Predominantly late C15, tower of mid C16, mid C19 restoration. Doulting ashlar; low pitched roofs. Clerestoried nave with north and south aisles, continuing as chapels clasping the chancel and polygonal vestry of 1485. Important fixtures, fittings and furnishings. The church is generally very well maintained but the roofing materials are coming to the end of their lives. The poor condition classification therefore relates to the roof only.

Contact: Annie Evans 0117 975 0673

© Historic England

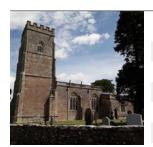

SITE NAME:	Church of St Leonard, Stoke Street, Rodney Stoke
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	A (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1058592

Small Anglican parish church with C12 origins and later additions. Restored in 1879. Perpendicular style. The pierced parapet along the top of the nave is rapidly deteriorating.

Contact: Alessandra Perrone 0117 975 1345

© Historic England



SITE NAME:	Church of St Matthew, High Street, Wookey
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1295105

Parish church, dated predominantly from C15 but with C13 chancel. The building is well maintained, however the nave and aisle roofs are improperly fixed and thus split and leak annually letting water into the C15 roof structure.

Contact: Annie Evans 0117 975 0673

© Historic England

SITE NAME:	Small multivallate promontory fort on Blacker's Hill, Chilcompton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015493
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
			7 (ICSSAIIGIA I CITOTIC OTTI 773 TS 13
			7 Nessandra Ferrone 0117 775 1515
SITE NAME:	Bowl barrow 300 metres north east of Whitnell Co	orner, Emborough	Alessandra Ferrone of 17, 773 1313
SITE NAME: DESIGNATION:	Bowl barrow 300 metres north east of Whitnell Co	orner, Emborough	1011670
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011670

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair or in fair to good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Drying house at The Coach House, Willow Vale, F	rome	
DESIGNATION:	Scheduled Monument, LB grade II, CA	LIST ENTRY NUMBER:	1016955
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Glastonbury lake village, Godney		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006156
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Lake villages north west of Oxenpill, Meare		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006160
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Section of the Abbot's Way trackway, 500 metres	WSW of Honeygar	Farm, Meare
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014432
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Alessandra Perrone 0117 975 134
SITE NAME:	Sections of the Sweet Track and Post Track, 240 m	etres south west o	of Sunnyside Farm, Meare
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014440
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Sections of the Sweet Track and Post Track, 250 m	etres ESE of Statio	n House, Meare
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014831
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
	Private, multiple owners Timber trackway site, 700 metres west of Honeyga		Alessandra Perrone 0117 975 134.
SITE NAME:	<u>_</u>		Alessandra Perrone 0117 975 134.
SITE NAME: DESIGNATION:	Timber trackway site, 700 metres west of Honeygo	ır Farm, Meare	
SITE NAME: DESIGNATION: CONDITION:	Timber trackway site, 700 metres west of Honeyga	er Farm, Meare LIST ENTRY NUMBER:	1014434
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Timber trackway site, 700 metres west of Honeygo Scheduled Monument Unknown	ur Farm, Meare LIST ENTRY NUMBER: TREND:	I014434 Unknown No
SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE:	Timber trackway site, 700 metres west of Honeyga Scheduled Monument Unknown Drainage/dewatering	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	1014434 Unknown No Alessandra Perrone 0117 975 1345
DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Timber trackway site, 700 metres west of Honeygo Scheduled Monument Unknown Drainage/dewatering Private	LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	1014434 Unknown No Alessandra Perrone 0117 975 1345
SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION:	Timber trackway site, 700 metres west of Honeyga Scheduled Monument Unknown Drainage/dewatering Private Fussell's Lower Works: an iron edge tool works, 2	ur Farm, Meare LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT:	I014434 Unknown No Alessandra Perrone 0117 975 1345 ast of Wadbury, Mells
OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Timber trackway site, 700 metres west of Honeygo Scheduled Monument Unknown Drainage/dewatering Private Fussell's Lower Works: an iron edge tool works, 2 Scheduled Monument, LB grade II Generally satisfactory but with significant localised	ur Farm, Meare LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: 10 metres south ea	Unknown No Alessandra Perrone 0117 975 1345 sst of Wadbury, Mells 1019796
SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Timber trackway site, 700 metres west of Honeyga Scheduled Monument Unknown Drainage/dewatering Private Fussell's Lower Works: an iron edge tool works, 2 Scheduled Monument, LB grade II Generally satisfactory but with significant localised problems	Ir Farm, Meare LIST ENTRY NUMBER: TREND: NEW ENTRY?: CONTACT: 10 metres south ea LIST ENTRY NUMBER: TREND:	I014434 Unknown No Alessandra Perrone 0117 975 1345 st of Wadbury, Mells I019796 Stable

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	TH WEST / MENDIP		
SITE NAME:	Whatley Combe Roman villa, Nunney		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006188
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bowl barrow 250 metres north east of King Down	Farm, Priddy	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011530
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bowl barrow 300 metres south west of Moor View	v, Priddy	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009773
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bowl barrow 800 metres south of Townsend Farm	, Priddy	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009740
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Romano-British settlement on Stoke Moor, Rodne	y Stoke / Cheddar	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011125
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Group of round barrows 750 metres north west of Ivy Cottage, St. Cuthbert Out		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020494
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Marston Moat, Trudoxhill		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016302
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Alessandra Perrone 0117 975 1345

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SEDGEMOOR



© Historic England

SITE NAME:	Castle House, Queen Street, Bridgwater
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Charity (heritage)

1355168

LIST ENTRY NUMBER:

House in the centre of Bridgwater in the early Tudor Revival style, built for William Ackerman in 1851. It is notable for the earliest surviving use of prefabricated cast concrete and constructional post tensioning. The building has been in a structurally precarious condition and has had an arson attack. Owned by SAVE Building Preservation Trust. Historic England has grant aided phases of repair with a final phase taking place in 2018. However the building remains empty while SAVE purses a sustainable long term future for the building.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Westonzoyland Pumping Station, Westonzoyland
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1174295

A former pumping station, built in the early C19, now preserved by the Westonzoyland Engine Trust. The first pumping station to be built to lift floodwater from the Somerset Levels and Moors, and the only one to survive with the steam engine still working and with the buildings intact. Much work has been done but further repair is needed, and the Trust has been working up a scheme for reuse of underused areas. Parts are under possible threat from rapid alteration of surrounding drainage. Historic England is grant aiding investigation of cracking to the building close to the riverbank.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of All Saints, High Street, Ashcott
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1058957

Parish church. Mainly C15 with alterations in the C19. The woodblock floor has lifted and is decayed in many places. This could be due to a leak from the buried C19 cast iron heating pipework. The vestry roof needs re-covering and significant masonry repairs to the tower and nave parapets will be needed in the near future.

Contact: Annie Evans 0117 975 0673



© Historic England

© Historic England

SITE NAME:	Baptist Church, St Mary Street, Bridgwater
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1298798

Baptist church, built in 1837 by Edwin Down. Rectangular plan with schoolrooms to the rear. Classical frontage with Bath stone pediment and cornice, flight of steps up to central Egyptian style doors. High level stonework is in poor condition. Rainwater goods are also poor. Rear of the building has vegetation growth and the brickwork needs repointing.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Edward, Church Lane, Chilton Polden
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1060126

Parish church of C15 origin, largely rebuilt in 1889. Rubble, slate roofs with coped verges and bellcote at west end. Chancel and nave, north aisle, north transept, north and south porches and vestry. Neo-Perpendicular with some Perpendicular features remaining. There is cracking to the vestry wall and the roof covering is failing. The church was awarded a Listed Places of Worship Roof Repairs Grant in 2016 but more repairs are required.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG

Unitary Authority World Heritage Site



(C)	Historic	Fngland

© Historic England

© Historic England

SITE NAME:	Church of St Mary, Fore Street, North Petherton
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Religious organisation

1058924

The church was mostly built in the late C14 and early C15 including the tower, in a Perpendicular style. Inside the tower at the height of the nave is a fine fan vault, unusual for a village church. The north aisle parapet and south aisle roof have been repaired with National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship, completed in 2013. Further work to rainwater goods is now complete, funded by a Listed Places of Worship Roof Repairs Grant. Some unsafe stonework was removed by rope access masons in 2017, but the ornate tower is still in need of repair.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of St Michael and All Angels, Rye, Puriton
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1344664

Parish church. C14 to C15 chancel nave and north aisle and early C13 unbuttressed west tower with lancet window. South porch, north vestry. Coursed rubble, freestone dressings, mixed material roofs, interior has Perpendicular rood screen. Tower render failing and falling from the tower. Historic England gave advice following removal of the render in late 2016. Additional issues with the vestry wall and aisle roof remain.

Contact: Annie Evans 0117 975 0673



SITE NAME:	Church of St Mary Magdalene, Stockland Bristol
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1059049

Parish church built in 1865 of blue lias rubble stone. Designed by Arthur of Plymouth for the Daniel family of Stockland Manor. Roofs need re-covering and there are a number of slipped tiles. Structural stability is poor with cracking to window surrounds and major fracture through the tower, with loose stonework on the parapet and vice turret. Some repairs to valley gutter and one window which was blown in were carried out in 2017 but the church remains in a very poor state.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Peter, Church Lane, West Huntspill
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER	1040138

Largely C14, lias with Ham stone dressings. The church was gutted by fire in 1878 and restored in neo-Gothic style. The aisle roofs leak and are patched with sealant and flashband as they are too fragile for more reliable repairs. Lias stone has problems, notably the north parapet, north aisle vice turret and the tower which is now roped off for safety. The congregation is putting together a 2019 bid to the National Lottery Heritage Fund for the tower and interior improvements.

Large parish church, with chancel, nave, quire aisles and nave aisles, two-storeyed south porch and western tower.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Mary, Main Road, Westonzoyland
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Fair
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1174351

Parish church of C13, C14, C15, C16 and C19 with significant additions by WD Caroe 1933-1939. Notable for housing 500 defeated rebels following the Battle of Sedgemoor in 1685. The C15 timber roof structure is of considerable significance with carved angel corbels. The congregation undertook a large scheme of roof repair in 2016 with a Listed Places of Worship Roof Repairs Grant but there are concerns about the condition of the tower.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument

A Unitary Authority
/HS World Heritage Site

SITE NAME:	Medieval estate boundary earthwork on Shute She	lve Hill, Axbridge /	Winscombe and Sandford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015495
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Horsey medieval settlement immediately north of	Board's Farm, Bridg	water Without
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020438
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Ruborough Camp large univallate hillfort, Broomfie	eld	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007670
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Timber trackways 850 metres east of Catcott Burt	le Farm, Burtle	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014433
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Cynwit Castle, Cannington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006225
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	World War II anti-aircraft rocket battery and bom Ashridge Farm, Cheddar	bing decoy control	building 265 metres north east of
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1020994
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
0 111 L			
	Platform cairn, 180 metres east of Wilmot's Pool, 6	Over Stowey	
SITE NAME:	Platform cairn, 180 metres east of Wilmot's Pool, of Scheduled Monument	Over Stowey LIST ENTRY NUMBER:	1417363
SITE NAME: DESIGNATION:		•	1417363 Stable
SITE NAME: DESIGNATION: CONDITION: PRINCIPAL VULNERABILITY:	Scheduled Monument	LIST ENTRY NUMBER:	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

SITE NAME:	Bronze Age and	l Iron Age timber trackways, 700 n	netres north west o	f Coppice Gate Farm, Shapwick
DESIGNATION:	Scheduled Monu		LIST ENTRY NUMBER:	1014431
CONDITION:	Unknown		TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	g	NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Sections of the Farm, Shapwick	Sweet Track, the Post Track and a	ssociated remains 5	00 metres north east of Moorgate
DESIGNATION:	Scheduled Monu	ument	LIST ENTRY NUMBER:	1014438
CONDITION:	Generally satisfa problems	actory but with minor localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewa	tering	NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bronze Age and	I Iron Age trackways 600 metres n	orth east of Northb	rook Farm, Shapwick / Ashcott
DESIGNATION:	Scheduled Monu	ument	LIST ENTRY NUMBER:	1014444
CONDITION:	Extensive signific	cant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Round barrows 600 yards (550 metres) north west of Longbottom Farm, Shipham		rm, Shipham	
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1006223
CONDITION:	Generally satisfactory but with minor localised problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development		NEW ENTRY?:	No
OWNER TYPE:	Private	Private		Charlotte Russell 01271 831505
SITE NAME:	Prehistoric timber trackways, 670 metres SSE of Parchey Bridge, Stawell		rell	
DESIGNATION:	Scheduled Monu	ument	LIST ENTRY NUMBER:	1014430
CONDITION:	Unknown		TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewa	tering	NEW ENTRY?:	No
OWNER TYPE:	Government or agency		CONTACT:	Charlotte Russell 01271 831505
	SITE NAME:	Halswell Park, Goathurst / Broomfield	An C18 landscape park. Local preservation trusts he restored two important garden buildings but some	
	DESIGNATION:	Registered Park and Garden grade II, 17 LBs	the design, Mill V however it chang	n in poor condition. The centrepiece of Vood, was largely denuded of trees, ged hands in spring 2015 and was reunite
	CONDITION:	Extensive significant problems	with the house. The replanting and re	This has led to a major programme of pairs to structures including the listed Ba
	CONDITION: VULNERABILITY:	Extensive significant problems High	 replanting and re 	pairs to structures including the listed Ba spite this, the majority of the park remai



© Historic England

SITE NAME:	Halswell Park, Goathurst / Broomfield	Ar re:
DESIGNATION:	Registered Park and Garden grade II, 17 LBs	str the ho
CONDITION:	Extensive significant problems	wi re
VULNERABILITY:	High	sto
TREND:	Declining	un
NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	
LIST ENTRY NUMBER:	1001145	Co

Contact: Jo McAllister 0117 975 0696

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:

SOMERSET WEST AND TAUNTON



© Historic England

SITE NAME:	Sandhill Park, Bishop's Lydeard
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private

1295317

Country house c1720. A fire in 2011 caused serious damage to the roof structure and top floor. In 2013 planning permission was granted for an enabling development scheme which has now been completed, although works to the house did not commence. In 2017, consent was granted for conversion of the ancillary buildings and a new roof to the main house. The new roof has been completed and works to the ancillary buildings are underway. Pre-application discussions continue in respect of the principal building as of 2019.

Contact: Rhiannon Rhys 0117 975 0685

i	R.
m,	ЭШ
11	

© Historic England

SITE NAME:	Gatehouse at Cothelstone Manor, Cothelstone
DESIGNATION:	Listed Building grade I, RPG grade II, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private

1059192

A mid C16 gatehouse which is part of a much larger estate. Consent has been granted for use as holiday let with associated repairs. As of 2019 no works have been undertaken to the property to implement the scheme.

Contact: Rhiannon Rhys 0117 975 0685



© Historic England

SITE NAME:	Remains of Chantry at Kilve, Sea Lane, Kilve
DESIGNATION:	Scheduled Monument and Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private

1002960 and 1345688

Early C14, with later medieval additions, formerly believed to be remains of collegiate dwelling of chantry priests. A Historic England survey has shown that the ruins are part of an important manorial complex. Historic England funded emergency repairs in 2010 and 2011, a conservation plan and further works in 2013 and 2014. Further jointly funded consolidation works were undertaken in 2015. Structural movement in one gable, which is propped, remains to be addressed and a major phase of work is underway and due to start on site later in 2019.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Cloth finishing works at Tone Mills, North Range, Wellington
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1271246

A near complete example of a C19 cloth dyeing and finishing works which developed between c1830 and c1920. Somerset West and Taunton Council and Historic England are actively engaged in trying to find a solution to conserve the buildings. The site has suffered from vandalism on multiple occasions during the last five years.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Tonedale Mills (east complex), Milverton Road, Wellington
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Commercial company, multiple owners

1176514

Eastern complex of an integrated multi-component wool textile factory, now largely disused. Consent granted for mixed use redevelopment of the complex but work halted in 2008. Previous owners went into receivership leaving some buildings in a very vulnerable condition. The site had some scaffolding and emergency work carried out in 2018 but this has now ceased. Enforcement Action has been undertaken to secure Tonedale House following unauthorised works. Discussions between owners, local authority and Historic England, concerning the future and conservation of the site, are ongoing.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

LIST ENTRY NUMBER:

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Historic England

SITE NAME:	Tonedale Mills (west complex) Wellington
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private

1051987

Western complex of an integrated multi-component wool textile factory, now largely disused. Consent was granted for mixed use redevelopment of the complex. Works halted on site in 2008 and previous owners went into receivership leaving some buildings in a very vulnerable condition. The site had some scaffolding and work carried out in 2017 but following concerns raised by the Local Authority this ceased. Enforcement Action has been undertaken to secure Tonedale House following unauthorised works with further ongoing discussions concerning the future of the site and its conservation.

Contact: Annie Evans 0117 975 0673

© Historic England Archive

SITE NAME:	Wellington Monument, Wellington Without
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1060281

175 feet high triangular tower commemorating the Duke of Wellington's victory at the Battle of Waterloo. Construction began in 1817; money ran out and a cheaper revised design was then followed, completed in 1854. The stonework has extensive cracking, with successive repair campaigns over generations. The National Trust has owned it since 1934, but closed the monument to the public in 2007 due to safety concerns. Extensive investigatory work has been undertaken. A large part of the funding for repair has now been secured and work is due to start late 2019.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St John, Park Street, Taunton
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1059951

Built 1858-1863, by George Gilbert Scott. Chancel, nave, north and south aisles; north chapel; south porch and choir vestries at the north-east. Prominent tower and spire with polychrome banded decoration, and figures of the apostles in tabernacles masking the broaches. A faculty was granted in 2016 for alterations to the west end to make the church accessible to a wider range of people. The roofs are also aging and in need of work, and the high level stonework is potentially fragile.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Mary, Brompton Regis, Somerset West and Taunton
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1057978

Anglican parish church with C13 west tower, chancel possibly partly C13 with later rebuilding, C14 south transept much rebuilt in C19, nave and north aisle rebuilt around 1490. Restored in 1853 and reroofed in 1885. The tower was restored in 1895 but is now leaking badly with algal growth inside. A National Lottery Heritage Fund Grant for Places of Worship was awarded and repairs started in 2018, due to be completed in 2019.

Contact: Annie Evans 0117 975 0673

SITE NAME:	The Castles, Bathealton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019150
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Bowl barrow and folly ruins on Cothelstone Hill, I	kilometre north ea	st of St Agnes' Well, Cothelstone
SITE NAME: DESIGNATION:	Bowl barrow and folly ruins on Cothelstone Hill, I	kilometre north ea	st of St Agnes' Well, Cothelstone
	,		
DESIGNATION:	Scheduled Monument Generally satisfactory but with significant localised	LIST ENTRY NUMBER:	1015086

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

I PA ΝP RPG

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

SITE NAME:	Bowl barrow on Cothelstone Hill, 1,070 metres no	orth east of St Agne	es' Well, Cothelstone
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015087
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Barrow and cairn cemetery on Black Hill, 490 met	res north west of C	Crowcombe Park Gate, Holford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019381
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Dowsborough hillfort and associated round barrow	w, Holford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010494
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Entrenchment on Heydon Hill, Huish Champflowe	r	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006173
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Four medieval fish weirs 500 metres east of the Ha	arbour, Minehead	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020017
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Duck decoy 250 metres north west of Moredon H	louse, North Curry	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014441
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Norton Camp large univallate hillfort, Norton Fitz	warren	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008467
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Charlotte Russell 01271 831505

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:		c Pale, Pitminster / Trull		
DESIGNATION:		ment, part in RPG grade II	LIST ENTRY NUMBER:	1002957
CONDITION:	Generally satisfac	tory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	problems Scrub/tree growth		NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple o		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Curdon Wood (Camp, Stogumber		
DESIGNATION:	Scheduled Monu	· · · · · ·	LIST ENTRY NUMBER:	1006158
CONDITION:	Generally satisfac	tory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Stringston churc	hyard cross, Stringston		
DESIGNATION:	Scheduled Monu	ment, 2 LBs	LIST ENTRY NUMBER:	1006171
CONDITION:	Generally satisfac	ctory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - ir	n need of management	NEW ENTRY?:	No
OWNER TYPE:	Religious organisa	ation	CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Cairn 280 metres south of Triscombe Stone, West Bagborough			
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1016707
CONDITION:	Generally unsatis problems	factory with major localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Charlotte Russell 01271 831505
SITE NAME:	Round barrow c	emetery at Battle Gore immediate	ly west of North R	oad, Williton
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1019032
CONDITION:	Generally unsatis problems	factory with major localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping		NEW ENTRY?:	No
OWNER TYPE:	Private	Private		Charlotte Russell 01271 831505
SITE NAME:	Camp south of N	1anor Farm, Wiveliscombe		
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1006167
CONDITION:	Extensive significa	ant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Commercial com	npany	CONTACT:	Charlotte Russell 01271 831505
	SITE NAME:	St Audries (House), West Quantoxhead / Williton	mansion, togethe	pleasure grounds, surrounding a C19 er with parkland developed from the mid-
	DESIGNATION:	Registered Park and Garden grade II, 16 LBs	C18 and improved in the mid-C19. St Audries has succession of institutional uses; derelict former so buildings remain in the walled garden. The parkla mostly under cultivation and few parkland trees should have a should be	titutional uses; derelict former school in the walled garden. The parkland is
	CONDITION:	Generally unsatisfactory with major localised problems		tivation and few parkland trees survive. S
	VULNERABILITY:	Medium		
	TREND:	Stable		
	NEW ENTRY?:	No		
	OWNER TYPE:	Mixed, multiple owners		
	LIST ENTRY NUMBER:	1001155		llister 0117 975 0696

Immediate risk of further rapid deterioration or loss of fabric; no

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet

implemented.

C Slow decay; no solution agreed.

D Slow decay; solution agreed but not yet implemented.

E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Wellington		
DESIGNATION:	Conservation Area, 90 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Nigel Pratt (LPA) 01823 356492

SOUTH SOMERSET



SITE NAME: Top mill building, Higher Flax Mills, Torbay Road, Castle Cary DESIGNATION: Listed Building grade II*, CA CONDITION: Poor OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: F (F) OWNER TYPE: Private 1056226

This mid C19 former mill has been sold and an application approved for conversion to one live/work unit in 2011. Works are underway and making slow but good progress. The southern roof is now complete. The building is mostly occupied. Work is still on-going as of 2019.

LIST ENTRY NUMBER: © South Somerset District Council

SITE NAME:

Contact: Rhiannon Rhys 0117 975 0685



Chard School, Fore Street, Chard Town DESIGNATION: Listed Building grade II*, CA CONDITION: Poor Occupied/in use OCCUPANCY: PRIORITY CATEGORY C (C) OWNER TYPE: Educational (independent) LIST ENTRY NUMBER: 1205594

The building dates to 1583. It became Chard Grammar School in 1671 and has been a school ever since. It has an L-Plan layout with five bays, a rear wing and two storeys with attics. The building was an advanced plan form for its date, notable for passage access to the main rooms. Features include squared chert Hamstone dressings, window hoods and mullions, plain tile roof and brick stacks. The rainwater goods are inadequate, areas of water ingress and structural issues where trusses have been altered.

© Historic England

Contact: Annie Evans 0117 975 0673



SITE NAME: Waterloo House and Manor Court House, 7A, 7B, 9, 11, 13 and I3A, Fore Street, Chard Town DESIGNATION: Listed Building grade I, CA CONDITION: Poor OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: C (C)

Mixed, multiple owners

Late C16/early C17 group of shops, offices, houses and flats with two prominent projecting two and three storey porches. A 2010 planning appeal refused a proposed subdivision to create smaller units. In 2014 the Local Authority commissioned a feasibility study with Historic England grant-aid. Work to repair the three-storey porch to 7A was completed in 2018 with Historic England grantaid. Discussions with the multiple owners over options for the building are continuing.

© Historic England

LIST ENTRY NUMBER: 1197449

OWNER TYPE:

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME: Gatehouse to Cathanger, Cathanger Lane, Fivehead DESIGNATION: Listed Building grade II* CONDITION: OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: C (New entry) OWNER TYPE: Private LIST ENTRY NUMBER: 1249561

Late C16 gatehouse to Cathanger Manor, with central throughway and first floor over. Banded lias and Ham stone, thatched roof, wood coving to eaves. Principal trusses have spread and wall plates have moved outwards. Crude props inserted to support the collars are causing significant deflection to first floor and damage to partition and door jamb. Decay to main beam and joists on south. Thatch thin with water ingress. Cracking and erosion to east wall with general decay of banded lias.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site

LIST ENTRY NUMBER:



© Historic England

SITE NAME:	Madey Mill, East Street, Martock
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1226550

Water mill with medieval origins, although current buildings are largely C17. The building is situated on a working farm, is under-used and is suffering from lack of maintenance. Viable new uses and/or funding opportunities need to be investigated to obtain adequate funding for repairs. A Historic England funded condition survey has been completed, identifying urgent repairs but as of 2019 the condition remains poor. Historic England hopes to work further with the owners regarding repair and reuse.

Attached to this chantry college is a group of medieval and C16 farm buildings, some of which are in poor condition and unroofed. However others, such as the threshing barn, are capable of beneficial use. Owned by the National Trust, Historic England has had a number of meetings on site and funded an options appraisal to consider ways of bringing the buildings back into use. As of 2019, Historic England and the National Trust are jointly funding the first phase of repair work to the Dovecote. The National Trust is considering ways to improve the use of the site.

Contact: Chris Miners 0117 975 1355



© Historic England

SITE NAME:	Secular college at Parsonage Farm, Stoke Sub Hamdon
designation:	Scheduled Monument and Listed Buildings - I grade I; 6 grade II, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Charity (heritage)

1020665 and 1260178;

1242240; 1260179; 1242150; 1260105; 1260180; 1242246

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	The east Rope Walk, at Job Gould's West of England Twine Works, East Street, West Coker
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1057116

Early C19 Rope walk. Extremely long (97 metres) building of three-storeys, partly open at ground floor level, oak trusses with weatherboarding and windows along the east and west; later brick southern end; undulating double roman clay tile roof, five ropewalks on two levels, some original machinery. The building is fragile, roof has been patched but battens have slipped in numerous places allowing in water; trusses fractured and structure under stress. Historic England grant-aided works to support the structure in 2016 and as of 2019 the building is being gradually repaired by a new owner.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	White Horse Hotel, 4, High Street, Wincanton
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1274102

Inn dated 1733 built by Nathaniel Ireson in free baroque style. Local stone cut and squared with painted ashlar dressings; plain clay tile roof behind parapet, simple gables; brick end chimney stacks. Three-storey and three bays to road. Early cross-wing, also second cross-wing with columns that may relate to use as an inn. Early C20 dance hall at the rear. Building in poor condition with façade parting from roof, and floors decayed. Work had commenced on site but has now stopped. The building was listed for sale in 2019.

Contact: Rhiannon Rhys 0117 975 0685



© Historic England

SITE NAME:	Church of St Andrew, Aller
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1227327

Small church of Saxon origin with C12/C13 and C15 additions and major restoration 1861 to 1862 by H John Norton. Tower stonework was repaired under the joint National Lottery Heritage Fund and Historic England Repair Grant for Places for Worship scheme in 2013. The church was offered a Listed Places of Worship Roof Repairs Grant and in 2017-18 the nave and south porch roofs were recovered, and ceilings repaired. The chancel, north aisle and north porch roofs remain in poor condition.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Full ladar repair on in fair to good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBR	eviations
CA LB LPA NP RPG SM UA WHS	Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garde Scheduled Monument Unitary Authority World Heritage Site



SITE NAME:	Church of the Holy Trinity, Main Street, Ash
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1057286

Parish church built in 1841 by Sampson Kempthorne, chancel added 1887, and tower added 1919. Ham stone cut and squared with ashlar dressings and a Welsh slate roof between coped gables. The coping stones have become dangerous and the tower masonry is in poor condition.

Contact: Annie Evans 0117 975 0673

© Historic England



SITE NAME:	Church of St Mary Magdalene, Church Lane, Barwick
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1057217

Parish church C13 and later. Ham stone roughly squared and coursed, with ashlar dressings; plain clay tiles between coped gables to chancel south aisle and nave, stone slates to south porch. Chancel is an 1885 rebuild incorporating earlier fragments. The tower roof is in poor condition, the bell frame needs work and the nave and aisle roofs are also in poor condition. The church has been awarded a National Lottery Heritage Fund Grant for Places of Worship and repairs started in 2019.

Contact: Annie Evans 0117 975 0673

© Historic England



SITE NAME:	Church of St Nicholas, Bratton Seymour
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Very bad
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1177220

Parish church with C13 origins. Two-cell plan, of two-bay chancel and three-bay nave, with west tower and south porch, and small north-east vestry. High level stonework needs repairing urgently. Interior poor with ceilings at risk of falling and some plaster already having fallen.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Church of St John the Baptist, Charcroft Hill, Brewham
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1056463

Parish church reputed to date from the C13 with much C19 rebuilding. The tower is inhabited by birds making inspection difficult. The church has been subject to heritage crime previously and the roofs are generally in need of repair. The rainwater goods are in poor condition.

LIST ENTRY NUMBER:

© Historic England

© Historic England



© Historic England

SITE NAME:	Church of St Mary, West Charlton, Charlton Mackrell
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation

1056728

Parish church. C13 origins, but restored in 1792-1794 and in 1847. Local lias stone cut and squared, with Ham stone ashlar dressings. Stone slate roof between coped gables. Signs in the churchyard warning of the danger of slipping roof slates. All roofs need recovering as the fixings have rusted and the stone tiles are laminating.

Contact: Annie Evans 0117 975 0673

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



SITE NAME:	Church of St Stephen, Charlton Musgrove
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1346185

C13 church with later additions and alterations. The stone slate roofs are slipping and areas around the church have been cordoned off pending repairs. The congregation was awarded a National Lottery Heritage Fund Grant for Places of Worship in 2017. Delivery phase started in March 2019 and is due for completion by December 2019.

Contact: Sarah Ball 0117 975 0666

© Historic England



SITE NAME:	Church of St Mary, Church Street, Donyatt
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	D (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1057074

The current church dates primarily from the C15 and is a rebuild of an earlier church. Consists of nave, chancel, north and south aisles, south porch and west tower. Extensive works carried out in the C19 which included the nave and aisle roofs. The chancel is full width and height. There is severe cracking over the chancel arch and the east window, both full width of the walls.

LIST ENTRY NUMBER: 1057074 Contact: Sarah Ball 0117 975 0666

SITE NAME:	Church of All Saints, Isle Brewers
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	F (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1263514

Parish church built 1861 by CE Giles. Built of lias stone with Ham stone dressings. The roof tiling is poor and the ceiling, which appears to be plastered directly onto the underside of the rafters, is falling in so that the whole of the interior of the nave is netted. A couple of the windows are in need of repair. The stair tower has severe fracturing. A National Lottery Heritage Fund Grant for Places of Worship Delivery grant has been awarded and is expected to be completed by December 2019.

Contact: Sarah Ball 0117 975 0666

© Historic England



© Historic England

SITE MAINE:	Street, Limington
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1056844

Church of St Mary Church

Church of St Mary the Virgin

Church dating from C13 onwards. Local squared random rubble with Ham stone dressings. Tiled roofs except for the fine north chapel of 1328 which has an unusual stone roof over ribbed barrel vault. The nave roof is at the end of its life particularly the south slope. The chantry chapel roof is leaking and causing damage to the interior. The congregation has secured a National Lottery Heritage Fund Grant for Places of Worship. The repair scheme is in progress during 2019.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE TO VIE.	Stoke Sub Hamdon
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1260420

Parish church of mainly C12 and C13 with later additions. Water ingress problems leading to damp as evidenced by the algal growth on the north and south side of the nave (and in the porch). Vegetation needs clearing from between the coping stones and roof slates. Rainwater goods in need of repair. The congregation has been awarded a Listed Places of Worship Roof Repairs Grant and some work was carried out in 2016-17 but more repairs are needed.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Under repair on in fair to good.

SITE NAME

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise,

New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Low Ham Romar	n villa, High Ham			
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1006192	
CONDITION:	Generally unsatist problems	factory with major localised	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Animal burrowing	g - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Commercial com	pany	CONTACT:	Alessandra Perrone 0117 975 1345	
SITE NAME:	Northover Hous	e, late Roman cemetery, Ilchester			
DESIGNATION:	Scheduled Monur	ment, CA	LIST ENTRY NUMBER:	1006128	
CONDITION:	Generally unsatist problems	factory with major localised	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Scrub/tree grow	th	NEW ENTRY?:	No	
OWNER TYPE:	Charity (heritage)	Charity (heritage)		Annie Evans 0117 975 0673	
SITE NAME:	Hamdon Hill cam	np, Montacute / Norton Sub Hamd	on / Stoke Sub Hai	mdon	
DESIGNATION:	Scheduled Monur	Scheduled Monument, LB grade II, part in CA		1003678	
CONDITION:	Generally satisfactory but with significant localised problems		TREND:	Declining	
PRINCIPAL VULNERABILITY:	Mineral extraction	n/related subsidence	NEW ENTRY?:	Yes	
OWNER TYPE:	Local authority		CONTACT:	Alessandra Perrone 0117 975 1345	
SITE NAME:	Large multivallate	e hillfort and associated earthwork	s at South Cadbury	, South Cadbury	
DESIGNATION:	Scheduled Monument, 2 CAs		LIST ENTRY NUMBER:	1011980	
CONDITION:	Generally satisfactory but with significant localised problems		TREND:	Improving	
PRINCIPAL VULNERABILITY:	Scrub/tree growth		NEW ENTRY?:	No	
OWNER TYPE:	Private		CONTACT:	Alessandra Perrone 0117 975 1345	
	SITE NAME:	Redlynch Park, Bruton / Shepton Montague	Formerly the principal seat of the Earls of Ilchester, Redlynch is a large landscape park near Wincanton. The		
	DESIGNATION:	Registered Park and Garden grade II, 10 LBs	are now in multip	main house has gone and the stables and ancillary buildin are now in multiple ownership. The majority of the parkland planting has disappeared, boundary walls and	
	CONDITION:	Generally unsatisfactory with major localised problems	also on-going dev	e generally in poor condition. There are velopment pressures. An C18 Gothic Fowers, was repaired in 2012 and is no	
A STATE OF	VULNERABILITY:	Medium	longer at risk, and	d sections of the park wall have been	
一	TREND:	Stable	repaired with a N	Natural England Stewardship Scheme.	
Historic England	NEW ENTRY?:	No			
	OWNER TYPE:	Private, multiple owners			
	LIST ENTRY NUMBER:	1000420	Contact: Jo McA	llister 0117 975 0696	
	SITE NAME:	Cricket House, Cricket St.	C18 landscape p	ark and pleasure grounds surrounding	
	5.7.2.7.W. I.E.	Thomas / Winsham	listed mansion, partly by Sir John Soane. Pressure for development from a large hotel and from farm diversification into the leisure market. Parts of the park have been restored through a Natural England Stewards Scheme.		
	DESIGNATION:	Registered Park and Garden grade II*, 8 LBs			
* (1) * (1)					
	CONDITION:	Generally satisfactory but with significant localised problems	Scheme.		
	CONDITION: VULNERABILITY:		Scheme.		

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Νo

1001142

Mixed, multiple owners

NEW ENTRY?:

OWNER TYPE:

LIST ENTRY NUMBER:

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Jo McAllister 0117 975 0696

OWNER TYPE:

SITE NAME:

LIST ENTRY NUMBER:

SOUTH GLOUCESTERSHIRE (UA)



© Historic England Archive

Whitfield Tabernacle, Park Road DESIGNATION: Listed Building grade I, CA CONDITION: Very bad OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: A (A)

Private

1116201

Former chapel, built in 1741. The building has been redundant for many years and a fire has placed the building in an even more vulnerable position. In 2019 Historic England has grant-aided some works to improve access to the site while continuing discussion with the Local Authority and the owners to establish a sustainable and viable long term strategy for the site.

Contact: Alessandra Perrone 0117 975 1345



© Historic England Archive

SITE NAME:	Monument to Lord Robert Edward Somerset, Hawkesbury
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1320834

A tall tapering stone tower ashlar monument by Lewis Vulliamy dated 1846. Repairs needed at high-level to cast iron balcony and stonework.



© Historic England

	Lodge, Badminton Park, Hawkesbury
DESIGNATION:	Listed Building grade II*, RPG grade I
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)

Ragged Castle or Keeper's

Folly Castle. Set on a motte at end of a main drive from Badminton House, c1750 by Thomas Wright of Durham. Largely hidden by trees. Shell of structure is in poor condition. Interior has been lost. There has been clearance of vegetation on and around the structure.

OWNER TYPE: Private LIST ENTRY NUMBER: 1156209

Contact: Sarah Ball 0117 975 0666

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Brandy Bottom Colliery, Pucklechurch
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1019400

A former C19 steam-powered colliery built on the site of C18 colliery. The Avon Industrial Buildings Trust have taken on the site and run regular work parties. They have undertaken vegetation clearance and minor repairs to stabilise the structures. Historic England grant aided works since 2014 have included repairs to the chimney, the structures within the Old Pit and New Pit and some interpretation. A Heritage Partnership Agreement document forms the basis of an on-going programme of repair and research.

Contact: Alessandra Perrone 0117 975 1345



© Historic England

SITE NAME:	Coach House and stables north east of Oxwick Farmhouse, Oxwick Lane, Yate, Wickwar
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1312305

Coach house and stables, built 1722 in a mannered provincial baroque. The building is under a temporary roof. Listed Building Consent was approved in 2011 for substantial repair works. A separate application was made for a wind turbine which was approved in 2013 on the basis that the revenue generated from it should assist in funding the repairs to both listed properties on the site. Historic England provided structural advice in early 2018 on the condition of the scaffolding with the view of securing maintenance works to the temporary supporting structure.

Contact: Stephen Guy 0117 975 0725

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP Registered Park and Garden Scheduled Monument RPG Unitary Authority World Heritage Site



© Historic England

	, ,
SITE NAME:	Oxwick Farmhouse, Oxwick Lane, Yate, Wickwar
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1321124

Farmhouse dated 1722, in flamboyant artisan mannerist/baroque style. Part occupied. Vacant part has serious decay of floor structures and in areas is unsafe, but emergency repairs have been implemented. Discussions over full repair remain on-going. Some enabling development has been permitted in the form of renewable energy.

Contact: Stephen Guy 0117 975 0725

Acceptance

SITE NAME: Parish Church of St Andrew, Church Lane, Cromhall DESIGNATION: Listed Place of Worship grade I CONDITION: Poor PRIORITY CATEGORY: A(A)OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1114974

Parish church. C12, rebuilt in C13/C14 and altered C15; restored 1852. Rubble with freestone dressings; stone slate roof with coped raised verges, slate to the nave. The sandstone slates have slipped or are missing. The rainwater system is rusted and leaking. There is structural cracking over the south aisle east window and over the west window.

Contact: Chris Miners 0117 975 1355



SITE NAME: Church of St Mary the Virgin, Church Road, Yate DESIGNATION: Listed Place of Worship grade I CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1128753

Large urban parish church with a nave, chancel, aisles, transepts and west tower. Sandstone with limestone dressings and roofed with stone slates. Localised leaks over many years are steadily worsening over much of the roof. The north aisle and the south chancel roofs should be the first to be repaired.

Contact: Chris Miners 0117 975 1355

© Historic	England
© I listoric	Lingiania

© Historic England

SITE NAME:	Round barrow on Barrow Hill, Bitton		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1004521
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Roman villa and earlier settlement remains in Badmi Hawkesbury	nton Park, 340 me	tres south of Hinnegar Lodges,
DESIGNATION:	Scheduled Monument, RPG grade I	LIST ENTRY NUMBER:	1021415
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345
SITE NAME:	Bury Hill camp, Moorend, Winterbourne		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007023
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Alessandra Perrone 0117 975 1345

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is

shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Tortworth Court, Cromhall / Falfield / Tortworth
DESIGNATION:	Registered Park and Garden grade II*, 7 LBs, part in SM
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1000394

Important Victorian house and grounds, including renowned arboretum. House now a hotel and part of grounds lost to Leyhill Open Prison. Walled garden being redeveloped for light industrial use. Arboretum neglected. Extensive loss of trees in park. The registered area is in multiple ownership and suffers from a lack of holistic management. In 2016 a Conservation Management Plan for part of the registered park was produced with grant aid from Historic England. This was followed in 2017 by a grant to assist with de-silting the lake (now completed), which forms the centrepiece of the design.

Contact: Jo McAllister 0117 975 0696



© Historic England

SITE NAME:	Stoke Park, Stoke Gifford
DESIGNATION:	Registered Park and Garden grade II, 10 LBs, SM, part in CA
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Stable
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners


1000129

Mid-C18 park laid out around crenellated Dower House. The park is in a dramatic location on a hill overlooking the city of Bristol and is embellished by monuments and eyecatchers. Now bisected by the M32 motorway. Setting compromised by dense residential development. Park under pressure from heavy and occasionally anti-social use, particularly affecting park structures. In 2012, the majority of the site was transferred to Bristol City Council who received Historic England grant towards a Conservation Management Plan in 2015-16 which is now being implemented under Natural England Stewardship.

Contact: Jo McAllister 0117 975 0696

SITE NAME:	Warmley, Siston / Oldland		
DESIGNATION:	Conservation Area, 9 LBs, RPG grade II, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Ian Gething (LPA) 01454 863578
SITE NAME:	Whitfield Tabernacle		
SITE NAME: DESIGNATION:	Whitfield Tabernacle Conservation Area, 3 LBs	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Improving
DESIGNATION:	Conservation Area, 3 LBs		

SWINDON (UA)

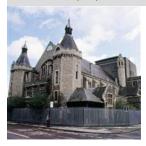

© Historic England Archive

SITE NAME:	The Mechanics Institute, Emlyn Square
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company

1198947

Mechanics Institute, 1853-5; now vacant. Outstanding example at heart of railway village. The council served an Urgent Works Notice on the owner in 2009 and implemented works in 2010 to secure the building. The shell of the building has been stabilised but it is not possible to enter due to health and safety concerns. The "Railway Village", of which the Mechanics forms the centrepiece, is now a Historic England Heritage Action Zone, which it is hoped will deliver a road-map to restoration of the building.

Contact: Simon Hickman 0117 975 0717

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair or in fair to good.

LIST ENTRY NUMBER:

- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Historic England

SITE NAME:	Church of St Margaret, Church Street, Stratton St. Margaret
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Religious organisation

1185393

Large parish church now within the northern suburbs of Swindon. Consists of nave, chancel, north aisle, north vestry (an extension of the aisle), south aisle with two-storey south porch and two-stage west tower. C13 origins, C19 low two-stage west tower. The stone slating to the roofs of the porch, chancel and south slope of the south aisle roofs are in poor condition. National Lottery Heritage Fund Grant for Places of Worship offered in 2017 for roof repairs. Works are due to be completed in 2019.

Contact: Sarah Ball 0117 975 0666

SITE NAME:	Bowl barrow 280 metres north of Downs Barn, Bis	shopstone	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010419
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow on Hinton Downs, Bishopstone		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010461
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Disc barrow on Burderop Down, I kilometre nort	h east of Upper He	erdswick Farm, Chiseldon
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010457
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow I kilometre west of Sheppard's Farm	Dairy, Chiseldon /	Ogbourne St. George
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012439
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Badger - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Field system and earthwork enclosure on Burderop	Down, Chiseldon	/ Ogbourne St. George
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016383
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Four Highworth circles 150 metres north east of P	ickett's Copse, Hig	hworth
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016386
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 - Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Three Highworth circles 600 metres east of North Leaze Farm, Highworth		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018221
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 700 metres south west of Liddington	Warren Farm, Lide	dington
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009634
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Site of Roman town, west of Wanborough House,	Wanborough / Co	vingham
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1004684
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow 700 metres north of Liddington Warren Farm, Liddington / Wanborough		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009631
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Remains of Holy Rood Church, The Lawn, Old To	wn	
DESIGNATION:	Scheduled Monument, 3 LBs	LIST ENTRY NUMBER:	1018057
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
		001.71.07	N: 1 C 0770F (4F44F
OWNER TYPE:	Local authority	CONTACT:	Nick Croxson 07795 665645

TORBAY (UA)



© Historic England

SITE NAME:	Lupton House (Gramercy Hall School)
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1195173

C18 and C19 country house remodelled by G Wightwick c1840, with extensive ancillary buildings and fine Italianate garden. Altered after a fire in 1928. In use as a school from mid C20 to 2004. A charitable trust has acquired the house and parts are used for weddings and community health activities. Historic England grant-aided development work to the Italianate Garden in 2015, and a condition survey of the house and ancillary structures, and emergency repairs including a trial area of repair to the Italianate Garden, in 2017-18. Further major funding from other sources will be required.

Contact: Annie Evans 0117 975 0673

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



© Historic England

SITE NAME:	llsham Manor Oratory, llsham Road, llsham
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Charity (non-heritage)

1206789

Redundant oratory, part of the demolished medieval Ilsham Manor. Sited in the grounds of a school, which closed in 2015. Neglected and in poor condition, when assessed in 2012 the chapel was not in use. By 2015 large holes in the roof coverings had opened up and the rainwater goods were missing, causing significant water ingress. Historic England grant-aided a condition survey in 2016 and urgent repairs to the roof were completed with Historic England grant-aid in 2017. Repointing, window, and interior repairs remain to be tackled by new owners.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	The Bishop's Palace, Tower Road, Paignton
DESIGNATION:	Scheduled Monument, 2 LBs, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Local authority

1020764

LIST ENTRY NUMBER:

C14 curtain wall and tower, forming part of the medieval fortified residence of the Bishop of Exeter. Vegetation growth, especially valerian on the wall tops and growing from crevices, threatens the medieval walls. Their root system grows to a large bulbous form within the wall, pushing stones out of line and leading to breakdown of the structure. Ivy has also taken hold and is rapidly spreading along the south wall. In 2016 Historic England grant-aided a programme of vegetation removal and door rerfubishment.

Contact: Daniel Bashford 07824 103102



© Torbay Council

SITE NAME:	Torbay Cinema, Torbay Road, Paignton
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1208209

Cinema first licensed in 1912 and frequented by Agatha Christie. An extremely well preserved example of an early purpose-built cinema. The building closed in 1999 and Historic England helped with the transfer of ownership of the building to a new Trust. Coastal Revival funds were secured in 2016 for work which allowed the building to be accessible for public visits. Historic England has offered a grant in 2019 to investigate emergency work that will be needed to the two-storey bay window. Further feasibility work is also being undertaken by the Trust to look at future uses within the building.

Contact: Annie Evans 0117 975 0673



© Historic England

SITE NAME:	Church of St Mary Magdalene, Upper Union Street, Torquay
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1219197

Parish church. Built between 1843 and 1849 to the designs of A Salvin, by contractor Jacob Harvey. Altered and partly re-fitted under GG Scott 1881-82; further embellishment 1906 and 1927. Local grey limestone rubble with Bath stone dressings; slate roof. Rainwater goods all need overhauling. The church received a Listed Places of Worship Roof Repairs Grant in 2017 and rainwater goods have been overhauled. High level stonework in very bad condition and difficult to access. The clerestory stonework spalling badly. A rope access survey has identified these problems in more detail.

Contact: Annie Evans 0117 975 0673

SITE NAME:	Ashhole Cavern, Brixham		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1019133
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Daniel Bashford 07824 103102

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS Conservation Area Listed Building Local Planning Authority National Park I PA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site



© Historic England

SITE NAME:	Oldway Mansion
DESIGNATION:	Registered Park and Garden grade II, 12 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	Medium
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1001368

Formal gardens laid out to complement a grand house, apparently inspired by the Palace of Versailles. Built by the Singer sewing machine dynasty, the grounds have been steadily rationalised and simplified. Permission was granted in 2012 for mixed-use development, including a hotel in the main house and housing in the grounds, but this was never implemented. The property remains in Local Authority ownership, with no scheme identified.

Contact: Jo McAllister 0117 975 0696

© Historic England

SITE NAME:	Princess Gardens and Royal Terrace Gardens, Torquay
DESIGNATION:	Registered Park and Garden grade II, 4 LBs, 2 CAs
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	Medium
TREND:	Improving
NEW ENTRY?:	No
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1001507

Important formal Victorian seaside park with later phases and additions. Major development agreed, including a multi-storey, mixed-use building to be attached to the grade II listed Pavilion and the seasonal installation of a Ferris wheel. A condition report and management plan for the gardens was completed in early 2017.

Contact: Jo McAllister 0117 975 0696

SITE NAME:	Brixham Town, Brixham		
DESIGNATION:	Conservation Area, 107 LBs, 3 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Hal Bishop (LPA) 01803 207788

TORBAY (UA) / SOUTH HAMS



© Historic England

SITE NAME:	Lupton Park, Kingswear
DESIGNATION:	Registered Park and Garden grade II*, 7 LBs, part in CA
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Improving
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1000696

The designed landscape was principally developed from the late-C18 through to mid-C19. After World War II the house became a hotel, then a school. Today a trust occupies the house (at risk) with the degraded Italianate garden, while other owners occupy the park, walled garden, pleasure grounds and woodlands. In 2015 Historic England funded a condition report for the Italianate Garden and a further grant for development work on the house and garden was offered with work underway in 2017-18. The condition of the park is being tackled by a Natural England Stewardship Scheme.

Contact: Jo McAllister 0117 975 0696

WILTSHIRE (UA)



0	Historic	Englar	nd

SITE NAME:	Rudloe Manor, Box
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1022808

Late C17 manor house surrounded by ancillary buildings including a grade II listed barn. The house was part of a larger Ministry of Defence site which was vacated in 1998. The current owners have consent for a residential scheme with enabling development. Work has been undertaken to the exterior of the listed building to make it watertight but it remains vacant. The property has recently been put up for sale but not sold.

Contact: Jacqueline Smith 0117 975 0667

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area is LB Listed Building e, LPA Local Planning Authority NP National Park RPG Registered Park and Garden SM Scheduled Monument UA Unitary Authority WHS World Heritage Site



© Wiltshire Council

SITE NAME:	Buildings to the rear of the Lansdowne Arms Hotel, The Strand, Calne
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use

C (C)

Private

1247495

Former coach house, stable and brewhouse to rear of Lansdowne Arms Hotel. Buildings range from mid C17 to mid C19. Condition of roofs and coverings are continuing to degenerate leading to further internal decay. Urgent Works Notices have previously been complied with; however, the condition of these buildings continues to decline. Pre-application discussions and assessment work on-going, with progress meetings having taken place in 2018.

Obelisk constructed in 1845 by Sir Charles Barry for the 3rd Marquess of Lansdowne in memory of Sir William Petty, ancestor of the Petty-Fitzmaurice family. The condition of this monumental local landmark is in decline due to the effect of weathering on the stonework. An appplication for planning permssion to maintain temporary protection was made in January 2019 whilst a project to

Late medieval market cross in the centre of Castle Combe, in a later roofed open structure built to provide shelter.

Contact: Samuel Souter 0117 975 0690

	- 8		
	- 8		
	1		
	463		
	1		
- Sililara		Same D	

© Historic England

SITE NAME:	The Lansdowne Monument, Calne Without
DESIGNATION:	Listed Building grade II*, SM
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Charity (heritage)

LIST ENTRY NUMBER: 1253569

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

Contact: Sarah Ball 0117 975 0666

repair the monument is developed.



© Historic England

SITE NAME:	Medieval market cross immediately east of St Andrew's Church, Castle Combe
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Local authority
PRIORITY CATEGORY:	D (D)

1019387

The central cross sits on a plinth that is raised on two steps and sits on a stone platform. On this sits the sheltering structure made up of stone. The market cross is in its original position, built when Castle Combe was an important and wealthy settlement. Historic England grantaided project development work which was completed in 2017. A project to repair the roof and stonework is due to start in summer 2019 with further grant-aid from Historic England.

Contact: Sarah Ball 0117 975 0666



© Historic England

SITE NAME:	Former hangars at Yatesbury Airfield, Cherhill
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1283146

Two aircraft hangars, built c1917 as part of a training centre. Two hangars from the first years of military flying. One hangar has been repaired, though there is no current end use. Consent has been granted to demolish the second hangar and this is currently in a collapsed state. As of 2019, previously approved applications not implemented.

SITE NAME: Former Law Courts and County Law courts and po



© Historic England Archive

SITE NAME:	Former Law Courts and County Police Station, Northgate Street, Devizes
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1251744

Law courts and police station, 1835. Wind and weather tight. Interior has been gutted. Several schemes have been granted consent, including residential and nightclub use, but none have been implemented. Planning Permission and Listed Building Consent granted in 2012 for a new residential scheme was renewed 2015 and expired 2018. Urgent works carried out in 2015. Purchase by Wiltshire Historic Buildings Trust completed in 2018 and site is now in ownership of Assize Courts Trust. Emergency work is largely complete. There are proposed plans to carry out conversion for use as a museum.

Contact: Jacqueline Smith 0117 975 0667

Contact: Jacqueline Smith 0117 975 0667

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

LIST ENTRY NUMBER:



© Historic England Archive

•	·
SITE NAME:	Stable block to Tottenham House, Great Bedwyn
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (B)
OWNER TYPE:	Private

1365488

Impressive stable block of 1818, by Thomas Cundy, located 150 metres NNW of Tottenham House. Following neglect, the structure has recently suffered a collapse to the clock tower and the surviving structure is in an unsafe and partially ruinous condition. A planning application was granted early 2018 supporting the return of Tottenham House to a single family dwelling, with some additional development and the conversion of the Stable Block for ancillary leisure use. The site is now under new ownership and discussions regarding rebuilding and implementation of the agreed scheme are underway.

Contact: Jacqueline Smith 0117 975 0667

1-1-	1	Marine Service
	1	-
100	-11-11-	
		Total Control
	115	
n Copyright NMR	ref: BB86/05	409

© Historic England Archive

SITE NAME:	Tottenham House, Great Bedwyn
DESIGNATION:	Listed Building grade I, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1183809

Country house 1825 by Thomas Cundy, situated in park, developed from C15 to C17 and landscaped by Lancelot 'Capability' Brown in the 1760s. Previously used as a preparatory school (from the 1950s) now vacant. A planning application was granted early 2018 supporting the return of Tottenham House to a single family dwelling with some additional development and the conversion of the Stable Block for ancillary leisure use. The site is now under new ownership and the implementation of the agreed works will result in the buildings being removed from the Heritage at Risk Register.

Contact: Jacqueline Smith 0117 975 0667



© Historic England

SITE NAME:	Chapel at Knowle House, Little Bedwyn
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Unknown
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

1004708

Early C15 former chapel in curtilage of a listed house. In poor condition and needs some work and repair to roof and gable wall.



© Historic England

SITE NAME:	Medieval undercroft at Bradenstoke Priory, Lyneham and Bradenstoke
DESIGNATION:	Scheduled Monument, LB grade II, part in CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
	F () I

CONDITION: Poor

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: F (New entry)

OWNER TYPE: Private, multiple owners

LIST ENTRY NUMBER: 1010807

C14 undercroft to priory. The building above was removed in the 1920s to America by Randolph Hearst. The undercroft was propped with grant aid from Historic England to prevent collapse. There was clearance of scrub and re-pointing in 2012. A Historic England project development grant was offered in November 2017 and completed in March 2019. A repair project to consolidate the vaults and provide a green roof commenced in Spring 2019 with further Historic England funding.

Contact: Sarah Ball 0117 975 0666

Contact: Sarah Ball 0117 975 0666

SITE NAME:	The Red House at Eastwell Manor, Eastwell Road, Potterne
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1258775

Red brick garden building. Built c1700. One of several buildings on this site that are presently disused and in a decaying condition. An Enforcement Notice has been served in respect of unauthorised alterations. An appeal was lodged by the owner but was rejected by the planning inspector. Access to the site is currently restricted.

Contact: Jacqueline Smith 0117 975 0667

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Full ladar repair on in fair to good.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted). ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

LIST ENTRY NUMBER:

LIST ENTRY NUMBER:



© Historic England

SITE NAME:	Courtfield House, Polebarn Road, Trowbridge
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private

1021635

Courtfield House is a clothier's house built c1754 with an earlier C17 building to rear. The house was used as a preparatory school which closed in April 2012. Adjoining the house is a relatively unaltered wool store. The roof structure of the house is in poor condition with a collapsing valley gutter. The property is currently vacant and subject to vandalism. Purchased in April 2016 by a developer to convert the main house to residential units with new build residential in the grounds. Building is now scaffolded and secure and negotiations to reach an acceptable application continue.

Contact: Samuel Souter 0117 975 0690



© Salisbury District Council

SITE NAME:	Chapel, immediately north of Pythouse, Pythouse Park, West Tisbury
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Privata

1131162

Former private chapel to country house, c1827. Built by John Bennett of Pythouse for his wife nee Lucy Lambert of Boyton. The chapel is derelict and overgrown and the stonework has been vandalised. The building is now scaffolded. Some of the vegetation has been removed.

Contact: Sarah Ball 0117 975 0666



© Historic England Archive

SITE NAME:	Phipps Mausoleum, Westbury Cemetery, Bratton Road, Westbury
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private

Late C19 privately owned mausoleum, within a local authority municipal cemetery. The building is currently disused and continues to deteriorate. It is the subject of on-going vandalism but has been secured against break-ins.



SITE NAME:	Church of St Peter, Calne Without
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1261936

1364424

Parish church, probably C13, altered and extended 1859 and restored 1907 by CE Ponting. Rubble stone coped chancel gable and gabled stone slate hung west bellcote. The church has structural movement and monitoring was carried out for over a year to inform a specification for repair. Advice on repairs was given by Historic England in Spring 2018 following which the congregation are progressing a repair project.

Contact: Sarah Ball 0117 975 0666

Contact: Sarah Ball 0117 975 0666

© Historic England



© Historic England

SITE NAME:	Church of St Nicholas, Baydon
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1034135

Anglican parish church with fabric dating from C12, C13 and C15 with C19 restorations in 1857, 1876 and 1892. Consists of nave, north aisle, chancel, north vestry and west tower. East window by GE Street dated 1857-58. Severe vertical cracking in east and north walls of chancel. Emergency propping erected in February 2019.

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 F. Under repair or in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS CA Conservation Area LB Listed Building LPA Local Planning Auth

LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site




SITE NAME:	Church of St Peter, Charlton
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1365532

Parish church. C16 and 1857-8 by JL Pearson. Medieval work in ashlar limestone. C19 work in flint banded with limestone ashlar and brick. Tiled roof. North porch with tower over and north chapel, all C15-C16. Nave and chancel in one, rebuilding original work. The plain clay tiles to the roof are failing and although regular patching and repair is being undertaken, the roof will need renewing.

Contact: Sarah Ball 0117 975 0666

© Historic England

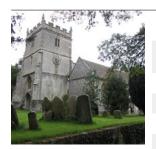

SITE NAME:	Church of St Mary, A419, Chilton Foliat
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1034139

Parish church, c1300, early C14 and C19. Flint with Bath stone dressings. North nave wall, tower and chancel rendered. Stone tile roof with slate to nave. Nave, south aisle and porch, chancel, west tower and vestry. Chancel and nave roofs and rainwater goods in poor condition.

© Historic England



SITE NAME:
Church of St Mary, Church Road, Kilmington

DESIGNATION:
Listed Place of Worship grade II*
CONDITION:
Poor
PRIORITY CATEGORY:
D (C)

OWNER TYPE:
Religious organisation

LIST ENTRY NUMBER:
1318459

Church of England parish church. C15 tower, chancel rebuilt 1864, complete rebuilding 1869, tower restored 1903 by CE Ponting. Dressed limestone, rubblestone, tiled roof with ceramic ridge cresting and coped verges. West tower and entrance, nave and north aisle, south transept, north vestry and chancel. Narrow three-stage tower of Somerset type. Roofs and masonry in poor condition, particularly tower. Unsuccessful in attempts to obtain National Lottery Heritage Fund grant. Repair of tower roof proposed as first phase of repair.

Contact: Sarah Ball 0117 975 0666

Contact: Sarah Ball 0117 975 0666

© Marcus Chantrey, Benjamin Beauchamp Architects



SITE NAME:	Church of St Peter, Swindon Road, Langley Burrell Without
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1199423

Parish church, c1200, c1300, C14 and C15, carefully restored 1890 (chancel) by CE Ponting and 1898 (nave and north aisle) by H Brakspear. Rubble stone with stone slate roofs and coped gables. Nave, north aisle, transeptal south tower with porch, chancel and south east chapel. Stone tiles to nave roof in poor condition and rainwater goods require overhauling.

Contact: Sarah Ball 0117 975 0666

© Historic England



© Marcus Chantrey, Benjamin Beauchamp Architects

SITE NAME:	Church of St Anne, Bowden Hill, Lacock
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER	1363962

Church of England parish church 1856-7 by SB Gabriel of Bristol. Consists of nave, chancel and north porch in Early English style with Romanesque style north east tower. There has been past structural movement in the church but since Summer 2018 this has accelerated and large cracks have opened around the chancel arch. Emergency propping has been erected externally in the south-east corner of the nave since October 2018.

Contact: Sarah Ball 0117 975 0666

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

 Full lader repairs on in fair to good.
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



SITE NAME:	All Saints Chapel, Swan Lane, Leigh
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1356042

Church of England parish church. C14 and 1896 by CE Ponting. Squared limestone rubble, stone slate roof. Nave rebuilt from old church and new chancel added. C14 porch entrance with wave moulding and hood. Sundial above. Stone slate roof and rainwater goods are in poor condition. Render to bell turret is failing.

Contact: Sarah Ball 0117 975 0666

© Historic England



SITE NAME:	Church of St Andrew, Church Lane, Melksham
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1286098

Church of England parish church, 1876 by Charles Adye. Ashlar, decorative tiled roof with coped verges, cross finials and cresting. Nave and chancel with south door and north vestry. Early English style. The clay tiled roofs and rainwater goods to the nave and chancel are in poor condition. In 2017, a scheme was drawn up to redevelop the modern extension to provide community use as part of the church. Funding sources for this will be explored.

Contact: Sarah Ball 0117 975 0666

0	Historic	Eng	and
---	----------	-----	-----

SITE NAME:	Wermere pond, Alvediston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004774
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	A bell barrow and two bowl barrows east of The Avenue on Countess Farm: part of a linear round barrow cemetery, Amesbury		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010331
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bell barrow 550 metres east of New Barn, Earl's Farm Down, Amesbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009872
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Linear boundary earthwork on Amesbury Down w	vest of Stock Botto	m, Amesbury
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015218
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Conservation Area Listed Building Local Planning Authority National Park LPA ΝP RPG Registered Park and Garden Scheduled Monument Unitary Authority World Heritage Site

EGGOATION Scheduled Monument ST DATEY NUMBER 1009572 CONDITION Generally unsatisfactory with major localised problems PRESCRA VALE PRESENTITY CONNEX TYPE Educational (state sector) CONNEX TYPE Educational (state sector) Educational (state sector) CONNEX TYPE CONNEX Scheduled Monument Extensive significant problems TREND CONNEX TYPE Private CONNEX TYPE Private CONNEX TYPE Private Beckhampton round barrow cemetery 150 metres north east of the Waggon and Horses', Avebury CONNEX TYPE CONNEX TYPE CONNEX TYPE CONNEX Scheduled Monument, WHS Generally satisfactory but with significant localised problems RENDOW VALENAMILITY Animal burrowing - extensive Mixed, multiple owners CONTACT: Nick Crosson 07795 665645 MIXED CONNEX TYPE	SITE NAME:	Three bell barrows 300 metres north east of New	Barn, Earl's Farm [Down, Amesbury	
problems problems problems Arable clipping NEWENTIME Arable clipping NEWENTIME Educational (state sector) CONTACT: Nick Croxson 07795 665645 III NAME: Linear boundary earthwork 250 metres west of Stockport, Amesbury / Idmiston Scheduled Monument SCHITTENAME: CONDITION Scheduled Monument SCHITTENAME: DISTRIPTIMENSES 1015689 Linear boundary earthwork 250 metres west of Stockport, Amesbury / Idmiston Scheduled Monument SCHITTENAME: DISTRIPTIMENSES Linear boundary earthwork 250 metres west of Stockport, Amesbury / Idmiston Scheduled Monument Arable ploughing Private CONTACT: Nick Croxson 07795 665645 Scheduled Monument, WHS SCHITTENAME: DESCRIPTION Scheduled Monument, WHS SCHITTENAME: DESCRIPTION Scheduled Monument, WHS SCHITTENAME: DISTRIPTIMENSES LINEAR SCHITTENAME LINEAR S	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009572	
Educational (state sector) CONTACT: Nick Croxson 07795 665645 Internation Scheduled Monument Arable ploughing New Bottan: No Now North Title Private Beckhampton round barrow cemetery I50 metres north east of the Waggon and Horses', Avebury Scheduled Monument, WHS Scheduled Monument, WHS Generally satisfactory but with significant localised problems RECORDITION Generally satisfactory but with significant localised problems Animal burrowing - extensive No CONTACT: Nick Croxson 07795 665645 New Holling RECORDITION Bowket Title Bow barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury Scheduled Monument, WHS Schedule	CONDITION:		TREND:	Declining	
Linear boundary earthwork 250 metres west of Stockport, Amesbury / Idmiston 2008/0011000 Scheduled Monument 2018 INTERNATED 2008/0011000 Extensive significant problems 3018 INTERNATED 2008/0011000 Private 2008/0011	PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
Scheduled Monument IST DYTRY NUMBER 1015689 Extensive significant problems TREND: Unknown RENCEM WILLERMARITY: Arable ploughing NEW PRITEY: No DWINER TYPE: Private CONTACT: Nick Crosson 07795 665645 Beckhampton round barrow cemetery ISO metres north east of the "Waggon and Horses", Avebury Scheduled Monument, WHS IST DYTRY NUMBER 1008221 CONDITION: Generally satisfactory but with significant localised problems RENCEM WILLERMARITY: Animal burrowing - extensive NEW PRITEY: No DWINER TYPE: Mixed, multiple owners Willed, multiple owners Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury DESCRIPTION: Scheduled Monument, WHS Extensive significant problems TREND: Unknown RENCEDIA WILLERMARITY: Arable ploughing NEW PRITEY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Crosson 07795 665645 SERENDAL WILLERMARITY: Arable ploughing NEW ENTRY: No Declining Declining Declining NEW ENTRY: No Declining	OWNER TYPE:	Educational (state sector)	CONTACT:	Nick Croxson 07795 665645	
Extensive significant problems TREND: Unknown NEW ENTER: No CONTACT: Nick Crosson 07795 665645 TRENDE: No Nick Crosson 07795 665645 TRENDE: Nick Crosson 07795 665645 TRENDE: Nick Crosson 07795 665645 TRENDE: Declining CONDITION: Scheduled Monument, WHS TREND: Declining CONTACT: Nick Crosson 07795 665645 TREND: Declining TREND: Declining TREND: Declining TREND: Declining TREND: Nick Crosson 07795 665645 TREND: Nick Crosson 07795 665645 TREND: Unknown TREND: Unk	SITE NAME:	Linear boundary earthwork 250 metres west of Stockport, Amesbury / Idmiston			
Arable ploughing NEW ENTRY: No Nick Croxson 07795 665645 Arable ploughing NEW ENTRY: Nick Croxson 07795 665645 Beckhampton round barrow cemetery 150 metres north east of the 'Waggon and Horses', Avebury Cemonations Scheduled Monument, WHS UST ENTRY NUMBER 1008221 CONDITION: Scheduled Monument, WHS UST ENTRY NUMBER 1008221 CONDITION: Scheduled Monument, WHS UST ENTRY NUMBER 1008221 CONDITION: NEW ENTRY: No Declining Problems Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury CESCONATION: Scheduled Monument, WHS UST ENTRY NUMBER 1008107 CONDITION: Extensive significant problems TREND: TREND: TREND: Nick Croxson 07795 665645 STE NAME: CONDITION: Control of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury CONDITION: Extensive significant problems TREND: TREND: Nick Croxson 07795 665645 STE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury CONDITION: Extensive significant problems TREND: Declining CONDITION: Extensive significant problems TREND: Declining NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining TREND: Declining NEW ENTRY: No CONDITION: Extensive significant problems TREND: Declining TR	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015689	
Private CONTACT: Nick Croxson 07795 665645 Beckhampton round barrow cemetery I50 metres north east of the 'Waggon and Horses', Avebury Scheduled Monument, WHS IIIST ENTRY NUMBER: 1008221 CONDITION Generally satisfactory but with significant localised problems PREMICIPAL VILL NEARBILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Mick Croxson 07795 665645 Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS IIIST ENTRY NUMBER: 1008107 Extensive significant problems TREND: Unknown PREMICIPAL VILL NEARBILITY: Arable ploughing NEW ENTRY: No CONTRACT: Nick Croxson 07795 665645 STE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS IIIST ENTRY NUMBER: 1014031 CONDITION Extensive significant problems TREND: Declining PREMICIPAL VILL NEARBILITY: Arable ploughing NEW ENTRY: No CONDITION Extensive significant problems TREND: Declining PREMICIPAL VILL NEARBILITY: Arable ploughing NEW ENTRY: No CONDITION Extensive significant problems TREND: Declining PREMICIPAL VILL NEARBILITY: No CONNECTIVE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 STE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situates on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS IIIST ENTRY NUMBER: 1008075 CONTACT: Nick Croxson 07795 665645 STE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery situates on Avebury Down, Avebury CONTACT: Nick Croxson 07795 665645 STE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury Scheduled Monument, WHS IIIST ENTRY NUMBER: 1008101 EXTENSITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury Scheduled Monument, WHS IIIST ENTRY NUMBER: 10081	CONDITION:	Extensive significant problems	TREND:	Unknown	
Beckhampton round barrow cemetery 150 metres north east of the "Waggon and Horses", Avebury Scheduled Monument, WHS Generally satisfactory but with significant localised problems Animal burrowing - extensive New Entry: No Nick Croxson 07795 665645 STENANE: Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury Scheduled Monument, WHS Extensive significant problems TREND: Unknown Arable ploughing New ENTRY: No No CONSTRUCT: Nick Croxson 07795 665645 STENANE: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Unknown TREND: Unknown TREND: Unknown TREND: Unknown TREND: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining TREND: Declining TREND: Declining TREND: Declining TREND: Declining TREND: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining TREND: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: No DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1014031 DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Nick Croxson 07795 665645 STENAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situated on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining PRINCIPLE UNIVERABILITY: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining TREND: Declining TREND: Declining TREND: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
CONDITION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008221 CONDITION: Generally satisfactory but with significant localised problems Animal burrowing - extensive NEW ENTRY!: No DOWNER TYPE: Mixed, multiple owners CONTACT: Nick Croxson 07795 665645 STEENAME: Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Unknown REPRINCIPAL VULNERABILITY: Arable ploughing DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Unknown New ENTRY: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining NEW ENTRY: No DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining	OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
Generally satisfactory but with significant localised problems RENCEPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRYP: No DWNER TYPE: Mixed, multiple owners CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LET ENTRY NUMBER: 1008 107 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: No DWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS LET ENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS LET ENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situated on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LET ENTRY NUMBER: 1008075 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 DESIGNATION: Scheduled Monument, WHS LIST ENTRY: Declining DESIGNATION: Scheduled Monument, WHS LIST ENTR	SITE NAME:	Beckhampton round barrow cemetery 150 metres north east of the 'Waggon and Horses', Avebury			
PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY: No Nick Croxson 07795 665645 PRINCIPAL VULNERABILITY: Animal burrowing - extensive Newst of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No Nick Croxson 07795 665645 STEINAME: Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury PRINCIPAL VULNERABILITY: No Nick Croxson 07795 665645 STEINAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury CONTACT: Nick Croxson 07795 665645 STEINAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 STEINAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008075 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 STEINAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 DESIGNATION: Scheduled Monument, WHS DESIGNATION: Scheduled Mon	DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008221	
Mixed, multiple owners CONTACT: Nick Croxson 07795 665645 Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems REND: Unknown REND: Unknown REND: Unknown REND: Unknown REND: Nick Croxson 07795 665645 SITE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems REND: Declining REND: Declining REND: Declining REND: Declining REND: Declining REND: Nick Croxson 07795 665645 STE NAME: Extensive significant problems REND: Declining REND: Declining REND: Declining REND: Nick Croxson 07795 665645 STE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems REND: Declining REND: Nick Croxson 07795 665645 STE NAME: REND: Declining REND: Declining REND: Declining REND: Declining REND: Declining REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665645 STE NAME: REND: Nick Croxson 07795 665	CONDITION:		TREND:	Declining	
Bowl barrow 770 metres south west of the junction of the Ridgeway and Green Street, forming part of a round barrow cemetery on Avebury Scheduled Monument, WHS LISTENTRY NUMBER: 1008107 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY? No CONTACT: Nick Croxson 07795 665645 SETENAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS LISTENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Nick Croxson 07795 665645 STENAME: Declining PRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 STENAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LISTENTRY NUMBER: 1008075 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No OWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 STENAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LISTENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DESIGNATION: Scheduled Monument, WHS LISTENTRY NUMBER: 1008101 CONTACT: Nick Croxson 07795 665645 STENAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LISTENTRY NUMBER: 1008101 DECINITION: Extensive significant problems TREND: Declining NEW ENTRY: No Declining	PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
round barrow cemetery on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008107 Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008075 Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 EXTENSIVE Significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645	
Extensive significant problems TREND: Unknown Arable ploughing NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems TREND: Volver Entry?: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems TREND: UST ENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining RENCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 EXTENAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008075 EXTENDIBLY VULNERABILITY: Animal burrowing - extensive RENDIDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 EXTENDER OF TREND: Declining RENDIDITION: Extensive significant problems TREND: No CONTACT: Nick Croxson 07795 665645 EXTENDER OF TOWN DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008075 EXTENDER OF TOWN DESIGNATION: NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 EXTENDER OF TOWN DESIGNATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXENCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No RENDER OF TREND: Declining RENDITION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXERCIPATION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXENCIPAL VULNERABILITY: No RENDITION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXENCIPAL VULNERABILITY: No RENDITION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXENCIPAL VULNERABILITY: No RENDITION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXENCIPAL VULNERABILITY: No RENDITION: Scheduled Monument, WHS UST ENTRY NUMBER: 1008101 EXENCIPAL VULNERABILITY: No RENDITION: RENDITION: NEW ENTRY?: No	SITE NAME:				
Arable ploughing NEW ENTRY?: Arable ploughing NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: LID (1403 I) Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 No CONTACT: Nick Croxson 07795 665645 No CONTACT: Nick Croxson 07795 665645 Declining NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: LID (108075) CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: LION 10810 I DEClining REND: REND: Declining REND:	DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008107	
Charity (heritage) CONTACT: Nick Croxson 07795 665645 Extensive significant problems Extensive significant problems FRINCIPAL VULNERABILITY: Arable Monument, WHS CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 Extensive significant problems FRINCIPAL VULNERABILITY: Number: 1008101 Extensive significant problems FRINCIPAL VULNERABILITY: New Extensive Significant problems FRINCIPAL VULNERABILITY: No CONDITION: Extensive significant problems FRINCIPAL VULNERABILITY: No FRINCIPAL VULNERABILITY: No CONDITION: Extensive significant problems FRINCIPAL VULNERABILITY: No FR	CONDITION:	Extensive significant problems	TREND:	Unknown	
Earthwork enclosure 950 metres SSE of Manor Farm, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 STE NAME: New ENTRY?: No DOWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 EXTENDION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1014031 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYY: No OWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008075 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRYY: No OWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYY: No	OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Croxson 07795 665645	
Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008075 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No Bettensive Declining PRINCIPAL VULNERABILITY: No Bettensive Declining PRINCIPAL VULNERABILITY: No Bettensive Declining New ENTRY?: No	SITE NAME:	Earthwork enclosure 950 metres SSE of Manor Farm, Avebury			
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008075 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Charity (heritage) CONTACT: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1014031	
Charity (heritage) Charity (heritage) Contact: Nick Croxson 07795 665645 Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury Designation: Scheduled Monument, WHS List entry number: 1008075 Condition: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive Charity (heritage) Contact: Nick Croxson 07795 665645 SITE NAME: Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	CONDITION:	Extensive significant problems	TREND:	Declining	
Pair of round barrows 400 metres west of the Ridgeway, forming part of a round barrow cemetery situate on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008075 Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: NO CONTACT: Nick Croxson 07795 665645 LIST ENTRY NUMBER: 1008101 Extensive significant problems TREND: Declining NEW ENTRY: NO DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 Extensive significant problems TREND: Declining NEW ENTRY?: NO	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
on Avebury Down, Avebury DESIGNATION: Scheduled Monument, WHS Extensive significant problems FXEND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive OWNER TYPE: Charity (heritage) Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No	OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Croxson 07795 665645	
Extensive significant problems TREND: Declining Animal burrowing - extensive New Entry?: No Charity (heritage) Contact: Nick Croxson 07795 665645 Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury Designation: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No New ENTRY?: No	SITE NAME:		geway, forming part	t of a round barrow cemetery situate	
PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	•	LIST ENTRY NUMBER:	1008075	
PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	CONDITION:	Extensive significant problems	TREND:	Declining	
Pair of round barrows forming part of the Bronze Age round barrow cemetery 400 metres north east of West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	· · · · · · · · · · · · · · · · · · ·	NEW ENTRY?:	No	
West Kennett Farm, Avebury DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1008101 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No	OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Croxson 07795 665645	
CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No	SITE NAME:				
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No	DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008101	
, was a proughting	CONDITION:	Extensive significant problems	TREND:	Declining	
	PRINCIPAL VULNERABILITY:	·	NEW ENTRY?:	-	
	OWNER TYPE:		CONTACT:	Nick Croxson 07795 665645	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Remains of 'Falkner's Circle', a Neolithic stone cir	cle 180 metres east	of the West Kennet Avenue, Avebur	
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008109	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Croxson 07795 665645	
ITE NAME:	Round barrow cemetery 400 metres south of Ave	ebury henge monum	ent on Waden Hill, Avebury	
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008216	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Ten barrows forming part of Fox Covert round by	arrow cemetery, W	est Down, Avebury	
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008293	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Local authority	CONTACT:	Nick Croxson 07795 665645	
ITE NAME:	West Kennet Avenue and an earthwork bank east of West Kennett Farm, Avebury			
DESIGNATION:	Scheduled Monument, LB grade II, 2 CAs, WHS	LIST ENTRY NUMBER:	1015547	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	A henge, four Bronze Age barrows and part of a F / Bishops Cannings	Roman road 500 me	tres south west of Fox Covert, Aveb	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007491	
CONDITION:	Extensive significant problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	West Kennett Farm palisaded enclosures, Avebur	y / East Kennett		
DESIGNATION:	Scheduled Monument, 2 LBs, part in CA, WHS	LIST ENTRY NUMBER:	1015157	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Grovely Ditch, Barford St. Martin / Burcombe Without / Great Wishford / Wilton			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005584	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Croxson 07795 665645	
	, \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \			

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	ITH WEST / WILTSHIRE (UA)				
SITE NAME:	South Lodge camp Bronze Age enclosure with a metres east of Rushmore Farm, Berwick St. John	ssociated field system	and round barrow cemetery, 350		
DESIGNATION:	Scheduled Monument, RPG grade II	LIST ENTRY NUMBER:	1020962		
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No		
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645		
SITE NAME:	Bowl barrow 300 metres east of Furze Knoll, Bishops Cannings				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013068		
CONDITION:	Extensive significant problems	TREND:	Unknown		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645		
SITE NAME:	Bowl barrow 550 metres north east of Baltic Farm, Bishops Cannings				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012629		
CONDITION:	Extensive significant problems	TREND:	Unknown		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645		
SITE NAME:	Bowl barrow 950 metres SSW of Beckhampton Plantation, forming part of a round barrow cemetery on Horton Down, Bishops Cannings				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012983		
CONDITION:	Extensive significant problems	TREND:	Unknown		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645		
SITE NAME:	Bowl barrow situated 500 metres SSW of Sheph	erds' Shore, Bishops	Cannings		
DESIGNATION:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1013756		
CONDITION:	Extensive significant problems	TREND:	Unknown		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645		
SITE NAME:	Eleven round barrows 1000 metres north of Baltic Farm forming part of a barrow cemetery, and a probable enclosed Iron Age farmstead on North Down, Bishops Cannings				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013773		
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No		
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645		
SITE NAME:	Enclosed Iron Age farmstead 450 metres south of Down Barn on Bishop's Cannings Down, Bishops Canning				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013230		
CONDITION:	Extensive significant problems	TREND:	Unknown		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No		
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645		

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Five round barrows 1040 metres NNE of Baltic Fal Bishops Cannings	rm forming part of	a barrow cemetery on North Down,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014737
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Four bowl barrows forming part of a cemetery 270 Cannings) metres east of lor	ng barrow on Roughridge Hill, Bishop
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014027
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Group of three bowl barrows 250 metres north ea	ast of Shepherds' Sh	nore, Bishops Cannings
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013232
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Kitchen Barrow: a long barrow on Kitchen Barrow	Hill, Bishops Cann	ings
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012519
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow 650 metres WSW of Shepherds' Sho	re, Bishops Canning	gs
designation:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1014030
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow on Easton Down, Bishops Cannings		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013366
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Saucer barrow 600 metres west of Beckhampton E	Buildings, Bishops C	Cannings
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012193
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Two saucer barrows and a pair of bowl barrows 7 of a round barrow cemetery on Horton Down, Bis		Beckhampton Plantation, forming pa
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012982
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 85 metres north of Bishopstrow Hou	use, Bishopstrow	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1019507
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Corton long barrow, Boyton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010518
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Scrubbed Oak enclosure and linear boundary earth	nwork, Boyton	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1017713
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow on Cold Kitchen Hill, Brixton Deveri	II	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1010416
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow on Pertwood Down, 1400 metres no	orth west of Lower	Pertwood, Brixton Deverill
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1010463
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Knowle Hill round barrow, Broad Chalke		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003033
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JTH WEST / WILTSHIRE (UA)		
SITE NAME:	Round barrow 860 yards (786 metres) south eas	st of Knighton Hill Bu	ildings, Broad Chalke
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004771
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Knighton Roman road (stretching from Reddish	Gore to reservoir), B	road Chalke / Bishopstone
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003728
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Roman road in Spye Park, Bromham		
DESIGNATION:	Scheduled Monument, part in RPG grade II	LIST ENTRY NUMBER:	1003010
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow: one of a group of round barrows	south of Bulford, Bulf	ord
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009545
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow: one of a group of round barrows	south of Bulford, Bulf	ord
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009564
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Bowl barrow: one of a group of round barrows	south of Bulford, Bulf	ord
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009602
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow: one of a group of round barrows	south of Bulford, Bulf	ord
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009604
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow: one of a group of round barrows	south of Bulford, Bulf	ord
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009605
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Multiple trackway south of Bulford Camp, Bulfor	rd / Cholderton / Ame	esbury
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009613
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow 240 metres south west of Green B	arrow Farm, Castle C	Combe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018419
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 350 metres north east of White H	orse Plantation, Cher	hill
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010134
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 700 metres south east of Field Bar	n, Chicklade	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015937
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Three bowl barrows in Colerne Park, 450 metre	es north of Keeper's (Cottage, Colerne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010758
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow on Wick Down, Collingbourne Du	ıcis	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012510
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 650 metres east of Summer Down Fa	rm, Collingbourne	Kingston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012544	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Two bowl barrows 400 metres south of Summer Down Farm, Collingbourne Kingston			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012518	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Crowdown Clump earthwork (Godsbury), Collingt	ourne Kingston / I	Burbage	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004759	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow on Little Toyd Down, 650 metres sou	ith west of Grims	Lodge Farm, Coombe Bissett	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015704	
CONDITION:	Extensive significant problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Moated site and surrounding earthwork enclosure,	100 metres south	of Chelworth Farm, Cricklade	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013353	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Devizes Castle, Devizes			
DESIGNATION:	Scheduled Monument and Listed Building grade II, 3 LBs, part in CA	LIST ENTRY NUMBER:	1021375 and 1249362	
CONDITION:	Extensive significant problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Hugh Beamish 0117 975 0726	
SITE NAME:	Berwick Coombe ditch, Donhead St. Andrew / Ber	wick St. John		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005587	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
	11 0			
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645	

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Long barrow on Ashmore Down, 775 metres nort	h of Ashgrove Cot	tages, Donhead St. Mary
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015938
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Ogbury camp, Durnford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005677
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Nine bowl barrows, two disc barrows and two sau cemetery on Durrington Down, Durrington	cer barrows formi	ng the majority of a round barrow
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1008943
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Nine round barrows forming a round barrow ceme Durrington	etery 400 metres n	orth of the eastern end of The Curs
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1009067
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	East Kennett long barrow, 600 metres south of East	st Kennett church,	East Kennett
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1012323
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Round barrow on Easton Down, Easton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005693
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Edington Priory (site of), Edington		
DESIGNATION:	Scheduled Monument, LB grade I, CA	LIST ENTRY NUMBER:	1004709
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Long barrow, Tinhead Hill, Edington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009783
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Badger - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	North Hill round barrows, Grafton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004746
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Bowl barrow 100 metres north of Great Botley	Copse, Grafton / Sha	lbourne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012301
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Grovely Castle and earthworks north of Grovel Martin	y Wood, Great Wish	ford / Steeple Langford / Barford St.
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005604
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Bowl barrow 340 metres east of Holly Bush Far	m, Grittleton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018418
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Bell barrow 250 metres NNE of the sports grou Down, Idmiston	nd: one of a group of	round barrows north west of Idmisto
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013971
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Bell barrow, three bowl barrows and gas testing	trenches on Idmistor	n Down, Idmiston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014818
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- deterioration or loss of labric; is solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

HERITAGE AT RISK 2019 / SOU	JTH WEST / WILTSHIRE (UA)		
SITE NAME:	Bowl barrow 260 metres SSE of the southern cobarrows on Porton Down, Idmiston	orner of Moll Harris's	Clump: one of a group of round
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014096
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 440 metres SSW of the southern obarrows on Porton Down, Idmiston	corner of Moll Harris's	s Clump: one of a group of round
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014094
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow 140 metres WSW of the Battery F	Hill triangulation point	, Idmiston
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014089
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 530 metres SSW of the southern obarrows on Porton Down, Idmiston	corner of Moll Harris'	s Clump: one of a group of round
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014092
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Saucer barrow 400 metres north east of the spo Idmiston Down, Idmiston	orts ground: one of a g	group of round barrows north west of
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013970
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 535 metres SSW of the southern obarrows on Porton Down, Idmiston	corner of Moll Harris's	s Clump: one of a group of round
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014093
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bronze Age enclosure and two bowl barrows 520 metres north east of Moll Harris's Clump on Idmiston Down, Idmiston			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014819	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Two bowl barrows 265 metres south of the south round barrows on Porton Down, Idmiston	ern corner of Moll	Harris's Clump: part of a group of	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1014095	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Two disc barrows and two bowl barrows 900 met Idmiston	res north of Moll F	Harris's Clump on Idmiston Down,	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1015557	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Bowl barrow on Keysley Down, 250 metres west of Deverill	of the A350 Warm	inster-Shaftesbury Road, Kingston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013877	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Moated site and fishponds south east of Rowden F	arm, Lacock		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1013876	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Settlement west of Latton, Latton			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004689	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Mineral extraction/related subsidence	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645	
SITE NAME:	Medieval pottery kilns, Milford Farm, Laverstock			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003252	
CONDITION:	Extensive significant problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645	

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

ieritage at Risk 2019 / Sol	JTH WEST / WILTSHIRE (UA)		
SITE NAME:	Bell barrow on Rook Hill, 200 metres west of Pert	wood Wood, Long	bridge Deverill
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010470
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Two saucer barrows 775 metres south east of Roo	dmead Farm, Maide	n Bradley with Yarnfield
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017697
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 190 metres north east of Burton Far	m, Mere	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017711
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Black Field Roman site, Mildenhall		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1004726
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Camp on Forest Hill, Mildenhall / Savernake / Marl	borough	
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1004697
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 200 metres north east of Everleigh A	shes, Milton Lilbou	rne
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1009543
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Roman tile and brick kiln site 1000 yards (900 met	res) west of Tidling	Corner, Minety
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004702
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Early medieval settlement, palace, church and B Norton / St. Paul Malmesbury Without	ronze Age ring ditches	340 metres east of Cowage Farm,
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018389
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow: one of a group of dispersed barro	ows south east of Nor	ton Plantation, Norton Bavant
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009830
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Round barrow on the south side of Cotley Hill,	Norton Bavant	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009835
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Barrow on Coombe Down, 1070 yards (980 me Andrew	etres) north east of Up	oper Poughcombe, Ogbourne St.
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005670
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bell barrow 200 metres north of Rockley Planta	ation, Ogbourne St. Ar	ndrew
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012195
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
ITE NAME:	Bowl barrow 375 metres east of Wick Bottom	Barn, Ogbourne St. Aı	ndrew
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015814
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 630 metres north east of Wick Bo	ottom Barn, Ogbourne	e St. Andrew
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015803
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow and a saucer barrow 200 metres in	north of Rockley Plant	ation, Ogbourne St. Andrew
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012197
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet
- implemented.

 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Round barrow cemetery 320 metres south east	of Down Farm, Pews	еу
designation:	Scheduled Monument	LIST ENTRY NUMBER:	1016779
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	The Spectacles, Pewsey		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005638
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Long barrow, Winterbourne, Pitton and Farley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005623
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Moated site 300 metres north east of Potterne I	Park Farm, Potterne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012152
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bell barrow 350 metres south west of Barbury B	Sarn, Preshute	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012190
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 300 metres east of Ivy House Farm	, Preshute	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012294
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Group of round barrows on Rough Hill, Preshut	e	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003034
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Preshute Down field system, Preshute		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004763
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
TRINGITAE VOENEIVABIETT.	F 0 · · · · 0		
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Sharpridge field system, Preshute		
Scheduled Monument	LIST ENTRY NUMBER:	1004764
Extensive significant problems	TREND:	Declining
Arable ploughing	NEW ENTRY?:	No
Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
Roundway Hill Farm round barrows, Roundway	/ Bishops Cannings	
Scheduled Monument, RB	LIST ENTRY NUMBER:	1004773
Extensive significant problems	TREND:	Declining
Arable ploughing	NEW ENTRY?:	No
Crown	CONTACT:	Nick Croxson 07795 665645
Bowl barrow 450 metres north of Cross Drove	s, Shalbourne	
Scheduled Monument	LIST ENTRY NUMBER:	1012274
Extensive significant problems	TREND:	Declining
Arable ploughing	NEW ENTRY?:	No
Private	CONTACT:	Nick Croxson 07795 665645
Long barrow on Smay Down, 300 metres east of The Hassock, Shalbourne		
Scheduled Monument	LIST ENTRY NUMBER:	1010467
Extensive significant problems	TREND:	Declining
Arable ploughing	NEW ENTRY?:	No
Private	CONTACT:	Nick Croxson 07795 665645
Wansdyke: Daniel's Lane section, Shalbourne		
Scheduled Monument	LIST ENTRY NUMBER:	1005594
Generally unsatisfactory with major localised problems	TREND:	Declining
Arable clipping	NEW ENTRY?:	No
Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
Great Botley Copse long barrow, and disc barro	ow near it, Shalbourne	e / Grafton
Scheduled Monument	LIST ENTRY NUMBER:	1005692
Generally unsatisfactory with major localised problems	TREND:	Declining
Arable clipping	NEW ENTRY?:	No
, , , ,		
Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
		Nick Croxson 07795 665645
Mixed, multiple owners		
Mixed, multiple owners Long barrow 250 metres east of Boyton Field Ba	arn, Sherrington / Boy	rton
	Scheduled Monument Extensive significant problems Arable ploughing Private, multiple owners Roundway Hill Farm round barrows, Roundway Scheduled Monument, RB Extensive significant problems Arable ploughing Crown Bowl barrow 450 metres north of Cross Drove Scheduled Monument Extensive significant problems Arable ploughing Private Long barrow on Smay Down, 300 metres east of Scheduled Monument Extensive significant problems Arable ploughing Private Wansdyke: Daniel's Lane section, Shalbourne Scheduled Monument Generally unsatisfactory with major localised problems Arable clipping Private, multiple owners Great Botley Copse long barrow, and disc barros Scheduled Monument Generally unsatisfactory with major localised	Scheduled Monument Extensive significant problems Arable ploughing Private, multiple owners CONTACT: Roundway Hill Farm round barrows, Roundway / Bishops Cannings Scheduled Monument, RB Extensive significant problems Arable ploughing Crown CONTACT: Bowl barrow 450 metres north of Cross Droves, Shalbourne Scheduled Monument Extensive significant problems Arable ploughing NEW ENTRY?: Crown CONTACT: Bowl barrow 450 metres north of Cross Droves, Shalbourne Scheduled Monument Extensive significant problems Arable ploughing Private CONTACT: Long barrow on Smay Down, 300 metres east of The Hassock, Shalbourne Scheduled Monument Extensive significant problems Arable ploughing Private CONTACT: Wansdyke: Daniel's Lane section, Shalbourne Scheduled Monument UST ENTRY NUMBER: CONTACT: Wansdyke: Daniel's Lane section, Shalbourne Scheduled Monument UST ENTRY NUMBER: CONTACT: Wansdyke: Daniel's Lane section, Shalbourne Scheduled Monument UST ENTRY?: CONTACT: Generally unsatisfactory with major localised problems Arable clipping Private, multiple owners CONTACT: Great Botley Copse long barrow, and disc barrow near it, Shalbourne Scheduled Monument UST ENTRY NUMBER: TREND:

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

HERITAGE AT RISK 2019 / SOU	JIH WEST / WILTSHIRE (UA)		
SITE NAME:	Six bowl barrows and two disc barrows forming th west of Fargo Road ammunition compound, Shrew	e majority of a rou ton	nd barrow cemetery 300 metres n
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1009124
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Newton Barrow, South Newton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005687
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Earthwork enclosure on Milk Hill, Stanton St. Bern	ard	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004735
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Stapleford Castle, Stapleford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005686
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Barrow north of 'The Spectacles', Steeple Langford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004742
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 240 metres east of The Penning, Stee	ple Langford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015025
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Deptford Down round barrow, Steeple Langford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005615
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Little Langford round barrow, north of Upper Farn	n Down, Steeple La	ingford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005605
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Round barrow 230 yards (210 metres) north west	of New Field Plant	ation, Steeple Langford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004725
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bell barrow on Parsonage Down, 1.3 kilometres so	outh east of Lord's	Hill Farm, Sutton Veny
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016677
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow on Littlecombe Down, Sutton Veny		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005683
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Fosbury camp, Tidcombe and Fosbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005682
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Castle Ditches camp, Tisbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005701
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Casterley Camp and associated monuments, Upavo	on	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010074
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

SITE NAME:	Bowl barrow 500 metres south of Upton Scudamo	re, Upton Scudamo	ore
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010398
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Enclosure and linear earthworks between Bishopst Bishopstrow / Norton Bavant	row Down and So	uth Down Sleight, Warminster /
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010283
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow in The Belt, 350 metres north east of	f Hill Barn, West O	verton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019901
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bowl barrow 400 metres west of Normanton Gor	se, Wilsford cum L	ake
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010831
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Ten bowl barrows, five disc barrows, a bell barrow Wilsford round barrow cemetery, Wilsford cum L		nd a saucer barrow forming the
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010874
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Horse Barrow, Winterbourne / Idmiston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005610
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
SITE NAME:	Bell barrow 450 metres south east of Greenland Fa of the Lesser Cursus, Winterbourne Stoke	arm, forming part o	of a linear round barrow cemetery we
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010899
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed.
 Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

### NAME Bowl barrow 350 metres north west of Greenland Farm, Winterbourne Stoke	HERITAGE AT RISK 2019 / SOU	JTH WEST / WILTSHIRE (UA)		
Extensive significant problems TREND Unknown PRINCEMENT VILLENAMENTED Arable ploughing NAMENTED Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITENAME Bowl barrow 830 metres south west of Greenlands Bungalow, east of Shrewton, Winterbourne Stoke DESIGNATION Scheduled Monument CONTACT: Nick Croxson 07795 665645 SITENAME Bowl barrow 830 metres south west of Greenlands Bungalow, east of Shrewton, Winterbourne Stoke DESIGNATION Scheduled Monument CONTACT: Nick Croxson 07795 665645 SITENAME Bronze Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbourne Stoke Down, Winterbourne Stoke Bascenation Scheduled Monument Estensive significant problems TREND: Unknown No OWNERTITE Private CONTACT: Nick Croxson 07795 665645 SITENAME Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION Scheduled Monument, WHS Scheduled Monument, WHS Extensive significant problems TREND: Unknown RINKERIA VILLIANIAMILITY: Arable ploughing NoW DITTY: No OWNERTITE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITENAME Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013984 CONNITION: Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITENAME Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013984 CONNITION: Nick Croxson 07795 665645 SITENAME Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013984 CONNITION: Nick Croxson 07795 665645 SITENAME Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013986 CONTACT: Nick Croxson 07795 665645 SITENAME Bowl barrow 750 metres west of Square Copes: part of the Square Copes barrow cemetery, Wootton Rivers DOWNERTHY: No DOWNERTHY: No DOWNERTHY: No DOWNERTHY: No DOWNERTHY: No DOWNERT	SITE NAME:	Bowl barrow 350 metres north west of Greenla	nd Farm, Winterbour	ne Stoke
Arable ploughing NEW PRINTED Private, multiple owners Bowl barrow 830 metres south west of Greenlands Bungalow, east of Shrewton, Winterbourne Stoke DESCRATION: Scheduled Monument JET DYTRY NAMED: 1015217 CONDITION Generally unsatisfactory with major localised problems PRINCIPLE AND DESCRATION: Arable ploughing NEW PRIVATE No. Nick Croxson 07795 665645 Bronze Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbours Stoke Down, Winterbourne Stoke Descration. Scheduled Monument, Wirls SIFE NAME. Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke Descration. Scheduled Monument, Wirls CONDITION Extensive significant problems TREND. Unknown PRINCIPLA VULNERABILITY: Arable ploughing NOW PATTER: No Unknown PRINCIPLA VULNERABILITY: Animal burrowing - extensive NOW of Last NAME NAME NOW PATTER No OWNER TITE: No CONTACT: Nick Croxson 07795 665645 STENAME Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESCRAPATION: Scheduled Monument ISI NAME NAMED: 1013986 CONNECTIVE: Government or agency CONTACT: Nick Croxson 07795 665645 STENAME Bowl barrow 750 metres west of Square Copec part of the Square Copes barrow cemetery, Wootton Rivers CONDITION: Scheduled Monument Scheduled Monument Arable ploughing	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010892
OWNER TITE Private, multiple owners Bowl barrow 830 metres south west of Greenlands Bungalow, east of Shrewton, Winterbourne Stoke DESIGNATION: Scheduled Monument Scheduled Monument Scheduled Monument Scheduled Monument Scheduled Monument Scheduled Monument Private Brance Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbourne Stoke Down, Winterbourne Stoke Downship Downship Now Downship Downship Now Downship Downship Downship Now Downship Downship Now Downship Dow	CONDITION:	Extensive significant problems	TREND:	Unknown
Bowl barrow 830 metres south west of Greenlands Bungalow, east of Shrewton, Winterbourne Stoke DESIGNATION: Scheduled Monument	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION Scheduled Monument UST EMINY NUMBER 1015217 CONDITION Problems Problems RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Bronze Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbours Stoke Down, Winterbourne Stoke DESIGNATION Scheduled Monument UST ENTRY NUMBER 1011048 CONDITION Extensive significant problems TREND Unknown RINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION Scheduled Monument, WHS UST ENTRY NUMBER 1010891 CONDITION Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: No CONDITION Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: No CONDITION Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: No CONDITION Extensive significant problems TREND: Unknown Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION Scheduled Monument UST ENTRY NUMBER: 1013984 CONDITION Generally unsatisfactory with major localised problems RRINCIPAL VULNERABILITY: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION Control No CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION Control Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION Control Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION Control Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION Control Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION Control Nick Croxson 07795 665645 SITE NAME: Bowl ba	OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TITE: Private CONTACT: Nick Croxson 07795 665645 BILE NAME: Bronze Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbourg Stoke Down, Winterbourg Stoke DESIGNATION: Scheduled Monument USTENTRY NUMBER: 1011048 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourge Stoke DESIGNATION: Scheduled Monument, WHS USTENTRY NUMBER: 1010891 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: No OWNER TYPE: Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS USTENTRY NUMBER: 1010891 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: No OWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 STENAMIC: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument USTENTERY NUMBER: 1013984 CONDITION: Problems Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 STENAMIC: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument USTENTERY NUMBER: 1013986 CONDITION: Problems Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument USTENTERY NUMBER: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 STENAMIC: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers STENAMIC: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument USTENTERY NUMBER: 1013352 DECINITION. DECIRION.	SITE NAME:	Bowl barrow 830 metres south west of Greenla	nds Bungalow, east of	f Shrewton, Winterbourne Stoke
PRINCIPAL VALNERABILITY: Arable ploughing New Entry: Private Bronze Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbourn Stoke Down, Winterbourne Stoke DESIGNATION: Scheduled Monument Estensive significant problems TRIND: Unknown MINICIPAL VALNERABILITY: Arable ploughing New Entry: Private CONDITION: Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS Estensive significant problems TRIND: Unknown MINICIPAL VALNERABILITY: Private Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS Estensive significant problems TRIND: Unknown MINICIPAL VALNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 STETNAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013984 CONDITION: Scheduled Monument UST ENTRY NUMBER: 1013984 CONDITION: Problems Private, multiple owners CONTACT: Nick Croxson 07795 665645 TRIND: Declining PRINCIPAL VALNERABILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 TRIND: DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013986 CONDITION: PRINCIPAL VALNERABILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: No OWNER TYPE: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: No OWNER TYPE: No OWNER TYPE: Declining PRINCIPAL VALNERABILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Declining PRINCIPAL VALNERABILITY: No OWNER TYPE: No OWNER TYPE: No OWNER TYPE: Declining PRINCIPAL VALNERABILITY: No OWNER TYPE: No OWNER TYPE: No OWNER TYPE: No OWNER TYPE:	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015217
Designation Scheduled Monument List entry number 10 10 10 10 10 10 10 10 10 10 10 10 10	CONDITION:		TREND:	Declining
Bronze Age enclosure and bowl barrow 100 metres west of Longbarrow Cross Roads on Winterbours Stoke Down, Winterbourne Stoke DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: OUNGROWN PRINCIPLE VALNERABILITY: Arable ploughing NEW ENTRY: Private Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: ID10891 OWNER TYPE: No OWNER TYPE: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument CONDITION: Britishame Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument CONDITION: Generally unsatisfactory with major localised problems PRINCIPLE VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: ID13986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPLE VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: ID13986 CONDITION: Generally unsatisfactory with major localised problems REND: DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: ID13986 CONDITION: Generally unsatisfactory with major localised problems REND: Declining PRINCIPLE VULNERABILITY: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 STENAME Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers Scheduled Monument LIST ENTRY NUMBER: LIST ENTRY NUMBER: ID13352 TREND: Designation: Designation: Designation: Scheduled Monument LIST ENTRY NUMBER: Designation: Des	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Stoke Down, Winterbourne Stoke Scheduled Monument LISTENTRY NUMBER: 1011048 CONDITION: Extensive significant problems Arable ploughing NEWENTRY: No OWNER TYPE: Private Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS LISTENTRY NUMBER: 1010891 CONDITION: Extensive significant problems TREND: Unknown Designation: CONDITION: Extensive significant problems TREND: OWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 STE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Ortchard, Winterslow DESIGNATION: CONDITION: Scheduled Monument LISTENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 STE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: CONDITION: CONDITION: Generally unsatisfactory with major localised problems Scheduled Monument LISTENTRY NUMBER: 1013986 CONTACT: Nick Croxson 07795 665645 STE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: CONTACT: Nick Croxson 07795 665645 STE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: CONTACT: Nick Croxson 07795 665645 STE NAME: Bowl barrow 750 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers REND: DESIGNATION: CONTACT: Nick Croxson 07795 665645 STE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: CONTACT: Nick Croxson 07795 665645	OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
Extensive significant problems FRENCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No OWNER TYPE: Private Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1010891 CONDITION: Extensive significant problems FRENCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No OWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 SETE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument Scheduled Monument Scheduled Monument CONDITION: Generally unsatisfactory with major localised problems FRENCIPAL VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 TREND: DEClining PRINCIPAL VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 TREND: DEClining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRYP: No OWNER TYPE: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 TREND: Declining PRINCIPAL VULNERABILITY: No OWNER TYPE: No OWNER TYPE: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352	SITE NAME:	Bronze Age enclosure and bowl barrow 100 me Stoke Down, Winterbourne Stoke	tres west of Longbarr	row Cross Roads on Winterbourne
PRINCIPAL VULNERABILITY: Arable ploughing New Entry: No OWNER TYPE Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION: Scheduled Monument, WHS Extensive significant problems TREND: Unknown New Entry: No OWNER TYPE Private, multiple owners CONTACT: Nick Croxson 07795 665645 STE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive ROWNER TYPE Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013986 GOVERNER TYPE Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013986 Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No OWNER TYPE Government or agency CONTACT: Nick Croxson 07795 665645 STE NAME Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013986 TREND: Declining PRINCIPAL VULNERABILITY: No OWNER TYPE Government or agency CONTACT: Nick Croxson 07795 665645 STE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No DESIGNATION: Scheduled Monument UST ENTRY NUMBER: 1013352 DECLINING DECLINING NEW ENTRY: No Declining PRINCIPAL VULNERABILITY: No DECLINING DECLINING NEW ENTRY: No DECLINING DEC	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011048
OWNER TYPE Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESIGNATION. Scheduled Monument, WHS LIST ENTRY NUMBER. 1010891 CONDITION: Extensive significant problems TREND. Unknown PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITE NAME. Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER. 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER. 1013986 Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER. 1013986 Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 STIE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	CONDITION:	Extensive significant problems	TREND:	Unknown
Disc barrow and pond barrow 350 metres NNW of Greenland Farm, Winterbourne Stoke DESCNATION: Scheduled Monument, WHS LIST ENTRY NUMBER: 1010891 CONDITION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESCNATION: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESCNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY: No DESCNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers BOWL barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESCNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument, WHS DESIGNATION: Extensive significant problems TREND: Unknown PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY!: No OWNER TYPE: Private, multiple owners DESIGNATION: Scheduled Monument CONDITION: Ust ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No GOVERNET TYPE: Government or agency DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No GOVERNMENT TYPE: Government or agency DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Scheduled Monument DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: No DESIGNATION: Scheduled Monument DESIGNATION: Scheduled Monument DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONTACT: Nick Croxson 07795 665645 DESIGNATION: Government or agency CONTACT: Nick Croxson 07795 665645 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 EXTENDED Scheduled Monument LIST ENTRY NUMBER: 1013352 EXTENDED Scheduled Monument LIST ENTRY NUMBER: 1013352 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 EXTENDED Scheduled Monument LIST ENTRY NUMBER: 1013352 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352	OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645
Extensive significant problems Extensive significant problems TREND: Unknown NEW ENTRY: No DOWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No DOWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No DESIGNATION: Generally unsatisfactory with major localised problems RINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No DOWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 DECLINING PRINCIPAL VULNERABILITY: No DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: LIST ENTRY NUMBER: 1013352 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: LIST ENTRY NUMBER: 1013352 DECLINING PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	SITE NAME:	Disc barrow and pond barrow 350 metres NNV	V of Greenland Farm,	, Winterbourne Stoke
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY!: No DWNER TYPE: Private, multiple owners CONTACT: Nick Croxson 07795 665645 SITE NAME: Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY!: No DWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY!: No DWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Government or agency LIST ENTRY NUMBER: 1013352 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY!: No	DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010891
Private, multiple owners CONTACT: Nick Croxson 07795 665645 Private, multiple owners CONTACT: Nick Croxson 07795 665645 Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow Designation: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Designation: Government or agency CONTACT: Nick Croxson 07795 665645 BETE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Designation: NEW ENTRY: No DOWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 Designation: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive DOWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: NEW ENTRY: No	CONDITION:	Extensive significant problems	TREND:	Unknown
Bell barrow and bowl barrow 500 metres NNW of Long Orchard, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRYP: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRYP: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRYP: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013984 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No	OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Croxson 07795 665645
Generally unsatisfactory with major localised problems Animal burrowing - extensive Animal burrowing - extensive New Entry?: No OWNER TYPE: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive New Entry?: No OWNER TYPE: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers Bite NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers Designation: Scheduled Monument LIST ENTRY NUMBER: No OWNER TYPE: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining New ENTRY?: No	SITE NAME:	Bell barrow and bowl barrow 500 metres NNV	of Long Orchard, W	/interslow
problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 TREND: Declining PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013984
OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 SITE NAME: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
Bowl barrow 750 metres NNE of Easton Down Farm, Winterslow DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive OWNER TYPE: Government or agency Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013986 CONDITION: Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive OWNER TYPE: Government or agency Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
Generally unsatisfactory with major localised problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive Animal burrowing - extensive OWNER TYPE: Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers Designation: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining No	SITE NAME:	Bowl barrow 750 metres NNE of Easton Down	Farm, Winterslow	
problems PRINCIPAL VULNERABILITY: Animal burrowing - extensive NEW ENTRY?: No OWNER TYPE: Government or agency CONTACT: Nick Croxson 07795 665645 Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Woottol Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013986
Government or agency Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No	CONDITION:		TREND:	Declining
Bowl barrow 175 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: No	PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
Rivers DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1013352 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	OWNER TYPE:	Government or agency	CONTACT:	Nick Croxson 07795 665645
CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing New Entry?: No	SITE NAME:		: part of the Square C	opse barrow cemetery, Wootton
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013352
, tradic prougrams	CONDITION:	Extensive significant problems	TREND:	Declining
OWNER TYPE: Crown CONTACT: Nick Croxson 07795 665645	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
	OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645

- Immediate risk of further rapid deterioration or loss of fabric; no
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.

 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but not yet implemented.

 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

SITE NAME:	Bowl barrow 275 metres west of Square Copse: part of the Square Copse barrow cemetery, Wootton Rivers		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013364
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nick Croxson 07795 665645



© Historic England

SITE NAME: Tottenham House and Savernake Forest, Savernake / Burbage / Great Bedwyn / Little Bedwyn / Marlborough / Mildenhall Registered Park and Garden grade II*, 20 LBs, 7 SMs DESIGNATION: CONDITION: Extensive significant problems VULNERABILITY: High TREND: **Improving** NEW ENTRY?: No OWNER TYPE: Mixed, multiple owners LIST ENTRY NUMBER: 1000472

Extensive landscape of rides linking Savernake Forest with ornamental parkland and pleasure grounds around the house. Exemplifies the work of Burlington, Brown, Cundy and others. Planning permission for hotel development has lapsed. The house and core of the landscape have been sold to a private owner and the process of conservation and repair has begun, allied to major development proposals (application under consideration). The Forestry Commission manages Savernake Forest on a long lease. There is a Natural England Stewardship Scheme over part of the park.

Contact: Jo McAllister 0117 975 0696

WILTSHIRE (UA) / NEW FOREST (NP)			
SITE NAME:	Barrows in Bath Hole and Bury Hill Plantations, Redlynch, Wiltshire (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004754
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Croxson 07795 665645

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- solution agreed.

 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA Conservation Area
Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

This document is one in a series of publications produced as part of Historic England's national Heritage at Risk programme. More information about Heritage at Risk and other titles in the series can be found at HistoricEngland.org.uk/har

Heritage at Risk
Published November 2019
4th Floor, Cannon Bridge House
25 Dowgate Hill
London EC4R 2YA
© Copyright Historic England 2019

Product code: HE0012

